

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-3542  
SCHOOL NAME: Durkin Park Elementary School (Old Lenart)  
ADDRESS OF SCHOOL: 8445 S. Kolin  
CITY: Chicago, IL, 60652

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/8/2016**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 673  
IDPH INSPECTOR LICENSE NUMBER: 100-00440  
IDPH LICENSED INSPECTOR NAME(Please Print): Shawn Brown  
IDPH MP LICENSE NUMBER: 100-01784  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Steven Geneser

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Durkin Park Elementary School (Old Lenart)**

8445 S. Kolin  
Chicago, IL, 60652

Unit: 26831  
Building ID: 7870

IDPH ID Number: 14-016-2990-3542

**REPORT DATE:**

Tuesday, October 01, 2019

**Prepared for:**

**Chicago Public Schools  
42 West Madison Street  
Chicago, IL 60602**

**Prepared by:**

**TEM Environmental, Inc.**

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

August 29, 2019

Mr. Glen E. Garner  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299            Unit: 26831            Region: 05            IDPH ID:14-016-2990-3542

School: Durkin Park Elementary School (Old Lenart)            Building ID: 7870

Address: 8445 S. Kolin

Chicago, IL, 60652

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 09/17/2019

Inspector: Shawn Brown

Inspector IDPH License: 100-00440

Management Planner: Steven Geneser

Management Planner IDPH License: 100-01784

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.

Steven Geneser  
100-01784

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: August 29, 2019

RE: Durkin Park Elementary School (Old Lenart), Unit 26831  
8445 S. Kolin  
Chicago, IL, 60652

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Durkin Park Elementary School (Old Lenart), following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Durkin Park Elementary School (Old Lenart), there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Durkin Park Elementary School (Old Lenart)      Unit: 26831      Region: 05  
Address: 8445 S. Kolin      Chicago, IL, 60652  
IDPH ID: 14-016-2990-3542      Building ID: 7870  
Contact:      Phone:

### 2. Description of Facility

Original Construction:      Additional Construction:  
Total Square Footage:      No of Floors:  
Current Occupancy: 673

### 3. LEA Designated Person

Contact: Robert Christlieb      Phone: (773) 553-3197  
Address: 42 West Madison Street  
Chicago, IL 60602

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone: 630-790-0880      Fax: 630-790-0882

### 5. Inspector

Inspector Name: Shawn Brown

Inspector IDPH license # 100-00440      Signature:  
Date: 8/29/2019

### 6. Management Planner

Management Planner Name: Steven Geneser

Management Planner IDPH license # 100-01784      Signature:  
Date: 09/17/2019

### 7. Review Date:09/17/2019

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/1/2019

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Durkin Park Elementary School (Old Lenart). This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 7870:

07B

9X9 Light Brown w/Streaks Floor Tile Mastic

B. The following new homogenous areas have been identified for Building 7870:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

03A	12x12 Beige w/Specks Floor Tile
03B	12x12 Cream w/Specks Floor Tile
07A	9x9 Dark Brown Floor Tile Mastic
07D	12x12 Beige Floor Tile
07E	12x12 Beige Floor Tile Mastic
08	Transite Table Tops
09	Transite Counter
10	Black Baseboard
11	Black Baseboard Mastic
12	Plaster
13	Fiberglass Wrap
14	Pipe Joint Mud
15	Vibration Gasket
16	Patch Floor Tile
17	Patch Floor Tile Mastic
18	12x12 Purple Floor Tile
19	12x12 Purple Floor Tile Mastic
20	12x12 Light Beige Floor Tile
21	12x12 Light Beige Floor Tile Mastic
22	Vinyl Baseboard Mastic
23	Blue Vinyl Flooring Mastic
24	Red Vinyl Flooring Mastic
25	2'x2' Ceiling Tile
26	2'x2' Ceiling Tile
27	12x12 White w/Grey Streaks Floor Tile
27A	12x12 White w/Grey Streaks Floor Tile Mastic
28	Drywall and Joint Compound
29	Beige Baseboard
29A	Beige Baseboard Mastic
30	Blue Linoleum
30A	Blue Linoleum Mastic
31	Gypsum Deck
32	9x9 Pink Vinyl Floor Tile
32A	9x9 Pink Vinyl Floor Tile Mastic
33	Textured Plaster Ceiling
34	12x12 Purple Vinyl Floor Tile
34A	12x12 Purple Vinyl Floor Tile Mastic
35	Red Linoleum
36	12x12 Red Vinyl Floor Tile
36A	12x12 Red Vinyl Floor Tile Mastic
37	12x12 Light Gray Vinyl Floor Tile
37A	12x12 Light Gray Vinyl Floor Tile Mastic

38	12x12 Black Vinyl Floor Tile
38A	12x12 Black Vinyl Floor Tile Mastic
39	12x12 Dark Gray Vinyl Floor Tile
39A	12x12 Dark Gray Vinyl Floor Tile Mastic
40	12x12 White Vinyl Floor Tile
40A	12x12 White Vinyl Floor Tile Mastic
41	12x12 Light Blue Vinyl Floor Tile
41A	12x12 Light Blue Vinyl Floor Tile Mastic
42	12x12 Dark Blue Vinyl Floor Tile
42A	121x12 Dark Blue Vinyl Floor Tile Mastic
43	Wall Panelling
44	2'x4' Ceiling Tile
45	Drywall
46	2'x2' Ceiling Tile
47	12x12 Green w/Specks Vinyl Floor Tile
48	12x12 Green w/Specks Vinyl Floor Ttile Mastic
49	12x12 Light Green w/Specks Vinyl Floor Tile
50	12x12 Light Green w/Specks Vinyl Floor Tile Mastic
C	Boiler Gaskets
WG-1	Window Glazing

The following areas were deemed to be inaccessible:

01	2x4 Ceiling Tile
11	Black Baseboard Mastic
15	Vibration Gasket
25	2'x2' Ceiling Tile
27A	12x12 White w/Grey Streaks Floor Tile Mastic
29A	Beige Baseboard Mastic
30A	Blue Linoleum Mastic
34A	12x12 Purple Vinyl Floor Tile Mastic
36A	12x12 Red Vinyl Floor Tile Mastic
37A	12x12 Light Gray Vinyl Floor Tile Mastic
38A	12x12 Black Vinyl Floor Tile Mastic
39A	12x12 Dark Gray Vinyl Floor Tile Mastic
40A	12x12 White Vinyl Floor Tile Mastic
41A	12x12 Light Blue Vinyl Floor Tile Mastic
42A	121x12 Dark Blue Vinyl Floor Tile Mastic
44	2'x4' Ceiling Tile
46	2'x2' Ceiling Tile
48	12x12 Green w/Specks Vinyl Floor Ttile Mastic
50	12x12 Light Green w/Specks Vinyl Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Shawn Brown, IDPH License # 100-00440. The Management Plan was updated by Steven Geneser, IDPH License # 100-01784. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Durkin Park Elementary School (Old Lenart) Building 7870 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Durkin Park Elementary School (Old Lenart) Unit 26831 Building ID 7870

Address 8445 S. Kolin Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	2x4 Ceiling Tile	13,000	SF	Throughout Main Building	CHR	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
03A	12x12 Beige w/Specks Floor Tile	5,750	SF	Throughout Main Building Corridors and Classrooms	ASSUMED	MISC	N		0		No	ACBM with the potential for damage		MODERATE
03B	12x12 Cream w/Specks Floor Tile	5,750	SF	Throughout Main Building Corridors and Classrooms	ASSUMED	MISC	N		0		No	ACBM with the potential for damage		MODERATE
04A	9x9 Dark Brown w/Streaks Floor Tile	2,000	SF	Main Building-Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
04B	9x9 Light Brown w/Streaks Floor Tile	2,105	SF	Main Building-Main Office, Perimeter of Principal's Office, Patch in Teachers' Lounge, Book Room, and Room 139	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
04C	9x9 Light Brown w/Splotches Floor Tile	5,320	SF	Main Building-Vault, Work Room, Teachers' Lounge, Gym Storage, Lab, Corridor Outside Rooms 139-200.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06A	12x12 Beige w/Specks Floor Tile Mastic	5,750	SF	Throughout Main Building Corridors and Classrooms	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06B	12x12 Cream w/Specks Floor Tile Mastic	5,750	SF	Throughout Main Building Corridors and Classrooms	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07A	9x9 Dark Brown Floor Tile Mastic	2,000	SF	Main Building-Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07B	9X9 Light Brown w/Streaks Floor Tile	2,105	SF	Main Building-	CHR	MISC	N	LOC	40		Yes	ACBM with the	2	LOW

# Chicago Public Schools

School Durkin Park Elementary School (Old Lenart) Unit 26831 Building ID 7870

Address 8445 S. Kolin Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Mastic			Main Office, Perimeter of Principal's Office, Lunchroom, Patch in Teachers' Lounge, Book Room, and Room 139 (Not Observed in Lunchroom)								potential for damage		
07C	9x9 Light Brown w/Splotches Floor Tile Mastic	5,320	SF	Main Building-Vault, Work Room, Teachers' Lounge, Gym Storage, Lab	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07D	12x12 Beige Floor Tile	200	SF	Main Building-South Entrance	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07E	12x12 Beige Floor Tile Mastic	200	SF	Main Building-South Entrance	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	Transite Table Tops	250	SF	Main Building- Lab	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
09	Transite Counter	100	SF	Main Building- Lab	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Black Baseboard	60	LF	Main Building-Stage & Work Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	Black Baseboard Mastic	60	LF	Main Building-Stage & Work Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Plaster	50,000	SF	Throughout Main Building	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Fiberglass Wrap	40	LF	Main Building-Boiler Room, Café Fan Room, Heat Supply Attic Over Stage	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
14	Pipe Joint Mud	30	LF	Main Building- Cafe Fan Room, Heat Supply Attic Over Stage	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
15	Vibration Gasket	8	LF	Main Building-Exhaust Attic Over Stage	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Patch Floor Tile	150	SF	Lunchroom (Not Observed)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
17	Patch Floor Tile Mastic	150	SF	Lunchroom (Not Observed)	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

# Chicago Public Schools

School Durkin Park Elementary School (Old Lenart) Unit 26831 Building ID 7870

Address 8445 S. Kolin Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Observed)								potential for damage		
18	12x12 Purple Floor Tile	1,800	SF	2004 Addition- First Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
19	12x12 Purple Floor Tile Mastic	1,800	SF	2004 Addition- First Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12x12 Light Beige Floor Tile	4,500	SF	2004 Addition- Corridor, Rooms 120-125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
21	12x12 Light Beige Floor Tile Mastic	4,500	SF	2004 Addition- Corridor, Rooms 120-125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Vinyl Baseboard Mastic	1,200	LF	Throughout 2004 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Blue Vinyl Flooring Mastic	300	SF	2004 Addition- Boys' Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Red Vinyl Flooring Mastic	300	SF	2004 Addition- Girls' Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	2'x2' Ceiling Tile	5,000	SF	Throughout 2004 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
26	2'x2' Ceiling Tile	3,500	SF	2009 Mobile Unit- Classrooms and Hallways	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
27	12x12 White w/Grey Streaks Floor Tile	3,100	SF	2009 Mobile Unit- Classrooms and Hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
27A	12x12 White w/Grey Streaks Floor Tile Mastic	3,100	SF	2009 Mobile Unit- Classrooms and Hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Drywall and Joint Compound	3,500	SF	2009 Mobile Unit- Classrooms and Hallways	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
29	Beige Baseboard	400	LF	2009 Mobile Unit- Classrooms and Hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29A	Beige Baseboard Mastic	400	LF	2009 Mobile Unit- Classrooms and Hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Blue Linoleum	200	SF	2009 Mobile Unit- Boys' Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
30A	Blue Linoleum Mastic	200	SF	2009 Mobile Unit- Boys' Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Gypsum Deck	13,000	SF	Throughout Main Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
32	9x9 Pink Vinyl Floor Tile	12	SF	Hall Outside Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE



# Chicago Public Schools

School Durkin Park Elementary School (Old Lenart) Unit 26831 Building ID 7870

Address 8445 S. Kolin Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				106								potential for damage		
32A	9x9 Pink Vinyl Floor Tile Mastic	12	SF	Hall Outside Room 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Textured Plaster Ceiling	1,800	SF	Boiler Room, Storage Room (145), South Vestibule, Southeast Vestibule	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
34	12x12 Purple Vinyl Floor Tile	3,400	SF	Gym and stage; gym storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
34A	12x12 Purple Vinyl Floor Tile Mastic	3,400	SF	Gym and stage; gym storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Red Linoleum	200	SF	Mobile Unit- Girls' Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36	12x12 Red Vinyl Floor Tile	1,200	SF	2012 Addition- Locker Link, Entries/Hallways to Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36A	12x12 Red Vinyl Floor Tile Mastic	1,200	SF	2012 Addition- Locker Link, Entries/Hallways to Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12x12 Light Gray Vinyl Floor Tile	3,200	SF	2012 Addition- Corridor, Serving Area, Partial Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
37A	12x12 Light Gray Vinyl Floor Tile Mastic	3,200	SF	2012 Addition- Corridor, Serving Area, Partial Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12x12 Black Vinyl Floor Tile	300	SF	2012 Addition- Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
38A	12x12 Black Vinyl Floor Tile Mastic	300	SF	2012 Addition- Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12x12 Dark Gray Vinyl Floor Tile	900	SF	2012 Addition- Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
39A	12x12 Dark Gray Vinyl Floor Tile Mastic	900	SF	2012 Addition- Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12x12 White Vinyl Floor Tile	4,000	SF	2012 Addition- Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
40A	12x12 White Vinyl Floor Tile Mastic	4,000	SF	2012 Addition- Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12x12 Light Blue Vinyl Floor Tile	2,700	SF	2012 Addition- Lunchroom, Computer Lab	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Durkin Park Elementary School (Old Lenart) Unit 26831 Building ID 7870

Address 8445 S. Kolin Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
41A	12x12 Light Blue Vinyl Floor Tile Mastic	2,700	SF	Lunchroom, Computer Lab (2012 Addition)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12x12 Dark Blue Vinyl Floor Tile	1,300	SF	2012 Addition-Lunchroom, Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
42A	12x12 Dark Blue Vinyl Floor Tile Mastic	1,300	SF	2012 Addition-Lunchroom, Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Wall Panelling	5,000	SF	2012 Addition-Upper Walls in Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	2'x4' Ceiling Tile	2,000	SF	2012 Addition-Hallway	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
45	Drywall	12,000	SF	Throughout 2012 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
46	2'x2' Ceiling Tile	1,500	SF	Corridor, Small Amounts in Each Classroom	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
47	12x12 Green w/Specks Vinyl Floor Tile	250	SF	Main Building-Room 142	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
48	12x12 Green w/Specks Vinyl Floor Tile Mastic	250	SF	Main Building-Room 142	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	12x12 Light Green w/Specks Vinyl Floor Tile	250	SF	Main Building-Room 142	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
50	12x12 Light Green w/Specks Vinyl Floor Tile Mastic	250	SF	Main Building-Room 142	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B	Fiberglass Fittings	110	LF	Throughout Main Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
C	Boiler Gaskets	40	LF	Main Building-Boiler Room	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
WC-1	Window Caulk	3,200	LF	Throughout Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
WG-1	Window Glazing	15,000	LF	Throughout Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Durkin Park Elementary School (Old Lenart) Unit 26831 Building ID 7870

Address 8445 S. Kolin Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>8/29/2019</b>
Inspector Name <b>Shawn Brown</b>
<b>100-00440</b> <b>5/15/2020</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01	
03A	
03B	
04A	
04B	Not Observed in Lunchroom
04C	
06A	
06B	
07A	
07B	20 SF of Mastic Exposed Inside Office, Tile Coming Apart; 20 SF of Loose Tile in Room 136, Taped Down
07C	
07D	
07E	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	

# Chicago Public Schools

**School** Durkin Park Elementary School (Old Lenart) **Unit** 26831 **Building ID** 7870

**Address** 8445 S. Kolin **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
27A	
28	
29	
29A	
30	
30A	
31	
32	
32A	
33	
34	
34A	
35	
36	
36A	
37	
37A	
38	
38A	

# Chicago Public Schools

**School** Durkin Park Elementary School (Old Lenart) **Unit** 26831 **Building ID** 7870

**Address** 8445 S. Kolin **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
39	
39A	
40	
40A	
41	
41A	
42	
42A	
43	
44	
45	
46	
47	
48	
49	
50	
B	
C	
WC-1	
WG-1	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Durkin Park Elementary School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	2x4 Ceiling Tile	13,000	SF	Throughout Main Building	Chrysotile	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03A	12x12 Beige w/Specks Floor Tile	5,750	SF	Throughout Main Building Corridors and Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03B	12x12 Cream w/Specks Floor Tile	5,750	SF	Throughout Main Building Corridors and Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04A	9x9 Dark Brown w/Streaks Floor Tile	2,000	SF	Main Building- Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04B	9x9 Light Brown w/Streaks Floor Tile	2,105	SF	Main Building- Main Office, Perimeter of Principal's Office, Patch in Teachers' Lounge, Book Room, and Room 139	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04C	9x9 Light Brown w/Splotches Floor Tile	5,320	SF	Main Building- Vault, Work Room, Teachers' Lounge, Gym Storage, Lab, Corridor Outside Rooms 139-200.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06A	12x12 Beige w/Specks Floor Tile Mastic	5,750	SF	Throughout Main Building Corridors and Classrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06B	12x12 Cream w/Specks Floor Tile Mastic	5,750	SF	Throughout Main Building Corridors and Classrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07A	9x9 Dark Brown Floor Tile Mastic	2,000	SF	Main Building- Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07B	9x9 Light Brown w/Streaks Floor Tile Mastic	2,105	SF	Main Building- Main Office, Perimeter of Principal's Office, Lunchroom, Patch in Teachers' Lounge, Book Room, and Room 139 (Not Observed in Lunchroom)	Chrysotile	MISC	No	40	SF	6 ACBM with the potential for damage	Follow O&M Plan
07C	9x9 Light Brown w/Splotches Floor Tile Mastic	5,320	SF	Main Building- Vault, Work Room, Teachers' Lounge, Gym Storage, Lab	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07D	12x12 Beige Floor Tile	200	SF	Main Building- South Entrance	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07E	12x12 Beige Floor Tile Mastic	200	SF	Main Building- South Entrance	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	Transite Table Tops	250	SF	Main Building- Lab	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Transite Counter	100	SF	Main Building- Lab	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
10	Black Baseboard	60	LF	Main Building- Stage & Work Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
11	Black Baseboard Mastic	60	LF	Main Building- Stage & Work Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12	Plaster	50,000	SF	Throughout Main Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Fiberglass Wrap	40	LF	Main Building- Boiler Room, Café Fan Room, Heat Supply Attic Over Stage	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
14	Pipe Joint Mud	30	LF	Main Building- Cafe Fan Room, Heat Supply Attic Over Stage	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
15	Vibration Gasket	8	LF	Main Building- Exhaust Attic Over Stage	Assumed	TSI	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
16	Patch Floor Tile	150	SF	Lunchroom (Not Observed)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Patch Floor Tile Mastic	150	SF	Lunchroom (Not Observed)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12x12 Purple Floor Tile	1,800	SF	2004 Addition- First Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12x12 Purple Floor Tile Mastic	1,800	SF	2004 Addition- First Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12x12 Light Beige Floor Tile	4,500	SF	2004 Addition- Corridor, Rooms 120-125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12x12 Light Beige Floor Tile Mastic	4,500	SF	2004 Addition- Corridor, Rooms 120-125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Vinyl Baseboard Mastic	1,200	LF	Throughout 2004 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
23	Blue Vinyl Flooring Mastic	300	SF	2004 Addition- Boys' Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Red Vinyl Flooring Mastic	300	SF	2004 Addition- Girls' Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	2'x2' Ceiling Tile	5,000	SF	Throughout 2004 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	2'x2' Ceiling Tile	3,500	SF	2009 Mobile Unit- Classrooms and Hallways	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12x12 White w/Grey Streaks Floor Tile	3,100	SF	2009 Mobile Unit- Classrooms and Hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27A	12x12 White w/Grey Streaks Floor Tile Mastic	3,100	SF	2009 Mobile Unit- Classrooms and Hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Drywall and Joint Compound	3,500	SF	2009 Mobile Unit- Classrooms and Hallways	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Beige Baseboard	400	LF	2009 Mobile Unit- Classrooms and Hallways	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
29A	Beige Baseboard Mastic	400	LF	2009 Mobile Unit- Classrooms and Hallways	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
30	Blue Linoleum	200	SF	2009 Mobile Unit- Boys' Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30A	Blue Linoleum Mastic	200	SF	2009 Mobile Unit- Boys' Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Gypsum Deck	13,000	SF	Throughout Main Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	9x9 Pink Vinyl Floor Tile	12	SF	Hall Outside Room 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32A	9x9 Pink Vinyl Floor Tile Mastic	12	SF	Hall Outside Room 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	Textured Plaster Ceiling	1,800	SF	Boiler Room, Storage Room (145), South Vestibule, Southeast Vestibule	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12x12 Purple Vinyl Floor Tile	3,400	SF	Gym and stage; gym storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34A	12x12 Purple Vinyl Floor Tile Mastic	3,400	SF	Gym and stage; gym storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Red Linoleum	200	SF	Mobile Unit- Girls' Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12x12 Red Vinyl Floor Tile	1,200	SF	2012 Addition- Locker Link, Entries/Hallways to Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36A	12x12 Red Vinyl Floor Tile Mastic	1,200	SF	2012 Addition- Locker Link, Entries/Hallways to Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12x12 Light Gray Vinyl Floor Tile	3,200	SF	2012 Addition- Corridor, Serving Area, Partial Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37A	12x12 Light Gray Vinyl Floor Tile Mastic	3,200	SF	2012 Addition- Corridor, Serving Area, Partial Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12x12 Black Vinyl Floor Tile	300	SF	2012 Addition- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38A	12x12 Black Vinyl Floor Tile Mastic	300	SF	2012 Addition- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12x12 Dark Gray Vinyl Floor Tile	900	SF	2012 Addition- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	12x12 Dark Gray Vinyl Floor Tile Mastic	900	SF	2012 Addition- Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12x12 White Vinyl Floor Tile	4,000	SF	2012 Addition- Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	12x12 White Vinyl Floor Tile Mastic	4,000	SF	2012 Addition- Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12x12 Light Blue Vinyl Floor Tile	2,700	SF	2012 Addition- Lunchroom, Computer Lab	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41A	12x12 Light Blue Vinyl Floor Tile Mastic	2,700	SF	Lunchroom, Computer Lab (2012 Addition)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12x12 Dark Blue Vinyl Floor Tile	1,300	SF	2012 Addition- Lunchroom, Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12x12 Dark Blue Vinyl Floor Tile Mastic	1,300	SF	2012 Addition- Lunchroom, Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Wall Panelling	5,000	SF	2012 Addition- Upper Walls in Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	2'x4' Ceiling Tile	2,000	SF	2012 Addition- Hallway	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
45	Drywall	12,000	SF	Throughout 2012 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	2'x2' Ceiling Tile	1,500	SF	Corridor, Small Amounts in Each Classroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12x12 Green w/Specks Vinyl Floor Tile	250	SF	Main Building- Room 142	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	12x12 Green w/Specks Vinyl Floor Tile Mastic	250	SF	Main Building- Room 142	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12x12 Light Green w/Specks Vinyl Floor Tile	250	SF	Main Building- Room 142	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12x12 Light Green w/Specks Vinyl Floor Tile Mastic	250	SF	Main Building- Room 142	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	Fiberglass Fittings	110	LF	Throughout Main Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
C	Boiler Gaskets	40	LF	Main Building- Boiler Room	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
WC-1	Window Caulk	3,200	LF	Throughout Main Building	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
WG-1	Window Glazing	15,000	LF	Throughout Main Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

*Management Planner's Comments Summarized at the End of the Report*

Review Date	09/17/2019
Manager Planner Name	Steven Geneser
100-01784	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
03A	
03B	
04A	
04B	
04C	
06A	
06B	
07A	
07B	
07C	
07D	
07E	
08	
09	
10	
11	
12	
13	
14	

# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
27A	
28	
29	
29A	
30	
30A	
31	
32	
32A	
33	
34	
34A	

# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
35	
36	
36A	
37	
37A	
38	
38A	
39	
39A	
40	
40A	
41	
41A	
42	
42A	
43	
44	
45	
46	
47	
48	
49	
50	
B	
C	

# Chicago Public Schools

**School** Durkin Park Elementary  
School (Old Lenart)

**Unit** 26831

**Building ID** 7870

**Address** 8445 S. Kolin

Chicago, IL, 60652

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
WC-1	
WG-1	

# Chicago Public Schools

TEM Environmental, Inc.

## 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **2x4 Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **2x4 Ceiling Tile**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03A**  
MATERIAL DESCRIPTION: **12x12 Beige w/Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**

MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **03A**  
MATERIAL DESCRIPTION: **12x12 Beige w/Specks Floor Tile**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03B**  
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **03B**  
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown w/Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Building- Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown w/Streaks Floor Tile**  
MATERIAL LOCATION: **Main Building- Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04B**  
MATERIAL DESCRIPTION: **9x9 Light Brown w/Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Building- Main Office, Perimeter of Principal's Office, Patch in Teachers' Lounge, Book Room, and Room 139**

MATERIAL QUANTITY: **2105** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not Observed in Lunchroom**

Inspector's Signature: \_\_\_\_\_ Date: **08/29/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **04B**  
MATERIAL DESCRIPTION: **9x9 Light Brown w/Streaks Floor Tile**  
MATERIAL LOCATION: **Main Building- Main Office, Perimeter of Principal's Office, Patch in Teachers' Lounge, Book Room, and Room 139**  
MATERIAL QUANTITY: **2105** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04C**  
MATERIAL DESCRIPTION: **9x9 Light Brown w/Spotches Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Building- Vault, Work Room, Teachers' Lounge, Gym Storage, Lab, Corridor Outside Rooms 139-200.**

MATERIAL QUANTITY: **5320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/29/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **04C**  
MATERIAL DESCRIPTION: **9x9 Light Brown w/Splotches Floor Tile**  
MATERIAL LOCATION: **Main Building- Vault, Work Room, Teachers' Lounge, Gym Storage, Lab, Corridor Outside Rooms 139-200.**  
MATERIAL QUANTITY: **5320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **12x12 Beige w/Specks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **12x12 Beige w/Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Throughout Main Building Corridors and Classrooms**  
MATERIAL QUANTITY: **5750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Main Building- Health Adjustment Room, Center Principal's Office, Gym Storage Large & Small, Park District Office, Room 101 & 139**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **9X9 Light Brown w/Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Delamination**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building- Main Office, Perimeter of Principal's Office, Lunchroom, Patch in Teachers' Lounge, Book Room, and Room 139 (Not Observed in Lunchroom)**  
MATERIAL QUANTITY: **2105** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **40** DAMAGE UNITS: **SF**  
COMMENTS: **20 SF of Mastic Exposed Inside Office, Tile Coming Apart; 20 SF of Loose Tile in Room 136, Taped Down**

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **9X9 Light Brown w/Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Main Building- Main Office, Perimeter of Principal's Office, Lunchroom, Patch in Teachers' Lounge, Book Room, and Room 139 (Not Observed in Lunchroom)**  
MATERIAL QUANTITY: **2105** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **40** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07C**  
MATERIAL DESCRIPTION: **9x9 Light Brown w/Spotches Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building- Vault, Work Room, Teachers' Lounge, Gym Storage, Lab**  
MATERIAL QUANTITY: **5320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **07C**  
MATERIAL DESCRIPTION: **9x9 Light Brown w/Splotches Floor Tile Mastic**  
MATERIAL LOCATION: **Main Building- Vault, Work Room, Teachers' Lounge, Gym Storage, Lab**  
MATERIAL QUANTITY: **5320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07D**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Main Building- South Entrance**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **07D**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile**  
MATERIAL LOCATION: **Main Building- South Entrance**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07E**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- South Entrance**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **07E**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile Mastic**  
MATERIAL LOCATION: **Main Building- South Entrance**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Transite Table Tops**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Building- Lab**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Transite Table Tops**  
MATERIAL LOCATION: **Main Building- Lab**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **Transite Counter**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building- Lab**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **Transite Counter**  
MATERIAL LOCATION: **Main Building- Lab**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **26831**    BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)**    INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin**    IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Black Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Stage & Work Room**

MATERIAL QUANTITY: **60**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Black Baseboard**  
MATERIAL LOCATION: **Main Building- Stage & Work Room**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Black Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Stage & Work Room**

MATERIAL QUANTITY: **60**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Black Baseboard Mastic**  
MATERIAL LOCATION: **Main Building- Stage & Work Room**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Plaster**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Fiberglass Wrap**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Boiler Room, Café Fan Room, Heat Supply Attic Over Stage**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Fiberglass Wrap**  
MATERIAL LOCATION: **Main Building- Boiler Room, Café Fan Room, Heat Supply Attic Over Stage**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **26831**    BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)**    INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin**    IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Pipe Joint Mud**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building- Cafe Fan Room, Heat Supply Attic Over Stage**  
MATERIAL QUANTITY: **30**    MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Pipe Joint Mud**  
MATERIAL LOCATION: **Main Building- Cafe Fan Room, Heat Supply Attic Over Stage**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Vibration Gasket**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Exhaust Attic Over Stage**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Vibration Gasket**  
MATERIAL LOCATION: **Main Building- Exhaust Attic Over Stage**  
MATERIAL QUANTITY: **8** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **26831**    BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)**    INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin**    IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Patch Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Lunchroom (Not Observed)**

MATERIAL QUANTITY: **150**    MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/29/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park  
Elementary School  
(Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Patch Floor Tile**  
MATERIAL LOCATION: **Lunchroom (Not Observed)**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Patch Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom (Not Observed)**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Patch Floor Tile Mastic**  
MATERIAL LOCATION: **Lunchroom (Not Observed)**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **12x12 Purple Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2004 Addition- First Floor Corridor**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **12x12 Purple Floor Tile**  
MATERIAL LOCATION: **2004 Addition- First Floor Corridor**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12x12 Purple Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2004 Addition- First Floor Corridor**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park  
Elementary School  
(Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12x12 Purple Floor Tile Mastic**  
MATERIAL LOCATION: **2004 Addition- First Floor Corridor**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **12x12 Light Beige Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2004 Addition- Corridor, Rooms 120-125**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **12x12 Light Beige Floor Tile**  
MATERIAL LOCATION: **2004 Addition- Corridor, Rooms 120-125**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12x12 Light Beige Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2004 Addition- Corridor, Rooms 120-125**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12x12 Light Beige Floor Tile Mastic**  
MATERIAL LOCATION: **2004 Addition- Corridor, Rooms 120-125**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 2004 Addition**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **Throughout 2004 Addition**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Blue Vinyl Flooring Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2004 Addition- Boys' Washroom**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Blue Vinyl Flooring Mastic**  
MATERIAL LOCATION: **2004 Addition- Boys' Washroom**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Red Vinyl Flooring Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2004 Addition- Girls' Washroom**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Red Vinyl Flooring Mastic**  
MATERIAL LOCATION: **2004 Addition- Girls' Washroom**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout 2004 Addition**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**  
MATERIAL LOCATION: **Throughout 2004 Addition**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Streaks Floor Tile**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27A**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **27A**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Drywall and Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Drywall and Joint Compound**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Beige Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Beige Baseboard**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29A**  
MATERIAL DESCRIPTION: **Beige Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **29A**  
MATERIAL DESCRIPTION: **Beige Baseboard Mastic**  
MATERIAL LOCATION: **2009 Mobile Unit- Classrooms and Hallways**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Blue Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2009 Mobile Unit- Boys' Washroom**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Blue Linoleum**  
MATERIAL LOCATION: **2009 Mobile Unit- Boys' Washroom**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30A**  
MATERIAL DESCRIPTION: **Blue Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2009 Mobile Unit- Boys' Washroom**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **30A**  
MATERIAL DESCRIPTION: **Blue Linoleum Mastic**  
MATERIAL LOCATION: **2009 Mobile Unit- Boys' Washroom**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Gypsum Deck**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Gypsum Deck**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **9x9 Pink Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Hall Outside Room 106**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **9x9 Pink Vinyl Floor Tile**  
MATERIAL LOCATION: **Hall Outside Room 106**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32A**  
MATERIAL DESCRIPTION: **9x9 Pink Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hall Outside Room 106**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **32A**  
MATERIAL DESCRIPTION: **9x9 Pink Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Hall Outside Room 106**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **Textured Plaster Ceiling**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room, Storage Room (145), South Vestibule, Southeast Vestibule**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **Textured Plaster Ceiling**  
MATERIAL LOCATION: **Boiler Room, Storage Room (145), South Vestibule, Southeast Vestibule**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12x12 Purple Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Gym and stage; gym storage**

MATERIAL QUANTITY: **3400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12x12 Purple Vinyl Floor Tile**  
MATERIAL LOCATION: **Gym and stage; gym storage**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34A**  
MATERIAL DESCRIPTION: **12x12 Purple Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym and stage; gym storage**

MATERIAL QUANTITY: **3400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **34A**  
MATERIAL DESCRIPTION: **12x12 Purple Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Gym and stage; gym storage**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Red Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Mobile Unit- Girls' Washroom**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Red Linoleum**  
MATERIAL LOCATION: **Mobile Unit- Girls' Washroom**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12x12 Red Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2012 Addition- Locker Link, Entries/Hallways to Lunchroom**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12x12 Red Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Locker Link, Entries/Hallways to Lunchroom**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36A**  
MATERIAL DESCRIPTION: **12x12 Red Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2012 Addition- Locker Link, Entries/Hallways to Lunchroom**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **36A**  
MATERIAL DESCRIPTION: **12x12 Red Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **2012 Addition- Locker Link, Entries/Hallways to Lunchroom**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2012 Addition- Corridor, Serving Area, Partial Classrooms**  
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Corridor, Serving Area, Partial Classrooms**  
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37A**  
MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2012 Addition- Corridor, Serving Area, Partial Classrooms**

MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **37A**  
MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **2012 Addition- Corridor, Serving Area, Partial Classrooms**  
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12x12 Black Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **2012 Addition- Hallway**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12x12 Black Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Hallway**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38A**  
MATERIAL DESCRIPTION: **12x12 Black Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2012 Addition- Hallway**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park  
Elementary School  
(Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **38A**  
MATERIAL DESCRIPTION: **12x12 Black Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **2012 Addition- Hallway**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12x12 Dark Gray Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **2012 Addition- Hallway**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park  
Elementary School  
(Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12x12 Dark Gray Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Hallway**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**  
MATERIAL DESCRIPTION: **12x12 Dark Gray Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2012 Addition- Hallway**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **39A**  
MATERIAL DESCRIPTION: **12x12 Dark Gray Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **2012 Addition- Hallway**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2012 Addition- Classrooms**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Classrooms**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A**  
MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2012 Addition- Classrooms**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **40A**  
MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **2012 Addition- Classrooms**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **12x12 Light Blue Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2012 Addition- Lunchroom, Computer Lab**  
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **12x12 Light Blue Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Lunchroom, Computer Lab**  
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41A**  
MATERIAL DESCRIPTION: **12x12 Light Blue Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom, Computer Lab (2012 Addition)**

MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **41A**  
MATERIAL DESCRIPTION: **12x12 Light Blue Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Lunchroom, Computer Lab (2012 Addition)**  
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12x12 Dark Blue Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2012 Addition- Lunchroom, Classrooms**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12x12 Dark Blue Vinyl Floor Tile**  
MATERIAL LOCATION: **2012 Addition- Lunchroom, Classrooms**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42A**  
MATERIAL DESCRIPTION: **121x12 Dark Blue Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2012 Addition- Lunchroom, Classrooms**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **42A**  
MATERIAL DESCRIPTION: **121x12 Dark Blue Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **2012 Addition- Lunchroom, Classrooms**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Wall Panelling**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2012 Addition- Upper Walls in Classrooms**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Wall Panelling**  
MATERIAL LOCATION: **2012 Addition- Upper Walls in Classrooms**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2012 Addition- Hallway**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**  
MATERIAL LOCATION: **2012 Addition- Hallway**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 2012 Addition**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **Throughout 2012 Addition**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Corridor, Small Amounts in Each Classroom**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**  
MATERIAL LOCATION: **Corridor, Small Amounts in Each Classroom**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **12x12 Green w/Specks Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Building- Room 142**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **12x12 Green w/Specks Vinyl Floor Tile**  
MATERIAL LOCATION: **Main Building- Room 142**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **12x12 Green w/Specks Vinyl Floor Ttile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Room 142**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **12x12 Green w/Specks Vinyl Floor Ttile Mastic**  
MATERIAL LOCATION: **Main Building- Room 142**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **12x12 Light Green w/Specks Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Building- Room 142**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **12x12 Light Green w/Specks Vinyl Floor Tile**  
MATERIAL LOCATION: **Main Building- Room 142**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **12x12 Light Green w/Specks Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Room 142**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **12x12 Light Green w/Specks Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Main Building- Room 142**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **26831**    BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)**    INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin**    IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Fiberglass Fittings**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Main Building**

MATERIAL QUANTITY: **110**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Fiberglass Fittings**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **110** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Boiler Gaskets**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Boiler Room**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Boiler Gaskets**  
MATERIAL LOCATION: **Main Building- Boiler Room**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **WC-1**  
MATERIAL DESCRIPTION: **Window Caulk**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Main Building**

MATERIAL QUANTITY: **3200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/29/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **WC-1**  
MATERIAL DESCRIPTION: **Window Caulk**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUIDLING ID: **7870**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shawn Brown**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** INSPECTION DATE: **8/29/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **WG-1**  
MATERIAL DESCRIPTION: **Window Glazing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/29/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26831** BUILDING ID: **7870**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Durkin Park Elementary School (Old Lenart)** REVIEW DATE: **9/17/2019**  
ADDRESS: **8445 S. Kolin** IDPH LICENSE NO: **100-00440**

---

HOMOGENEOUS AREA: **WG-1**  
MATERIAL DESCRIPTION: **Window Glazing**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/17/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
*2019 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses

---



# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 03/18/2019 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903BIR03

Certificate Number:



**PUBLIC HEALTH & SAFETY** inc.  
Environmental and Occupational Services  
375 Ashland Ave., Chicago, IL 60607  
www.public-health-safety.com

Office: 312-491-0081  
Fax: 312-421-2801

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN  
has completed the Asbestos Management Planner Refresher course and passed the examination  
on 03/18/2019 with a minimum score of 70% or better. Training was in accordance with U.S.  
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model  
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903MPR01

Certificate Number:



**PUBLIC HEALTH & SAFETY** Inc.  
Environmental and Occupational Services  
311 S. Ashland Ave., Chicago, IL 60607  
www.public-health-safety.com

Office: 312-491-0081  
Fax: 312-421-2901

Director of Training  
Nicholas J. Peneff  
Doctor of Public Health

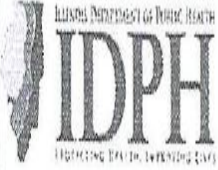


Phone: 312-491-0081

FORM # A-011

# COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		<b>ASBESTOS PROFESSIONAL LICENSE</b>		<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
<b>ID NUMBER</b>	<b>ISSUED</b>	<b>EXPIRES</b>		<b>INSPECTOR</b>	<b>3/19/2019</b>
100 - 02950	3/6/2019	05/15/2020			
<b>KEITH CLOUGH</b>				<b>PROJECT MANAGER</b>	<b>4/9/2019</b>
524 HOMELAND RD				<b>AIR SAMPLING PROFESSIONAL</b>	
MATTESON, IL 60443				<b>Alteration of this license shall result in legal action</b>	
Environmental Health				This license issued under authority of the State of Illinois	
				Department of Public Health	
				This license is valid only when accompanied by a valid training course certificate.	

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed