

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2823  
SCHOOL NAME: Ninos Heroes  
ADDRESS OF SCHOOL: 8344 S Commercial  
CITY: Chicago, IL, 60617

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/2/2016**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 326  
IDPH INSPECTOR LICENSE NUMBER: 100-19716  
IDPH LICENSED INSPECTOR NAME(Please Print): Imani Robinson  
IDPH MP LICENSE NUMBER: 100-00440  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Shawn Brown

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Ninos Heroes**

8344 S Commercial  
Chicago, IL, 60617

Unit: 31101  
Building ID: 3720

IDPH ID Number: 14-016-2990-2823

**REPORT DATE:**

Tuesday, October 01, 2019

**Prepared for:**

**Chicago Public Schools  
42 West Madison Street  
Chicago, IL 60602**

**Prepared by:**

**TEM Environmental, Inc.**

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**



## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: September 25, 2019

RE: Ninos Heroes, Unit 31101  
8344 S Commercial  
Chicago, IL, 60617

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Ninos Heroes, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Ninos Heroes, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Ninos Heroes  
Address: 8344 S Commercial  
IDPH ID: 14-016-2990-2823  
Contact: Unit: 31101  
Chicago, IL, 60617  
Building ID: 3720  
Phone: Region: 06

### 2. Description of Facility

Original Construction: 1981  
Total Square Footage: 73518  
Current Occupancy: 326  
Additional Construction:  
No of Floors: 3

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 42 West Madison Street  
Chicago, IL 60602  
Phone: (773) 553-3197

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone: 630-790-0880  
Fax: 630-790-0882

### 5. Inspector

Inspector Name: Imani Robinson

Inspector IDPH license # 100-19716

Signature:  
Date: 9/25/2019

### 6. Management Planner

Management Planner Name: Shawn Brown

Management Planner IDPH license # 100-00440

Signature:  
Date: 10/24/2019

### 7. Review Date:10/24/2019

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Ninos Heroes. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3720:

B. The following new homogenous areas have been identified for Building 3720:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01A	12x12 Off-White Speckled Floor Tile
01B	12x12 Taupe Floor Tile
05A	Brown Vinyl Baseboard
05B	Black Vinyl Baseboard
06A	12x12 Off-White Speckled Floor Tile Mastic
07A	Brown Vinyl Baseboard Mastic
07B	Black Vinyl Baseboard
08	Drywall
09	Drywall Compound
10	Hardcoat Plaster
11	Interior Window Glazing
12	Interior Window Caulking
13	Building Expansion Joint Compound
14	12x12 White w/Pink Speckles Floor Tile
14A	12x12 White w/Pink Speckles Floor Tile Mastic
15	12x12 White w/Blue Speckles Floor Tile
15A	12x12 White w/Blue Speckles Floor Tile Mastic
16	2'x4' White Fissured Lay-In Ceiling Tile
17	Spray-On Fireproofing on Beams
18	Tan Carpet Adhesive
19	Gray Carpet Adhesive
20	Blue Carpet Adhesive
21	Purple Carpet Adhesive
22	Gray Ceramic Tile Grout
23	Gray Ceramic Tile Adhesive
24	Brown Ceramic Tile Grout
25	Brown Ceramic Tile Adhesive
26	Blue Carpet Mastic
27	12x12 White w/Multicolor Speckles Vinyl Floor Tile
28	12x12 White w/Multicolor Speckles Vinyl Floor Tile Mastic
29	12x12 Brown Floor Tile
30	12x12 Brown Floor Tile Mastic
31	12x12 Cream Floor Tile
32	12x12 Cream Floor Mastic
33	12x12 Blue Speckled Floor Tile
34	12x12 Blue Speckled Floor Tile Mastic
35	12x12 Off-White w/Tan Speckles Floor Tile
36	12x12 Off-White w/Tan Speckles Floor Tile Mastic
39	Brown Tan Specks Carpet Mastic

The following areas were deemed to be inaccessible:

19	Gray Carpet Adhesive
25	Brown Ceramic Tile Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Imani Robinson, IDPH License # 100-19716. The Management Plan was updated by Shawn Brown, IDPH License # 100-00440. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 7/10/2019

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Ninos Heroes Building 3720 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Ninos Heroes Unit 31101 Building ID 3720

Address 8344 S Commercial Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01A	12x12 Off-White Speckled Floor Tile	25,000	SF	On 1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab.L Throughout- 2nd & 3rd Floor Corridors, Science Lab, Rooms 124, 130, 325, PE Office and Apparatus Room	ASSUMED	MISC	N	LOC	80		No	ACBM with the potential for damage	3	MODERATE
01B	12x12 Taupe Floor Tile	670	SF	Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and the Kindergarten Rooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04	Vinyl Duct Sleeves-Not Observed			Heat Pumps in the Ceiling		MISC								
05A	Brown Vinyl Baseboard	3,940	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05B	Black Vinyl Baseboard	1,700	LF	1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06A	12x12 Off-White Speckled Floor Tile Mastic	25,000	SF	1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab/ Throughout - 2nd and 3rd Floor Corridors, Science Lab, Rooms 124, 130 and 325, PE Office and the Apparatus Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06B	12x12 Taupe Floor Tile Mastic	750	SF	Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and All Kindergarten Rooms	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07A	Brown Vinyl Baseboard Mastic	3,940	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07B	Black Vinyl Baseboard	1,700	LF	1st Floor-	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

# Chicago Public Schools

School Ninos Heroes Unit 31101 Building ID 3720

Address 8344 S Commercial Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308								potential for damage		
08	Drywall	0	SF	Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	Drywall Compound	250	SF	Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Hardcoat Plaster	550	SF	Cafeteria Pillars	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
11	Interior Window Glazing	3,460	LF	Rooms with Exterior Windows	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Interior Window Caulking	2,754	LF	Rooms with Exterior Windows	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Building Expansion Joint Compound	100	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12x12 White w/Pink Speckles Floor Tile	70	SF	2nd and 3rd Floor Women's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
14A	12x12 White w/Pink Speckles Floor Tile Mastic	70	SF	2nd & 3rd Floor Women's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12x12 White w/Blue Speckles Floor Tile	70	SF	2nd & 3rd Floor Men's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15A	12x12 White w/Blue Speckles Floor Tile Mastic	70	SF	2nd & 3rd Floor Men's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	2'x4' White Fissured Lay-In Ceiling Tile	65,000	SF	Throughout School (excluding the Gym)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
17	Spray-On Fireproofing on Beams	30,000	LF	Throughout School	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
18	Tan Carpet Adhesive	7,000	SF	1st Floor Storage, Faculty Room, Rooms 202, 314, 315, 316 and 330, MDF Room and the Resource Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Gray Carpet Adhesive	4,172	SF	3rd Floor Hall Patch, Student Services Office, Business	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Ninos Heroes Unit 31101 Building ID 3720

Address 8344 S Commercial Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Office, Rooms 225, 302, 312 and 313										
20	Blue Carpet Adhesive	28	SF	Elevator	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Purple Carpet Adhesive	13,812	SF	Principal's Office and Conference Room, RM 101, 201, 205, 207, 211, 212, 326, 329, 200, 232, 223, 226, 300, Business Office, Student Services	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Gray Ceramic Tile Grout	1,482	SF	1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Gray Ceramic Tile Adhesive	1,482	SF	1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Brown Ceramic Tile Grout	1,295	SF	Vestibules and Kitchen Area	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Brown Ceramic Tile Adhesive	1,295	SF	Vestibules and Kitchen Area	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	Blue Carpet Mastic	1,800	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12x12 White w/Multicolor Speckles Vinyl Floor Tile	200	SF	Main Office and the Men's and Women's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
28	12x12 White w/Multicolor Speckles Vinyl Floor Tile Mastic	200	SF	Main Office and Men's and Women's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	12x12 Brown Floor Tile	1,000	SF	Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12x12 Brown Floor Tile Mastic	1,000	SF	Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12x12 Cream Floor Tile	300	SF	Library Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12x12 Cream Floor Mastic	300	SF	Library Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Ninon Heroes Unit 31101 Building ID 3720

Address 8344 S Commercial Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
33	12x12 Blue Speckled Floor Tile	16	SF	Library Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12x12 Blue Speckled Floor Tile Mastic	16	SF	Library Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12x12 Off-White w/Tan Speckles Floor Tile	1,200	SF	Gym Office and Apparatus Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12x12 Off-White w/Tan Speckles Floor Tile Mastic	1,200	SF	PE Office and Apparatus Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12x12 Beige W/Brown Specks Vinyl Floor Tile ABATED 2014			Room 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325	ABATED	MISC								
38	12x12 Beige W/Brown Specks Vinyl Floor Tile Mastic ABATED			Rooms 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325	ABATED	MISC								
39	Brown Tan Specks Carpet Mastic	2,000	SF	Principal Office, Confrence RM, Business Office, Student Services	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW



# Chicago Public Schools

School Ninos Heroes Unit 31101 Building ID 3720

Address 8344 S Commercial Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>9/25/2019</b>
Inspector Name <b><u>Imani Robinson</u></b>
<b>100-19716</b> <b>5/15/2020</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01A	80 SF of Damage Throughout the Lunchroom
01B	Room 301- 100 Sq Ft Abated; 103 100 SF Abated
04	NOT OBSERVED 2019
05A	
05B	
06A	
06B	Room 301- 100 Sq Ft Abated
07A	
07B	
08	
09	
10	
11	
12	
13	
14	
14A	
15	
15A	
16	
17	
18	
19	

# Chicago Public Schools

School Ninos Heroes Unit 31101 Building ID 3720

Address 8344 S Commercial Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Ninos Heroes  
**Address** 8344 S Commercial

**Unit** 31101  
Chicago, IL, 60617

**Building ID** 3720  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	12x12 Off-White Speckled Floor Tile	25,000	SF	On 1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab;L Throughout- 2nd & 3rd Floor Corridors, Science Lab, Rooms 124, 130, 325, PE Office and Apparatus Room	Assumed	MISC	No	80	SF	6 ACBM with the potential for damage	Remove
01B	12x12 Taupe Floor Tile	670	SF	Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and the Kindergarden Rooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	Vinyl Duct Sleeves-Not Observed			Heat Pumps in the Ceiling		MISC					
05A	Brown Vinyl Baseboard	3,940	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
05B	Black Vinyl Baseboard	1,700	LF	1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
06A	12x12 Off-White Speckled Floor Tile Mastic	25,000	SF	1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab/ Throughout - 2nd and 3rd Floor Corridors, Science Lab, Rooms 124, 130 and 325, PE Office and the Apparatus Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06B	12x12 Taupe Floor Tile Mastic	750	SF	Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and All Kindergarden Rooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07A	Brown Vinyl Baseboard Mastic	3,940	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
07B	Black Vinyl Baseboard	1,700	LF	1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
08	Drywall	0	SF	Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Drywall Compound	250	SF	Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Hardcoat Plaster	550	SF	Cafeteria Pillars	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Interior Window Glazing	3,460	LF	Rooms with Exterior Windows	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12	Interior Window Caulking	2,754	LF	Rooms with Exterior Windows	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
13	Building Expansion Joint Compound	100	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
14	12x12 White w/Pink Speckles Floor Tile	70	SF	2nd and 3rd Floor Women's	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Ninos Heroes  
Address 8344 S Commercial

Unit 31101  
Chicago, IL, 60617

Building ID 3720  
Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Washrooms							
14A	12x12 White w/Pink Speckles Floor Tile Mastic	70	SF	2nd & 3rd Floor Women's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12x12 White w/Blue Speckles Floor Tile	70	SF	2nd & 3rd Floor Men's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	12x12 White w/Blue Speckles Floor Tile Mastic	70	SF	2nd & 3rd Floor Men's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	2'x4' White Fissured Lay-In Ceiling Tile	65,000	SF	Throughout School (excluding the Gym)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Spray-On Fireproofing on Beams	30,000	LF	Throughout School	Assumed	SURFACE	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
18	Tan Carpet Adhesive	7,000	SF	1st Floor Storage, Faculty Room, Rooms 202, 314, 315, 316 and 330, MDF Room and the Resource Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Gray Carpet Adhesive	4,172	SF	3rd Floor Hall Patch, Student Services Office, Business Office, Rooms 225, 302, 312 and 313	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Blue Carpet Adhesive	28	SF	Elevator	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Purple Carpet Adhesive	13,812	SF	Principal's Office and Conference Room, RM 101, 201, 205, 207, 211, 212, 326, 329, 200, 232, 223, 226, 300, Business Office, Student Services	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Gray Ceramic Tile Grout	1,482	SF	1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Gray Ceramic Tile Adhesive	1,482	SF	1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Brown Ceramic Tile Grout	1,295	SF	Vestibules and Kitchen Area	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Brown Ceramic Tile Adhesive	1,295	SF	Vestibules and Kitchen Area	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Blue Carpet Mastic	1,800	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12x12 White w/Multicolor Speckles Vinyl Floor Tile	200	SF	Main Office and the Men's and Women's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12x12 White w/Multicolor Speckles Vinyl Floor Tile Mastic	200	SF	Main Office and Men's and Women's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12x12 Brown Floor Tile	1,000	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12x12 Brown Floor Tile Mastic	1,000	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12x12 Cream Floor Tile	300	SF	Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12x12 Cream Floor Mastic	300	SF	Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Ninos Heroes  
**Address** 8344 S Commercial

**Unit** 31101  
Chicago, IL, 60617

**Building ID** 3720  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
33	12x12 Blue Speckled Floor Tile	16	SF	Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12x12 Blue Speckled Floor Tile Mastic	16	SF	Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12x12 Off-White w/Tan Speckles Floor Tile	1,200	SF	Gym Office and Apparatus Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12x12 Off-White w/Tan Speckles Floor Tile Mastic	1,200	SF	PE Office and Apparatus Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12x12 Beige W/Brown Specks Vinyl Floor Tile ABATED 2014			Room 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325	Abated	MISC					
38	12x12 Beige W/Brown Specks Vinyl Floor Tile Mastic ABATED			Rooms 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325	Abated	MISC					
39	Brown Tan Specks Carpet Mastic	2,000	SF	Principal Office, Confrence RM, Business Office, Student Services	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Ninos Heroes  
**Address** 8344 S Commercial

**Unit** 31101  
 Chicago, IL, 60617

**Building ID** 3720  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

*Management Planner's Comments Summarized at the End of the Report*

Review Date	10/24/2019
Manager Planner Name	Shawn Brown
100-00440	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
01B	
04	
05A	
05B	
06A	
06B	
07A	
07B	
08	
09	
10	
11	
12	
13	
14	
14A	
15	
15A	
16	
17	

# Chicago Public Schools

**School** Ninos Heroes  
**Address** 8344 S Commercial

**Unit** 31101  
Chicago, IL, 60617

**Building ID** 3720  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	



# Chicago Public Schools

TEM Environmental, Inc.

## 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12x12 Off-White Speckled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**  
DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **On 1sr Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab;L Throughout- 2nd & 3rd Floor Corridors, Science Lab, Rooms 124, 130, 325, PE Office and Apparatus Room**  
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **80** DAMAGE UNITS: **SF**  
COMMENTS: **80 SF of Damage Throughout the Lunchroom**

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUILDING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12x12 Off-White Speckled Floor Tile**  
MATERIAL LOCATION: **On 1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab;L Throughout- 2nd & 3rd Floor Corridors, Science Lab, Rooms 124, 130, 325, PE Office and Apparatus Room**  
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **80** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and the Kindergarden Rooms**  
MATERIAL QUANTITY: **670** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS: **Room 301- 100 Sq Ft Abated; 103 100 SF Abated**

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile**  
MATERIAL LOCATION: **Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and the Kindergarden Rooms**  
MATERIAL QUANTITY: **670** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **Vinyl Duct Sleeves-Not Observed**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Heat Pumps in the Ceiling**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **NOT OBSERVED 2019**

Inspector's Signature: \_\_\_\_\_ Date: **09/25/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **Vinyl Duct Sleeves-Not Observed**

MATERIAL LOCATION: **Heat Pumps in the Ceiling**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **3940** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **3940** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05B**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308**

MATERIAL QUANTITY: **1700**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **05B**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard**  
MATERIAL LOCATION: **1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308**  
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **12x12 Off-White Speckled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab/ Throughout - 2nd and 3rd Floor Corridors, Science Lab, Rooms 124, 130 and 325, PE Office and the Apparatus Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **12x12 Off-White Speckled Floor Tile Mastic**  
MATERIAL LOCATION: **1st Floor- Gym, Cafeteria, Vault, Corridors, Workroom, Science Lab/ Throughout - 2nd and 3rd Floor Corridors, Science Lab, Rooms 124, 130 and 325, PE Office and the Apparatus Room**  
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and All Kindergarden Rooms**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Room 301- 100 Sq Ft Abated**

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile Mastic**  
MATERIAL LOCATION: **Gymnasium, Rooms 103, 206, 208, 305, 306, 308 and All Kindergarden Rooms**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **3940** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **3940** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308**

MATERIAL QUANTITY: **1700**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUILDING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard**  
MATERIAL LOCATION: **1st Floor- Kindergarten and Offices, 2nd Floor- Rooms 206 and 208, 3rd Floor- Rooms 300-308**  
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor**  
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor**  
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **Drywall Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **Drywall Compound**  
MATERIAL LOCATION: **Cafeteria, Stairwells, Library, Room 216 & the 3rd Floor Central Corridor**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Hardcoat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Cafeteria Pillars**  
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Hardcoat Plaster**  
MATERIAL LOCATION: **Cafeteria Pillars**  
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms with Exterior Windows**  
MATERIAL QUANTITY: **3460** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
MATERIAL LOCATION: **Rooms with Exterior Windows**  
MATERIAL QUANTITY: **3460** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Interior Window Caulking**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms with Exterior Windows**  
MATERIAL QUANTITY: **2754** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Interior Window Caulking**  
MATERIAL LOCATION: **Rooms with Exterior Windows**  
MATERIAL QUANTITY: **2754** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Building Expansion Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Building Expansion Joint Compound**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **12x12 White w/Pink Speckles Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2nd and 3rd Floor Women's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **12x12 White w/Pink Speckles Floor Tile**  
MATERIAL LOCATION: **2nd and 3rd Floor Women's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14A**  
MATERIAL DESCRIPTION: **12x12 White w/Pink Speckles Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd & 3rd Floor Women's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **14A**  
MATERIAL DESCRIPTION: **12x12 White w/Pink Speckles Floor Tile Mastic**  
MATERIAL LOCATION: **2nd & 3rd Floor Women's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12x12 White w/Blue Speckles Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd & 3rd Floor Men's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12x12 White w/Blue Speckles Floor Tile**  
MATERIAL LOCATION: **2nd & 3rd Floor Men's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **12x12 White w/Blue Speckles Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd & 3rd Floor Men's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **09/25/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **12x12 White w/Blue Speckles Floor Tile Mastic**  
MATERIAL LOCATION: **2nd & 3rd Floor Men's Washrooms**  
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **2'x4' White Fissured Lay-In Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout School (excluding the Gym)**  
MATERIAL QUANTITY: **65000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **2'x4' White Fissured Lay-In Ceiling Tile**  
MATERIAL LOCATION: **Throughout School (excluding the Gym)**  
MATERIAL QUANTITY: **65000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Spray-On Fireproofing on Beams**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout School**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Spray-On Fireproofing on Beams**  
MATERIAL LOCATION: **Throughout School**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Tan Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Storage, Faculty Room, Rooms 202, 314, 315, 316 and 330, MDF Room and the Resource Room**

MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Tan Carpet Adhesive**  
MATERIAL LOCATION: **1st Floor Storage, Faculty Room, Rooms 202, 314, 315, 316 and 330, MDF Room and the Resource Room**  
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Gray Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Floor Hall Patch, Student Services Office, Business Office, Rooms 225, 302, 312 and 313**

MATERIAL QUANTITY: **4172** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Gray Carpet Adhesive**  
MATERIAL LOCATION: **3rd Floor Hall Patch, Student Services Office, Business Office, Rooms 225, 302, 312 and 313**  
MATERIAL QUANTITY: **4172** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Blue Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Elevator**  
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Blue Carpet Adhesive**  
MATERIAL LOCATION: **Elevator**  
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Purple Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Principal's Office and Conference Room, RM 101, 201, 205, 207, 211, 212, 326, 329, 200, 232, 223, 226, 300, Business Office, Student Services**

MATERIAL QUANTITY: **13812** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUILDING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Purple Carpet Adhesive**  
MATERIAL LOCATION: **Principal's Office and Conference Room, RM 101, 201, 205, 207, 211, 212, 326, 329, 200, 232, 223, 226, 300, Business Office, Student Services**  
MATERIAL QUANTITY: **13812** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Gray Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms**

MATERIAL QUANTITY: **1482** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Gray Ceramic Tile Grout**  
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms**  
MATERIAL QUANTITY: **1482** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Gray Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms**

MATERIAL QUANTITY: **1482** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Gray Ceramic Tile Adhesive**  
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Girls' and Boys' Washrooms and 1st Floor Men's and Women's Washrooms**  
MATERIAL QUANTITY: **1482** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **31101**    BUILDING ID: **3720**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes**    INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial**    IDPH LICENSE NO: **100-19716**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Vestibules and Kitchen Area**  
MATERIAL QUANTITY: **1295**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUILDING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Grout**  
MATERIAL LOCATION: **Vestibules and Kitchen Area**  
MATERIAL QUANTITY: **1295** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Vestibules and Kitchen Area**  
MATERIAL QUANTITY: **1295** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Adhesive**  
MATERIAL LOCATION: **Vestibules and Kitchen Area**  
MATERIAL QUANTITY: **1295** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
MATERIAL LOCATION: **Library**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12x12 White w/Multicolor Speckles Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Main Office and the Men's and Women's Washrooms**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12x12 White w/Multicolor Speckles Vinyl Floor Tile**  
MATERIAL LOCATION: **Main Office and the Men's and Women's Washrooms**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12x12 White w/Multicolor Speckles Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office and Men's and Women's Washrooms**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **09/25/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12x12 White w/Multicolor Speckles Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Main Office and Men's and Women's Washrooms**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Tile**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Mastic**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12x12 Blue Speckled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12x12 Blue Speckled Floor Tile**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12x12 Blue Speckled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12x12 Blue Speckled Floor Tile Mastic**  
MATERIAL LOCATION: **Library Office**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **31101**    BUILDING ID: **3720**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes**    INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial**    IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Tan Speckles Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym Office and Apparatus Room**  
MATERIAL QUANTITY: **1200**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Tan Speckles Floor Tile**  
MATERIAL LOCATION: **Gym Office and Apparatus Room**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Tan Speckles Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **PE Office and Apparatus Room**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Tan Speckles Floor Tile Mastic**  
MATERIAL LOCATION: **PE Office and Apparatus Room**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12x12 Beige W/Brown Specks Vinyl Floor Tile ABATED 2014**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **09/25/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12x12 Beige W/Brown Specks Vinyl Floor Tile ABATED 2014**  
MATERIAL LOCATION: **Room 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12x12 Beige W/Brown Specks Vinyl Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **09/25/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12x12 Beige W/Brown Specks Vinyl Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **Rooms 101, 201, 200, 205, 211, 207, 212, 222, 223, 226, 300, 301, 307, 326, 329, 330, 325**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**  
SCHOOL NAME: **Ninos Heroes** INSPECTION DATE: **9/25/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **Brown Tan Specks Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Principal Office, Confrence RM, Business Office, Student Services**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 09/25/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31101** BUIDLING ID: **3720**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Ninos Heroes** REVIEW DATE: **10/24/2019**  
ADDRESS: **8344 S Commercial** IDPH LICENSE NO: **100-19716**

---

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **Brown Tan Specks Carpet Mastic**  
MATERIAL LOCATION: **Principal Office, Confrence RM, Business Office, Student Services**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **10/24/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
*2019 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses

---



# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that IMANI ROBINSON  
has completed the ASBESTOS INSPECTOR'S INITIAL course and successfully passed the  
examination on 01/30/2019 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/28/2019-01/30/2019

Course Dates:

01/30/2020

Expires:

1901BI05

Certificate Number:



**PUBLIC HEALTH & SAFETY** inc.

Environmental and Occupational Services  
375 Ashland Ave., Chicago, IL 60607

[www.public-health-safety.com](http://www.public-health-safety.com)

Office: 312-491-0081  
Fax: 312-421-2901

Director of Training

Nicholas J. Peneff

Doctor of Public Health


Phone: 312-491-0081

FORM # A-010

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

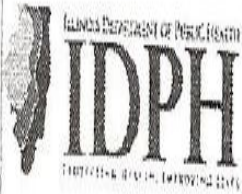

**ASBESTOS  
PROFESSIONAL  
LICENSE**

**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

3/29/2020

PROJECT MANAGER

3/30/2020

AIR SAMPLING PROFESSIONAL

ID NUMBER

100 - 19716

ISSUED

5/22/2019

EXPIRES

05/15/2020

**IMANI ROBINSON**

12823 S. GREEN

CHICAGO, IL 60643

Environmental Health



**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 03/18/2019 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903BIR03

Certificate Number:



**PUBLIC HEALTH & SAFETY** Inc.

Environmental and Occupational Services  
37 S. Ashland Ave., Chicago, IL 60607

[www.public-health-safety.com](http://www.public-health-safety.com)

Office: 312-491-0081  
Fax: 312-421-2901

Director of Training

Nicholas J. Penelf

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN  
has completed the Asbestos Management Planner Refresher course and passed the examination  
on 03/18/2019 with a minimum score of 70% or better. Training was in accordance with U.S.  
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model  
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903MPR01

Certificate Number:



**PUBLIC HEALTH & SAFETY** inc.

Environmental and Occupational Services  
371 S. Ashland Ave., Chicago, IL 60607

[www.public-health-safety.com](http://www.public-health-safety.com)

Office: 312-491-0081

Fax: 312-421-2501

Director of Training

Nicholas J. Peneff

Doctor of Public Health


Phone: 312-491-0081

FORM # A-011

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

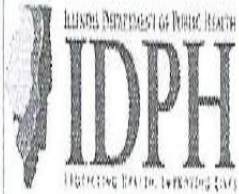

**ASBESTOS  
PROFESSIONAL  
LICENSE**

**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

3/19/2019

ID NUMBER	ISSUED	EXPIRES
100 - 02950	3/6/2019	05/15/2020

PROJECT MANAGER

4/9/2019

AIR SAMPLING PROFESSIONAL

**KEITH CLOUGH**  
524 HOMELAND RD  
MATTESON, IL 60443



Environmental Health

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---



## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed