

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-0028  
SCHOOL NAME: Lindblom High School  
ADDRESS OF SCHOOL: 6130 Wolcott  
CITY: Chicago, IL, 60636

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/11/2016**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** (Please type or print)

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 1350  
IDPH INSPECTOR LICENSE NUMBER: 100-09106  
IDPH LICENSED INSPECTOR NAME(Please Print): Michael Hasier  
IDPH MP LICENSE NUMBER: 100-00440  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Shawn Brown

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Lindblom High School**

6130 Wolcott  
Chicago, IL, 60636

Unit: 46511  
Building ID: 1450

IDPH ID Number: 14-016-2990-0028

**REPORT DATE:**

Tuesday, October 01, 2019

**Prepared for:**

**Chicago Public Schools  
42 West Madison Street  
Chicago, IL 60602**

**Prepared by:**

**TEM Environmental, Inc.**

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

August 8, 2109

Mr. Glen E. Garner  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299            Unit: 46511                      Region: 05                      IDPH ID:14-016-2990-0028

School: Lindblom High School    Building ID: 1450

Address: 6130 Wolcott

Chicago, IL, 60636

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 08/30/2019

Inspector: Michael Hasier

Inspector IDPH License: 100-09106

Management Planner: Shawn Brown

Management Planner IDPH License: 100-00440

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.

Shawn Brown  
100-00440

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: August 08, 2109

RE: Lindblom High School, Unit 46511  
6130 Wolcott  
Chicago, IL, 60636

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Lindblom High School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Lindblom High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Lindblom High School  
Address: 6130 Wolcott  
IDPH ID: 14-016-2990-0028  
Contact:

Unit: 46511  
Chicago, IL, 60636  
Building ID: 1450  
Phone:

Region: 05

### 2. Description of Facility

Original Construction: 1919  
Total Square Footage: 305788  
Current Occupancy: 1350

Additional Construction:  
No of Floors: 3

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 42 West Madison Street  
Chicago, IL 60602

Phone: (773) 553-3197

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address: 174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone: 630-790-0880

Fax: 630-790-0882

### 5. Inspector

Inspector Name: Michael Hasier

Inspector IDPH license # 100-09106

Signature:  
Date: 8/8/2109

### 6. Management Planner

Management Planner Name: Shawn Brown

Management Planner IDPH license # 100-00440

Signature:  
Date: 08/30/2019

### 7. Review Date:08/30/2019

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Lindblom High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1450:

B. The following new homogenous areas have been identified for Building 1450:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02A	12x12 Yellow Floor Tile
1	Plaster Walls
10A	12x12 Light Tan w/White & Brown Flecks Floor Tile
2	Plaster Ceilings
22A	Transite Panels
50	2 x 4 White Ceiling Tiles
51	12 x 12 White and Gray Checked Floor Tile
52	Beige Linoleum
53	Lab Tables
54	2' x 2' White Ceiling Tiles
55	Gray Linoleum
56	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile
56M	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile Mastic
57	12" x 12" Beige w/Tan Vinyl Floor Tile
57M	12" x 12" Beige w/Tan Vinyl Floor Tile Mastic
58	12 x 12 Yellow Vinyl Floor Tile
58M	12 x 12 Yellow Vinyl Floor Tile Mastic
59	Accoustical Ceiling Tiles
60	12x12 Off-White w/Brown Streaks Vinyl Floor Tile
60M	12x12 Off-White w/Brown Streaks Vinyl Floor Tile Mastic
61	12 x 12 Tan w/Dark Brown Streaks Floor Tile
61M	12 x 12 Tan w/Dark Brown Streaks Floor Tile Mastic
62	12 x 12 Beige w/Tan Streaks Floor Tile
62M	12 x 12 Beige w/Tan Streaks Floor Tile Mastic
63	Tan, Red, Grey & Black Terrazzo Flooring
64	Light Brown Carpet Mastic
67	Light Grey Linoleum
68	Light Grey Linoleum Adhesive
69	12x12 White w/Grey Floor Tile
70	12x12 White w/Grey Floor Tile Mastic
71	Purple Carpet Adhesive-NOT OBSERVED
D	Spray-On Fire Proofing
FT-02	12x12 Tan w/White Flecks Floor Tile-NOT OBSERVED
FT-03	12x12 Checkerboard Cream & Light Brown Floor Tile
FT-04	12x12 Checkerboard Champagne & Cream Floor

	Tile
FT-05	12x12 Tan w/Brown & White Streaks Floor Tile
FT-09	12x12 Checkerboard Cream & Light Tan Floor Tile-
	NOT OBSERVED
I	Boiler Insulation-NOT OBSERVED

The following areas were deemed to be inaccessible:

15A	Light Wire Insulation
16A	Vibration Dampener
56M	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile Mastic
57M	12" x 12" Beige w/Tan Vinyl Floor Tile Mastic
58M	12 x 12 Yellow Vinyl Floor Tile Mastic
60M	12x12 Off-White w/Brown Streaks Vinyl Floor Tile Mastic
61M	12 x 12 Tan w/Dark Brown Streaks Floor Tile Mastic
62M	12 x 12 Beige w/Tan Streaks Floor Tile Mastic
64	Light Brown Carpet Mastic
68	Light Grey Linoleum Adhesive
70	12x12 White w/Grey Floor Tile Mastic
FT-01	12x12 Orange Floor Tile
FT-05	12x12 Tan w/Brown & White Streaks Floor Tile
FTM-01	12x12 Orange Floor Tile Mastic
FTM-05	12x12 Tan w/Brown & White Streaks Floor Tile Mastic
TSI-1	Cardboard Pipe Insulation

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Hasier, IDPH License # 100-09106. The Management Plan was updated by Shawn Brown, IDPH License # 100-00440. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 7/13/2017

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Lindblom High School Building 1450 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---



# Chicago Public Schools

School Lindblom High School Unit 46511 Building ID 1450

Address 6130 Wolcott Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Room										
50	2 x 4 White Ceiling Tiles	100,000	SF	222, 227, 220, 223B, 223A, 221, 304, 303, 323, 322, 327, 127, 324, 325, 322, 323, 313, 303, 304, 302, lower level hallways and 2nd floor hallway	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
51	12 x 12 White and Gray Checked Floor Tile	3,000	SF	Rooms 200, 206, 208 & 208A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	Beige Linoleum	5,300	SF	Rooms 227, 205, 302, 304, 323 & 322	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	Lab Tables	1,000	SF	Rooms 227, 205, 302, 304, 323, 322 & 127	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	2' x 2' White Ceiling Tiles	2,500	SF	205, 302, Counselor's Suite, Health Services	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
55	Gray Linoleum	6,000	SF	Fitness Center, 4th Floor Cafeteria, Staff Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile	1,400	SF	Room 127	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56M	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile Mastic	1,400	SF	Room 127	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	12" x 12" Beige w/Tan Vinyl Floor Tile	1,000	SF	Main Office Entry, Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57M	12" x 12" Beige w/Tan Vinyl Floor Tile Mastic	250	SF	Main Office Entry, Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	12 x 12 Yellow Vinyl Floor Tile	2,000	SF	Health Services	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58M	12 x 12 Yellow Vinyl Floor Tile Mastic	2,000	SF	Health Services	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	Accoustical Ceiling Tiles	1,500	SF	Choral Room (137) and Piano Lab (139)	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
60	12x12 Off-White w/Brown Streaks Vinyl Floor Tile	1,250	SF	Robotics Classroom and Engineering Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60M	12x12 Off-White w/Brown Streaks Vinyl Floor Tile Mastic	1,250	SF	Robotics Classroom and Engineering Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	12 x 12 Tan w/Dark Brown Streaks Floor	800	SF	Book Store	ASSUMED	MISC	N	LOC	30		No	ACBM with the	5	LOW

# Chicago Public Schools

School Lindblom High School Unit 46511 Building ID 1450

Address 6130 Wolcott Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Tile											potential for damage		
61M	12 x 12 Tan w/Dark Brown Streaks Floor Tile Mastic	800	SF	Book Store	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	12 x 12 Beige w/Tan Streaks Floor Tile	750	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62M	12 x 12 Beige w/Tan Streaks Floor Tile Mastic	750	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Tan, Red, Grey & Black Terrazzo Flooring	22,000	SF	Entrance and Hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	Light Brown Carpet Mastic	15,000	SF	Engineer's Office, Counselor's Office, Room 111, 124, Office, Library, Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	Light Grey Linoeum	7,500	SF	Rooms 201, 325, 313, 308, 322, 301, 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	Light Grey Linoleum Adhesive	7,500	SF	Rooms 201, 325, 313, 308, 322, 301, 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	12x12 White w/Grey Floor Tile	5,000	SF	Rooms 127 & 127A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70	12x12 White w/Grey Floor Tile Mastic	5,000	SF	Rooms 127 & 127A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	Purple Carpet Adhesive-NOT OBSERVED			Rooms 137 & 139	ASSUMED	MISC								
D	Spray-On Fire Proofing	12,000	SF	Boys' & Girls' Gym	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
E	Pipe Insulation	800	LF	1948 Building	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
F	Pipe Fitting Insulation	100	LF	1948 Building-ROTC Storage	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
FT-01	12x12 Orange Floor Tile			Auditorium	INACCESSIBLE	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-02	12x12 Tan w/White Flecks Floor Tile-NOT OBSERVED			Room 323	ASSUMED	MISC								
FT-03	12x12 Checkerboard Cream & Light Brown Floor Tile	4,500	SF	Main Office, Room 208, 303A & 327	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-04	12x12 Checkerboard Champagne & Cream Floor Tile	200	SF	Main Office Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-05	12x12 Tan w/Brown & White Streaks Floor Tile	1,500	SF	Room 126	ASSUMED	MISC	N				No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Lindblom High School Unit 46511 Building ID 1450

Address 6130 Wolcott Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
FT-06	9x9 Dark Brown Floor Tile ABATED			Engineer's Office	ABATED	MISC								
FT-07	9x9 Checkerboard Green & Pinkish Floor Tile ABATED			Rooms 127, 127B	ABATED	MISC								
FT-08	9x9 Checkerboard Brown & Tan Floor Tile ABATED			Rooms 103A & 101-Breakroom	ABATED	MISC								
FT-09	12x12 Checkerboard Cream & Light Tan Floor Tile-NOT OBSERVED			Rooms 242, 244, 313	ASSUMED	MISC								
FT-11	12x12 Checkerboard Red & Dark Tan Floor Tile	250	SF	Girls' Gym Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-12	9x9 Checkerboard Brown & Tan Floor Tile ABATED			Room 310	ABATED	MISC								
FT-13	12x12 Beige Specked Floor Tile			Room 130	ABATED	MISC								
FTM-01	12x12 Orange Floor Tile Mastic			Auditorium	INACCESSIBLE	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-02	12x12 Tan w/White Flecks Floor Tile Mastic-VFT NOT OBSERVED			Room 324	CHR	MISC								
FTM-03	12x12 Checkerboard Cream & Light Brown Floor Tile Mastic			Main Office, Rooms 208, 303A and 327	NO_ACBM	MISC								
FTM-04	12x12 Checkerboard Champagne & Cream Floor Tile Mastic			Main Office Hall	NO_ACBM	MISC								
FTM-05	12x12 Tan w/Brown & White Streaks Floor Tile Mastic	1,500	SF	Room 126	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-06	9x9 Dark Brown Floor Tile Mastic			Engineer's Office	NO_ACBM	MISC								
FTM-07	9x9 Checkerboard Green & Pinkish Floor Tile Mastic			Rooms 127, 127B, Outside Room 203,	NO_ACBM	MISC								
FTM-08	9x9 Checkerboard Brown & Tan Floor Tile Mastic			Rooms 103A & 101 - Breakroom	NO_ACBM	MISC								
FTM-09	12x12 Checkerboard Cream & Light Tan Floor Tile Mastic-VFT NOT OBSERVED			Room 242, 244, 313	CHR	MISC								
FTM-11	12x12 Checkerboard Red & Dark Tan Floor Tile Mastic			Girls' Gym Office	NO_ACBM	MISC								
FTM-12	9x9 Checkerboard Brown & Tan Floor Tile Mastic ABATED			Room 310	ABATED	MISC								
FTM-13	12x12 Beige Specked Floor Tile Mastic-VFT ABATED			Room 130	CHR	MISC								
G	Aircell Pipe Insulation-NOT OBSERVED			1916 Building-Room 137, East & West Fan Rooms (1st Floor)	CHR	TSI								
H	Pipe Fitting Insulation-NOT OBSERVED			1916 Building	CHR	TSI								
I	Boiler Insulation-NOT OBSERVED			Boiler Room	ASSUMED	TSI								
TSI-1	Cardboard Pipe Insulation	560	LF	3rd Floor Throughout- Pipe Chasing, Boiler	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW





# Chicago Public Schools

School Lindblom High School Unit 46511 Building ID 1450

Address 6130 Wolcott Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>8/8/2109</b>
Inspector Name <b>Michael Hasier</b>
<b>100-09106</b> <b>5/15/2020</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01A	
02A	Not Observed in Rooms 201, 224 (Wood Floor), 225, 300 & 310
04A	
06A	
07A	
08A	
1	
10A	
12A	
13A	
14A	Not Observed Multiple Years
15A	Inaccessible Due to Live Wires
16A	INACCESSIBLE
17A	
19A	
2	
20A	
21A	Not Observed 2019- Now Concrete Floor
22A	
35B	
36C	ACBM Removed, Replaced with Fiberglass
50	
51	Not Observed in Room 225

# Chicago Public Schools

School Lindblom High School Unit 46511 Building ID 1450

Address 6130 Wolcott Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
52	
53	
54	
55	
56	
56M	
57	
57M	
58	
58M	
59	
60	
60M	
61	Damage is located in the Book Store
61M	
62	
62M	
63	
64	
67	
68	
69	
70	
71	Not Observed Multiple Years
D	
E	
F	
FT-01	
FT-02	Not Observed Multiple Years

# Chicago Public Schools

School Lindblom High School Unit 46511 Building ID 1450  
Address 6130 Wolcott Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
FT-03	Not Observed in Room 208 & 327
FT-04	
FT-05	Not Observed 2019, Possibly under Carpet
FT-06	
FT-07	
FT-08	
FT-09	Not Observed Multiple Years
FT-11	
FT-12	
FT-13	
FTM-01	
FTM-02	Not Observed Multiple Years
FTM-03	
FTM-04	
FTM-05	
FTM-06	
FTM-07	
FTM-08	
FTM-09	Not Observed Multiple Years
FTM-11	
FTM-12	
FTM-13	Not Observed Multiple Years
G	Not Observed Multiple Years
H	Not Observed Multiple Years
I	Not Observed Multiple Years
TSI-1	Attic Abated

# Chicago Public Schools

**School** Lindblom High School **Unit** 46511 **Building ID** 1450

**Address** 6130 Wolcott **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School Lindblom High School

Unit 46511

Building ID 1450

Address 6130 Wolcott

Chicago, IL, 60636

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	9x9 Tan w/Cream Streaks Floor Tile ABATED			1916 Building - Room 322	Abated	MISC					
02A	12x12 Yellow Floor Tile	5,250	SF	1916 Building- Rooms 101, 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04A	Linoleum			1916 Building- Room 102	No ACBM	MISC					
06A	Cork Floor			1916 Building- Gym Track Floor	No ACBM	MISC					
07A	9x9 Tan w/Cream Streaks Floor Tile Mastic ABATED			1916 Building- Room 322	Abated	MISC					
08A	12x12 Yellow Floor Tile Mastic			1916 Building- Rooms 101, 103, 201, 224, 239, 240, 225, 310 & 300	No ACBM	MISC					
1	Plaster Walls	98,000	SF	Throughout	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A	12x12 Light Tan w/White & Brown Flecks Floor Tile	2,200	SF	1948 Building- 2nd Floor Hall, Rooms 242 & 244	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12A	12x12 Light Tan w/White & Brown Flecks Floor Tile Mastic ABATED			1948 Building- 2nd Floor Hall, Rooms 242 & 244	Abated	MISC					
13A	Green Floor Sheeting			1948 Building - Room 142	No ACBM	MISC					
14A	Transite Panels-NOT OBSERVED			1916 Building		MISC					Follow O&M Plan
15A	Light Wire Insulation			1916 Building	Inaccessibl e	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
16A	Vibration Dampener			1916 Building	Inaccessibl e	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
17A	Baseboard			1916 Building- 3rd Floor	No ACBM	MISC					
19A	Baseboard Mastic			1916 Building 3rd Floor	No ACBM	MISC					
2	Plaster Ceilings	58,000	SF	Throughout	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	Linoleum Mastic			Room 102	No ACBM	MISC					
21A	Green Floor Sheeting Mastic ABATED			Room 142- ROTC Area	Abated	MISC					
22A	Transite Panels	60	SF	Lab Hoods, Room 322, Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35B	Boiler Gaskets	80	LF	Boiler Room	Chrysotile	MISC	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
36C	Tank Insulation ABATED			Pump Room/Boiler Room	Abated	TSI					
50	2 x 4 White Ceiling Tiles	100,000	SF	222, 227, 220, 223B, 223A, 221, 304, 303, 323, 322, 327, 127, 324, 325, 322, 323, 313, 303, 304, 302, lower level hallways and 2nd floor hallway	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
51	12 x 12 White and Gray Checked Floor Tile	3,000	SF	Rooms 200, 206, 208 & 208A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Beige Linoleum	5,300	SF	Rooms 227, 205, 302, 304, 323 & 322	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Lindblom High School

Unit 46511

Building ID 1450

Address 6130 Wolcott

Chicago, IL, 60636

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
53	Lab Tables	1,000	SF	Rooms 227, 205, 302, 304, 323, 322 & 127	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	2' x 2' White Ceiling Tiles	2,500	SF	205, 302, Counselor's Suite, Health Services	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
55	Gray Linoleum	6,000	SF	Fitness Center, 4th Floor Cafeteria, Staff Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile	1,400	SF	Room 127	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56M	12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile Mastic	1,400	SF	Room 127	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	12" x 12" Beige w/Tan Vinyl Floor Tile	1,000	SF	Main Office Entry, Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57M	12" x 12" Beige w/Tan Vinyl Floor Tile Mastic	250	SF	Main Office Entry, Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12 x 12 Yellow Vinyl Floor Tile	2,000	SF	Health Services	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58M	12 x 12 Yellow Vinyl Floor Tile Mastic	2,000	SF	Health Services	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Accoustical Ceiling Tiles	1,500	SF	Choral Room (137) and Piano Lab (139)	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
60	12x12 Off-White w/Brown Streaks Vinyl Floor Tile	1,250	SF	Robotics Classroom and Engineering Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60M	12x12 Off-White w/Brown Streaks Vinyl Floor Tile Mastic	1,250	SF	Robotics Classroom and Engineering Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12 x 12 Tan w/Dark Brown Streaks Floor Tile	800	SF	Book Store	Assumed	MISC	No	30	SF	6 ACBM with the potential for damage	Remove
61M	12 x 12 Tan w/Dark Brown Streaks Floor Tile Mastic	800	SF	Book Store	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12 x 12 Beige w/Tan Streaks Floor Tile	750	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62M	12 x 12 Beige w/Tan Streaks Floor Tile Mastic	750	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	Tan, Red, Grey & Black Terrazzo Flooring	22,000	SF	Entrance and Hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	Light Brown Carpet Mastic	15,000	SF	Engineer's Office, Counselor's Office, Room 111, 124, Office, Library, Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Light Grey Linoleum	7,500	SF	Rooms 201, 325, 313, 308, 322, 301, 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	Light Grey Linoleum Adhesive	7,500	SF	Rooms 201, 325, 313, 308, 322, 301, 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	12x12 White w/Grey Floor Tile	5,000	SF	Rooms 127 & 127A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

School Lindblom High School

Unit 46511

Building ID 1450

Address 6130 Wolcott

Chicago, IL, 60636

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
70	12x12 White w/Grey Floor Tile Mastic	5,000	SF	Rooms 127 & 127A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	Purple Carpet Adhesive-NOT OBSERVED			Rooms 137 & 139	Assumed	MISC					
D	Spray-On Fire Proofing	12,000	SF	Boys' & Girls' Gym	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E	Pipe Insulation	800	LF	1948 Building	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Pipe Fitting Insulation	100	LF	1948 Building- ROTC Storage	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
FT-01	12x12 Orange Floor Tile			Auditorium	Inaccessibl e	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
FT-02	12x12 Tan w/White Flecks Floor Tile-NOT OBSERVED			Room 323	Assumed	MISC					
FT-03	12x12 Checkerboard Cream & Light Brown Floor Tile	4,500	SF	Main Office, Room 208, 303A & 327	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-04	12x12 Checkerboard Champagne & Cream Floor Tile	200	SF	Main Office Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-05	12x12 Tan w/Brown & White Streaks Floor Tile	1,500	SF	Room 126	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-06	9x9 Dark Brown Floor Tile ABATED			Engineer's Office	Abated	MISC					
FT-07	9x9 Checkerboard Green & Pinkish Floor Tile ABATED			Rooms 127, 127B	Abated	MISC					
FT-08	9x9 Checkerboard Brown & Tan Floor Tile ABATED			Rooms 103A & 101- Breakroom	Abated	MISC					
FT-09	12x12 Checkerboard Cream & Light Tan Floor Tile-NOT OBSERVED			Rooms 242, 244, 313	Assumed	MISC					
FT-11	12x12 Checkerboard Red & Dark Tan Floor Tile	250	SF	Girls' Gym Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	
FT-12	9x9 Checkerboard Brown & Tan Floor Tile ABATED			Room 310	Abated	MISC					
FT-13	12x12 Beige Specked Floor Tile			Room 130	Abated	MISC					
FTM-01	12x12 Orange Floor Tile Mastic			Auditorium	Inaccessibl e	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
FTM-02	12x12 Tan w/White Flecks Floor Tile Mastic-VFT NOT OBSERVED			Room 324	Chrysotile	MISC					
FTM-03	12x12 Checkerboard Cream & Light Brown Floor Tile Mastic			Main Office, Rooms 208, 303A and 327	No ACBM	MISC					
FTM-04	12x12 Checkerboard Champagne & Cream Floor			Main Office Hall	No ACBM	MISC					

# Chicago Public Schools

School Lindblom High School

Unit 46511

Building ID 1450

Address 6130 Wolcott

Chicago, IL, 60636

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Tile Mastic										
FTM-05	12x12 Tan w/Brown & White Streaks Floor Tile Mastic	1,500	SF	Room 126	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-06	9x9 Dark Brown Floor Tile Mastic			Engineer's Office	No ACBM	MISC					
FTM-07	9x9 Checkerboard Green & Pinkish Floor Tile Mastic			Rooms 127, 127B, Outside Room 203,	No ACBM	MISC					
FTM-08	9x9 Checkerboard Brown & Tan Floor Tile Mastic			Rooms 103A & 101 - Breakroom	No ACBM	MISC					
FTM-09	12x12 Checkerboard Cream & Light Tan Floor Tile Mastic-VFT NOT OBSERVED			Room 242, 244, 313	Chrysotile	MISC					
FTM-11	12x12 Checkerboard Red & Dark Tan Floor Tile Mastic			Girls' Gym Office	No ACBM	MISC					
FTM-12	9x9 Checkerboard Brown & Tan Floor Tile Mastic ABATED			Room 310	Abated	MISC					
FTM-13	12x12 Beige Specked Floor Tile Mastic-VFT ABATED			Room 130	Chrysotile	MISC					
G	Aircell Pipe Insulation-NOT OBSERVED			1916 Building- Room 137, East & West Fan Rooms (1st Floor)	Chrysotile	TSI					
H	Pipe Fitting Insulation-NOT OBSERVED			1916 Building	Chrysotile	TSI					
I	Boiler Insulation-NOT OBSERVED			Boiler Room	Assumed	TSI					
TSI-1	Cardboard Pipe Insulation	560	LF	3rd Floor Throughout- Pipe Chasing, Boiler Storage	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

# Chicago Public Schools

**School** Lindblom High School

**Unit** 46511

**Building ID** 1450

**Address** 6130 Wolcott

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

*Management Planner's Comments Summarized at the End of the Report*

Review Date	08/30/2019
Manager Planner Name	Shawn Brown
100-00440	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
02A	
04A	
06A	
07A	
08A	
1	
10A	
12A	
13A	
14A	
15A	
16A	
17A	
19A	

# Chicago Public Schools

**School** Lindblom High School  
**Address** 6130 Wolcott

**Unit** 46511  
 Chicago, IL, 60636

**Building ID** 1450  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
2	
20A	
21A	
22A	
35B	
36C	
50	
51	
52	
53	
54	
55	
56	
56M	
57	
57M	
58	
58M	
59	
60	
60M	
61	
61M	
62	
62M	
63	

# Chicago Public Schools

**School** Lindblom High School

**Unit** 46511

**Building ID** 1450

**Address** 6130 Wolcott

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
64	
67	
68	
69	
70	
71	
D	
E	
F	
FT-01	
FT-02	
FT-03	
FT-04	
FT-05	
FT-06	
FT-07	
FT-08	
FT-09	
FT-11	
FT-12	
FT-13	
FTM-01	
FTM-02	
FTM-03	
FTM-04	
FTM-05	

# Chicago Public Schools

**School** Lindblom High School

**Unit** 46511

**Building ID** 1450

**Address** 6130 Wolcott

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
FTM-06	
FTM-07	
FTM-08	
FTM-09	
FTM-11	
FTM-12	
FTM-13	
G	
H	
I	
TSI-1	

# Chicago Public Schools

TEM Environmental, Inc.

## 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **9x9 Tan w/Cream Streaks Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building - Room 322**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **9x9 Tan w/Cream Streaks Floor Tile ABATED**  
MATERIAL LOCATION: **1916 Building - Room 322**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A**  
MATERIAL DESCRIPTION: **12x12 Yellow Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1916 Building- Rooms 101, 103**  
MATERIAL QUANTITY: **5250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not Observed in Rooms 201, 224 (Wood Floor), 225, 300 & 310**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **02A**  
MATERIAL DESCRIPTION: **12x12 Yellow Floor Tile**  
MATERIAL LOCATION: **1916 Building- Rooms 101, 103**  
MATERIAL QUANTITY: **5250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building- Room 102**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **Linoleum**  
MATERIAL LOCATION: **1916 Building- Room 102**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **Cork Floor**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building- Gym Track Floor**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **Cork Floor**  
MATERIAL LOCATION: **1916 Building- Gym Track Floor**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **9x9 Tan w/Cream Streaks Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building- Room 322**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **9x9 Tan w/Cream Streaks Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1916 Building- Room 322**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**  
MATERIAL DESCRIPTION: **12x12 Yellow Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building- Rooms 101, 103, 201, 224, 239, 240, 225, 310 & 300**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **08A**  
MATERIAL DESCRIPTION: **12x12 Yellow Floor Tile Mastic**  
MATERIAL LOCATION: **1916 Building- Rooms 101, 103, 201, 224, 239, 240, 225, 310 & 300**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **Plaster Walls**  
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **98000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **Plaster Walls**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **98000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10A**  
MATERIAL DESCRIPTION: **12x12 Light Tan w/White & Brown Flecks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1948 Building- 2nd Floor Hall, Rooms 242 & 244**  
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **10A**  
MATERIAL DESCRIPTION: **12x12 Light Tan w/White & Brown Flecks Floor Tile**  
MATERIAL LOCATION: **1948 Building- 2nd Floor Hall, Rooms 242 & 244**  
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**  
MATERIAL DESCRIPTION: **12x12 Light Tan w/White & Brown Flecks Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1948 Building- 2nd Floor Hall, Rooms 242 & 244**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **12A**  
MATERIAL DESCRIPTION: **12x12 Light Tan w/White & Brown Flecks Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1948 Building- 2nd Floor Hall, Rooms 242 & 244**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13A**  
MATERIAL DESCRIPTION: **Green Floor Sheeting**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1948 Building - Room 142**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **13A**  
MATERIAL DESCRIPTION: **Green Floor Sheeting**  
MATERIAL LOCATION: **1948 Building - Room 142**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14A**  
MATERIAL DESCRIPTION: **Transite Panels-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE:    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **14A**

MATERIAL DESCRIPTION: **Transite Panels-NOT OBSERVED**

MATERIAL LOCATION: **1916 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **Light Wire Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Inaccessible**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1916 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

COMMENTS: **Inaccessible Due to Live Wires**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **Light Wire Insulation**  
MATERIAL LOCATION: **1916 Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: **0** DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**  
MATERIAL DESCRIPTION: **Vibration Dampener**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Inaccessible** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1916 Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: **0** DAMAGE UNITS:  
COMMENTS: **INACCESSIBLE**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **16A**  
MATERIAL DESCRIPTION: **Vibration Dampener**  
MATERIAL LOCATION: **1916 Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: **0** DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A**  
MATERIAL DESCRIPTION: **Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building- 3rd Floor**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **17A**

MATERIAL DESCRIPTION: **Baseboard**

MATERIAL LOCATION: **1916 Building- 3rd Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**  
MATERIAL DESCRIPTION: **Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building 3rd Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **19A**  
MATERIAL DESCRIPTION: **Baseboard Mastic**  
MATERIAL LOCATION: **1916 Building 3rd Floor**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **Plaster Ceilings**  
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **58000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **Plaster Ceilings**  
MATERIAL LOCATION: **Throughout**  
MATERIAL QUANTITY: **58000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**  
MATERIAL DESCRIPTION: **Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 102**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **20A**

MATERIAL DESCRIPTION: **Linoleum Mastic**

MATERIAL LOCATION: **Room 102**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**  
MATERIAL DESCRIPTION: **Green Floor Sheeting Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 142- ROTC Area**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019- Now Concrete Floor**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **21A**  
MATERIAL DESCRIPTION: **Green Floor Sheeting Mastic ABATED**  
MATERIAL LOCATION: **Room 142- ROTC Area**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**  
MATERIAL DESCRIPTION: **Transite Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Lab Hoods, Room 322, Room 201**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **22A**  
MATERIAL DESCRIPTION: **Transite Panels**  
MATERIAL LOCATION: **Lab Hoods, Room 322, Room 201**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35B**  
MATERIAL DESCRIPTION: **Boiler Gaskets**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **35B**  
MATERIAL DESCRIPTION: **Boiler Gaskets**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36C**  
MATERIAL DESCRIPTION: **Tank Insulation ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Pump Room/Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **ACBM Removed, Replaced with Fiberglass**

Inspector's Signature: \_\_\_\_\_

Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **36C**  
MATERIAL DESCRIPTION: **Tank Insulation ABATED**  
MATERIAL LOCATION: **Pump Room/Boiler Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **2 x 4 White Ceiling Tiles**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **222, 227, 220, 223B, 223A, 221, 304, 303, 323, 322, 327, 127, 324, 325, 322, 323, 313, 303, 304, 302, lower level hallways and 2nd floor hallway**

MATERIAL QUANTITY: **100000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/08/2109

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **2 x 4 White Ceiling Tiles**  
MATERIAL LOCATION: **222, 227, 220, 223B, 223A, 221, 304, 303, 323, 322, 327, 127, 324, 325, 322, 323, 313, 303, 304, 302, lower level hallways and 2nd floor hallway**  
MATERIAL QUANTITY: **100000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **12 x 12 White and Gray Checked Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 200, 206, 208 & 208A**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS: **Not Observed in Room 225**

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **12 x 12 White and Gray Checked Floor Tile**  
MATERIAL LOCATION: **Rooms 200, 206, 208 & 208A**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Beige Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 227, 205, 302, 304, 323 & 322**  
MATERIAL QUANTITY: **5300**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Beige Linoleum**  
MATERIAL LOCATION: **Rooms 227, 205, 302, 304, 323 & 322**  
MATERIAL QUANTITY: **5300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Lab Tables**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 227, 205, 302, 304, 323, 322 & 127**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Lab Tables**  
MATERIAL LOCATION: **Rooms 227, 205, 302, 304, 323, 322 & 127**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tiles**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **205, 302, Counselor's Suite, Health Services**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tiles**  
MATERIAL LOCATION: **205, 302, Counselor's Suite, Health Services**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **Gray Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Fitness Center, 4th Floor Cafeteria, Staff Lunchroom**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **Gray Linoleum**  
MATERIAL LOCATION: **Fitness Center, 4th Floor Cafeteria, Staff Lunchroom**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 127**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile**  
MATERIAL LOCATION: **Room 127**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56M**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 127**  
MATERIAL QUANTITY: **1400**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **56M**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Colored Streaks Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Room 127**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Tan Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office Entry, Engineer's Office**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Tan Vinyl Floor Tile**  
MATERIAL LOCATION: **Main Office Entry, Engineer's Office**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57M**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Tan Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office Entry, Engineer's Office**  
MATERIAL QUANTITY: **250**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **57M**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Tan Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Main Office Entry, Engineer's Office**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12 x 12 Yellow Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Health Services**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12 x 12 Yellow Vinyl Floor Tile**  
MATERIAL LOCATION: **Health Services**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58M**  
MATERIAL DESCRIPTION: **12 x 12 Yellow Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Health Services**  
MATERIAL QUANTITY: **2000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **58M**  
MATERIAL DESCRIPTION: **12 x 12 Yellow Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Health Services**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **Accoustical Ceiling Tiles**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Choral Room (137) and Piano Lab (139)**  
MATERIAL QUANTITY: **1500**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **Accoustical Ceiling Tiles**  
MATERIAL LOCATION: **Choral Room (137) and Piano Lab (139)**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Brown Streaks Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Robotics Classroom and Engineering Storage**  
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Brown Streaks Vinyl Floor Tile**  
MATERIAL LOCATION: **Robotics Classroom and Engineering Storage**  
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60M**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Brown Streaks Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Robotics Classroom and Engineering Storage**  
MATERIAL QUANTITY: **1250**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **60M**  
MATERIAL DESCRIPTION: **12x12 Off-White w/Brown Streaks Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Robotics Classroom and Engineering Storage**  
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12 x 12 Tan w/Dark Brown Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Book Store**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**  
COMMENTS: **Damage is located in the Book Store**

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12 x 12 Tan w/Dark Brown Streaks Floor Tile**  
MATERIAL LOCATION: **Book Store**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61M**  
MATERIAL DESCRIPTION: **12 x 12 Tan w/Dark Brown Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Book Store**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **61M**  
MATERIAL DESCRIPTION: **12 x 12 Tan w/Dark Brown Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Book Store**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **12 x 12 Beige w/Tan Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **12 x 12 Beige w/Tan Streaks Floor Tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62M**  
MATERIAL DESCRIPTION: **12 x 12 Beige w/Tan Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **750**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **62M**  
MATERIAL DESCRIPTION: **12 x 12 Beige w/Tan Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **Tan, Red, Grey & Black Terrazzo Flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Entrance and Hallways**  
MATERIAL QUANTITY: **22000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **Tan, Red, Grey & Black Terrazzo Flooring**  
MATERIAL LOCATION: **Entrance and Hallways**  
MATERIAL QUANTITY: **22000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **Light Brown Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engineer's Office, Counselor's Office, Room 111, 124, Office, Library, Auditorium**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **Light Brown Carpet Mastic**  
MATERIAL LOCATION: **Engineer's Office, Counselor's Office, Room 111, 124, Office, Library, Auditorium**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **Light Grey Linoeum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 201, 325, 313, 308, 322, 301, 304**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **Light Grey Linoleum**  
MATERIAL LOCATION: **Rooms 201, 325, 313, 308, 322, 301, 304**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**  
MATERIAL DESCRIPTION: **Light Grey Linoleum Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 201, 325, 313, 308, 322, 301, 304**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **68**  
MATERIAL DESCRIPTION: **Light Grey Linoleum Adhesive**  
MATERIAL LOCATION: **Rooms 201, 325, 313, 308, 322, 301, 304**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 127 & 127A**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **69**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Floor Tile**  
MATERIAL LOCATION: **Rooms 127 & 127A**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 127 & 127A**  
MATERIAL QUANTITY: **5000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **70**  
MATERIAL DESCRIPTION: **12x12 White w/Grey Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 127 & 127A**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **Purple Carpet Adhesive-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 137 & 139**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **Purple Carpet Adhesive-NOT OBSERVED**

MATERIAL LOCATION: **Rooms 137 & 139**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Spray-On Fire Proofing**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boys' & Girls' Gym**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Spray-On Fire Proofing**  
MATERIAL LOCATION: **Boys' & Girls' Gym**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1948 Building**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Pipe Insulation**  
MATERIAL LOCATION: **1948 Building**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1948 Building- ROTC Storage**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation**  
MATERIAL LOCATION: **1948 Building- ROTC Storage**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-01**  
MATERIAL DESCRIPTION: **12x12 Orange Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Inaccessible** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-01**

MATERIAL DESCRIPTION: **12x12 Orange Floor Tile**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-02**  
MATERIAL DESCRIPTION: **12x12 Tan w/White Flecks Floor Tile-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-02**

MATERIAL DESCRIPTION: **12x12 Tan w/White Flecks Floor Tile-NOT OBSERVED**

MATERIAL LOCATION: **Room 323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-03**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office, Room 208, 303A & 327**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS: **Not Observed in Room 208 & 327**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-03**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Brown Floor Tile**  
MATERIAL LOCATION: **Main Office, Room 208, 303A & 327**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-04**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Champagne & Cream Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office Hall**  
MATERIAL QUANTITY: **200**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-04**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Champagne & Cream Floor Tile**  
MATERIAL LOCATION: **Main Office Hall**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-05**  
MATERIAL DESCRIPTION: **12x12 Tan w/Brown & White Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 126**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **Not Observed 2019, Possibly under Carpet**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-05**

MATERIAL DESCRIPTION: **12x12 Tan w/Brown & White Streaks Floor Tile**

MATERIAL LOCATION: **Room 126**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-06**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-06**

MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile ABATED**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-07**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Green & Pinkish Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 127, 127B**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-07**

MATERIAL DESCRIPTION: **9x9 Checkerboard Green & Pinkish Floor Tile ABATED**

MATERIAL LOCATION: **Rooms 127, 127B**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-08**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 103A & 101- Breakroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-08**

MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile ABATED**

MATERIAL LOCATION: **Rooms 103A & 101- Breakroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-09**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Tan Floor Tile-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 242, 244, 313**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-09**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Tan Floor Tile-NOT OBSERVED**  
MATERIAL LOCATION: **Rooms 242, 244, 313**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-11**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Red & Dark Tan Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Girls' Gym Office**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-11**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Red & Dark Tan Floor Tile**  
MATERIAL LOCATION: **Girls' Gym Office**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-12**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 310**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-12**

MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile ABATED**

MATERIAL LOCATION: **Room 310**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-13**  
MATERIAL DESCRIPTION: **12x12 Beige Specked Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 130**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FT-13**

MATERIAL DESCRIPTION: **12x12 Beige Specked Floor Tile**

MATERIAL LOCATION: **Room 130**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-01**  
MATERIAL DESCRIPTION: **12x12 Orange Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Inaccessible** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-01**  
MATERIAL DESCRIPTION: **12x12 Orange Floor Tile Mastic**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: **0** DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-02**  
MATERIAL DESCRIPTION: **12x12 Tan w/White Flecks Floor Tile Mastic-VFT NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 324**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-02**  
MATERIAL DESCRIPTION: **12x12 Tan w/White Flecks Floor Tile Mastic-VFT NOT OBSERVED**  
MATERIAL LOCATION: **Room 324**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-03**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office, Rooms 208, 303A and 327**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-03**

MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Brown Floor Tile Mastic**

MATERIAL LOCATION: **Main Office, Rooms 208, 303A and 327**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-04**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Champagne & Cream Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-04**

MATERIAL DESCRIPTION: **12x12 Checkerboard Champagne & Cream Floor Tile Mastic**

MATERIAL LOCATION: **Main Office Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **46511**    BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School**    INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott**    IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-05**  
MATERIAL DESCRIPTION: **12x12 Tan w/Brown & White Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 126**  
MATERIAL QUANTITY: **1500**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-05**  
MATERIAL DESCRIPTION: **12x12 Tan w/Brown & White Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Room 126**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-06**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-06**

MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-07**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Green & Pinkish Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 127, 127B, Outside Room 203,**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-07**

MATERIAL DESCRIPTION: **9x9 Checkerboard Green & Pinkish Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 127, 127B, Outside Room 203,**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-08**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 103A & 101 - Breakroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-08**

MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 103A & 101 - Breakroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-09**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Tan Floor Tile Mastic-VFT NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 242, 244, 313**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: 08/08/2109

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-09**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Cream & Light Tan Floor Tile Mastic-VFT NOT OBSERVED**  
MATERIAL LOCATION: **Room 242, 244, 313**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-11**  
MATERIAL DESCRIPTION: **12x12 Checkerboard Red & Dark Tan Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Girls' Gym Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-11**

MATERIAL DESCRIPTION: **12x12 Checkerboard Red & Dark Tan Floor Tile Mastic**

MATERIAL LOCATION: **Girls' Gym Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-12**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 310**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-12**  
MATERIAL DESCRIPTION: **9x9 Checkerboard Brown & Tan Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **Room 310**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-13**  
MATERIAL DESCRIPTION: **12x12 Beige Specked Floor Tile Mastic-VFT ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 130**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_

Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **FTM-13**

MATERIAL DESCRIPTION: **12x12 Beige Specked Floor Tile Mastic-VFT ABATED**

MATERIAL LOCATION: **Room 130**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building- Room 137, East & West Fan Rooms (1st Floor)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation-NOT OBSERVED**  
MATERIAL LOCATION: **1916 Building- Room 137, East & West Fan Rooms (1st Floor)**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1916 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Pipe Fitting Insulation-NOT OBSERVED**

MATERIAL LOCATION: **1916 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Boiler Insulation-NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: \_\_\_\_\_

Date: **08/08/2109**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUILDING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Boiler Insulation-NOT OBSERVED**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**  
SCHOOL NAME: **Lindblom High School** INSPECTION DATE: **8/8/2109**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **TSI-1**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Throughout- Pipe Chasing, Boiler Storage**  
MATERIAL QUANTITY: **560** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**  
COMMENTS: **Attic Abated**

Inspector's Signature: \_\_\_\_\_ Date: **08/08/2109**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46511** BUIDLING ID: **1450**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**  
SCHOOL NAME: **Lindblom High School** REVIEW DATE: **8/30/2019**  
ADDRESS: **6130 Wolcott** IDPH LICENSE NO: **100-09106**

---

HOMOGENEOUS AREA: **TSI-1**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **3rd Floor Throughout- Pipe Chasing, Boiler Storage**  
MATERIAL QUANTITY: **560** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **08/30/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
*2019 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses


---

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MICHAEL HASIER  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 05/01/2019 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

05/01/2019  
Course Dates:  
05/01/2020  
Expires:  
1905BIR02  
Certificate Number:



Office: 312-491-0081  
Fax: 312-421-2901

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

# COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



## ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS	TC EXPIRES
SUPERVISOR/WORKER	3/1/2020
INSPECTOR	5/1/2020

ID NUMBER	ISSUED	EXPIRES
100 - 09106	5/8/2019	05/15/2020

**MICHAEL S HASIER**  
444 OLD BARN RD., APT. B  
BARRINGTON, IL 60010

Environmental Health



PROJECT MANAGER 3/1/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action  
This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 03/18/2019 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903BIR03

Certificate Number:



**PUBLIC HEALTH & SAFETY** Inc.

Environmental and Occupational Services  
37 S. Ashland Ave., Chicago, IL 60607

[www.public-health-safety.com](http://www.public-health-safety.com)

Office: 312-491-0081  
Fax: 312-421-2901

Director of Training

Nicholas J. Penelf

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN  
has completed the Asbestos Management Planner Refresher course and passed the examination  
on 03/18/2019 with a minimum score of 70% or better. Training was in accordance with U.S.  
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model  
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903MPR01

Certificate Number:



**PUBLIC HEALTH & SAFETY** inc.

Environmental and Occupational Services  
371 S. Ashland Ave., Chicago, IL 60607

[www.public-health-safety.com](http://www.public-health-safety.com)

Office: 312-491-0081  
Fax: 312-421-2501

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

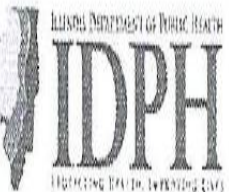

FORM # A-011



# COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

	<b>ASBESTOS PROFESSIONAL LICENSE</b>	<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
<b>ID NUMBER</b> 100 - 02950	<b>ISSUED</b> 3/6/2019	INSPECTOR	3/19/2019
<b>EXPIRES</b> 05/15/2020		PROJECT MANAGER	4/9/2019
<b>KEITH CLOUGH</b> 524 HOMELAND RD MATTESON, IL 60443 Environmental Health		AIR SAMPLING PROFESSIONAL	
		<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed