

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-640X  
SCHOOL NAME: Namaste Charter  
ADDRESS OF SCHOOL: 3737 S. Paulina Street  
CITY: Chicago, IL, 60609

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 469  
IDPH INSPECTOR LICENSE NUMBER: 100-7278  
IDPH LICENSED INSPECTOR NAME(Please Print): Kenneth Karuhn  
IDPH MP LICENSE NUMBER: 100-19466  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

not correct address - see comments

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Namaste Charter**

3737 S. Paulina Street  
Chicago, IL, 60609

Unit: 66271  
Building ID: 6530

IDPH ID Number: 14-016-2990-640X

**REPORT DATE:**

Tuesday, October 01, 2019

**Prepared for:**

**Chicago Public Schools  
42 West Madison Street  
Chicago, IL 60602**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Chicago, IL, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**



## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: June 04, 2019

RE: Namaste Charter, Unit 66271  
3737 S. Paulina Street  
Chicago, IL, 60609

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Namaste Charter, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Namaste Charter, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Namaste Charter  
Address: 3737 S. Paulina Street  
IDPH ID: 14-016-2990-640X  
Contact: Unit: 66271  
Chicago, IL, 60609  
Building ID: 6530  
Phone: Region: 02

### 2. Description of Facility

Original Construction: Additional Construction:  
Total Square Footage: No of Floors:  
Current Occupancy: 469

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 42 West Madison Street  
Chicago, IL 60602  
Phone: (773) 553-3197

### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Doug McCormick  
Address 600 West Van Buren St., Ste 500  
Chicago, IL, 60607  
Phone: (312) 762-2900  
Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Kenneth Karuhn

Inspector IDPH license # 100-7278

Signature:  
Date: 6/4/2019

### 6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:  
Date: 06/30/2019

### 7. Review Date:06/30/2019

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Namaste Charter. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 6530:

05	12"x12" Light Grey Tones Mottled Floor Tile
07	12"x12" Medium Grey Tones Mottled Floor Tile
09	12"x12" Dark Blue Tones Mottled Floor Tile
11	12"x12" Blue Grey Tones Mottled Floor Tile
15	Wood Pattern Roll Out Vinyl Sheeting
36	12"x12" Purple Tones Mottled Floor Tile
38	Canvas Wall Covering
T1	Aircell Pipe Insulation
T2	2" Cardboard Pipe Insulation

- T3 6" Cardboard Pipe Insulation
- T4 Hard Fittings on 6" Cardboard Pipe Insulation



B. The following new homogenous areas have been identified for Building 6530:

52	Ceramic Wall tile
53	Leveling Compound
54	Duct Sealant

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

05	12"x12" Light Grey Tones Mottled Floor Tile
06	12"x12" Light Grey Tones Mottled Floor Tile Mastic
07	12"x12" Medium Grey Tones Mottled Floor Tile
08	12"x12" Medium Grey Tones Mottled Floor Tile Mastic
09	12"x12" Dark Blue Tones Mottled Floor Tile
10	12"x12" Dark Blue Tones Mottled Floor Tile Mastic
11	12"x12" Blue Grey Tones Mottled Floor Tile
13	12"x12" Green Tones Mottled Floor Tile
14	12"x12" Green Tones Mottled Floor Tile Mastic
15	Wood Pattern Roll Out Vinyl Sheeting
16	Wood Pattern Roll Out Vinyl Sheeting Mastic
23	2"x2" Dark Grey Ceramic Tile Grout
25	Mastic Under Beige Carpet
26	Mastic Under Brown w/ Purple Carpet
27	Grey/Dark Blue Carpet Squares Mastic
28	Grey/Maroon Carpet Squares Mastic
29	Mastic Under Grey Carpet
31	Grey Vinyl Baseboard Mastic
33	Tan Vinyl Baseboard Mastic
34	Black Vinyl Baseboard
35	Black Vinyl Baseboard Mastic
36	12"x12" Purple Tones Mottled Floor Tile
37	12"x12" Purple Tones Mottled Floor Tile Mastic
38	Canvas Wall Covering
41	Fire Doors
42	Fire Door Frames
43	White Ceramic Wall Tile Grout
44	Blue Ceramic Wall Tiles Grout
45	Blue Ceramic Wall Tile Grout
46	Elevator Brake Pads
50	Grey Vinyl Stair Tread
51	Grey Vinyl Stair Tread Mastic
52	Ceramic Wall tile
53	Leveling Compound
54	Duct Sealant

The following areas were deemed to be inaccessible:

06	12"x12" Light Grey Tones Mottled Floor Tile Mastic
08	12"x12" Medium Grey Tones Mottled Floor Tile Mastic
10	12"x12" Dark Blue Tones Mottled Floor Tile Mastic
14	12"x12" Green Tones Mottled Floor Tile Mastic
16	Wood Pattern Roll Out Vinyl Sheeting Mastic
17	Old 9"x9" Floor Tile Under Carpet
18	Old 9"x9" Floor Tile Mastic Under Carpet
19	Old 9"x9" Floor Tile Under Carpet
20	Old 9"x9" Floor Tile Mastic Under Carpet
25	Mastic Under Beige Carpet
26	Mastic Under Brown w/ Purple Carpet
27	Grey/Dark Blue Carpet Squares Mastic
28	Grey/Maroon Carpet Squares Mastic
29	Mastic Under Grey Carpet
31	Grey Vinyl Baseboard Mastic
33	Tan Vinyl Baseboard Mastic
35	Black Vinyl Baseboard Mastic
37	12"x12" Purple Tones Mottled Floor Tile Mastic
46	Elevator Brake Pads
51	Grey Vinyl Stair Tread Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Kenneth Karuhn, IDPH License # 100-7278. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Namaste Charter Building 6530 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Namaste Charter Unit 66271 Building ID 6530

Address 3737 S. Paulina Street Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Spray-On Fireproofing			Metal Deck of 2009 Addition	NO_ACBM	SURFACE								
02	Plaster Walls			Throughout Original Building	NO_ACBM	SURFACE								
03	Plaster Ceiling			Throughout Original Building	NO_ACBM	SURFACE								
04	Drywall, Tape and Joint Compound			Throughout 2009 Addition	NO_ACBM	MISC								
05	12"x12" Light Grey Tones Mottled Floor Tile	4,150	SF	Hallways and Lobby	ASSUMED	MISC	N	NONE	5		Yes	ACBM with the potential for damage		MODERATE
06	12"x12" Light Grey Tones Mottled Floor Tile Mastic	4,150	SF	Hallways and Lobby	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	12"x12" Medium Grey Tones Mottled Floor Tile	850	SF	Stairwell Landings	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
08	12"x12" Medium Grey Tones Mottled Floor Tile Mastic	850	SF	Stairwell Landings	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	12"x12" Dark Blue Tones Mottled Floor Tile	475	SF	Pantry, Work Area, Copy Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
10	12"x12" Dark Blue Tones Mottled Floor Tile Mastic	475	SF	Pantry, Work Area, Copy Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12"x12" Blue Grey Tones Mottled Floor Tile	570	SF	Servery	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
12	12"x12" Blue/Grey Tones Mottled Floor Tile Mastic			Servery	NO_ACBM	MISC								
13	12"x12" Green Tones Mottled Floor Tile	450	SF	Teachers Resource Room 019	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12"x12" Green Tones Mottled Floor Tile Mastic	450	SF	Teachers Resource Room 019	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Wood Pattern Roll Out Vinyl Sheeting	4,375	SF	3rd Floor Gymnasium, 1st Floor Fitness Center	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
16	Wood Pattern Roll Out Vinyl Sheeting Mastic	4,375	SF	3rd Floor Gymnasium, 1st Floor Fitness Center	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Old 9"x9" Floor Tile Under Carpet	3,900	SF	Classrooms and Closets rooms - 101, 102, 103, 104, 105	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	Old 9"x9" Floor Tile Mastic Under Carpet	3,900	SF	Classrooms and Closets rooms - 101, 102, 103, 104, 105	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Old 9"x9" Floor Tile Under Carpet	3,900	SF	Classrooms and Closets rooms - 201, 202, 204, 205	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Old 9"x9" Floor Tile Mastic Under Carpet	3,900	SF	Classrooms and	CHR	MISC	N	NONE	0		No	ACBM with the		LOW



# Chicago Public Schools

School Namaste Charter Unit 66271 Building ID 6530

Address 3737 S. Paulina Street Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
40	Sink Caulk			Bathrooms	NO_ACBM	MISC								
41	Fire Doors	15	EA	Mechanical Areas, Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	Fire Door Frames	15	EA	Mechanical Areas	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	White Ceramic Wall Tile Grout	1,300	SF	Basement and 3rd floor Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	Blue Ceramic Wall Tiles Grout	2,400	SF	1st and 2nd Floor Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	Blue Ceramic Wall Tile Grout	1,000	SF	1st, 2nd and 3rd Floor Hallways in Original Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	Elevator Brake Pads	1	EA	Elevator Mechanical	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	2'x4' White Textured Ceiling Tile			Throughout 2009 Addition, Hallways, Rooms 202 & 203	NO_ACBM	MISC								
49	1'x1' Small Holes Ceiling Tile (Spline System)			Servery	NO_ACBM	MISC								
50	Grey Vinyl Stair Tread	1,400	SF	Stairs	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	Grey Vinyl Stair Tread Mastic	1,400	SF	Stairs	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	Ceramic Wall tile	600	SF	East Stairwell	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	Leveling Compound	20	SF	Basement Hallway outside Parent Center	ASSUMED	MISC	N	LOC	20			ACBM with the potential for damage	5	MODERATE
54	Duct Sealant	40	SF	Third Floor Hallway and Gross Motor Room	ASSUMED	MISC		NONE	0			ACBM with the potential for damage		LOW
T1	Aircell Pipe Insulation	20	LF	East Stairs At Basement Level	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		MODERATE
T2	2" Cardboard Pipe Insulation	35	LF	Lunch Room (Above Drop Ceiling on Southeast Side)	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
T3	6" Cardboard Pipe Insulation	1,000	LF	Basement West Hallway (Above Drop Ceiling), Pipe Chases (assumed)	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
T4	Hard Fittings on 6" Cardboard Pipe Insulation	100	LF	Basement West Hallway (above drop	CHR	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable		LOW



# Chicago Public Schools

School Namaste Charter Unit 66271 Building ID 6530

Address 3737 S. Paulina Street Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				ceiling), Pipe Chases (assumed)								suspect ACBM		

# Chicago Public Schools

School Namaste Charter Unit 66271 Building ID 6530  
Address 3737 S. Paulina Street Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>6/4/2019</b>
Inspector Name <b><u>Kenneth Karuhn</u></b>
<b>100-7278</b> <b>5/15/2020</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01	Not Observed
02	Not Observed
03	Not Observed
04	Not Observed
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	

# Chicago Public Schools

School Namaste Charter Unit 66271 Building ID 6530

Address 3737 S. Paulina Street Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
48	
49	
50	
51	
52	
53	

# Chicago Public Schools

**School** Namaste Charter **Unit** 66271 **Building ID** 6530

**Address** 3737 S. Paulina Street **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
54	
T1	
T2	
T3	
T4	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Namaste Charter  
**Address** 3737 S. Paulina Street

**Unit** 66271  
Chicago, IL, 60609

**Building ID** 6530  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Spray-On Fireproofing			Metal Deck of 2009 Addition	No ACBM	SURFACE					
02	Plaster Walls			Throughout Original Building	No ACBM	SURFACE					
03	Plaster Ceiling			Throughout Original Building	No ACBM	SURFACE					
04	Drywall, Tape and Joint Compound			Throughout 2009 Addition	No ACBM	MISC					
05	12"x12" Light Grey Tones Mottled Floor Tile	4,150	SF	Hallways and Lobby	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" Light Grey Tones Mottled Floor Tile Mastic	4,150	SF	Hallways and Lobby	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Medium Grey Tones Mottled Floor Tile	850	SF	Stairwell Landings	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Medium Grey Tones Mottled Floor Tile Mastic	850	SF	Stairwell Landings	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12"x12" Dark Blue Tones Mottled Floor Tile	475	SF	Pantry, Work Area, Copy Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12"x12" Dark Blue Tones Mottled Floor Tile Mastic	475	SF	Pantry, Work Area, Copy Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12"x12" Blue Grey Tones Mottled Floor Tile	570	SF	Servery	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12"x12" Blue/Grey Tones Mottled Floor Tile Mastic			Servery	No ACBM	MISC					
13	12"x12" Green Tones Mottled Floor Tile	450	SF	Teachers Resource Room 019	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" Green Tones Mottled Floor Tile Mastic	450	SF	Teachers Resource Room 019	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Wood Pattern Roll Out Vinyl Sheeting	4,375	SF	3rd Floor Gymnasium, 1st Floor Fitness Center	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Wood Pattern Roll Out Vinyl Sheeting Mastic	4,375	SF	3rd Floor Gymnasium, 1st Floor Fitness Center	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Old 9"x9" Floor Tile Under Carpet	3,900	SF	Classrooms and Closets rooms - 101, 102, 103, 104, 105	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	Old 9"x9" Floor Tile Mastic Under Carpet	3,900	SF	Classrooms and Closets rooms - 101, 102, 103, 104, 105	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Old 9"x9" Floor Tile Under Carpet	3,900	SF	Classrooms and Closets rooms - 201, 202, 204, 205	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Old 9"x9" Floor Tile Mastic Under Carpet	3,900	SF	Classrooms and Closets rooms - 201, 202, 204, 205	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Green Terrazzo Flooring	4,500	SF	Hallways and Washrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Black Terrazzo Flooring	1,000	SF	Hallways, Stairways, Bathrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	2"x2" Dark Grey Ceramic Tile Grout	700	SF	Boys/Girls Washrooms Baseemnt and 3rd Floor edging	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Namaste Charter  
**Address** 3737 S. Paulina Street

**Unit** 66271  
Chicago, IL, 60609

**Building ID** 6530  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
24	Gey/White/Black Epoxy Flooring			Lunch Room	No ACBM	MISC					Follow O&M Plan
25	Mastic Under Beige Carpet	3,100	SF	Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Mastic Under Brown w/ Purple Carpet	3,800	SF	Rooms 106, 206, 207, 208, 209, 304, 304, Library, Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	Grey/Dark Blue Carpet Squares Mastic	2,450	SF	Rooms - 102, 104, 105, 202, 201, 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Grey/Maroon Carpet Squares Mastic	800	SF	Rooms 101, 103, 204, 302	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Mastic Under Grey Carpet	640	SF	Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Grey Vinyl Baseboard			Throughout 2009 Addition	No ACBM	MISC					
31	Grey Vinyl Baseboard Mastic	2,750	LF	Throughout 2009 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
32	Tan Vinyl Baseboard			Teachers Resource Room 019	No ACBM	MISC					
33	Tan Vinyl Baseboard Mastic	100	LF	Teachers Resource Room 019	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
34	Black Vinyl Baseboard	100	LF	Servery	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
35	Black Vinyl Baseboard Mastic	100	LF	Servery	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
36	12"x12" Purple Tones Mottled Floor Tile	325	SF	Parent Resource Room 027	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12"x12" Purple Tones Mottled Floor Tile Mastic	325	SF	Parent Resource Room 027	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	Canvas Wall Covering	1,200	SF	Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Red Caulking Material			Throughout Building	No ACBM	MISC					
40	Sink Caulk			Bathrooms	No ACBM	MISC					
41	Fire Doors	15	EA	Mechanical Areas, Kitchen	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
42	Fire Door Frames	15	EA	Mechanical Areas	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
43	White Ceramic Wall Tile Grout	1,300	SF	Basement and 3rd floor Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	Blue Ceramic Wall Tiles Grout	2,400	SF	1st and 2nd Floor Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	Blue Ceramic Wall Tile Grout	1,000	SF	1st, 2nd and 3rd Floor Hallways in Original Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Elevator Brake Pads	1	EA	Elevator Mechanical	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
48	2'x4' White Textured Ceiling Tile			Throughout 2009 Addition, Hallways, Rooms 202 & 203	No ACBM	MISC					
49	1'x1' Small Holes Ceiling Tile (Spline System)			Servery	No ACBM	MISC					
50	Grey Vinyl Stair Tread	1,400	SF	Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Grey Vinyl Stair Tread Mastic	1,400	SF	Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Ceramic Wall tile	600	SF	East Stairwell	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Leveling Compound	20	SF	Basement Hallway outside Parent Center	Assumed	MISC	No	20	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Duct Sealant	40	SF	Third Floor Hallway and Gross Motor	Assumed	MISC		0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Namaste Charter  
**Address** 3737 S. Paulina Street

**Unit** 66271  
 Chicago, IL, 60609

**Building ID** 6530  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Room							
T1	Aircell Pipe Insulation	20	LF	East Stairs At Basement Level	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
T2	2" Cardboard Pipe Insulation	35	LF	Lunch Room (Above Drop Ceiling on Southeast Side)	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
T3	6" Cardboard Pipe Insulation	1,000	LF	Basement West Hallway (Above Drop Ceiling), Pipe Chases (assumed)	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
T4	Hard Fittings on 6" Cardboard Pipe Insulation	100	LF	Basement West Hallway (above drop ceiling), Pipe Chases (assumed)	Chrysotile	MISC	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan



# Chicago Public Schools

**School** Namaste Charter  
**Address** 3737 S. Paulina Street

**Unit** 66271  
 Chicago, IL, 60609

**Building ID** 6530  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

Review Date	06/30/2019
Manager Planner Name	Evan Christian
100-19466	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	replace damaged flooring as needed.
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	

# Chicago Public Schools

**School** Namaste Charter  
**Address** 3737 S. Paulina Street

**Unit** 66271  
Chicago, IL, 60609

**Building ID** 6530  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
48	
49	
50	
51	
52	

# Chicago Public Schools

**School** Namaste Charter  
**Address** 3737 S. Paulina Street

**Unit** 66271  
Chicago, IL, 60609

**Building ID** 6530  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
53	
54	
T1	
T2	
T3	
T4	

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **Spray-On Fireproofing**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Metal Deck of 2009 Addition**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed**

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **Spray-On Fireproofing**

MATERIAL LOCATION: **Metal Deck of 2009 Addition**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66271**    BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**    INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**    IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **Plaster Walls**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Original Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed**

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **Plaster Walls**

MATERIAL LOCATION: **Throughout Original Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**  
MATERIAL DESCRIPTION: **Plaster Ceiling**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Original Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed**

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **Plaster Ceiling**

MATERIAL LOCATION: **Throughout Original Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **Drywall, Tape and Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 2009 Addition**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed**

Inspector's Signature: \_\_\_\_\_

Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **Drywall, Tape and Joint Compound**

MATERIAL LOCATION: **Throughout 2009 Addition**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **12"x12" Light Grey Tones Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Hallways and Lobby**  
MATERIAL QUANTITY: **4150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **12"x12" Light Grey Tones Mottled Floor Tile**  
MATERIAL LOCATION: **Hallways and Lobby**  
MATERIAL QUANTITY: **4150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

replace damaged flooring as needed.

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **12"x12" Light Grey Tones Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallways and Lobby**

MATERIAL QUANTITY: **4150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **12"x12" Light Grey Tones Mottled Floor Tile Mastic**

MATERIAL LOCATION: **Hallways and Lobby**

MATERIAL QUANTITY: **4150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66271**    BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**    INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**    IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **12"x12" Medium Grey Tones Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Stairwell Landings**  
MATERIAL QUANTITY: **850**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **12"x12" Medium Grey Tones Mottled Floor Tile**

MATERIAL LOCATION: **Stairwell Landings**

MATERIAL QUANTITY: **850**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **12"x12" Medium Grey Tones Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Stairwell Landings**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **12"x12" Medium Grey Tones Mottled Floor Tile Mastic**

MATERIAL LOCATION: **Stairwell Landings**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **12"x12" Dark Blue Tones Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Pantry, Work Area, Copy Room**  
MATERIAL QUANTITY: **475** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **12"x12" Dark Blue Tones Mottled Floor Tile**  
MATERIAL LOCATION: **Pantry, Work Area, Copy Room**  
MATERIAL QUANTITY: **475** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **12"x12" Dark Blue Tones Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Pantry, Work Area, Copy Room**

MATERIAL QUANTITY: **475**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **12"x12" Dark Blue Tones Mottled Floor Tile Mastic**  
MATERIAL LOCATION: **Pantry, Work Area, Copy Room**  
MATERIAL QUANTITY: **475** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **12"x12" Blue Grey Tones Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY: **570**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **12"x12" Blue Grey Tones Mottled Floor Tile**  
MATERIAL LOCATION: **Servery**  
MATERIAL QUANTITY: **570** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **12"x12" Blue/Grey Tones Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **12"x12" Blue/Grey Tones Mottled Floor Tile Mastic**

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **12"x12" Green Tones Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teachers Resource Room 019**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **12"x12" Green Tones Mottled Floor Tile**

MATERIAL LOCATION: **Teachers Resource Room 019**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **12"x12" Green Tones Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Teachers Resource Room 019**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **12"x12" Green Tones Mottled Floor Tile Mastic**

MATERIAL LOCATION: **Teachers Resource Room 019**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66271**    BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**    INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**    IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Wood Pattern Roll Out Vinyl Sheeting**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Gymnasium, 1st Floor Fitness Center**  
MATERIAL QUANTITY: **4375**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Wood Pattern Roll Out Vinyl Sheeting**  
MATERIAL LOCATION: **3rd Floor Gymnasium, 1st Floor Fitness Center**  
MATERIAL QUANTITY: **4375** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Wood Pattern Roll Out Vinyl Sheeting Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Gymnasium, 1st Floor Fitness Center**  
MATERIAL QUANTITY: **4375** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Wood Pattern Roll Out Vinyl Sheeting Mastic**  
MATERIAL LOCATION: **3rd Floor Gymnasium, 1st Floor Fitness Center**  
MATERIAL QUANTITY: **4375** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Under Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Closets rooms - 101, 102, 103, 104, 105**

MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Under Carpet**  
MATERIAL LOCATION: **Classrooms and Closets rooms - 101, 102, 103, 104, 105**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Mastic Under Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Classrooms and Closets rooms - 101, 102, 103, 104, 105**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Mastic Under Carpet**  
MATERIAL LOCATION: **Classrooms and Closets rooms - 101, 102, 103, 104, 105**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Under Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Classrooms and Closets rooms - 201, 202, 204, 205**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Under Carpet**  
MATERIAL LOCATION: **Classrooms and Closets rooms - 201, 202, 204, 205**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Mastic Under Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Classrooms and Closets rooms - 201, 202, 204, 205**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Old 9"x9" Floor Tile Mastic Under Carpet**

MATERIAL LOCATION: **Classrooms and Closets rooms - 201, 202, 204, 205**

MATERIAL QUANTITY: **3900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Green Terrazzo Flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Hallways and Washrooms**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Green Terrazzo Flooring**

MATERIAL LOCATION: **Hallways and Washrooms**

MATERIAL QUANTITY: **4500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Black Terrazzo Flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallways, Stairways, Bathrooms**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Black Terrazzo Flooring**

MATERIAL LOCATION: **Hallways, Stairways, Bathrooms**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **2"x2" Dark Grey Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boys/Girls Washrooms Baseemnt and 3rd Floor edging**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **2"x2" Dark Grey Ceramic Tile Grout**  
MATERIAL LOCATION: **Boys/Girls Washrooms Baseemnt and 3rd Floor edging**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Gey/White/Black Epoxy Flooring**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Lunch Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Gey/White/Black Epoxy Flooring**

MATERIAL LOCATION: **Lunch Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Mastic Under Beige Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Offices**  
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Mastic Under Beige Carpet**

MATERIAL LOCATION: **Offices**

MATERIAL QUANTITY: **3100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Mastic Under Brown w/ Purple Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 106, 206, 207, 208, 209, 304, 304, Library, Library Office**  
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Mastic Under Brown w/ Purple Carpet**  
MATERIAL LOCATION: **Rooms 106, 206, 207, 208, 209, 304, 304, Library, Library Office**  
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Grey/Dark Blue Carpet Squares Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms - 102, 104, 105, 202, 201, 205**  
MATERIAL QUANTITY: **2450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Grey/Dark Blue Carpet Squares Mastic**  
MATERIAL LOCATION: **Rooms - 102, 104, 105, 202, 201, 205**  
MATERIAL QUANTITY: **2450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

## Carnow, Conibear and Associates 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Grey/Maroon Carpet Squares Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 101, 103, 204, 302**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Grey/Maroon Carpet Squares Mastic**

MATERIAL LOCATION: **Rooms 101, 103, 204, 302**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Mastic Under Grey Carpet**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 301**  
MATERIAL QUANTITY: **640** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Mastic Under Grey Carpet**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **640** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Grey Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 2009 Addition**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Grey Vinyl Baseboard**

MATERIAL LOCATION: **Throughout 2009 Addition**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Grey Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 2009 Addition**  
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **Grey Vinyl Baseboard Mastic**

MATERIAL LOCATION: **Throughout 2009 Addition**

MATERIAL QUANTITY: **2750**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **Tan Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teachers Resource Room 019**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Tan Vinyl Baseboard**

MATERIAL LOCATION: **Teachers Resource Room 019**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **Tan Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Teachers Resource Room 019**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **Tan Vinyl Baseboard Mastic**

MATERIAL LOCATION: **Teachers Resource Room 019**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Servery**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Black Vinyl Baseboard**

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Servery**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Black Vinyl Baseboard Mastic**

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12"x12" Purple Tones Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Parent Resource Room 027**

MATERIAL QUANTITY: **325**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12"x12" Purple Tones Mottled Floor Tile**

MATERIAL LOCATION: **Parent Resource Room 027**

MATERIAL QUANTITY: **325**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66271**    BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**    INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**    IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12"x12" Purple Tones Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Parent Resource Room 027**

MATERIAL QUANTITY: **325**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12"x12" Purple Tones Mottled Floor Tile Mastic**  
MATERIAL LOCATION: **Parent Resource Room 027**  
MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **Canvas Wall Covering**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 301**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Canvas Wall Covering**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **Red Caulking Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Red Caulking Material**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **Sink Caulk**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Bathrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Sink Caulk**

MATERIAL LOCATION: **Bathrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **Fire Doors**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Mechanical Areas, Kitchen**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Fire Doors**

MATERIAL LOCATION: **Mechanical Areas, Kitchen**

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Fire Door Frames**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Mechanical Areas**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Fire Door Frames**

MATERIAL LOCATION: **Mechanical Areas**

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **White Ceramic Wall Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement and 3rd floor Bathrooms**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **White Ceramic Wall Tile Grout**  
MATERIAL LOCATION: **Basement and 3rd floor Bathrooms**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **Blue Ceramic Wall Tiles Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st and 2nd Floor Bathrooms**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **Blue Ceramic Wall Tiles Grout**

MATERIAL LOCATION: **1st and 2nd Floor Bathrooms**

MATERIAL QUANTITY: **2400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Blue Ceramic Wall Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd and 3rd Floor Hallways in Original Building**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Blue Ceramic Wall Tile Grout**  
MATERIAL LOCATION: **1st, 2nd and 3rd Floor Hallways in Original Building**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Elevator Brake Pads**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Elevator Mechanical**  
MATERIAL QUANTITY: **1** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **Elevator Brake Pads**

MATERIAL LOCATION: **Elevator Mechanical**

MATERIAL QUANTITY: **1**

MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **2'x4' White Textured Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 2009 Addition, Hallways, Rooms 202 &203**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **2'x4' White Textured Ceiling Tile**

MATERIAL LOCATION: **Throughout 2009 Addition, Hallways, Rooms 202 &203**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **1'x1' Small Holes Ceiling Tile (Spline System)**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **1'x1' Small Holes Ceiling Tile (Spline System)**

MATERIAL LOCATION: **Servery**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66271**    BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**    INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**    IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Grey Vinyl Stair Tread**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Stairs**  
MATERIAL QUANTITY: **1400**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Grey Vinyl Stair Tread**  
MATERIAL LOCATION: **Stairs**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Grey Vinyl Stair Tread Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Stairs**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **Grey Vinyl Stair Tread Mastic**

MATERIAL LOCATION: **Stairs**

MATERIAL QUANTITY: **1400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T1**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **East Stairs At Basement Level**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**



# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **T1**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **East Stairs At Basement Level**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T2**  
MATERIAL DESCRIPTION: **2" Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Lunch Room (Above Drop Ceiling on Southeast Side)**  
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **T2**  
MATERIAL DESCRIPTION: **2" Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Lunch Room (Above Drop Ceiling on Southeast Side)**  
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T3**  
MATERIAL DESCRIPTION: **6" Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement West Hallway (Above Drop Ceiling), Pipe Chases (assumed)**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **T3**  
MATERIAL DESCRIPTION: **6" Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Basement West Hallway (Above Drop Ceiling), Pipe Chases (assumed)**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T4**  
MATERIAL DESCRIPTION: **Hard Fittings on 6" Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement West Hallway (above drop ceiling), Pipe Chases (assumed)**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter** REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

HOMOGENEOUS AREA: **T4**  
MATERIAL DESCRIPTION: **Hard Fittings on 6" Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Basement West Hallway (above drop ceiling), Pipe Chases (assumed)**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66271**      BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**      INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**      IDPH LICENSE NO: **100-7278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **Duct Sealant**

MATERIAL LOCATION: **Third Floor Hallway and Gross Motor Room**

MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC**      FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW**      CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:

DAMAGE QUANTITY: **0**      DAMAGE REASON:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 06/04/2019



# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66271**      BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter**      REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street**      IDPH LICENSE NO: **100-7278**

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Duct Sealant**  
MATERIAL LOCATION: **Third Floor Hallway and Gross Motor Room**  
MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

## Carnow, Conibear and Associates 2019 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66271** BUIDLING ID: **6530**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter** INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street** IDPH LICENSE NO: **100-7278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Ceramic Wall tile**  
MATERIAL LOCATION: **East Stairwell**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66271**      BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter**      REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street**      IDPH LICENSE NO: **100-7278**

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Ceramic Wall tile**  
MATERIAL LOCATION: **East Stairwell**  
MATERIAL QUANTITY: **600**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66271**    BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Namaste Charter**    INSPECTION DATE: **6/4/2019**  
ADDRESS: **3737 S. Paulina Street**    IDPH LICENSE NO: **100-7278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Leveling Compound**  
MATERIAL LOCATION: **Basement Hallway outside Parent Center**  
MATERIAL QUANTITY: **20**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **MODERATE**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **20**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **06/04/2019**

# Chicago Public Schools

Carnow, Conibear and Associates

**2019 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66271**      BUILDING ID: **6530**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Namaste Charter**      REVIEW DATE: **6/30/2019**  
ADDRESS: **3737 S. Paulina Street**      IDPH LICENSE NO: **100-7278**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **Leveling Compound**

MATERIAL LOCATION: **Basement Hallway outside Parent Center**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **20**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **06/30/2019**

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2019 AHERA REINSPECTION***

# APPENDIX B

## Inspector and Management Planner Licenses

---

2019



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ [www.otssafety.com](http://www.otssafety.com)

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

## Kenneth Karuhn

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/13/2019

Exam Date: 9/13/2019

Expiration Date: 9/13/2020

Certificate Number: BIR1909131705

---

Kathy DeSalvo, Director





**ASBESTOS  
PROFESSIONAL  
LICENSE**

ID NUMBER  
**100 - 07278**

ISSUED  
**4/12/2019**

EXPIRES  
**05/15/2020**

**KENNETH A KARUHN**  
600 W VAN BUREN ST., STE 5  
CHICAGO, IL 60607

Environmental Health



**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

11/28/2019

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

12/5/2019

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

2015



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159

  
Katy DeSalvo, Director

**Reliable**  
**Environmental**  
**Solutions, Inc.** **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,  
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

**Asbestos Management Planner Initial Training**

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)  
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

*William S. Williams*

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ [www.ReliableEnv.com](http://www.ReliableEnv.com)

2019



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ [www.otssafety.com](http://www.otssafety.com)

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that  
**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2019

Exam Date: 11/19/2019

Expiration Date: 11/19/2020

Certificate Number: BIR1911192384

  
Kathy DeSalvo, Director



**ASBESTOS  
PROFESSIONAL  
LICENSE**

ID NUMBER  
**100 - 19466**

ISSUED  
**4/12/2019**

EXPIRES  
**05/15/2020**

**EVAN I CHRISTIAN**  
3024 N RACINE AVE, APT 2  
CHICAGO, IL 60657



Environmental Health

**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

11/28/2019

MANAGEMENT PLANNER

1/5/2019

PROJECT MANAGER

2/5/2020

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

2019



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ [www.otssafety.com](http://www.otssafety.com)

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/7/2019

Exam Date: 1/7/2019


Expiration Date: 1/7/2020

Certificate Number: MPR1901070063

  
Kathy DeSalvo, Director

# Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

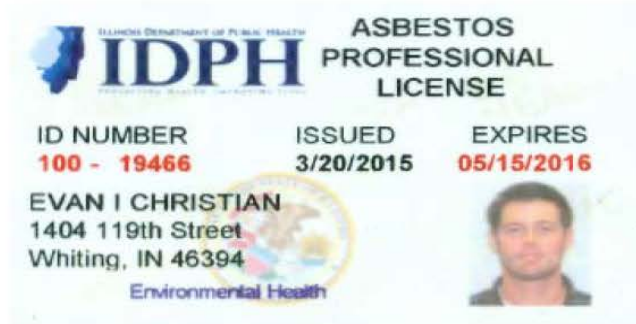

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW  
CONIBEAR**

# APPENDIX C

## Laboratory Accreditations

---



# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed