

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-537x
SCHOOL NAME: UNO - Rufino Tomayo Campus
ADDRESS OF SCHOOL: 5135 S. California Ave.
CITY: Chicago, IL, 60629-

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **8/23/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 284
IDPH INSPECTOR LICENSE NUMBER: 100-03175
IDPH LICENSED INSPECTOR NAME(Please Print): Marcos Iwankiw
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

UNO - Rufino Tomayo Campus

5135 S. California Ave.
Chicago, IL, 60629-

Unit: 66391
Building ID: 3340

IDPH ID Number: 14-016-2990-537x

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

July 11, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66391 Region: 02 IDPH ID:14-016-2990-537x

School: UNO - Rufino Tomayo Campus Building ID: 3340

Address: 5135 S. California Ave.

Chicago, IL, 60629-

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 08/01/2019

Inspector: Marcos Iwankiw

Inspector IDPH License: 100-03175

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates

Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: July 11, 2019

RE: UNO - Rufino Tomayo Campus, Unit 66391
5135 S. California Ave.
Chicago, IL, 60629-

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at UNO - Rufino Tomayo Campus, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at UNO - Rufino Tomayo Campus, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the UNO - Rufino Tomayo Campus. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3340:

007	Vinyl Floor Tile Mastic 12"x12" Brown
B	9x9 Floor Tile Beige w/ Dark Spots
C	9x9 Floor Tile Off-White w/ Black Marks

B. The following new homogenous areas have been identified for Building 3340:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

001	MJP on Fiberglass Pipe Insulation
002	MJP on Fiberglass Pipe Insulation
003	Lay In Ceiling Panels 2X2 w/Random Dots
004	Vinyl Floor Tile
005	Vinyl Floor Tile 12"x12" Brown
006	Vinyl Floor Tile Mastic
007	Vinyl Floor Tile Mastic 12"x12" Brown
008	Hard Ceiling Plaster
050	Marble Window Sills
051	Vibration Dampers
052	Window Caulk
075	Boiler Breeching Insulation
076	Layered Plaster
77	2'X4' Ceiling Tile w/ Divots & Dots
78	12"X12" Lime green floor tile
79	12"X12" Lime Green Floor Tile Mastic
A	9x9 Floor Tile White w/ Green
B	9x9 Floor Tile Beige w/ Dark Spots
C	9x9 Floor Tile Off-White w/ Black Marks
D	9x9 Floor Tile - Lt Brown w/ Dark Brown Streaks
E	2x4 Ceiling Tile White w/ Worm
F	12x12 Lt Beige w/White Spots
G	9x9 Green Floor Tile w/White and Dark Green streaks
J	9x9 Floor Tile White w/Green Mastic
K	Mastic under 9x9 Floor Tile Beige With Dark Spots
L	Mastic under 9x9 Floor Tile Off White w/ Black Mar
M	Mastic-9x9 floor Tile Lt Brown w/ Dark Brown Marks
N	Mastic under 12x12 Floor Tile Beige w/White Spots
o	Mastic Under 9x9 FloorTile Green w/Dark Green Spot

The following areas were deemed to be inaccessible:

005	Vinyl Floor Tile 12"x12" Brown
006	Vinyl Floor Tile Mastic
007	Vinyl Floor Tile Mastic 12"x12" Brown
J	9x9 Floor Tile White w/Green Mastic

- K Mastic under 9x9 Floor Tile Beige With Dark Spots
- L Mastic under 9x9 Floor Tile Off White w/ Black Mar
- M Mastic-9x9 floor Tile Lt Brown w/ Dark Brown Marks
- N Mastic under 12x12 Floor Tile Beige w/White Spots
- o Mastic Under 9x9 FloorTile Green w/Dark Green Spot

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Marcos Iwankiw, IDPH License # 100-03175. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The UNO - Rufino Tomayo Campus Building 3340 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School UNO - Rufino Tomayo Campus Unit 66391 Building ID 3340

Address 5135 S. California Ave. Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
001	MJP on Fiberglass Pipe Insulation	105	LF	Heating Water System Throughout Facility	ASSUMED	TSI	Y	LOC	20		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	MODERATE
002	MJP on Fiberglass Pipe Insulation	65	LF	Domestic Cold Water Lines	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
003	Lay In Ceiling Panels 2X2 w/Random Dots	13,500	SF	Classrooms	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
004	Vinyl Floor Tile	8,000	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
005	Vinyl Floor Tile 12"x12" Brown	520	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
006	Vinyl Floor Tile Mastic	9,000	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
007	Vinyl Floor Tile Mastic 12"x12" Brown	520	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
008	Hard Ceiling Plaster	3,780	SF	Washrooms, Kitchen, Staff Area, Locker Areas, Teacher's Lounge, Offices and Janitor's Room	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
050	Marble Window Sills	114	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
051	Vibration Dampers	25	SF	Gym/Stage Ceiling	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
052	Window Caulk	2,200	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
075	Boiler Breeching Insulation	550	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
076	Layered Plaster	2,500	SF	Boiler Room	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
77	2'X4' Ceiling Tile w/ Divots & Dots	4,900	SF	Corridors 1st floor & 2nd floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
78	12"X12" Lime green floor tile	125	SF	main office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
79	12"X12" Lime Green Floor Tile Mastic	125	SF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
A	9x9 Floor Tile White w/ Green	3,000	SF	Room 101-105, 204, 205	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
B	9x9 Floor Tile Beige w/ Dark Spots	1,600	SF	Rooms 102-203	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
C	9x9 Floor Tile Off-White w/ Black Marks	1,600	SF	Rooms 103-202	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School UNO - Rufino Tomayo Campus Unit 66391 Building ID 3340

Address 5135 S. California Ave. Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
D	9x9 Floor Tile - Lt Brown w/ Dark Brown Streaks	1,600	SF	Rooms 102-201, Music Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
E	2x4 Ceiling Tile White w/ Worm	2,000	SF	Lunch Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
F	12x12 Lt Beige w/White Spots	2,000	SF	Lunch Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
G	9x9 Green Floor Tile w/White and Dark Green streaks	200	SF	Special Education Room	ASSUMED	MISC	N	LOC	3		No	ACBM with the potential for damage	2	MODERATE
H	Brown Carpet Glue			Principal's Office		MISC								
I	Gray carpet glue			Main Office		MISC								
J	9x9 Floor Tile White w/Green Mastic	3,000	SF	Rooms 101,105, 204-205	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
K	Mastic under 9x9 Floor Tile Beige With Dark Spots	1,600	SF	Rooms 102-203	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
L	Mastic under 9x9 Floor Tile Off White w/ Black Mar	1,600	SF	Rooms 103-202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
M	Mastic-9x9 floor Tile Lt Brown w/ Dark Brown Marks	1,600	SF	Rooms 102-201 and Music Room	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
N	Mastic under 12x12 Floor Tile Beige w/White Spots	2,000	SF	Lunch Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
o	Mastic Under 9x9 FloorTile Green w/Dark Green Spot	200	SF	Special Education Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School UNO - Rufino Tomayo Campus Unit 66391 Building ID 3340
Address 5135 S. California Ave. Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 7/11/2019
Inspector Name <u>Marcos Iwankiw</u>
100-03175 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
001	
002	
003	
004	
005	
006	
007	
008	
050	
051	
052	
075	
076	
77	
78	
79	
A	
B	
C	
D	
E	
F	
G	

Chicago Public Schools

School UNO - Rufino Tomayo Campus **Unit** 66391 **Building ID** 3340
Address 5135 S. California Ave. **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
H	
I	
J	
K	
L	
M	
N	
O	

Table II

Management Planner's Review

Chicago Public Schools

School UNO - Rufino Tomayo
Campus

Unit 66391

Building ID 3340

Address 5135 S. California Ave.

Chicago, IL, 60629-

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, Il, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	MJP on Fiberglass Pipe Insulation	105	LF	Heating Water System Throughout Facility	Assumed	TSI	Yes	20	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Remove
002	MJP on Fiberglass Pipe Insulation	65	LF	Domestic Cold Water Lines	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
003	Lay In Ceiling Panels 2X2 w/Random Dots	13,500	SF	Classrooms	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
004	Vinyl Floor Tile	8,000	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
005	Vinyl Floor Tile 12"x12" Brown	520	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006	Vinyl Floor Tile Mastic	9,000	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007	Vinyl Floor Tile Mastic 12"x12" Brown	520	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
008	Hard Ceiling Plaster	3,780	SF	Washrooms, Kitchen, Staff Area, Locker Areas, Teacher's Lounge, Offices and Janitor's Room	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
050	Marble Window Sills	114	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
051	Vibration Dampers	25	SF	Gym/Stage Ceiling	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
052	Window Caulk	2,200	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
075	Boiler Breeching Insulation	550	SF	Boiler Room	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
076	Layered Plaster	2,500	SF	Boiler Room	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	2'X4' Ceiling Tile w/ Divots & Dots	4,900	SF	Corridors 1st floor & 2nd floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
78	12"X12" Lime green floor tile	125	SF	main office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	12"X12" Lime Green Floor Tile Mastic	125	SF	Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	9x9 Floor Tile White w/ Green	3,000	SF	Room 101-105, 204, 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	9x9 Floor Tile Beige w/ Dark Spots	1,600	SF	Rooms 102-203	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	9x9 Floor Tile Off-White w/ Black Marks	1,600	SF	Rooms 103-202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
D	9x9 Floor Tile - Lt Brown w/ Dark Brown Streaks	1,600	SF	Rooms 102-201, Music Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	2x4 Ceiling Tile White w/ Worm	2,000	SF	Lunch Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F	12x12 Lt Beige w/White Spots	2,000	SF	Lunch Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	9x9 Green Floor Tile w/White and Dark Green streaks	200	SF	Special Education Room	Assumed	MISC	No	3	SF	6 ACBM with the potential for damage	Follow O&M Plan
H	Brown Carpet Glue			Principal's Office		MISC					
I	Gray carpet glue			Main Office		MISC					
J	9x9 Floor Tile White w/Green Mastic	3,000	SF	Rooms 101,105, 204-205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K	Mastic under 9x9 Floor Tile Beige With Dark Spots	1,600	SF	Rooms 102-203	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
L	Mastic under 9x9 Floor Tile Off White w/ Black	1,600	SF	Rooms 103-202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School UNO - Rufino Tomayo
Campus

Unit 66391

Building ID 3340

Address 5135 S. California Ave.

Chicago, IL, 60629-

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Mar										
M	Mastic-9x9 floor Tile Lt Brown w/ Dark Brown Marks	1,600	SF	Rooms 102-201 and Music Room	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
N	Mastic under 12x12 Floor Tile Beige w/White Spots	2,000	SF	Lunch Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
o	Mastic Under 9x9 FloorTile Green w/Dark Green Spot	200	SF	Special Education Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School UNO - Rufino Tomayo
Campus
Address 5135 S. California Ave.

Unit 66391
Chicago, IL, 60629-

Building ID 3340
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	08/01/2019
Manager Planner Name	Evan Christian
100-19466	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002	
003	
004	
005	
006	
007	
008	
050	
051	
052	
075	
076	
77	
78	
79	
A	
B	
C	
D	
E	
F	
G	
H	

Chicago Public Schools

School UNO - Rufino Tomayo
Campus
Address 5135 S. California Ave.

Unit 66391
Chicago, IL, 60629-

Building ID 3340
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
I	
J	
K	
L	
M	
N	
o	

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration
Physical Damage**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration
Physical Damage**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Heating Water System Throughout Facility**
MATERIAL QUANTITY: **105** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **20** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: **07/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **001**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Heating Water System Throughout Facility**
MATERIAL QUANTITY: **105** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **20** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Domestic Cold Water Lines**
MATERIAL QUANTITY: **65** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Domestic Cold Water Lines**
MATERIAL QUANTITY: **65** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **Lay In Ceiling Panels 2X2 w/Random Dots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Classrooms**
MATERIAL QUANTITY: **13500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **Lay In Ceiling Panels 2X2 w/Random Dots**
MATERIAL LOCATION: **Classrooms**
MATERIAL QUANTITY: **13500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUILDING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **Vinyl Floor Tile**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005**
MATERIAL DESCRIPTION: **Vinyl Floor Tile 12"x12" Brown**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **520**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **005**
MATERIAL DESCRIPTION: **Vinyl Floor Tile 12"x12" Brown**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUILDING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **Vinyl Floor Tile Mastic 12"x12" Brown**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **Vinyl Floor Tile Mastic 12"x12" Brown**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **Hard Ceiling Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Washrooms, Kitchen, Staff Area, Locker Areas, Teacher's Lounge, Offices and Janitor's Room**

MATERIAL QUANTITY: **3780** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **Hard Ceiling Plaster**
MATERIAL LOCATION: **Washrooms, Kitchen, Staff Area, Locker Areas, Teacher's Lounge, Offices and Janitor's Room**
MATERIAL QUANTITY: **3780** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **050**
MATERIAL DESCRIPTION: **Marble Window Sills**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **114** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **050**
MATERIAL DESCRIPTION: **Marble Window Sills**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **114** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **051**
MATERIAL DESCRIPTION: **Vibration Dampers**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Gym/Stage Ceiling**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **051**
MATERIAL DESCRIPTION: **Vibration Dampers**
MATERIAL LOCATION: **Gym/Stage Ceiling**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **052**
MATERIAL DESCRIPTION: **Window Caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **052**
MATERIAL DESCRIPTION: **Window Caulk**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **075**
MATERIAL DESCRIPTION: **Boiler Breeching Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **075**
MATERIAL DESCRIPTION: **Boiler Breeching Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **076**
MATERIAL DESCRIPTION: **Layered Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **076**
MATERIAL DESCRIPTION: **Layered Plaster**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **2'X4' Ceiling Tile w/ Divots & Dots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Corridors 1st floor & 2nd floor**
MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **2'X4' Ceiling Tile w/ Divots & Dots**
MATERIAL LOCATION: **Corridors 1st floor & 2nd floor**
MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUILDING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **12"X12" Lime green floor tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **main office**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **12"X12" Lime green floor tile**
MATERIAL LOCATION: **main office**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **12"X12" Lime Green Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **12"X12" Lime Green Floor Tile Mastic**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **9x9 Floor Tile White w/ Green**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 101-105, 204, 205**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **9x9 Floor Tile White w/ Green**
MATERIAL LOCATION: **Room 101-105, 204, 205**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **9x9 Floor Tile Beige w/ Dark Spots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 102-203**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **9x9 Floor Tile Beige w/ Dark Spots**
MATERIAL LOCATION: **Rooms 102-203**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **9x9 Floor Tile Off-White w/ Black Marks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 103-202**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **9x9 Floor Tile Off-White w/ Black Marks**
MATERIAL LOCATION: **Rooms 103-202**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **9x9 Floor Tile - Lt Brown w/ Dark Brown Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 102-201, Music Room**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **9x9 Floor Tile - Lt Brown w/ Dark Brown Streaks**
MATERIAL LOCATION: **Rooms 102-201, Music Room**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **2x4 Ceiling Tile White w/ Worm**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **2x4 Ceiling Tile White w/ Worm**
MATERIAL LOCATION: **Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **12x12 Lt Beige w/White Spots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **12x12 Lt Beige w/White Spots**
MATERIAL LOCATION: **Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **9x9 Green Floor Tile w/White and Dark Green streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Delamination
Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Special Education Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **3** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **9x9 Green Floor Tile w/White and Dark Green streaks**
MATERIAL LOCATION: **Special Education Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **3** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Brown Carpet Glue**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Brown Carpet Glue**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Gray carpet glue**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Gray carpet glue**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **9x9 Floor Tile White w/Green Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 101,105, 204-205**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **9x9 Floor Tile White w/Green Mastic**
MATERIAL LOCATION: **Rooms 101,105, 204-205**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Mastic under 9x9 Floor Tile Beige With Dark Spots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 102-203**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Mastic under 9x9 Floor Tile Beige With Dark Spots**
MATERIAL LOCATION: **Rooms 102-203**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Mastic under 9x9 Floor Tile Off White w/ Black Mar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 103-202**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Mastic under 9x9 Floor Tile Off White w/ Black Mar**
MATERIAL LOCATION: **Rooms 103-202**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Mastic-9x9 floor Tile Lt Brown w/ Dark Brown Marks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 102-201 and Music Room**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Mastic-9x9 floor Tile Lt Brown w/ Dark Brown Marks**
MATERIAL LOCATION: **Rooms 102-201 and Music Room**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Mastic under 12x12 Floor Tile Beige w/White Spots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Mastic under 12x12 Floor Tile Beige w/White Spots**
MATERIAL LOCATION: **Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** INSPECTION DATE: **7/11/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **o**
MATERIAL DESCRIPTION: **Mastic Under 9x9 FloorTile Green w/Dark Green Spot**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Special Education Room**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66391** BUIDLING ID: **3340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Rufino Tomayo Campus** REVIEW DATE: **8/1/2019**
ADDRESS: **5135 S. California Ave.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **o**
MATERIAL DESCRIPTION: **Mastic Under 9x9 FloorTile Green w/Dark Green Spot**
MATERIAL LOCATION: **Special Education Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **08/01/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2019

Exam Date: 11/19/2019

Expiration Date: 11/19/2020

Certificate Number: BIR1911192384


Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 19466

ISSUED
4/12/2019

EXPIRES
05/15/2020

EVAN I CHRISTIAN
3024 N RACINE AVE, APT 2
CHICAGO, IL 60657



Environmental Health

ENDORSEMENTS

TC EXPIRES

INSPECTOR

11/28/2019

MANAGEMENT PLANNER

1/5/2019

PROJECT MANAGER

2/5/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/7/2019

Exam Date: 1/7/2019


Expiration Date: 1/7/2020

Certificate Number: MPR1901070063


Kathy DeSalvo, Director

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

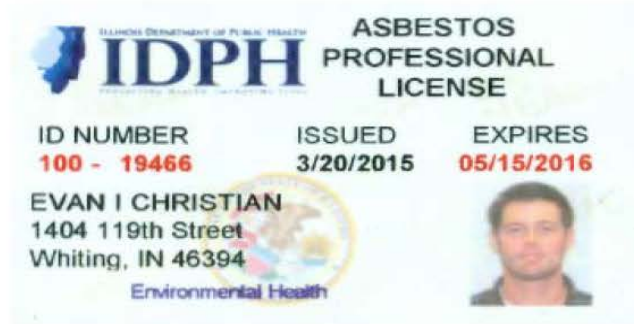

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed