

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: UNKNOWN
SCHOOL NAME: UNO - Archer Heights North
ADDRESS OF SCHOOL: 4248 W 47th St.
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **8/22/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 612
IDPH INSPECTOR LICENSE NUMBER: 100-03175
IDPH LICENSED INSPECTOR NAME(Please Print): Marcos Iwankiw
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

UNO - Archer Heights North

4248 W 47th St.
Chicago, IL, 60632

Unit: 66395
Building ID: 3344

IDPH ID Number: UNKNOWN

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

July 17, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66395 Region: 04 IDPH ID: UNKNOWN

School: UNO - Archer Heights North Building ID: 3344

Address: 4248 W 47th St.

Chicago, IL, 60632

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 07/31/2019

Inspector: Marcos Iwankiw

Inspector IDPH License: 100-03175

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates

Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: July 17, 2019

RE: UNO - Archer Heights North, Unit 66395
4248 W 47th St.
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at UNO - Archer Heights North, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at UNO - Archer Heights North, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: UNO - Archer Heights North
Address: 4248 W 47th St.
IDPH ID: UNKNOWN
Contact:

Unit: 66395
Chicago, IL, 60632
Building ID: 3344
Phone:

Region: 04

2. Description of Facility

Original Construction:
Total Square Footage:
Current Occupancy: 612

Additional Construction:
No of Floors:

3. LEA Designated Person

Contact: Robert Christlieb
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Doug McCormick
Address 600 West Van Buren St., Ste 500
Chicago, Il, 60607
Phone: (312) 762-2900

Fax: (312) 782-5145

5. Inspector

Inspector Name: Marcos Iwankiw

Inspector IDPH license # 100-03175

Signature:
Date: 7/17/2019

6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:
Date: 07/31/2019

7. Review Date:07/31/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the UNO - Archer Heights North. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3344:

B. The following new homogenous areas have been identified for Building 3344:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	Drywall Joint Compound
11	12" X 12" White with Green Specks Floor Tile
11M	12" X 12" White with Green Specks Floor Tile
13	Carpet Adhesive for Blue/Black Striped Carpet Tile
15	4" Sky Blue Baseboard
17	Mastic used for 4" Sky Blue Baseboard
18	2' X 2' White Ceiling Tiles
19	2' x 4' Drop Face White with Pin Dots Ceiling Tile
2	Drywall Joint Compound
20	Sinks
3	12"X 12" Light Blue Mix Floor Tile
3M	12" X 12" Light Blue Mix Floor Tile Mastic
4	12" X 12" Blue Mix Floor Tile
4M	12" X 12" Blue Mix Floor Tile Mastic
5	12" X 12" Dark Blue Mix Floor Tile
5M	12" X 12" Dark Blue Mix Floor Tile Mastic
6	12" X 12" White with Gray Mix Floor Tile
6M	12" X 12" White with Gray Mix Floor Tile Mastic
7	12" X 12" White with Blue Specks Floor Tile
7M	12"X12" White with Blue Specks Floor Tile Mastic

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Marcos Iwankiw, IDPH License # 100-03175. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The UNO - Archer Heights North Building 3344 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School UNO - Archer Heights North Unit 66395 Building ID 3344

Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	Drywall Joint Compound	4,500	SF	Throughout 1st Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12" X 12" White with Green Specks Floor Tile	200	SF	1st Floor NW Vestibule	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
11M	12" X 12" White with Green Specks Floor Tile	200	SF	1st Floor NW Vestibule	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
13	Carpet Adhesive for Blue/Black Striped Carpet Tile	275	SF	1st Floor- Small Corner Offices	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
15	4" Sky Blue Baseboard	5,400	LF	Throughout 1st Floor	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
17	Mastic used for 4" Sky Blue Baseboard	5,460	LF	Throughout 1st Floor	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
18	2' X 2' White Ceiling Tiles	14,000	SF	1st Floor halls, Vestibule , Teachers office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
19	2' x 4' Drop Face White with Pin Dots Ceiling Tile	10,940	SF	1st Floor Classrooms and Multi-Purpose Room	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
2	Drywall Joint Compound	4,500	SF	Throughout 1st Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Sinks	7		Classrooms (Art Room & Science Room) in 1st Floor, and Multi-purpose room	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
3	12"X 12" Light Blue Mix Floor Tile	23,325	SF	1st Floor - Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3M	12" X 12" Light Blue Mix Floor Tile Mastic	23,325	SF	1st Floor Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
4	12" X 12" Blue Mix Floor Tile	1,250	SF	1st Floor- Halls, Engineer's Office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
4M	12" X 12" Blue Mix Floor Tile Mastic	1,250	SF	1st Floor-Halls, Engineer's Office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
5	12" X 12" Dark Blue Mix Floor Tile	55	SF	1st Floor Halls and Engineer's Office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
5M	12" X 12" Dark Blue Mix Floor Tile Mastic	55	SF	1st Floor Halls and Engineer's Office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
6	12" X 12" White with Gray Mix Floor Tile	13,675	SF	1st Floor Halls, Teacher's offices,	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW

Chicago Public Schools

School UNO - Archer Heights North Unit 66395 Building ID 3344

Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Bathrooms, Resource Room										
6M	12" X 12" White with Gray Mix Floor Tile Mastic	13,675	SF	1st Floor Halls, Teacher's Offices, Bathrooms, Resource Room	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
7	12" X 12" White with Blue Specks Floor Tile	270	SF	1st Floor Teachers Office 1-50	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
7M	12"X12" White with Blue Specks Floor Tile Mastic	270	SF	1st Floor Teachers Offices 1-50	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW

Chicago Public Schools

School UNO - Archer Heights North Unit 66395 Building ID 3344
Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 7/17/2019
Inspector Name <u>Marcos Iwankiw</u>
100-03175 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	
11	
11M	
13	
15	
17	
18	
19	
2	
20	
3	
3M	
4	
4M	
5	
5M	
6	
6M	
7	
7M	

Chicago Public Schools

School UNO - Archer Heights North **Unit** 66395 **Building ID** 3344
Address 4248 W 47th St. **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School UNO - Archer Heights
North

Unit 66395

Building ID 3344

Address 4248 W 47th St.

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	Drywall Joint Compound	4,500	SF	Throughout 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12" X 12" White with Green Specks Floor Tile	200	SF	1st Floor NW Vestibule	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
11M	12" X 12" White with Green Specks Floor Tile	200	SF	1st Floor NW Vestibule	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Carpet Adhesive for Blue/Black Striped Carpet Tile	275	SF	1st Floor- Small Corner Offices	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
15	4" Sky Blue Baseboard	5,400	LF	Throughout 1st Floor	Assumed	MISC	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
17	Mastic used for 4" Sky Blue Baseboard	5,460	LF	Throughout 1st Floor	Assumed	MISC	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
18	2' X 2' White Ceiling Tiles	14,000	SF	1st Floor halls, Vestibule , Teachers office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
19	2' x 4' Drop Face White with Pin Dots Ceiling Tile	10,940	SF	1st Floor Classrooms and Multi-Purpose Room	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
2	Drywall Joint Compound	4,500	SF	Throughout 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Sinks	7		Classrooms (Art Room & Science Room) in 1st Floor, and Multi-purpose room	Assumed	MISC	Yes			6 ACBM with the potential for damage	Follow O&M Plan
3	12"X 12" Light Blue Mix Floor Tile	23,325	SF	1st Floor - Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3M	12" X 12" Light Blue Mix Floor Tile Mastic	23,325	SF	1st Floor Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
4	12" X 12" Blue Mix Floor Tile	1,250	SF	1st Floor- Halls, Engineer's Office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
4M	12" X 12" Blue Mix Floor Tile Mastic	1,250	SF	1st Floor-Halls, Engineer's Office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
5	12" X 12" Dark Blue Mix Floor Tile	55	SF	1st Floor Halls and Engineer's Office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
5M	12" X 12" Dark Blue Mix Floor Tile Mastic	55	SF	1st Floor Halls and Engineer's Office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
6	12" X 12" White with Gray Mix Floor Tile	13,675	SF	1st Floor Halls, Teacher's offices, Bathrooms, Resource Room	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
6M	12" X 12" White with Gray Mix Floor Tile Mastic	13,675	SF	1st Floor Halls, Teacher's Offices, Bathrooms, Resource Room	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
7	12" X 12" White with Blue Specks Floor Tile	270	SF	1st Floor Teachers Office 1-50	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
7M	12"X12" White with Blue Specks Floor Tile Mastic	270	SF	1st Floor Teachers Offices 1-50	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School UNO - Archer Heights
North

Unit 66395

Building ID 3344

Address 4248 W 47th St.

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	07/31/2019
Manager Planner Name	Evan Christian
100-19466	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
11	
11M	
13	
15	
17	
18	
19	

Chicago Public Schools

School UNO - Archer Heights
North
Address 4248 W 47th St.

Unit 66395
Chicago, IL, 60632

Building ID 3344
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
2	
20	
3	
3M	
4	
4M	
5	
5M	
6	
6M	
7	
7M	

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" X 12" White with Green Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor NW Vestibule**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" X 12" White with Green Specks Floor Tile**
MATERIAL LOCATION: **1st Floor NW Vestibule**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11M**
MATERIAL DESCRIPTION: **12" X 12" White with Green Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor NW Vestibule**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **11M**
MATERIAL DESCRIPTION: **12" X 12" White with Green Specks Floor Tile**
MATERIAL LOCATION: **1st Floor NW Vestibule**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Carpet Adhesive for Blue/Black Striped Carpet Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor- Small Corner Offices**

MATERIAL QUANTITY: **275**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Carpet Adhesive for Blue/Black Striped Carpet Tile**
MATERIAL LOCATION: **1st Floor- Small Corner Offices**
MATERIAL QUANTITY: **275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **4" Sky Blue Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **4" Sky Blue Baseboard**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Mastic used for 4" Sky Blue Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **5460** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Mastic used for 4" Sky Blue Baseboard**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **5460** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **2' X 2' White Ceiling Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor halls, Vestibule , Teachers office**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **2' X 2' White Ceiling Tiles**
MATERIAL LOCATION: **1st Floor halls, Vestibule , Teachers office**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **2' x 4' Drop Face White with Pin Dots Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Classrooms and Multi-Purpose Room**
MATERIAL QUANTITY: **10940** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **2' x 4' Drop Face White with Pin Dots Ceiling Tile**
MATERIAL LOCATION: **1st Floor Classrooms and Multi-Purpose Room**
MATERIAL QUANTITY: **10940** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Sinks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms (Art Room & Science Room) in 1st Floor, and Multi-purpose room**

MATERIAL QUANTITY: **7** MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Sinks**
MATERIAL LOCATION: **Classrooms (Art Room & Science Room) in 1st Floor, and Multi-purpose room**
MATERIAL QUANTITY: **7** MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12"X 12" Light Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor - Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms**
MATERIAL QUANTITY: **23325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12"X 12" Light Blue Mix Floor Tile**
MATERIAL LOCATION: **1st Floor - Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms**
MATERIAL QUANTITY: **23325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3M**
MATERIAL DESCRIPTION: **12" X 12" Light Blue Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms**
MATERIAL QUANTITY: **23325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **3M**
MATERIAL DESCRIPTION: **12" X 12" Light Blue Mix Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Halls, Classrooms, Teacher Offices, Vestibules, Bathrooms**
MATERIAL QUANTITY: **23325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" X 12" Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor- Halls, Engineer's Office**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" X 12" Blue Mix Floor Tile**
MATERIAL LOCATION: **1st Floor- Halls, Engineer's Office**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4M**
MATERIAL DESCRIPTION: **12" X 12" Blue Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor-Halls, Engineer's Office**

MATERIAL QUANTITY: **1250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **4M**
MATERIAL DESCRIPTION: **12" X 12" Blue Mix Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor-Halls, Engineer's Office**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" X 12" Dark Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Halls and Engineer's Office**

MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" X 12" Dark Blue Mix Floor Tile**
MATERIAL LOCATION: **1st Floor Halls and Engineer's Office**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5M**
MATERIAL DESCRIPTION: **12" X 12" Dark Blue Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Halls and Engineer's Office**

MATERIAL QUANTITY: **55**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **5M**
MATERIAL DESCRIPTION: **12" X 12" Dark Blue Mix Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Halls and Engineer's Office**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" X 12" White with Gray Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Halls, Teacher's offices, Bathrooms, Resource Room**
MATERIAL QUANTITY: **13675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" X 12" White with Gray Mix Floor Tile**
MATERIAL LOCATION: **1st Floor Halls, Teacher's offices, Bathrooms, Resource Room**
MATERIAL QUANTITY: **13675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6M**
MATERIAL DESCRIPTION: **12" X 12" White with Gray Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Halls, Teacher's Offices, Bathrooms, Resource Room**
MATERIAL QUANTITY: **13675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **6M**
MATERIAL DESCRIPTION: **12" X 12" White with Gray Mix Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Halls, Teacher's Offices, Bathrooms, Resource Room**
MATERIAL QUANTITY: **13675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" X 12" White with Blue Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Teachers Office 1-50**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" X 12" White with Blue Specks Floor Tile**
MATERIAL LOCATION: **1st Floor Teachers Office 1-50**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights North** INSPECTION DATE: **7/17/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7M**
MATERIAL DESCRIPTION: **12"X12" White with Blue Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Teachers Offices 1-50**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/17/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66395** BUIDLING ID: **3344**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **UNO - Archer Heights North** REVIEW DATE: **7/31/2019**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **7M**
MATERIAL DESCRIPTION: **12"X12" White with Blue Specks Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Teachers Offices 1-50**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **07/31/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2019

Exam Date: 11/19/2019

Expiration Date: 11/19/2020

Certificate Number: BIR1911192384


Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 19466

ISSUED
4/12/2019

EXPIRES
05/15/2020

EVAN I CHRISTIAN
3024 N RACINE AVE, APT 2
CHICAGO, IL 60657



Environmental Health

ENDORSEMENTS

TC EXPIRES

INSPECTOR

11/28/2019

MANAGEMENT PLANNER

1/5/2019

PROJECT MANAGER

2/5/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/7/2019

Exam Date: 1/7/2019

Expiration Date: 1/7/2020


Certificate Number: MPR1901070063



Kathy DeSalvo, Director

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

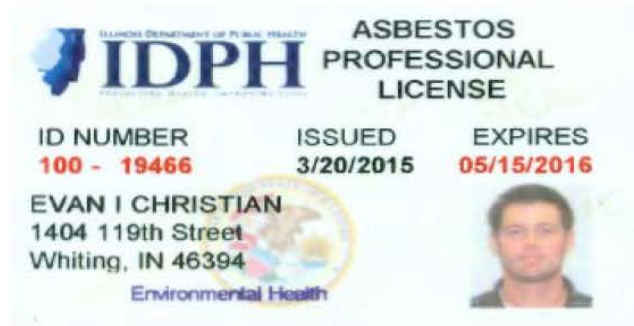

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed