

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-LERN
SCHOOL NAME: LEARN Charter School - Hunter Perkins
ADDRESS OF SCHOOL: 1700 83RD
CITY: Chicago, IL, 60620

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 1/18/2017

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 470
IDPH INSPECTOR LICENSE NUMBER: 100-09106
IDPH LICENSED INSPECTOR NAME(Please Print): Michael Hasier
IDPH MP LICENSE NUMBER: 100-00746
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Amy Williams

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

LEARN Charter School - Hunter Perkins

1700 83RD
Chicago, IL, 60620

Unit: 66564
Building ID: 54796

IDPH ID Number: 14-016-2990-LERN

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

September 24, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66564 Region: IDPH ID:14-016-2990-LERN

School: LEARN Charter School - Hunter Perkins Building ID: 54796

Address: 1700 83RD

Chicago, IL, 60620

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 10/20/2019

Inspector: Michael Hasier

Inspector IDPH License: 100-09106

Management Planner: Amy Williams

Management Planner IDPH License: 100-00746

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

Amy Williams
100-00746

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 24, 2019

RE: LEARN Charter School - Hunter Perkins, Unit 66564
1700 83RD
Chicago, IL, 60620

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at LEARN Charter School - Hunter Perkins, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at LEARN Charter School - Hunter Perkins, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: LEARN Charter School - Hunter Perkins Unit: 66564 Region:
Address: 1700 83RD Chicago, IL, 60620
IDPH ID: 14-016-2990-LERN Building ID: 54796
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 470

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880 Fax: 630-790-0882

5. Inspector

Inspector Name: Michael Hasier

Inspector IDPH license # 100-09106

Signature:
Date: 9/24/2019

6. Management Planner

Management Planner Name: Amy Williams

Management Planner IDPH license # 100-00746

Signature:
Date: 10/20/2019

7. Review Date:10/20/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the LEARN Charter School - Hunter Perkins. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 54796:

B. The following new homogenous areas have been identified for Building 54796:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	4" Beige Baseboard
02	4" Beige Baseboard Adhesive
03	4" Violet Baseboard
04	4" Violet Baseboard Adhesive
05	Drywall
06	Drywall Joint Compound
07	2' x 4' Mini Dot w/Small Specks Ceiling Tile
08	Carpet Adhesive
09	Plaster
10	Gray Duct Work Joint Sealant
11	2' x 2' White Ceiling Tile
12	2' x 4' White Ceiling Tile
13	12" x 12" Tan Mix Floor Tile
14	12" x 12" Tan Mix Floor Tile Mastic
15	Red Pipe & Conduit Wall Penetration Sealant
16	4" Aqua Baseboard
17	4" Aqua Baseboard Adhesive
18	Imitation Wood Sheet Flooring
19	Imitation Wood Sheet Flooring Adhesive
20	4" Lime Green Baseboard
21	4" Lime Green Baseboard Adhesive
22	4" Light Blue Baseboard
23	4" Light Blue Baseboard Adhesive
24	Dark Brown Window & Door Frame Flexible Caulk
25	4" Rust Brown Baseboard
26	4" Rust Brown Baseboard Adhesive
27	Gray, Flexible Window Frame Caulk
28	Caulk on Stained Glass Windows
29	Terrazzo Flooring and Wall Panels
30	Remnant of 1' x 1' Ceiling Tile
31	Ceiling Tile Adhesive
32	Waterproofing/Insulation on Exterior Supply Air HVAC Duct
33	Textured Plaster
34	Red Sealant on Exhaust Duct
35	Transite Window Sill

The following areas were deemed to be inaccessible:

02	4" Beige Baseboard Adhesive
----	-----------------------------

04	4" Violet Baseboard Adhesive
08	Carpet Adhesive
14	12" x 12" Tan Mix Floor Tile Mastic
17	4" Aqua Baseboard Adhesive
19	Imitation Wood Sheet Flooring Adhesive
21	4" Lime Green Baseboard Adhesive
23	4" Light Blue Baseboard Adhesive
26	4" Rust Brown Baseboard Adhesive
31	Ceiling Tile Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Hasier, IDPH License # 100-09106. The Management Plan was updated by Amy Williams, IDPH License # 100-00746. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The LEARN Charter School - Hunter Perkins Building 54796 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School LEARN Charter School - Hunter Perkins Unit 66564 Building ID 54796

Address 1700 83RD Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	4" Beige Baseboard	3,000	LF	Throughout facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02	4" Beige Baseboard Adhesive	3,000	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03	4" Violet Baseboard	200	LF	Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04	4" Violet Baseboard Adhesive	200	LF	Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05	Drywall	46,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06	Drywall Joint Compound	46,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	2' x 4' Mini Dot w/Small Specks Ceiling Tile	1,700	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
08	Carpet Adhesive	20,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	Plaster	3,100	SF	Room 202, 1st & 2nd Floor Hall, 2nd Floor Elevator Hall, 2nd Floor Boys' & Girls' Bathrooms, East & West Stairwells	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Gray Duct Work Joint Sealant	1,600	LF	Throughout Facility	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
11	2' x 2' White Ceiling Tile	670	SF	Lobby Stairs/Vestibule Front Door, 1st & 2nd Floor Staff Bathroom, Copy Room 109, Administration 112	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
12	2' x 4' White Ceiling Tile	770	SF	Conference Room, Staff Room by Lobby, 2nd Floor Boys' & Girls' Bathroom	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
13	12" x 12" Tan Mix Floor Tile	400	SF	Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LEARN Charter School - Hunter Perkins Unit 66564 Building ID 54796

Address 1700 83RD Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Stairwells										
14	12" x 12" Tan Mix Floor Tile Mastic	400	SF	Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Red Pipe & Conduit Wall Penetration Sealant	25	SF	103 N & S Vestibule, Electrical Room, Elevator Room, Mechanical Room, Generator Room, Pipe Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	4" Aqua Baseboard	100	LF	Rooms 101, 104, 105	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	4" Aqua Baseboard Adhesive	100	SF	Rooms 101, 104, 105	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	Imitation Wood Sheet Flooring	2,400	SF	Multi-Purpose Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Imitation Wood Sheet Flooring Adhesive	2,400	SF	Multi-Purpose Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	4" Lime Green Baseboard	500	LF	Rooms 001-011, Basement Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	4" Lime Green Baseboard Adhesive	500	LF	Rooms 001-011, Basement Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	4" Light Blue Baseboard	20	LF	Room 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	4" Light Blue Baseboard Adhesive	20	LF	Room 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Dark Brown Window & Door Frame Flexible Caulk	2,000	LF	Interior Sides of All Exterior Window & Door Frames	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	4" Rust Brown Baseboard	70	LF	Copy Room 109, Principal's Office 110, Administration 112, Conference Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	4" Rust Brown Baseboard Adhesive	70	LF	Copy Room 109, Principal's Office 110, Administration 112, Conference Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	Gray, Flexible Window Frame Caulk	100	LF	2nd Floor Interior Windows	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LEARN Charter School - Hunter Perkins Unit 66564 Building ID 54796

Address 1700 83RD Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
28	Caulk on Stained Glass Windows	10	LF	Teacher's Break Room, Office & Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Terrazzo Flooring and Wall Panels	750	SF	Lobby and Front Stairwell	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Remnant of 1' x 1' Ceiling Tile	1	SF	1st Floor on Corner of Front Stair Stringer in Lobby	ASSUMED	MISC	Y	LOC	1		No	Damaged or significantly damaged friable misc. ACBM		LOW
31	Ceiling Tile Adhesive	1	SF	1st Floor on Corner of Front Stair Stringer in Lobby	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Waterproofing/Insulation on Exterior Supply Air HVAC Duct	1,500	SF	North Exterior and Roof	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Textured Plaster	200	SF	Southeast Corner, Exterior Portico	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
34	Red Sealant on Exhaust Duct	15	LF	Mechanical Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Transite Window Sill	250	SF	Interior Side of Exterior Windows	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LEARN Charter School - Hunter Perkins Unit 66564 Building ID 54796

Address 1700 83RD Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 9/24/2019
Inspector Name Michael Hasier
100-09106 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	

Chicago Public Schools

School LEARN Charter School - Hunter Perkins Unit 66564 Building ID 54796

Address 1700 83RD Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	

Table II

Management Planner's Review

Chicago Public Schools

School LEARN Charter School -
Hunter Perkins

Unit 66564

Building ID 54796

Address 1700 83RD

Chicago, IL, 60620

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	4" Beige Baseboard	3,000	LF	Throughout facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
02	4" Beige Baseboard Adhesive	3,000	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
03	4" Violet Baseboard	200	LF	Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
04	4" Violet Baseboard Adhesive	200	LF	Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
05	Drywall	46,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	Drywall Joint Compound	46,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	2' x 4' Mini Dot w/Small Specks Ceiling Tile	1,700	SF	Throughout Facility	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
08	Carpet Adhesive	20,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Plaster	3,100	SF	Room 202, 1st & 2nd Floor Hall, 2nd Floor Elevator Hall, 2nd Floor Boys' & Girls' Bathrooms, East & West Stairwells	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Gray Duct Work Joint Sealant	1,600	LF	Throughout Facility	Assumed	TSI	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
11	2' x 2' White Ceiling Tile	670	SF	Lobby Stairs/Vestibule Front Door, 1st & 2nd Floor Staff Bathroom, Copy Room 109, Administration 112	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
12	2' x 4' White Ceiling Tile	770	SF	Conference Room, Staff Room by Lobby, 2nd Floor Boys' & Girls' Bathroom	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
13	12" x 12" Tan Mix Floor Tile	400	SF	Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12" x 12" Tan Mix Floor Tile Mastic	400	SF	Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Red Pipe & Conduit Wall Penetration Sealant	25	SF	103 N & S Vestibule, Electrical Room, Elevator Room, Mechanical Room, Generator Room, Pipe Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	4" Aqua Baseboard	100	LF	Rooms 101, 104, 105	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
17	4" Aqua Baseboard Adhesive	100	SF	Rooms 101, 104, 105	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	Imitation Wood Sheet Flooring	2,400	SF	Multi-Purpose Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School LEARN Charter School -
Hunter Perkins

Unit 66564

Building ID 54796

Address 1700 83RD

Chicago, IL, 60620

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
19	Imitation Wood Sheet Flooring Adhesive	2,400	SF	Multi-Purpose Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	4" Lime Green Baseboard	500	LF	Rooms 001-011, Basement Hall	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
21	4" Lime Green Baseboard Adhesive	500	LF	Rooms 001-011, Basement Hall	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
22	4" Light Blue Baseboard	20	LF	Room 106	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
23	4" Light Blue Baseboard Adhesive	20	LF	Room 106	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
24	Dark Brown Window & Door Frame Flexible Caulk	2,000	LF	Interior Sides of All Exterior Window & Door Frames	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
25	4" Rust Brown Baseboard	70	LF	Copy Room 109, Principal's Office 110, Administration 112, Conference Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
26	4" Rust Brown Baseboard Adhesive	70	LF	Copy Room 109, Principal's Office 110, Administration 112, Conference Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
27	Gray, Flexible Window Frame Caulk	100	LF	2nd Floor Interior Windows	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
28	Caulk on Stained Glass Windows	10	LF	Teacher's Break Room, Office & Kitchen	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
29	Terrazzo Flooring and Wall Panels	750	SF	Lobby and Front Stairwell	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Remnant of 1' x 1' Ceiling Tile	1	SF	1st Floor on Corner of Front Stair Stringer in Lobby	Assumed	MISC	Yes	1	SF	4 Damaged or significantly damaged friable misc. ACBM	Remove
31	Ceiling Tile Adhesive	1	SF	1st Floor on Corner of Front Stair Stringer in Lobby	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Waterproofing/Insulation on Exterior Supply Air HVAC Duct	1,500	SF	North Exterior and Roof	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	Textured Plaster	200	SF	Southeast Corner, Exterior Portico	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	Red Sealant on Exhaust Duct	15	LF	Mechanical Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
35	Transite Window Sill	250	SF	Interior Side of Exterior Windows	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School LEARN Charter School -
Hunter Perkins

Unit 66564

Building ID 54796

Address 1700 83RD

Chicago, IL, 60620

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	10/20/2019
Manager Planner Name	Amy Williams
100-00746	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	

Chicago Public Schools

School LEARN Charter School -
Hunter Perkins

Unit 66564

Building ID 54796

Address 1700 83RD

Chicago, IL, 60620

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	

Chicago Public Schools

School LEARN Charter School -
Hunter Perkins

Unit 66564

Building ID 54796

Address 1700 83RD

Chicago, IL, 60620

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **4" Beige Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout facility**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **4" Beige Baseboard**
MATERIAL LOCATION: **Throughout facility**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **4" Beige Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **4" Beige Baseboard Adhesive**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **4" Violet Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **4" Violet Baseboard**
MATERIAL LOCATION: **Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **4" Violet Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **4" Violet Baseboard Adhesive**
MATERIAL LOCATION: **Rooms 201, 204, 205, 207, 209, 210, 2nd Floor Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **46000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **46000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **46000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **46000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **2' x 4' Mini Dot w/Small Specks Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **2' x 4' Mini Dot w/Small Specks Ceiling Tile**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Carpet Adhesive**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 202, 1st & 2nd Floor Hall, 2nd Floor Elevator Hall, 2nd Floor Boys' & Girls' Bathrooms, East & West Stairwells**

MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **Room 202, 1st & 2nd Floor Hall, 2nd Floor Elevator Hall, 2nd Floor Boys' & Girls' Bathrooms, East & West Stairwells**
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 10/20/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Gray Duct Work Joint Sealant**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Gray Duct Work Joint Sealant**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lobby Stairs/Vestibule Front Door, 1st & 2nd Floor Staff Bathroom, Copy Room 109, Administration 112**

MATERIAL QUANTITY: **670** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tile**
MATERIAL LOCATION: **Lobby Stairs/Vestibule Front Door, 1st & 2nd Floor Staff Bathroom, Copy Room 109, Administration 112**
MATERIAL QUANTITY: **670** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 10/20/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **2' x 4' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Conference Room, Staff Room by Lobby, 2nd Floor Boys' & Girls' Bathroom**
MATERIAL QUANTITY: **770** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **2' x 4' White Ceiling Tile**
MATERIAL LOCATION: **Conference Room, Staff Room by Lobby, 2nd Floor Boys' & Girls' Bathroom**
MATERIAL QUANTITY: **770** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12" x 12" Tan Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12" x 12" Tan Mix Floor Tile**
MATERIAL LOCATION: **Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 10/20/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12" x 12" Tan Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12" x 12" Tan Mix Floor Tile Mastic**
MATERIAL LOCATION: **Basement Elevator Hall, Storage behind Room 002, 2nd Floor Elevator Hall, East & West Stairwells**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 10/20/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Red Pipe & Conduit Wall Penetration Sealant**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **103 N & S Vestibule, Electrical Room, Elevator Room, Mechanical Room, Generator Room, Pipe Room**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Red Pipe & Conduit Wall Penetration Sealant**
MATERIAL LOCATION: **103 N & S Vestibule, Electrical Room, Elevator Room, Mechanical Room, Generator Room, Pipe Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 10/20/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **4" Aqua Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 101, 104, 105**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **4" Aqua Baseboard**
MATERIAL LOCATION: **Rooms 101, 104, 105**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **4" Aqua Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 101, 104, 105**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **4" Aqua Baseboard Adhesive**
MATERIAL LOCATION: **Rooms 101, 104, 105**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Imitation Wood Sheet Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Imitation Wood Sheet Flooring**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Imitation Wood Sheet Flooring Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Imitation Wood Sheet Flooring Adhesive**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **4" Lime Green Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001-011, Basement Hall**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **4" Lime Green Baseboard**
MATERIAL LOCATION: **Rooms 001-011, Basement Hall**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **4" Lime Green Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001-011, Basement Hall**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **4" Lime Green Baseboard Adhesive**
MATERIAL LOCATION: **Rooms 001-011, Basement Hall**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **4" Light Blue Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 106**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **4" Light Blue Baseboard**
MATERIAL LOCATION: **Room 106**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **4" Light Blue Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 106**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **4" Light Blue Baseboard Adhesive**
MATERIAL LOCATION: **Room 106**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Dark Brown Window & Door Frame Flexible Caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Interior Sides of All Exterior Window & Door Frames**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Dark Brown Window & Door Frame Flexible Caulk**
MATERIAL LOCATION: **Interior Sides of All Exterior Window & Door Frames**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **4" Rust Brown Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Copy Room 109, Principal's Office 110, Administration 112, Conference Room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **4" Rust Brown Baseboard**
MATERIAL LOCATION: **Copy Room 109, Principal's Office 110, Administration 112, Conference Room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **4" Rust Brown Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Copy Room 109, Principal's Office 110, Administration 112, Conference Room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **4" Rust Brown Baseboard Adhesive**
MATERIAL LOCATION: **Copy Room 109, Principal's Office 110, Administration 112, Conference Room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Gray, Flexible Window Frame Caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Interior Windows**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Gray, Flexible Window Frame Caulk**
MATERIAL LOCATION: **2nd Floor Interior Windows**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Caulk on Stained Glass Windows**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Break Room, Office & Kitchen**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Caulk on Stained Glass Windows**
MATERIAL LOCATION: **Teacher's Break Room, Office & Kitchen**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Terrazzo Flooring and Wall Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lobby and Front Stairwell**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Terrazzo Flooring and Wall Panels**
MATERIAL LOCATION: **Lobby and Front Stairwell**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Remnant of 1' x 1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **4 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor on Corner of Front Stair Stringer in Lobby**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Remnant of 1' x 1' Ceiling Tile**
MATERIAL LOCATION: **1st Floor on Corner of Front Stair Stringer in Lobby**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Ceiling Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor on Corner of Front Stair Stringer in Lobby**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** REVIEW DATE: **10/20/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Ceiling Tile Adhesive**
MATERIAL LOCATION: **1st Floor on Corner of Front Stair Stringer in Lobby**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Waterproofing/Insulation on Exterior Supply Air HVAC Duct**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **North Exterior and Roof**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Waterproofing/Insulation on Exterior Supply Air HVAC Duct**
MATERIAL LOCATION: **North Exterior and Roof**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/0219**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Textured Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Southeast Corner, Exterior Portico**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/0219

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Textured Plaster**
MATERIAL LOCATION: **Southeast Corner, Exterior Portico**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Red Sealant on Exhaust Duct**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Room**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Red Sealant on Exhaust Duct**
MATERIAL LOCATION: **Mechanical Room**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUILDING ID: **54796**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **LEARN Charter School - Hunter Perkins** INSPECTION DATE: **9/24/2019**
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Transite Window Sill**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Interior Side of Exterior Windows**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66564** BUIDLING ID: **54796**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **LEARN Charter School** REVIEW DATE: **10/20/2019**
- Hunter Perkins
ADDRESS: **1700 83RD** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Transite Window Sill**
MATERIAL LOCATION: **Interior Side of Exterior Windows**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/20/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MICHAEL HASIER
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 05/01/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

05/01/2019
Course Dates:
05/01/2020
Expires:
1905BIR02
Certificate Number:



Office: 312-491-0081
Fax: 312-421-2901

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS	TC EXPIRES
SUPERVISOR/WORKER	3/1/2020
INSPECTOR	5/1/2020

ID NUMBER	ISSUED	EXPIRES
100 - 09106	5/8/2019	05/15/2020

MICHAEL S HASIER
444 OLD BARN RD., APT. B
BARRINGTON, IL 60010

Environmental Health



PROJECT MANAGER 3/1/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**Reliable
Environmental
Solutions, Inc.** **RES**

This is to certify that **Amy J. Williams**

*has on 04/03/19, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: April 03, 2019

COURSE LENGTH: 4 HOURS

Examination Date: April 03, 2019

Expiration Date: April 03, 2020

William S. Williams

Certificate Number: BIR/0808

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com



2539 Vandalia Street, Collinsville, IL 62234 * Phone: 618-855-8764

Environmental and Occupational Safety & Health Training

Does hereby certify

William Williams

4211 Westgate Drive, Springfield, IL 62711

*Has successfully completed and passed the course examination with at least
70% for re-accreditation under AHERA (Title II)*

Asbestos Management Planner Refresher

Class Date: 02/15/2019
Examination Date: 02/15/2019
STC Certificate Number: STC-20190215-000527AMPR
Certification Expiration: 02/15/2020

David M. Mendoza – President/Training Director
Certified Environmental Specialist
OSHA Authorized Instructor

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS

TC EXPIRES

INSPECTOR

4/21/2019

ID NUMBER

ISSUED

EXPIRES

MANAGEMENT PLANNER

4/21/2019

100 - 00746

4/11/2019

05/15/2020

PROJECT MANAGER

4/2/2020


AIR SAMPLING PROFESSIONAL

AMY J WILLIAMS

1408 S CLAY

JACKSONVILLE, IL 62650

Environmental Health

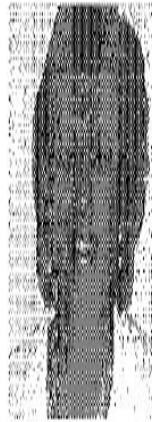

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed