

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2208
SCHOOL NAME: Frazier School
ADDRESS OF SCHOOL: 4027 W. Grenshaw
CITY: Chicago, IL, 60624

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/9/2010

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/6/2013 ENROLLMENT 0

IDPH INSPECTOR LICENSE NUMBER: 100-09725

IDPH LICENSED INSPECTOR NAME (Please Print): Patrick Hrycyk

IDPH MP LICENSE NUMBER: 100-03613

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



4/6/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Frazier School

4027 W. Grenshaw
Chicago, IL, 60624

Unit: 26531
Building ID: 7780

IDPH ID Number: 14-016-2990-2208

REPORT DATE:

Saturday, April 06, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 15, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 26531 Region: 03 IDPH ID: 14-016-2990-2208

School: Frazier School Building ID: 7780

Address: 4027 W. Grenshaw
Chicago, IL, 60624

Building Contact: Contact Phone:


Current Building Owners: Chicago Public Schools

Review Date: 4/6/2013

Inspector: Patrick Hrycyk Inspector IDPH License: 100-09725
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 15, 2013

RE: Frazier School, Unit 26531
4027 W. Grenshaw
Chicago, IL, 60624

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Frazier School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Frazier School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Frazier School Unit: 26531 Region: 03
Address: 4027 W. Grenshaw Chicago, IL, 60624
IDPH ID: 14-016-2990-2208 Building ID: 7780
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 0

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Patrick Hrycyk


Inspector IDPH license # 100-09725

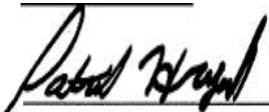Signature: 
Date: 3/15/2013

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

Signature: 
Date: 4/6/2013

7. Review Date: 4/6/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/6/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Frazier School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 7780:

38	2' x 4' Long Fissured w/pinholes Ceiling Tile
39	2' x 4' Small Fissured w/pinholes Ceiling Tile
40	2' x 4' Fissured Ceiling Tile w/brown backing
41	White Sink Coat

B. The following new homogenous areas have been identified for Building 7780:

65	12"x12" Dark Blue w/Blue Floor Tile
65M	12"x12" Dark Blue w/Blue Floor Tile Mastic
66	12"x12" Orange Floor Tile
66M	12"x12" Orange Floor Tile Mastic
67	12"x12" Dark Brown w/ Light Brown Floor Tile
67M	12"x12" Dark Brown w/ Light Brown Floor Tile Mastic
68	12"x12" White w/Multi Color Floor Tile
68M	12"x12" White w/Multi Color Floor Tile Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

20	9" x 9" White/multi-colored Vinyl Floor Tile
21	9" x 9" White/multi-colored VFT Mastic
22	9" x 9" Blue Vinyl Floor Tile
34	Stage Lights Electrical Insulation
35	12" x 12" Tan Floor Tile and Mastic
36	9" x 9" Black with White Streaks Floor Tile
37	9" x 9" Black with White Streaks Floor Tile Mastic
38	2' x 4' Long Fissured w/pinholes Ceiling Tile
39	2' x 4' Small Fissured w/pinholes Ceiling Tile
40	2' x 4' Fissured Ceiling Tile w/brown backing
41	White Sink Coat
43	Vault Door Core
44	12" x 12" White w/Green & Brown Specks FT
45	12" x 12" White w/Green & Brown Specks FT Mastic
46	4" Green Vinyl Baseboard
47	4" Green Vinyl Baseboard Adhesive
48	Chalk Board/Poster Board Adhesive
49	Poster Board Adhesive
5	12" x 12" Off-white Vinyl Floor Tile
50	12x12 Tan Floor Tile
51	12x12 Tan Floor tile mastic
52	12" x 12" White with Blue Floor Tile
52M	12" x 12" White with Blue Floor Tile Mastic
53	12" x 12" White with Grey Floor Tile
53M	12" x 12" White with Grey Floor Tile Mastic
54	12" x 12" Light Brown Floor Tile
54M	12" x 12" Light Brown Floor Tile Mastic
55	12" x 12" Grey with Blue Floor Tile
55M	12" x 12" Grey with Blue Floor Tile Mastic
56	Carpet Mastic
57	12" x 12" Light Grey Floor Tile
57M	12" x 12" Light Grey Floor Tile Mastic
58	Carpet Glue
59	Blue Ceramic Tile and Grout
60	Blue Ceramic Floor Tile Mastic
61	White Ceramic Floor Tile & Grout
62	White Ceramic Floor Tile Mastic
63	Red Ceramic Floor Tile and Grout
64	Red Ceramic TFLoor Tile Mastic
65	12"x12" Dark Blue w/Blue Floor Tile
65M	12"x12" Dark Blue w/Blue Floor Tile Mastic
66	12"x12" Orange Floor Tile
66M	12"x12" Orange Floor Tile Mastic

67	12"x12" Dark Brown w/ Light Brown Floor Tile
67M	12"x12" Dark Brown w/ Light Brown Floor Tile Mastic
68	12"x12" White w/Multi Color Floor Tile
68M	12"x12" White w/Multi Color Floor Tile Mastic

The following areas were deemed to be inaccessible:

11	9" x 9" Brown Vinyl Floor Tile Mastic
13	9" x 9" Tan Vinyl Floor Tile Mastic
15	9" x 9" Grey Vinyl Floor Tile Mastic
17	9" x 9" Green Vinyl Floor Tile Mastic
19	9" x 9" Beige Vinyl Floor Tile Mastic
21	9" x 9" White/multi-colored VFT Mastic
23	9" x 9" Blue Vinyl Floor Tile Mastic
34	Stage Lights Electrical Insulation
35	12" x 12" Tan Floor Tile and Mastic
43	Vault Door Core
47	4" Green Vinyl Baseboard Adhesive
48	Chalk Board/Poster Board Adhesive
49	Poster Board Adhesive
51	12x12 Tan Floor tile mastic
52M	12" x 12" White with Blue Floor Tile Mastic
53M	12" x 12" White with Grey Floor Tile Mastic
54M	12" x 12" Light Brown Floor Tile Mastic
55M	12" x 12" Grey with Blue Floor Tile Mastic
56	Carpet Mastic
57M	12" x 12" Light Grey Floor Tile Mastic
58	Carpet Glue
60	Blue Ceramic Floor Tile Mastic
62	White Ceramic Floor Tile Mastic
64	Red Ceramic Floor Tile Mastic
65M	12"x12" Dark Blue w/Blue Floor Tile Mastic
67M	12"x12" Dark Brown w/ Light Brown Floor Tile Mastic
68M	12"x12" White w/Multi Color Floor Tile Mastic
7	12" x 12" Off-white Vinyl Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Patrick Hrycyk, IDPH License # 100-09725. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Frazier School Building 7780 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Frazier School Unit 26531 Building ID 7780

Address 4027 W. Grenshaw Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	Fireproof Spray-on Insulation			Throughout school on I-beams	CHR	SURFACE	Y	None						Low
10	9" x 9" Brown Vinyl Floor Tile	1,035	SF	Stage Vestibules,214,216, 2ndFl. B-3,110 1st flr Teachers Lounge	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
11	9" x 9" Brown Vinyl Floor Tile Mastic	1,035	SF	Stage Vestibules,214, 216,2ndFl.B-3,110 , 1st Floor Teachers Lounge	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	9" x 9" Tan Vinyl Floor Tile	6,000	SF	Throughout Building 306,308,309,315,316	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
13	9" x 9" Tan Vinyl Floor Tile Mastic	6,000	SF	Throughout Building 306,308,309,315,316	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	9" x 9" Grey Vinyl Floor Tile	14,125	SF	Lunchroom, Princ. Ofc. Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316.B2	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
15	9" x 9" Grey Vinyl Floor Tile Mastic	14,125	SF	Lunchroom, Princ. Ofc. Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316.B2	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	9" x 9" Green Vinyl Floor Tile	4,000	SF	1st Fl.Teachers Lounge,101,107,Lunchroom,212,215,303,306,3rd Fl.Teachers Lounge	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
17	9" x 9" Green Vinyl Floor Tile Mastic	4,000	SF	1st Fl.Teachers Lounge,101,Lunchroom,212,215,303,306,3rd Fl.Teachers Lounge	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	9" x 9" Beige Vinyl Floor Tile	9,275	SF	Rms.200,203,206,21	CHR	MISC	N	NONE	0		No	ACBM with the		HIGH

Chicago Public Schools

School Frazier School Unit 26531 Building ID 7780

Address 4027 W. Grenshaw Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Classrooms below univents										
37	9" x 9" Black with White Streaks Floor Tile Mastic			Throughout Classrooms below univents	ASSUMED	MISC		None						Low
38	2' x 4' Long Fissured w/pinholes Ceiling Tile	10,000	SF	Classrooms throughout, Kitchen, Teachers Lounges, Main Office, Nurse's Office, Janitor Closets (2&3)	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
39	2' x 4' Small Fissured w/pinholes Ceiling Tile	10,000	SF	1st, 2nd and 3rd Floor Hallways, Lunchroom, Rooms 216, 217	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
40	2' x 4' Fissured Ceiling Tile w/brown backing	40	SF	1st Floor Janitor's Closet	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
41	White Sink Coat	20	SF	Rooms 111,112,115,216	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
42	Black Sink Coat	20	SF	Room 110, 108, 109, 205	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Vault Door Core	32	SF	Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12" x 12" White w/Green & Brown Specks FT	800	SF	Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
45	12" x 12" White w/Green & Brown Specks FT Mastic	800	SF	Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	4" Green Vinyl Baseboard	200	LF	Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
47	4" Green Vinyl Baseboard Adhesive	200	LF	Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	Chalk Board/Poster Board Adhesive	6,900	SF	Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	Poster Board Adhesive	450	SF	2nd Floor Hall and Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5	12" x 12" Off-white Vinyl Floor Tile	25	SF	Principal's Toilet Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	12x12 Tan Floor Tile	600	SF	Room 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
51	12x12 Tan Floor tile mastic	600	SF	Room 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	12" x 12" White with Blue Floor Tile	15,991	SF	3rd Floor Hallway West End, 2nd FLR Hallway, Computer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH

Chicago Public Schools

School Frazier School Unit 26531 Building ID 7780

Address 4027 W. Grenshaw Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Room, 1st Floor East Hallway, East Main Office, Rooms 200- 202,206,305,307										
52M	12" x 12" White with Blue Floor Tile Mastic	15,991	SF	3rd Flr Hallway westend, 2nd flr Hallway, East Main Office, Storage by Gym, Rooms 200- 202,204- 207,305,307	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12" x 12" White with Grey Floor Tile	9,750	SF	Room 311, 312, 313, 314, 211, 209, 108, 110,111,212,213	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
53M	12" x 12" White with Grey Floor Tile Mastic	9,750	SF	Rooms 311, 312, 313, 314, 211, 213, 209, 108, 110, 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12" x 12" Light Brown Floor Tile	1,368	SF	1, 2, 3, Floor Halls East End	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
54M	12" x 12" Light Brown Floor Tile Mastic	1,368	SF	1, 2, 3, Floor Halls Eat End	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12" x 12" Grey with Blue Floor Tile			Room 307	ASSUMED	MISC								
55M	12" x 12" Grey with Blue Floor Tile Mastic	900	SF	Room 307	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Carpet Mastic	1,400	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	12" x 12" Light Grey Floor Tile	36	SF	Janitor Closet B 1st Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
57M	12" x 12" Light Grey Floor Tile Mastic	36	SF	Janitor Closet B, 1st Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	Carpet Glue	625	SF	Room 300	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	Blue Ceramic Tile and Grout	625	SF	3rd Floor Boys Bathroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
60	Blue Ceramic Floor Tile Mastic	625	SF	3rd Floor Boys Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	White Ceramic Floor Tile & Grout	625	SF	3rd Floor Girls Bathroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
62	White Ceramic Floor Tile Mastic	625	SF	3rd Floor Girls Bathroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Red Ceramic Floor Tile and Grout	400	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
64	Red Ceramic TFlloor Tile Mastic	400	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Frazier School Unit 26531 Building ID 7780

Address 4027 W. Grenshaw Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/15/2013
Inspector Name Patrick Hrycyk
100-09725 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	Not Observed.
10	No 102,104,112
11	No 102,104,112
12	
13	
14	
15	
16	
17	
18	Room 203 Not Observed.
19	Room 203 Not Observed.
2	
20	Not Observed. See HA 22-23
21	Not Observed. See HA 22-23
22	
23	
24	
25	
26	
27	
28	
29	
3	
30	

Chicago Public Schools

School Frazier School Unit 26531 Building ID 7780

Address 4027 W. Grenshaw Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
31	Not Observed.
32	
34	
35	
36	Not Observed.
37	Not Observed.
38	
39	
40	
41	No room 112-115. Room 216 has no sink.
42	
43	
44	No room 112
45	No room 112, now room 111
46	No room 112, now room 111
47	No room 112, now room 111
48	
49	
5	
50	
51	
52	
52M	
53	
53M	
54	
54M	
55	Not Observed. HA 52-52M
55M	HA 52-52M

Chicago Public Schools

School Frazier School Unit 26531 Building ID 7780

Address 4027 W. Grenshaw Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
56	
57	
57M	
58	
59	
60	
61	
62	
63	
64	
65	
65M	
66	
66M	
67	
67M	
68	
68M	
7	
9	
A	Fiberglass not suspect material.
B	Not Observed.
C	Fiberglass not suspect material.
D	
E	
F	Fiberglass not suspect material.

Chicago Public Schools

School Frazier School **Unit** 26531 **Building ID** 7780

Address 4027 W. Grenshaw **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	Fireproof Spray-on Insulation			Throughout school on I-beams	Chrysotile	SURFACE	Yes				
10	9" x 9" Brown Vinyl Floor Tile	1,035	SF	Stage Vestibules,214,216,2ndFl. B-3,110 1st flr Teachers Lounge	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11	9" x 9" Brown Vinyl Floor Tile Mastic	1,035	SF	StageVestibules,214,216,2ndFl.B-3,110 , 1st Floor Teachers Lounge	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12	9" x 9" Tan Vinyl Floor Tile	6,000	SF	Throughout Building 306,308,309,315,316	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
13	9" x 9" Tan Vinyl Floor Tile Mastic	6,000	SF	Throughout Building 306,308,309,315,316	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
14	9" x 9" Grey Vinyl Floor Tile	14,125	SF	Lunchroom, Princ. Ofc, Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316, B2	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
15	9" x 9" Grey Vinyl Floor Tile Mastic	14,125	SF	Lunchroom, Princ. Ofc, Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316, B2	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	9" x 9" Green Vinyl Floor Tile	4,000	SF	1st Fl. Teachers Lounge,101,107,Lunchroom,212,215,303,306,3rd Fl. Teachers Lounge	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
17	9" x 9" Green Vinyl Floor Tile Mastic	4,000	SF	1st Fl. Teachers Lounge,101,Lunchroom,212,215,303,306,3rd Fl. Teachers Lounge	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
18	9" x 9" Beige Vinyl Floor Tile	9,275	SF	Rms.200,203,206,213,302/304,308,309 ,3rd Floor Mens Toilet,T-1,111A, 2nd Flr. Teachers Lounge	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
19	9" x 9" Beige Vinyl Floor Tile Mastic	9,275	SF	Rms.200,203,206,213,302/304,305,308 ,309,3rd Floor Mens Toilet,T-1,111A, 2nd Flr. Teachers Lounge	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
2	Hard Plaster			Boiler Room, Stage Vestibules, and Washrooms throughout building, T-1,111A, 2nd Flr. Teachers Lounge		SURFACE					
20	9" x 9" White/multi-colored Vinyl Floor Tile	1,200	SF	Classroom 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
21	9" x 9" White/multi-colored VFT Mastic	1,200	SF	Classroom 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
22	9" x 9" Blue Vinyl Floor Tile	525	SF	Classroom 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
23	9" x 9" Blue Vinyl Floor Tile Mastic	525	SF	Classroom 109	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
24	Exterior Brick			Exterior	No ACBM	MISC					
25	Exterior Brick Mortar			Exterior	No ACBM	MISC					
26	Boiler Furnace Gasket	25	SF	Boiler Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27	Boiler Rear Door Gasket			Boiler Room	No ACBM	MISC					
28	Roof Field- Non AHERA			Exterior	Chrysotile	MISC					
29	Roof Flashing- Non AHERA			Exterior	Chrysotile	MISC					
3	2' x 4' Ceiling Panels - REMOVED			Throughout Building							
30	Incinerator Lining			Boiler Room	No ACBM	MISC					
31	Interior Window Caulk			Throughout Building	Chrysotile	MISC					
32	Metal panel seam sealing compound (caulk)			Throughout building on metal ceilings	No ACBM	MISC					
34	Stage Lights Electrical Insulation	18	LF	Gymnasium/Stage	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
35	12" x 12" Tan Floor Tile and Mastic	600	SF	Room 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
36	9" x 9" Black with White Streaks Floor Tile			Throughout Classrooms below univents	Assumed	MISC					
37	9" x 9" Black with White Streaks Floor Tile Mastic			Throughout Classrooms below univents	Assumed	MISC					
38	2' x 4' Long Fissured w/pinholes Ceiling Tile	10,000	SF	Classrooms throughout, Kitchen, Teachers Lounges, Main Office, Nurse's Office, Janitor Closets (2&3)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
39	2' x 4' Small Fissured w/pinholes Ceiling Tile	10,000	SF	1st, 2nd and 3rd Floor Hallways, Lunchroom, Rooms 216, 217	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
40	2' x 4' Fissured Ceiling Tile w/brown backing	40	SF	1st Floor Janitor's Closet	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
41	White Sink Coat	20	SF	Rooms 111,112,115,216	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
42	Black Sink Coat	20	SF	Room 110, 108, 109, 205	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
43	Vault Door Core	32	SF	Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
44	12" x 12" White w/Green & Brown Specks FT	800	SF	Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
45	12" x 12" White w/Green & Brown Specks FT Mastic	800	SF	Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
46	4" Green Vinyl Baseboard	200	LF	Room 111	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
47	4" Green Vinyl Baseboard Adhesive	200	LF	Room 111	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
48	Chalk Board/Poster Board Adhesive	6,900	SF	Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
49	Poster Board Adhesive	450	SF	2nd Floor Hall and Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5	12" x 12" Off-white Vinyl Floor Tile	25	SF	Principal's Toilet Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
50	12x12 Tan Floor Tile	600	SF	Room 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51	12x12 Tan Floor tile mastic	600	SF	Room 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
52	12" x 12" White with Blue Floor Tile	15,991	SF	3rd Floor Hallway West End, 2nd FLr Hallway, Computer Room, 1st Floor East Hallway, East Main Office, Rooms 200-202,206,305,307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
52M	12" x 12" White with Blue Floor Tile Mastic	15,991	SF	3rd Flr Hallway westend, 2nd flr Hallway, East Main Office, Storage by Gym, Rooms 200-202,204-207,305,307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53	12" x 12" White with Grey Floor Tile	9,750	SF	Room 311, 312, 313, 314, 211, 209, 108, 110,111,212,213	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53M	12" x 12" White with Grey Floor Tile Mastic	9,750	SF	Rooms 311, 312, 313, 314, 211, 213, 209, 108, 110, 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
54	12" x 12" Light Brown Floor Tile	1,368	SF	1, 2, 3, Floor Halls East End	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
54M	12" x 12" Light Brown Floor Tile Mastic	1,368	SF	1, 2, 3, Floor Halls Eat End	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
55	12" x 12" Grey with Blue Floor Tile			Room 307	Assumed	MISC					
55M	12" x 12" Grey with Blue Floor Tile Mastic	900	SF	Room 307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
56	Carpet Mastic	1,400	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
57	12" x 12" Light Grey Floor Tile	36	SF	Janitor Closet B 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
57M	12" x 12" Light Grey Floor Tile Mastic	36	SF	Janitor Closet B, 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
58	Carpet Glue	625	SF	Room 300	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
59	Blue Ceramic Tile and Grout	625	SF	3rd Floor Boys Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
60	Blue Ceramic Floor Tile Mastic	625	SF	3rd Floor Boys Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
61	White Ceramic Floor Tile & Grout	625	SF	3rd Floor Girls Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
62	White Ceramic Floor Tile Mastic	625	SF	3rd Floor Girls Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
63	Red Ceramic Floor Tile and Grout	400	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
64	Red Ceramic TFLoor Tile Mastic	400	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
65	12"x12" Dark Blue w/Blue Floor Tile	3,800	SF	Lunch Room, Stone Room, English Office, 1st Floor East Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
65M	12"x12" Dark Blue w/Blue Floor Tile Mastic	3,800	SF	Lunch Room, Stone Room, English Office, 1st Floor East Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
66	12"x12" Orange Floor Tile	400	SF	Lunch Room, Stone Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
66M	12"x12" Orange Floor Tile Mastic	400	SF	Lunch Room, Stone Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
67	12"x12" Dark Brown w/ Light Brown Floor Tile	100	SF	Gym Storage Room, North 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
67M	12"x12" Dark Brown w/ Light Brown Floor Tile Mastic	100	PERCENT	Gym Storage Room, North 1st Floor	Assumed	MISC	No	0	PERCENT	6 ACBM with the potential for damage	Operations and Maintenance
68	12"x12" White w/Multi Color Floor Tile	2,190	SF	1st Floor West Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
 Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
68M	12"x12" White w/Multi Color Floor Tile Mastic	2,190	SF	1st Floor West Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
7	12" x 12" Off-white Vinyl Floor Tile Mastic	30	SF	Principal's Toilet Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
9	Vibration Isolater Cloth			Basement Fan Room	No ACBM	MISC					
A	Boiler Fiberglass Insulation			Boiler Room	Not Tested						
B	Tank Packing Insulation			Boiler Room	Undefined						
C	Fiberglass Pipe Insulation			Throughout Building	Not Tested						
D	Hard Joint Compound on Fiberglass Pipe Insulation	620	LF	Throughout Building and Tunnel	Amosite, Chrysotile	TSI	Yes	6	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Operations and Maintenance
E	Hard Joint Compound on Water Meter			3rd Floor Hallway West End, Room 305, 2nd FLr Hallway, Rooms 200, 201, 202, 204, 205, 207, Storage by Gym	Abated	MISC					
F	Fiberglass Duct Insulation			Throughout Building	Not Tested						

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
 Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/6/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
3	
30	

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
31	
32	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
5	
50	
51	
52	
52M	
53	
53M	
54	
54M	

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
 Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
 600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
55	
55M	
56	
57	
57M	
58	
59	
60	
61	
62	
63	
64	
65	
65M	
66	
66M	
67	
67M	
68	
68M	
7	
9	
A	
B	
C	
D	
E	

Chicago Public Schools

School Frazier School
Address 4027 W. Grenshaw

Unit 26531
Chicago, IL, 60624

Building ID 7780
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
F	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Fireproof Spray-on Insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Throughout school on I-beams**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **Fireproof Spray-on Insulation**

MATERIAL LOCATION: **Throughout school on I-beams**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

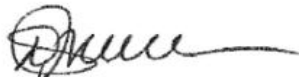

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" Brown Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Stage Vestibules,214,216,2ndFl. B-3,110 1st flr Teachers Lounge**
MATERIAL QUANTITY: **1035** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **No 102,104,112**

Inspector's Signature:

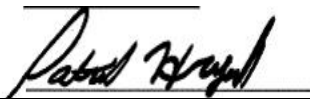

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" Brown Vinyl Floor Tile**
MATERIAL LOCATION: **Stage Vestibules,214,216,2ndFl. B-3,110 1st flr Teachers Lounge**
MATERIAL QUANTITY: **1035** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **9" x 9" Brown Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Stage Vestibules, 214, 216, 2nd Fl. B-3, 110, 1st Floor Teachers Lounge**
MATERIAL QUANTITY: **1035** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **No 102, 104, 112**

Inspector's Signature: _____

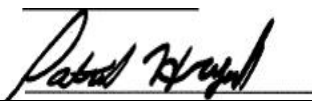

Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **9" x 9" Brown Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **StageVestibules,214,216,2ndFl.B-3,110 , 1st Floor Teachers Lounge**
MATERIAL QUANTITY: **1035** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **9" x 9" Tan Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Throughout Building 306,308,309,315,316**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

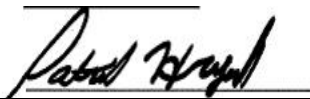

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **9" x 9" Tan Vinyl Floor Tile**
MATERIAL LOCATION: **Throughout Building 306,308,309,315,316**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **9" x 9" Tan Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Building 306,308,309,315,316**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

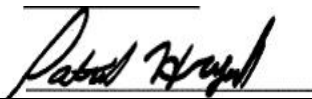

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **9" x 9" Tan Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Throughout Building 306,308,309,315,316**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **9" x 9" Grey Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**

MATERIAL LOCATION: **Lunchroom, Princ. Ofc, Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316,B2**

MATERIAL QUANTITY: **14125**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **9" x 9" Grey Vinyl Floor Tile**

MATERIAL LOCATION: **Lunchroom, Princ. Ofc, Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316,B2**

MATERIAL QUANTITY: **14125**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

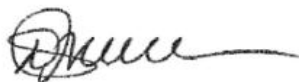

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **9" x 9" Grey Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Lunchroom, Princ. Ofc, Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316,B2**

MATERIAL QUANTITY: **14125** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **9" x 9" Grey Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Lunchroom, Princ. Ofc, Rms. 100,101,105,106,109,111,115,208,210,212,214-218,300,301,302,304,307,310,315,316,B2**
MATERIAL QUANTITY: **14125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9" x 9" Green Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **1st Fl. Teachers Lounge, 101, 107, Lunchroom, 212, 215, 303, 306, 3rd Fl. Teachers Lounge**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9" x 9" Green Vinyl Floor Tile**
MATERIAL LOCATION: **1st Fl. Teachers Lounge, 101, 107, Lunchroom, 212, 215, 303, 306, 3rd Fl. Teachers Lounge**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Green Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Fl. Teachers Lounge, 101, Lunchroom, 212, 215, 303, 306, 3rd Fl. Teachers Lounge**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Green Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **1st Fl. Teachers Lounge, 101, Lunchroom, 212, 215, 303, 306, 3rd Fl. Teachers Lounge**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

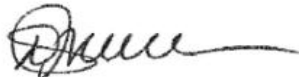

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9" x 9" Beige Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rms.200,203,206,213,302/304,308,309,3rd Floor Mens Toilet,T-1,111A, 2nd Flr. Teachers Lounge**
MATERIAL QUANTITY: **9275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Room 203 Not Observed.**

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9" x 9" Beige Vinyl Floor Tile**
MATERIAL LOCATION: **Rms.200,203,206,213,302/304,308,309,3rd Floor Mens Toilet,T-1,111A, 2nd Flr. Teachers Lounge**
MATERIAL QUANTITY: **9275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **9" x 9" Beige Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Rms.200,203,206,213,302/304,305,308,309,3rd Floor Mens Toilet,T-1,111A, 2nd Flr. Teachers Lounge**

MATERIAL QUANTITY: **9275** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Room 203 Not Observed.**

Inspector's Signature:

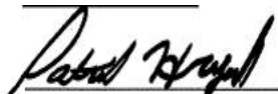

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **9" x 9" Beige Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Rms.200,203,206,213,302/304,305,308,309,3rd Floor Mens Toilet,T-1,111A, 2nd Flr. Teachers Lounge**
MATERIAL QUANTITY: **9275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Hard Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Boiler Room, Stage Vestibules, and Washrooms throughout building, T-1,111A, 2nd Flr. Teachers Lounge**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

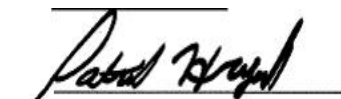

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Hard Plaster**
MATERIAL LOCATION: **Boiler Room, Stage Vestibules, and Washrooms throughout building, T-1,111A, 2nd Flr. Teachers Lounge**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9" x 9" White/multi-colored Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classroom 109**

MATERIAL QUANTITY: **1200**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not Observed. See HA 22-23**

Inspector's Signature:

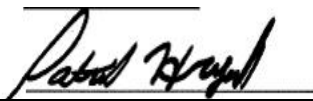

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9" x 9" White/multi-colored Vinyl Floor Tile**
MATERIAL LOCATION: **Classroom 109**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

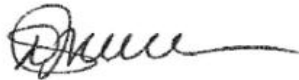

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **9" x 9" White/multi-colored VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classroom 109**

MATERIAL QUANTITY: **1200**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not Observed. See HA 22-23**

Inspector's Signature:

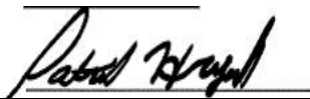

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **9" x 9" White/multi-colored VFT Mastic**
MATERIAL LOCATION: **Classroom 109**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **9" x 9" Blue Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classroom 109**
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **9" x 9" Blue Vinyl Floor Tile**
MATERIAL LOCATION: **Classroom 109**
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

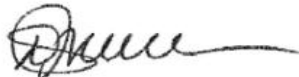

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9" x 9" Blue Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classroom 109**
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **9" x 9" Blue Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Classroom 109**

MATERIAL QUANTITY: **525**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Exterior Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

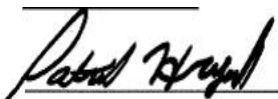

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Exterior Brick**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Exterior Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

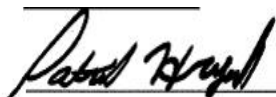

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Exterior Brick Mortar**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Boiler Furnace Gasket**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

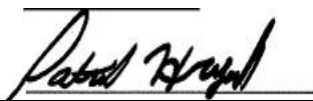

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Boiler Furnace Gasket**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Boiler Rear Door Gasket**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

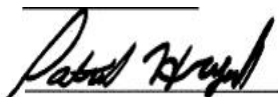

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Boiler Rear Door Gasket**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Roof Field- Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

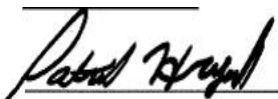

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Roof Field- Non AHERA**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Roof Flashing- Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Roof Flashing- Non AHERA**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels - REMOVED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **3**

MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels - REMOVED**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Incinerator Lining**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

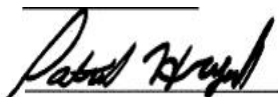

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Incinerator Lining**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Interior Window Caulk**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **Interior Window Caulk**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Metal panel seam sealing compound (caulk)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout building on metal ceilings**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

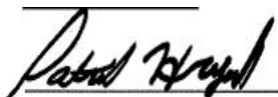

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Metal panel seam sealing compound (caulk)**

MATERIAL LOCATION: **Throughout building on metal ceilings**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Stage Lights Electrical Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gymnasium/Stage**
MATERIAL QUANTITY: **18** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Stage Lights Electrical Insulation**

MATERIAL LOCATION: **Gymnasium/Stage**

MATERIAL QUANTITY: **18**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile and Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 107**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

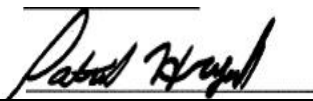

Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile and Mastic**
MATERIAL LOCATION: **Room 107**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **9" x 9" Black with White Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Classrooms below univents**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:

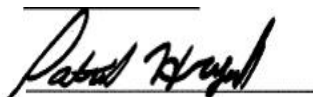

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **9" x 9" Black with White Streaks Floor Tile**

MATERIAL LOCATION: **Throughout Classrooms below univents**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9" x 9" Black with White Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**


MATERIAL LOCATION: **Throughout Classrooms below univents**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **9" x 9" Black with White Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Throughout Classrooms below univents**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

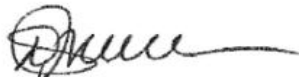

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **2' x 4' Long Fissured w/pinholes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms throughout, Kitchen, Teachers Lounges, Main Office, Nurse's Office, Janitor Closets (2&3)**

MATERIAL QUANTITY: **10000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **2' x 4' Long Fissured w/pinholes Ceiling Tile**
MATERIAL LOCATION: **Classrooms throughout, Kitchen, Teachers Lounges, Main Office, Nurse's Office, Janitor Closets (2&3)**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **2' x 4' Small Fissured w/pinholes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd and 3rd Floor Hallways, Lunchroom, Rooms 216, 217**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

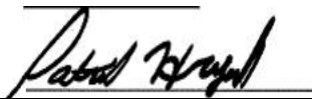

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **2' x 4' Small Fissured w/pinholes Ceiling Tile**
MATERIAL LOCATION: **1st, 2nd and 3rd Floor Hallways, Lunchroom, Rooms 216, 217**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **2' x 4' Fissured Ceiling Tile w/brown backing**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Janitor's Closet**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **2' x 4' Fissured Ceiling Tile w/brown backing**

MATERIAL LOCATION: **1st Floor Janitor's Closet**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **White Sink Coat**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 111,112,115,216**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **No room 112-115. Room 216 has no sink.**

Inspector's Signature:

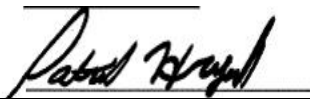

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **White Sink Coat**
MATERIAL LOCATION: **Rooms 111,112,115,216**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Black Sink Coat**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 110, 108, 109, 205**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

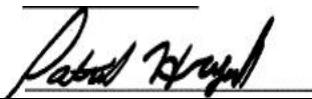

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Black Sink Coat**
MATERIAL LOCATION: **Room 110, 108, 109, 205**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Vault Door Core**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

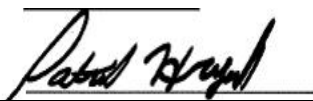

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Vault Door Core**
MATERIAL LOCATION: **Office**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12" x 12" White w/Green & Brown Specks FT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 111**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **No room 112**

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12" x 12" White w/Green & Brown Specks FT**
MATERIAL LOCATION: **Room 111**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" White w/Green & Brown Specks FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 111**

MATERIAL QUANTITY: **800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **No room 112, now room 111**

Inspector's Signature:

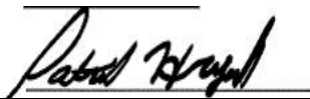

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" White w/Green & Brown Specks FT Mastic**
MATERIAL LOCATION: **Room 111**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **4" Green Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 111**

MATERIAL QUANTITY: **200**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS: **No room 112, now room 111**

Inspector's Signature:

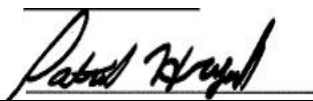

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **4" Green Vinyl Baseboard**
MATERIAL LOCATION: **Room 111**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **4" Green Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 111**

MATERIAL QUANTITY: **200**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS: **No room 112, now room 111**

Inspector's Signature:

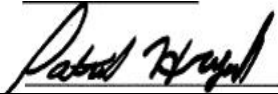

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **4" Green Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Room 111**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Chalk Board/Poster Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms**
MATERIAL QUANTITY: **6900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

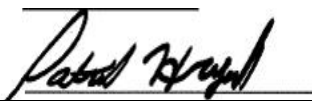

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Chalk Board/Poster Board Adhesive**
MATERIAL LOCATION: **Classrooms**
MATERIAL QUANTITY: **6900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Poster Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Hall and Room 111**

MATERIAL QUANTITY: **450**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **Poster Board Adhesive**

MATERIAL LOCATION: **2nd Floor Hall and Room 111**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

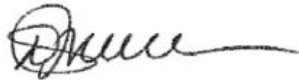

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Off-white Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Toilet Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

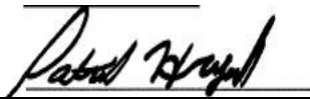

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Off-white Vinyl Floor Tile**
MATERIAL LOCATION: **Principal's Toilet Room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12x12 Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 107**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

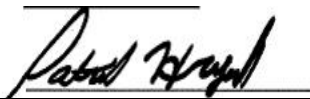

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12x12 Tan Floor Tile**
MATERIAL LOCATION: **Room 107**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12x12 Tan Floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 107**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

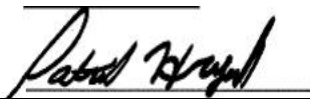

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12x12 Tan Floor tile mastic**
MATERIAL LOCATION: **Room 107**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

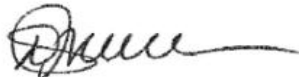

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" White with Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**


MATERIAL LOCATION: **3rd Floor Hallway West End, 2nd FLr Hallway, Computer Room, 1st Floor East Hallway, East Main Office, Rooms 200-202,206,305,307**

MATERIAL QUANTITY: **15991** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

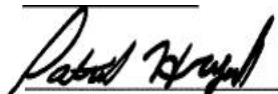

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" White with Blue Floor Tile**
MATERIAL LOCATION: **3rd Floor Hallway West End, 2nd FLr Hallway, Computer Room, 1st Floor East Hallway, East Main Office, Rooms 200-202,206,305,307**
MATERIAL QUANTITY: **15991** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: 04/06/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52M**
MATERIAL DESCRIPTION: **12" x 12" White with Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Flr Hallway westend, 2nd flr Hallway, East Main Office, Storage by Gym, Rooms 200-202,204-207,305,307**

MATERIAL QUANTITY: **15991**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

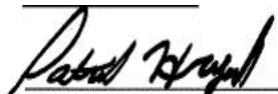

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **52M**
MATERIAL DESCRIPTION: **12" x 12" White with Blue Floor Tile Mastic**
MATERIAL LOCATION: **3rd Flr Hallway westend, 2nd flr Hallway, East Main Office, Storage by Gym, Rooms 200-202,204-207,305,307**
MATERIAL QUANTITY: **15991** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" White with Grey Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 311, 312, 313, 314, 211, 209, 108, 110,111,212,213**
MATERIAL QUANTITY: **9750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" White with Grey Floor Tile**
MATERIAL LOCATION: **Room 311, 312, 313, 314, 211, 209, 108, 110,111,212,213**
MATERIAL QUANTITY: **9750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53M**
MATERIAL DESCRIPTION: **12" x 12" White with Grey Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Rooms 311, 312, 313, 314, 211, 213, 209, 108, 110, 111**

MATERIAL QUANTITY: **9750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **53M**
MATERIAL DESCRIPTION: **12" x 12" White with Grey Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 311, 312, 313, 314, 211, 213, 209, 108, 110, 111**
MATERIAL QUANTITY: **9750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **1, 2, 3, Floor Halls East End**
MATERIAL QUANTITY: **1368** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Floor Tile**
MATERIAL LOCATION: **1, 2, 3, Floor Halls East End**
MATERIAL QUANTITY: **1368** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54M**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1, 2, 3, Floor Halls Eat End**
MATERIAL QUANTITY: **1368** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **54M**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Floor Tile Mastic**
MATERIAL LOCATION: **1, 2, 3, Floor Halls Eat End**
MATERIAL QUANTITY: **1368** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" x 12" Grey with Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 307**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed. HA 52-52M**

Inspector's Signature:

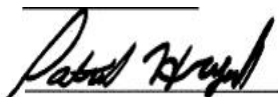

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **12" x 12" Grey with Blue Floor Tile**

MATERIAL LOCATION: **Room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

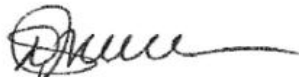

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55M**
MATERIAL DESCRIPTION: **12" x 12" Grey with Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 307**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **HA 52-52M**

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **55M**
MATERIAL DESCRIPTION: **12" x 12" Grey with Blue Floor Tile Mastic**
MATERIAL LOCATION: **Room 307**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

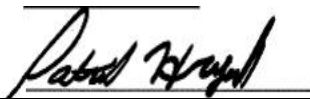

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12" x 12" Light Grey Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Janitor Closet B 1st Floor**
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

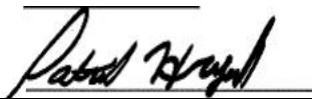

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **12" x 12" Light Grey Floor Tile**

MATERIAL LOCATION: **Janitor Closet B 1st Floor**

MATERIAL QUANTITY: **36**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57M**
MATERIAL DESCRIPTION: **12" x 12" Light Grey Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Janitor Closet B, 1st Floor**

MATERIAL QUANTITY: **36**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

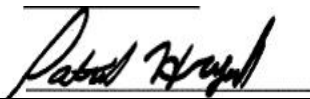

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **57M**
MATERIAL DESCRIPTION: **12" x 12" Light Grey Floor Tile Mastic**
MATERIAL LOCATION: **Janitor Closet B, 1st Floor**
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Carpet Glue**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 300**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Carpet Glue**
MATERIAL LOCATION: **Room 300**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Blue Ceramic Tile and Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **3rd Floor Boys Bathroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

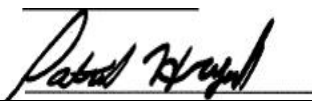

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Blue Ceramic Tile and Grout**
MATERIAL LOCATION: **3rd Floor Boys Bathroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Blue Ceramic Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Boys Restroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

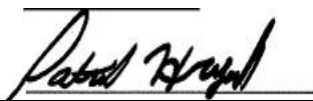

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Blue Ceramic Floor Tile Mastic**
MATERIAL LOCATION: **3rd Floor Boys Restroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **White Ceramic Floor Tile & Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **3rd Floor Girls Bathroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

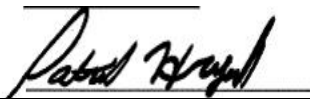

Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **White Ceramic Floor Tile & Grout**
MATERIAL LOCATION: **3rd Floor Girls Bathroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **White Ceramic Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Girls Bathroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

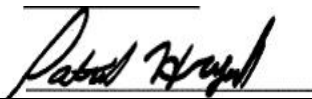

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **White Ceramic Floor Tile Mastic**
MATERIAL LOCATION: **3rd Floor Girls Bathroom**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Red Ceramic Floor Tile and Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

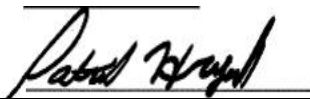

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Red Ceramic Floor Tile and Grout**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Red Ceramic TFLoor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

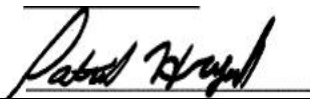

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Red Ceramic TFLoor Tile Mastic**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Off-white Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Principal's Toilet Room**

MATERIAL QUANTITY: **30**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

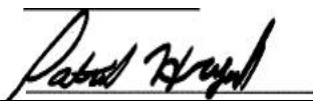

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **12" x 12" Off-white Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Principal's Toilet Room**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **Vibration Isolater Cloth**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Fan Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

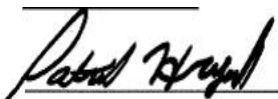

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **Vibration Isolater Cloth**

MATERIAL LOCATION: **Basement Fan Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Boiler Fiberglass Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Not Tested** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Fiberglass not suspect material.**

Inspector's Signature:

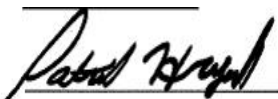

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Boiler Fiberglass Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Tank Packing Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Undefined** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:

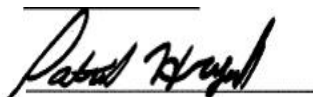

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **Tank Packing Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Not Tested** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Fiberglass not suspect material.**

Inspector's Signature:

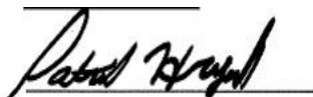

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

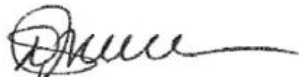

Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Hard Joint Compound on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Amosite, Chrysotile** FRIABLE: **Yes**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Building and Tunnel**
MATERIAL QUANTITY: **620** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

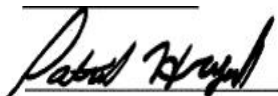

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Hard Joint Compound on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout Building and Tunnel**

MATERIAL QUANTITY: **620** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **6** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Hard Joint Compound on Water Meter**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **3rd Floor Hallway West End, Room 305, 2nd FLr Hallway, Rooms 200, 201, 202, 204, 205, 207, Storage by Gym**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

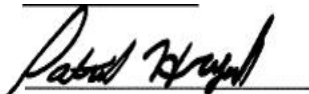

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Hard Joint Compound on Water Meter**

MATERIAL LOCATION: **3rd Floor Hallway West End, Room 305, 2nd FLr Hallway, Rooms 200, 201, 202, 204, 205, 207, Storage by Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Fiberglass Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Not Tested** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Fiberglass not suspect material.**

Inspector's Signature:

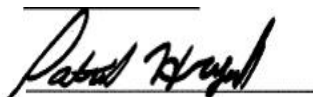

Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **Fiberglass Duct Insulation**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/06/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **67M**

MATERIAL DESCRIPTION: **12"x12" Dark Brown w/ Light Brown Floor Tile Mastic**

MATERIAL LOCATION: **Gym Storage Room, North 1st Floor**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **PERCENT**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**


ACCESSIBILITY: **Not Reachable** DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE REASON:

DAMAGE UNITS: **PERCENT**

COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **67M**

MATERIAL DESCRIPTION: **12"x12" Dark Brown w/ Light Brown Floor Tile Mastic**

MATERIAL LOCATION: **Gym Storage Room, North 1st Floor**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **PERCENT**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **PERCENT**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/06/2013**

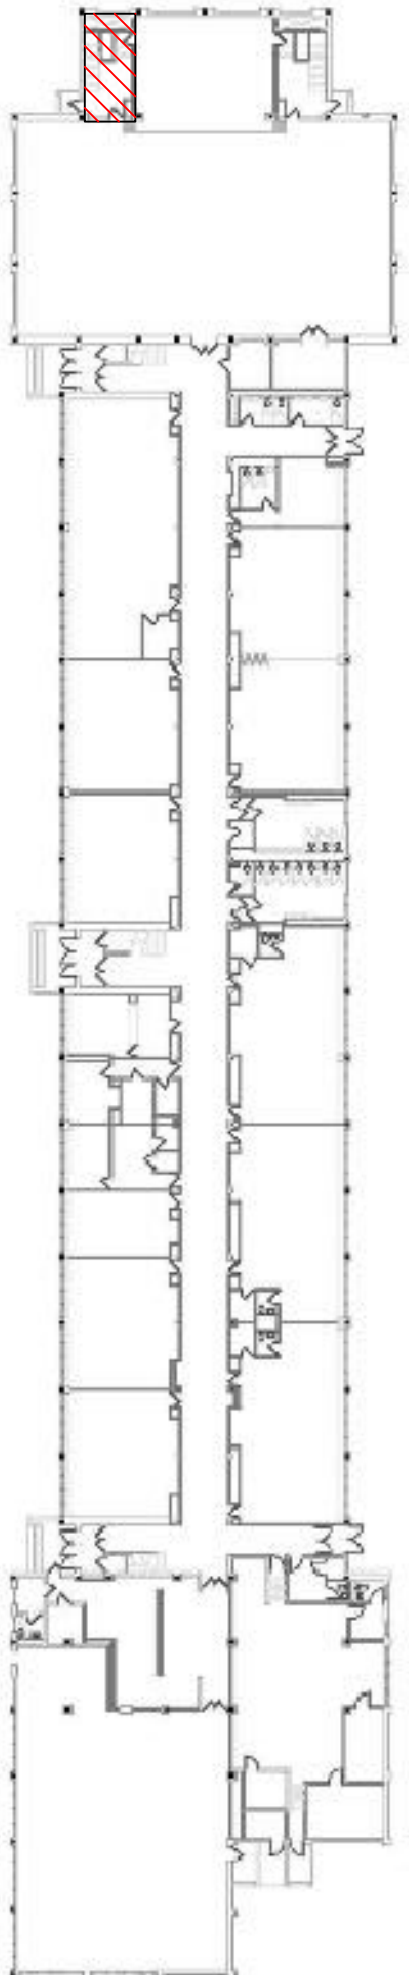


ASBESTOS REINSPECTION KEY NOTES:



HA-67M 12x12 Dark Brown With Light Brown Flecks Floor Tile Mastic

Frazier School First Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-67M

DRAWN BY: MAW	DATE: 3/20/13	CHECKED BY:
REVISION BY:	DATE:	CHECKED BY:
REVISION BY:	DATE:	CHECKED BY:
INSPECTED BY: Pat Hrycyk		

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
800 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccailld.com

CCA PROJECT NUMBER
A320130001-35
DATE
3/15/13
SHEET NUMBER
HA-67M



IDPH License #:100- 09725

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **65M**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Blue Floor Tile Mastic**
MATERIAL LOCATION: **Lunch Room, Stone Room, English Office, 1st Floor East Hallway**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

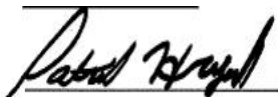

Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **65M**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Blue Floor Tile Mastic**
MATERIAL LOCATION: **Lunch Room, Stone Room, English Office, 1st Floor East Hallway**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 04/06/2013

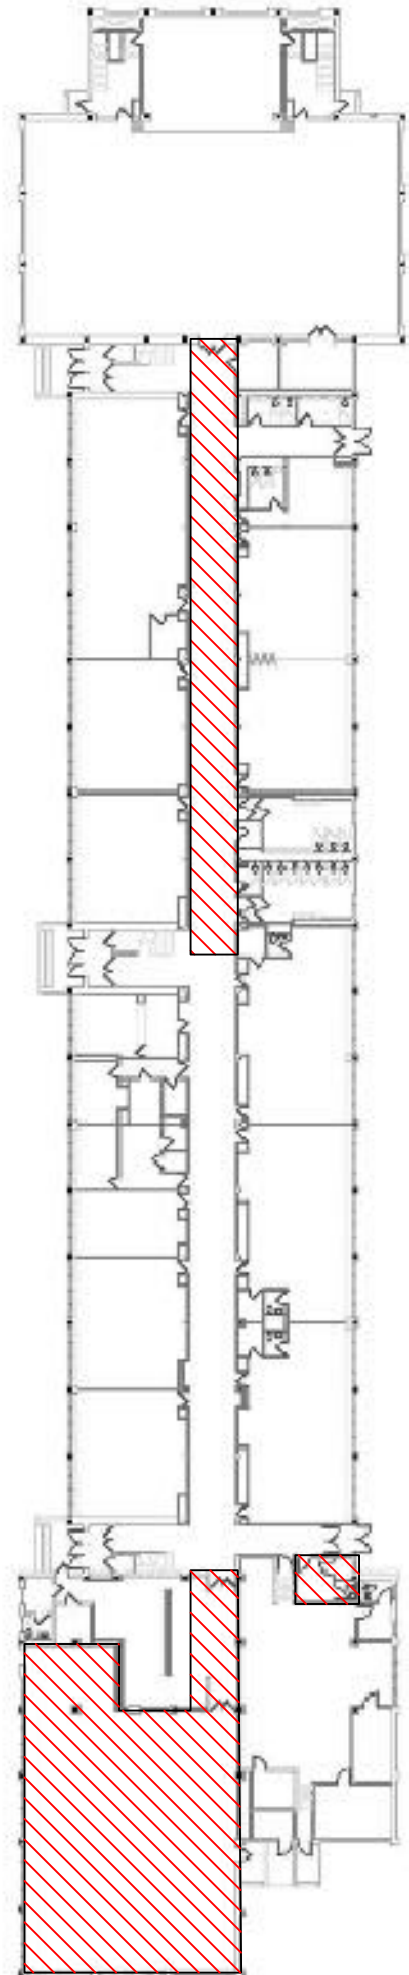


ASBESTOS REINSPECTION KEY NOTES:



HA-65M 12x12 Dark Blue with Blue floor Tile Mastic

Frazier School First Floor
2013 ASBESTOS REINSPECTION



NOT TO SCALE

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-65M

DRAWN BY: MAW	DATE: 3/20/13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
INSPECTED BY: Pat Hrycyk		

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
800 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccailld.com

CCA PROJECT NUMBER:
A320130001-35
DATE: 3/15/13
SHEET NUMBER:
HA-65M



IDPH License #: 100-09725

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **68M**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Color Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor West Hallway**
MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **68M**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Color Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor West Hallway**
MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **04/06/2013**

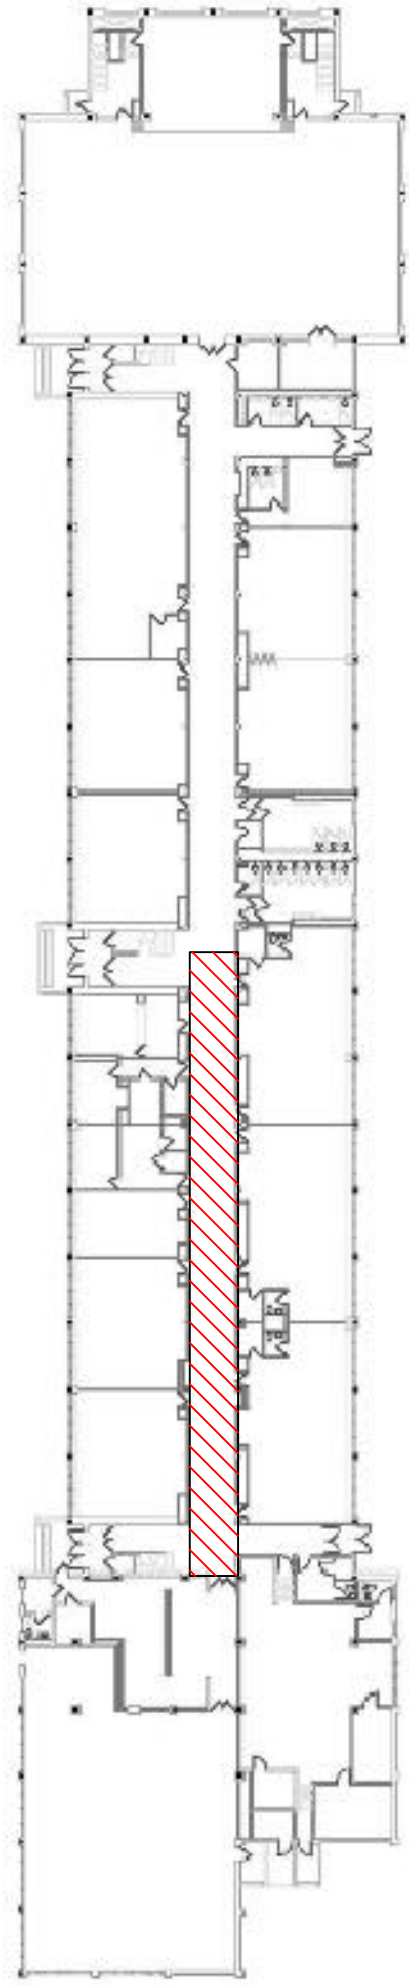


ASBESTOS REINSPECTION KEY NOTES:



HA-68M 12x12 White With Multi-Colored Floor Tile Mastic

Frazier School First Floor
2013 ASBESTOS REINSPECTION



NOT TO SCALE

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-68M

DRAWN BY: MAW	DATE: 3/20/13	CHECKED BY:
REVISION BY:	DATE:	CHECKED BY:
REVISION BY:	DATE:	CHECKED BY:
INSPECTED BY: Pat Hrycyk		

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccailld.com

CCA PROJECT NUMBER
A320130001-35
DATE
3/15/13
SHEET NUMBER
HA-68M

IDPH License #:100- 09725



Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Blue Floor Tile**
MATERIAL LOCATION: **Lunch Room, Stone Room, English Office, 1st Floor East Hallway**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

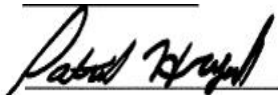

Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Blue Floor Tile**
MATERIAL LOCATION: **Lunch Room, Stone Room, English Office, 1st Floor East Hallway**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: 04/06/2013

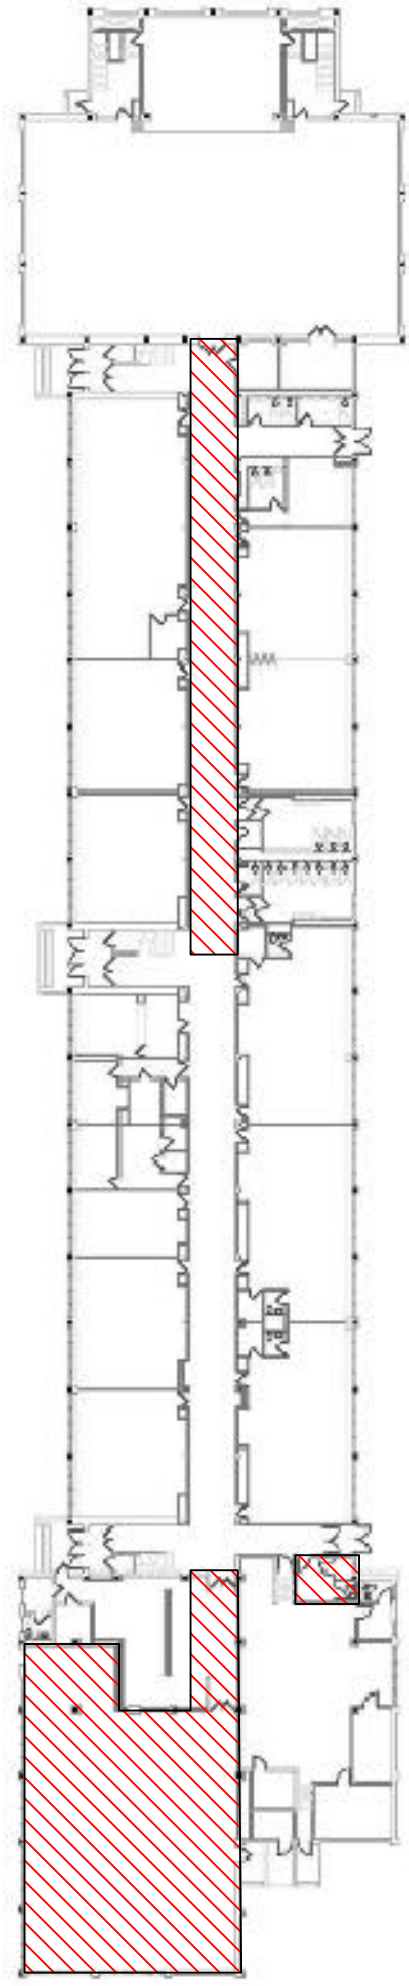

ASBESTOS REINSPECTION KEY NOTES:

 HA-65 12x12 Dark Blue with Blue Floor Tile

Frazier School First Floor
2013 ASBESTOS REINSPECTION



CLIENT: Chicago Public Schools 125 South Clark Street, Chicago, Illinois 60603		PROJECT NAME: 2013 AHERA Reinspection Frazier School 4027 W. Grenshaw Chicago, IL 60624	
SHEET NAME: Frazier School First Floor HA-65		INSPECTED BY: Pat Hrycyk	
DRAWN BY: MAW	DATE: 3/20/13	CHECKED BY:	DATE:
REVISION BY:	DATE:	CHECKED BY:	DATE:
REVISION BY:	DATE:	CHECKED BY:	DATE:
IDPH License #-100- 09725		Carnow, Conibear & Assoc., Ltd. Environmental Consulting Services 600 W. Van Buren St., Suite 500, Chicago, IL 60607 T: 312.782.4486 F: 312.782.5145 www.ccailld.com	
CCA PROJECT NUMBER A320130001-35		DATE 3/15/13	
SHEET NUMBER HA-65			



Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12"x12" Orange Floor Tile**
MATERIAL LOCATION: **Lunch Room, Stone Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12"x12" Orange Floor Tile**
MATERIAL LOCATION: **Lunch Room, Stone Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____



Date: 04/06/2013

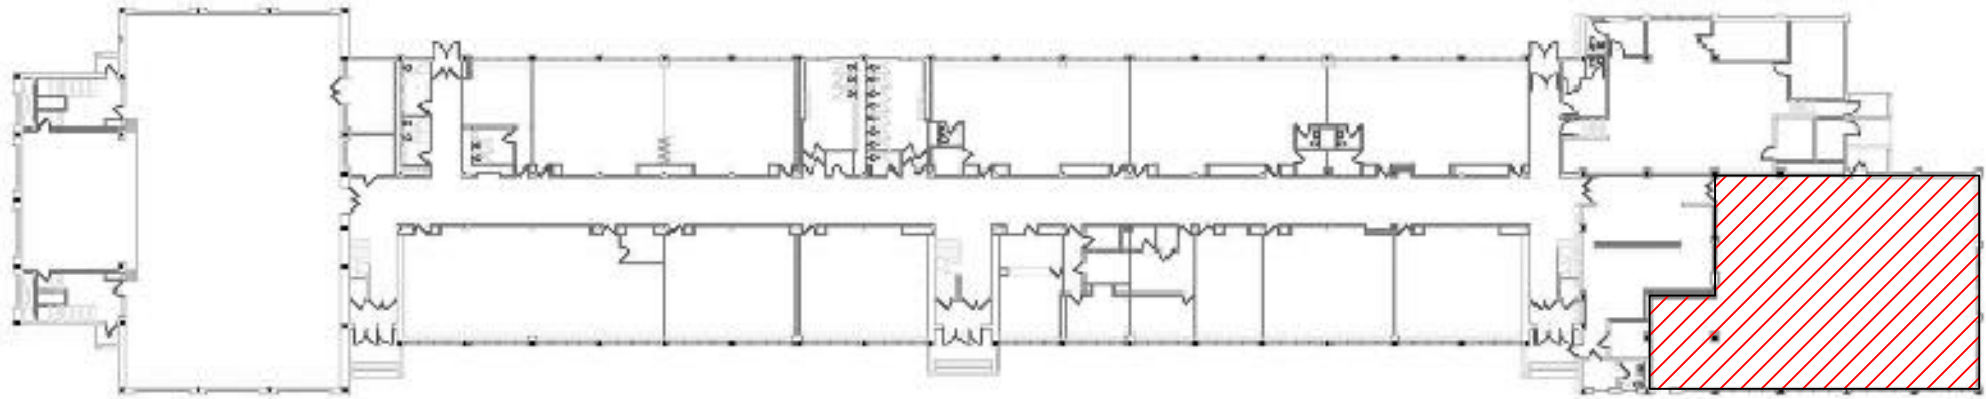


ASBESTOS REINSPECTION KEY NOTES:

 HA-66 12x12 Orange Floor Tile

Frazier School First Floor

2013 ASBESTOS REINSPECTION



K:\CPS\2011\2013 Three Year\G01 Drawings\Region 3\Frazier School\Frazier School\Floor Plans

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-66
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/20/13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-35
DATE
3/15/13
SHEET NUMBER
HA-66

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **66M**
MATERIAL DESCRIPTION: **12"x12" Orange Floor Tile Mastic**
MATERIAL LOCATION: **Lunch Room, Stone Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: 03/15/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **66M**
MATERIAL DESCRIPTION: **12"x12" Orange Floor Tile Mastic**
MATERIAL LOCATION: **Lunch Room, Stone Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: 04/06/2013

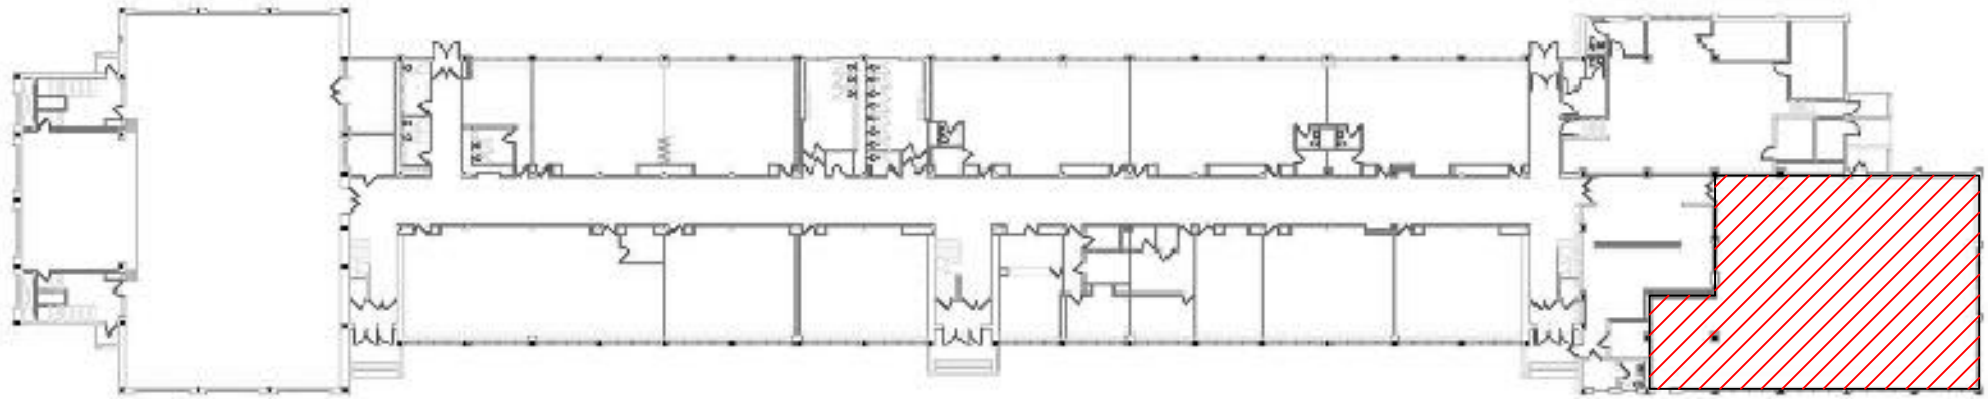

ASBESTOS REINSPECTION KEY NOTES:

 HA-66M 12x12 Orange Floor Tile Mastic

Frazier School First Floor
2013 ASBESTOS REINSPECTION



K:\CPS-2011\2013 Three Year Local Drinking Water Plan\3\Frazier_School\Frazier_School_First_Floor.dwg

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-66M
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/20/13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-35
DATE
3/15/13
SHEET NUMBER
HA-66M

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12"x12" Dark Brown w/ Light Brown Floor Tile**
MATERIAL LOCATION: **Gym Storage Room, North 1st Floor**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12"x12" Dark Brown w/ Light Brown Floor Tile**
MATERIAL LOCATION: **Gym Storage Room, North 1st Floor**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 04/06/2013

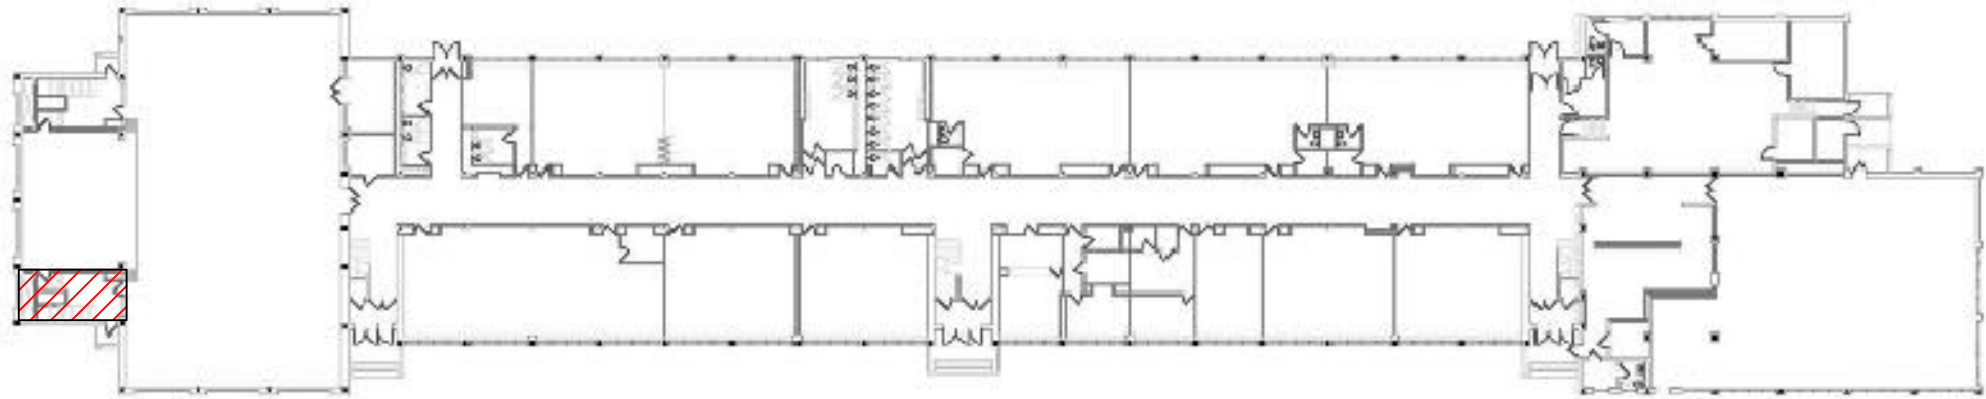


ASBESTOS REINSPECTION KEY NOTES:



HA-67 12x12 Dark Brown With Light Brown Flecks Floor Tile

Frazier School First Floor

2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-67

INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/20/13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com



CCA PROJECT NUMBER
A320130001-35

DATE
3/15/13

SHEET NUMBER
HA-67

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUIDLING ID: **7780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Frazier School** INSPECTION DATE: **3/15/2013**
ADDRESS: **4027 W. Greshaw** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Color Floor Tile**
MATERIAL LOCATION: **1st Floor West Hallway**
MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/15/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26531** BUILDING ID: **7780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Frazier School** REVIEW DATE: **4/6/2013**
ADDRESS: **4027 W. Grenshaw** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Color Floor Tile**
MATERIAL LOCATION: **1st Floor West Hallway**
MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/06/2013**

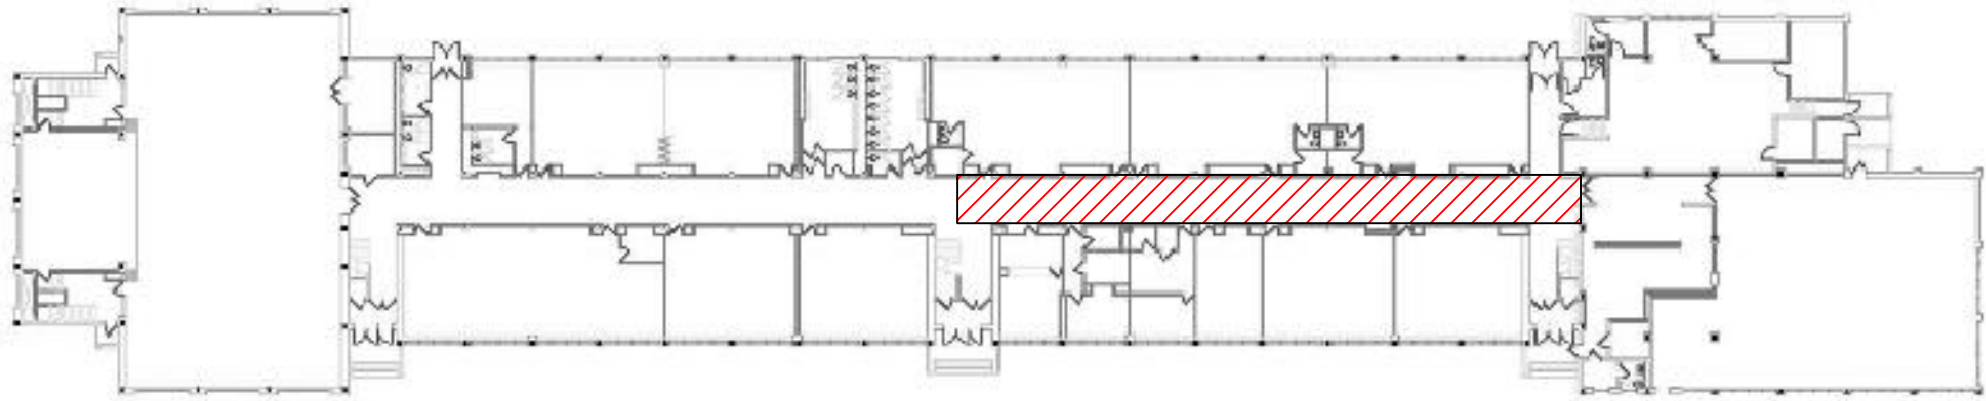


ASBESTOS REINSPECTION KEY NOTES:



HA-68 12x12 White With Multi-Colored Floor Tile

Frazier School First Floor

2013 ASBESTOS REINSPECTION



NOT TO SCALE

K:\CPS-2011\2013 Three Year/Full Drinking Water\3\Frazier_School\Frazier_School\Flooring.dwg

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Frazier School
4027 W. Grenshaw
Chicago, IL 60624

SHEET NAME:
Frazier School First Floor
HA-68
INSPECTED BY:
Pat Hrycyk

DRAWN BY: MJW	DATE: 3/20/13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-35
DATE
3/15/13
SHEET NUMBER
HA-68

APPENDIX B

Inspector and Management Planner Licenses

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/9/2012
PROJECT MANAGER	11/2/2012
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.


Illinois Department of
PUBLIC HEALTH

ASBESTOS PROFESSIONAL LICENSE

ID NUMBER	ISSUED	EXPIRES
100 - 09725	5/31/2012	05/15/2013

PATRICK L HRYCYK
2942 N. MASON AVE
CHICAGO, IL 60634

Environmental Health



CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PATRICK HRYCYK
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 12/07/2012 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools;
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



N. Penoff

12/07/2012

Course Dates:

12/07/2013

Expires:

1212BIR02

Certificate Number:

Phone Number: (312) 491-0081

Director of Training

Nicholas J. Penoff

Doctor of Public Health

FORM # A-010



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

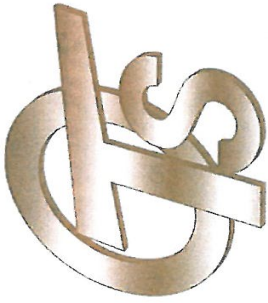

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

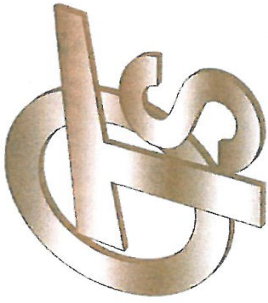

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed