

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0765
SCHOOL NAME: Collins High School
ADDRESS OF SCHOOL: 1313 S. Sacramento
CITY: Chicago, IL, 60623

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **2/19/2010**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 3/24/2013 ENROLLMENT 0
IDPH INSPECTOR LICENSE NUMBER: 100-11170
IDPH LICENSED INSPECTOR NAME (Please Print): Jesus Delgado
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



3/24/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Collins High School

1313 S. Sacramento
Chicago, IL, 60623

Unit: 46411
Building ID: 1880

IDPH ID Number: 14-016-2990-0765

REPORT DATE:

Sunday, March 24, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 8, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46411 Region: 03 IDPH ID: 14-016-2990-0765

School: Collins High School Building ID: 1880

Address: 1313 S. Sacramento
Chicago, IL, 60623

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 3/24/2013

Inspector: Jesus Delgado Inspector IDPH License: 100-11170
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 08, 2013

RE: Collins High School, Unit 46411
1313 S. Sacramento
Chicago, IL, 60623

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Collins High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Collins High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Collins High School Unit: 46411 Region: 03
Address: 1313 S. Sacramento Chicago, IL, 60623
IDPH ID: 14-016-2990-0765 Building ID: 1880
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 0

3. LEA Designated Person


Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Jesus Delgado

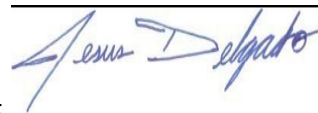

Signature:
Date: 3/8/2013

Inspector IDPH license # 100-11170

6. Management Planner

Management Planner Name: Daniel Juneau



Signature:
Date: 3/24/2013

Management Planner IDPH license # 100-03613

7. Review Date: 3/24/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.



Signature:

Date: 3/24/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Collins High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1880:

| | |
|-----|---|
| 1 | 12" x 12" White w/Reddish Brown Streaks Floor Tile |
| 115 | Drywall |
| 117 | Fire Caulk |
| 206 | 4" Gray Vinyl Baseboard Mastic - Installed in 1998 |
| 4 | 12" x 12" Gray Floor Tile |
| 6 | 2' x 4' Ceiling Panels |
| 60 | 12"x12" White w/Multi Colored Specks Floor Tile |
| 61 | 12"x12" White w/Multi Colored Specks Floor Tile Mastic |
| 62 | 12"x12" Dark Blue w/Light Blue Floor Tile |

| | |
|----|--|
| 63 | 12"x12" Dark Blue w/Light Blue Floor Tile Mastic |
| 64 | 12"x12" Yellow w/Light Yellow Floor Tile |
| 65 | 12"x12" Yellow w/Light Yellow Floor Tile Mastic |
| 66 | 12"x12" Beige w/Tan Floor Tile |
| 68 | 12"x12" Red Floor Tile |
| 69 | 12"x12" Red Floor Tile Mastic |
| 7 | 4' x 4' Ceiling Panels |
| 70 | 12"x12" Grey w/Blue Specks Floor Tile |
| 71 | 12"x12" Grey w/Blue Specks Floor Tile Mastic |
| 72 | Drywall |
| 73 | Drywall Tape and Joint Compound |
| 8 | Hard Plaster |

B. The following new homogenous areas have been identified for Building 1880:

| | |
|-----|---|
| 207 | Beige W/White Streak Linoleum |
| 208 | Beige W/White Streak Linoleum Mastic |
| 209 | Yellow Linoleum |
| 210 | Yellow Linoleum Mastic |
| 211 | Brown Carpet W/Grey Pattern Adhesive |
| 212 | Red Vinyl Base Cove |
| 213 | Red Vinyl Base Cove Mastic |
| 214 | Yellow Vinyl Base Cove |
| 215 | Yellow Vinyl Base Cove Mastic |
| 216 | Blue W/Gold Lines Carpet Adhesive |
| 217 | Gray W/Blue & Yellow Specs. Carpet Adhesive |
| 218 | Brown w/ Yellow & Green Specs Carpet Adhesive |
| 219 | Blue Vinyl Base Cove |
| 220 | Blue Vinyl Base Cove Mastic |
| 221 | 2' X 2' Grey & Dark Grey Tile Carpet Adhesive |
| 222 | Tan Carpet Adhesive |

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

| | |
|-----|--|
| 051 | Vibration Absorber |
| 1 | 12" x 12" White w/Reddish Brown Streaks Floor Tile |
| 103 | Carpet Mastic |
| 104 | 2'x4' Ceiling Tile |
| 105 | 12"x12" Off-White with Grey Specs Floor Tile |
| 106 | 12"x12" Off-White with Grey Specs Floor Tile Mastic |
| 107 | 12"x12" Dark Brown Floor Tile |
| 108 | 12"x12" Dark Brown Floor Tile Mastic |
| 109 | 4" Vinyl Baseboard |
| 110 | 4" Vinyl Baseboard Mastic |
| 111 | 4'x4' Ceiling Tile |
| 112 | 12"x12" Off-White with Blue Patterns Floor Tile |
| 113 | 12"x12" Off-White with Blue Patterns Floor Tile Mastic |
| 114 | White Sink Undercoat |
| 115 | Drywall |
| 116 | Drywall Joint Compound |
| 117 | Fire Caulk |
| 139 | Brown Carpet Mastic |
| 206 | 4" Gray Vinyl Baseboard Mastic - Installed in 1998 |
| 207 | Beige W/White Streak Linoleum |
| 208 | Beige W/White Streak Linoleum Mastic |
| 209 | Yellow Linoleum |
| 210 | Yellow Linoleum Mastic |
| 211 | Brown Carpet W/Grey Pattern Adhesive |
| 212 | Red Vinyl Base Cove |
| 213 | Red Vinyl Base Cove Mastic |
| 214 | Yellow Vinyl Base Cove |
| 215 | Yellow Vinyl Base Cove Mastic |
| 216 | Blue W/Gold Lines Carpet Adhesive |
| 217 | Gray W/Blue & Yellow Specs. Carpet Adhesive |
| 218 | Brown w/ Yellow & Green Specs Carpet Adhesive |
| 219 | Blue Vinyl Base Cove |
| 220 | Blue Vinyl Base Cove Mastic |
| 221 | 2' X 2' Grey & Dark Grey Tile Carpet Adhesive |
| 222 | Tan Carpet Adhesive |
| 3 | 12" x 12" Beige Floor Tile |
| 4 | 12" x 12" Gray Floor Tile |
| 44 | Roofing Material - Not AHERA |
| 45 | Roof Flashing - Not AHERA |
| 46 | Purple Carpet Mastic |
| 47 | Brown Carpet Mastic |
| 48 | Lab Tops |
| 49 | Blue Ceramic Tile Grout |

| | |
|--------|--|
| 5 | 12" x 12" Ceiling Tile and Mastic |
| 51 | Lab Hood Transite |
| 52 | 12" x 12" Beige w/White Speckle Floor Tile |
| 53 | 12" x 12" Beige w/White Speckle Floor Tile Mastic |
| 54 | 12" x 12" Tan with Brown Streaks Floor Tile |
| 55 | 12" x 12" Tan with Brown Streak Floor Tile Mastic |
| 56 | White & Red Ceramic Floor Tile and Grout |
| 57 | White & Red Ceramic Floor Tile Mastic |
| 58 | Grey Ceramic Floor Tile |
| 59 | Grey Ceramic Floor Tile Mastic |
| 6 | 2' x 4' Ceiling Panels |
| 60 | 12"x12" White w/Multi Colored Specks Floor Tile |
| 61 | 12"x12" White w/Multi Colored Specks Floor Tile Mastic |
| 62 | 12"x12" Dark Blue w/Light Blue Floor Tile |
| 63 | 12"x12" Dark Blue w/Light Blue Floor Tile Mastic |
| 64 | 12"x12" Yellow w/Light Yellow Floor Tile |
| 65 | 12"x12" Yellow w/Light Yellow Floor Tile Mastic |
| 66 | 12"x12" Beige w/Tan Floor Tile |
| 68 | 12"x12" Red Floor Tile |
| 69 | 12"x12" Red Floor Tile Mastic |
| 7 | 4' x 4' Ceiling Panels |
| 70 | 12"x12" Grey w/Blue Specks Floor Tile |
| 71 | 12"x12" Grey w/Blue Specks Floor Tile Mastic |
| 72 | Drywall |
| 73 | Drywall Tape and Joint Compound |
| 8 | Hard Plaster |
| HA-100 | 12"x12" red pattern design VFT |
| HA-101 | Adhesive for 12"x12" red pattern design VFT |
| HA-102 | Interior lining of the Kiln |

The following areas were deemed to be inaccessible:

| | |
|-----|---|
| 12 | 12" x 12" Gray Floor Tile Mastic |
| 208 | Beige W/White Streak Linoleum Mastic |
| 210 | Yellow Linoleum Mastic |
| 211 | Brown Carpet W/Grey Pattern Adhesive |
| 213 | Red Vinyl Base Cove Mastic |
| 215 | Yellow Vinyl Base Cove Mastic |
| 216 | Blue W/Gold Lines Carpet Adhesive |
| 217 | Gray W/Blue & Yellow Specs. Carpet Adhesive |
| 218 | Brown w/ Yellow & Green Specs Carpet Adhesive |
| 220 | Blue Vinyl Base Cove Mastic |
| 221 | 2' X 2' Grey & Dark Grey Tile Carpet Adhesive |
| 222 | Tan Carpet Adhesive |
| 55 | 12" x 12" Tan with Brown Streak Floor Tile Mastic |
| 57 | White & Red Ceramic Floor Tile Mastic |
| 59 | Grey Ceramic Floor Tile Mastic |

| | |
|----|--|
| 61 | 12"x12" White w/Multi Colored Specks Floor Tile Mastic |
| 63 | 12"x12" Dark Blue w/Light Blue Floor Tile Mastic |
| 65 | 12"x12" Yellow w/Light Yellow Floor Tile Mastic |
| 71 | 12"x12" Grey w/Blue Specks Floor Tile Mastic |

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Jesus Delgado, IDPH License # 100-11170. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Collins High School Building 1880 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 051 | Vibration Absorber | 10 | LF | Kitchen | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 1 | 12" x 12" White w/Reddish Brown Streaks Floor Tile | 3,000 | SF | Fine Arts Building and Basement | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 10 | 12" x 12" Brown Floor Tile Mastic - ABATED | | | Coach Love's Office, Weight Room, and Drivers Ed (Now ROTC Classroom), Rooms 176 & 177 | ABATED | MISC | | None | | | | ACBM with the potential for damage | | Low |
| 103 | Carpet Mastic | 8,175 | SF | Building B: First Floor - Auditorium, 134, 136, 140, 140A | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 104 | 2'x4' Ceiling Tile | 15,350 | SF | Building B: 1st Floor - 122, 130, 130A-C, 132, 132A-B, 133, 135, 136B, 137, 140, 1410A-F, 144, 144A-B, 146, 146A, 148 and Office 1 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 105 | 12"x12" Off-White with Grey Specs Floor Tile | 7,850 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 106 | 12"x12" Off-White with Grey Specs Floor Tile Mastic | 7,850 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 107 | 12"x12" Dark Brown Floor Tile | 2,150 | SF | Building B: 1st Floor - 130, 122, 132, 144, 146, and 148 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 108 | 12"x12" Dark Brown Floor Tile Mastic | 2,150 | SF | Building B: 1st Floor - 130, 122, 132, 144, 146, and 148 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 109 | 4" Vinyl Baseboard | 2,200 | LF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 11 | 12" x 12" Beige Floor Tile Mastic | | | Consumer Science and Music Complexes | NO_ACBM | MISC | | | | | | | | |
| 110 | 4" Vinyl Baseboard Mastic | 2,200 | LF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 111 | 4'x4' Ceiling Tile | 2,800 | SF | Building B: 1st Floor - 134 and 136 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 112 | 12"x12" Off-White with Blue Patterns Floor Tile | 830 | SF | Building B: 1st Floor - 140B and 140C | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 113 | 12"x12" Off-White with Blue Patterns Floor Tile Mastic | 830 | SF | Building B: 1st Floor - 140B and 140C | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 114 | White Sink Undercoat | 1 | Sink | Building B: 1st Floor - Room 144 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 115 | Drywall | 10,000 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 116 | Drywall Joint Compound | 48,000 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 17 | Green Linoleum | | | 3rd Floor Hall | NO_ACBM | MISC | | | | | | | | |
| 18 | Clay Tile | | | 2nd and 3rd Floor Kitchen, 3rd Floor Hall | NO_ACBM | MISC | | | | | | | | |
| 19 | Clay Tile Mortar | | | 2nd and 3rd Floor Kitchen, 3rd Floor Hall | NO_ACBM | MISC | | | | | | | | |
| 2 | 12" x 12" Brown Floor Tile - ABATED | | | Coach Love's Office, Weight Room and Driver's Ed (Now ROTC Classroom) | ABATED | MISC | | | | | | | | |
| 20 | Black Baseboard | | | Throughout Complex | NO_ACBM | MISC | | | | | | | | |
| 206 | 4" Gray Vinyl Baseboard Mastic - Installed in 1998 | | | Throughout Building | ASSUMED | MISC | | | | | Yes | | | |
| 207 | Beige W/White Streak Linoleum | 6,500 | SF | Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 208 | Beige W/White Streak Linoleum Mastic | 6,500 | SF | Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 209 | Yellow Linoleum | 4,300 | SF | Room 200, 200 b, 203, 205, 205A | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 21 | Black Baseboard Mastic | | | Throughout Complex | NO_ACBM | MISC | | | | | | | | |
| 210 | Yellow Linoleum Mastic | 4,300 | SF | Room 200, 200 b, 203, 205, 205A | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 211 | Brown Carpet W/Grey Pattern Adhesive | 200 | SF | Room 329 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 212 | Red Vinyl Base Cove | 2,000 | LF | Throughout 3rd Floor Classrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 213 | Red Vinyl Base Cove Mastic | 2,000 | LF | Throughout 3rd Floor Classrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 214 | Yellow Vinyl Base Cove | 2,750 | LF | Throughout 2nd & 3rd Floor Hallway | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 215 | Yellow Vinyl Base Cove Mastic | 2,750 | LF | Throughout 2nd and 3rd Floor Hallways | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 216 | Blue W/Gold Lines Carpet Adhesive | 7,000 | SF | Library, and Library Offices 100 to 105 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 217 | Gray W/Blue & Yellow Specs. Carpet Adhesive | 800 | SF | Room 140-142, 145, 120, 121, 126, 128- | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 39 | Fiberglass Pipe Insulation | | | Throughout Complex | NO_ACBM | TSI | | | | | | | | |
| 4 | 12" x 12" Gray Floor Tile | 1,500 | SF | 3rd Floor Lunchroom | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 40 | Hard Joint Compound on Fiberglass Pipe Insulation | | | Throughout Complex | NO_ACBM | TSI | | | | | | | | |
| 41 | Cover on Hard Joint Compound on Fiberglass Lag | | | Throughout Complex | NO_ACBM | TSI | | | | | | | | |
| 42 | Duct Insulation | | | Hall by Kitchen | NO_ACBM | TSI | | | | | | | | |
| 43 | Tank Insulation | | | Pump Room | NO_ACBM | TSI | | | | | | | | |
| 44 | Roofing Material - Not AHERA | 210,050 | SF | Roof | ASSUMED | MISC | | | | | | | | |
| 45 | Roof Flashing - Not AHERA | 5,000 | SF | Roof | ASSUMED | MISC | N | | | | No | | | |
| 46 | Purple Carpet Mastic | 2,400 | SF | Rooms 208, 210, 212, 213, 214, and 215 | ASSUMED | MISC | | | | | | | | |
| 47 | Brown Carpet Mastic | | | Library and Office | ASSUMED | MISC | | | | | | | | |
| 48 | Lab Tops | 600 | SF | Rooms 300, 305, and 310, 307, 313, and Commercial Arts | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 49 | Blue Ceramic Tile Grout | 2,350 | SF | Locker Rooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 5 | 12" x 12" Ceiling Tile and Mastic | | | Classrooms and Hallways | ASSUMED | MISC | | | | | | | | |
| 50 | Terrazzo Basins | | | 2nd & 3rd Floor Slop Rooms and Boys Locker Room | NO_ACBM | MISC | | | | | | | | |
| 51 | Lab Hood Transite | 100 | SF | Rooms 305 & 310 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 52 | 12" x 12" Beige w/White Speckle Floor Tile | 2,200 | SF | 1st Floor Attendance Office and Room 312 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 53 | 12" x 12" Beige w/White Speckle Floor Tile Mastic | 2,200 | SF | 1st Floor Attendance Office and Room 312 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 54 | 12" x 12" Tan with Brown Streaks Floor Tile | 2,200 | SF | 2nd Floor Lunch Room | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |
| 55 | 12" x 12" Tan with Brown Streak Floor Tile Mastic | 2,200 | SF | 2nd Floor Lunchroom | ASSUMED | MISC | N | None | 0 | | | ACBM with the potential for damage | | Low |
| 56 | White & Red Ceramic Floor Tile and Grout | 2,100 | SF | 2nd & 3rd Floor Boys and Girls Bathroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 57 | White & Red Ceramic Floor Tile Mastic | 2,100 | SF | 2nd & 3rd Floor Boys and Girls | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| | | | | Bathroom | | | | | | | | | | |
| 58 | Grey Ceramic Floor Tile | 3,500 | SF | 1st Floor Boys and Girls Bathrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 59 | Grey Ceramic Floor Tile Mastic | 3,500 | SF | 1st Floor Boys and Girls Bathroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 6 | 2' x 4' Ceiling Panels | 200,000 | SF | Throughout Complex | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 60 | 12"x12" White w/Multi Colored Specks Floor Tile | 12,000 | SF | First and Second Floor Hallways and Classrooms | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 61 | 12"x12" White w/Multi Colored Specks Floor Tile Mastic | 12,000 | SF | First and Second Floor Hallways and Classrooms | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 62 | 12"x12" Dark Blue w/Light Blue Floor Tile | 1,500 | SF | First Floor Hallways and Classrooms | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 63 | 12"x12" Dark Blue w/Light Blue Floor Tile Mastic | 1,500 | SF | First Floor Hallways and Classrooms | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 64 | 12"x12" Yellow w/Light Yellow Floor Tile | 3,000 | SF | Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 65 | 12"x12" Yellow w/Light Yellow Floor Tile Mastic | 3,000 | SF | Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 66 | 12"x12" Beige w/Tan Floor Tile | 6,000 | SF | Third Floor Hallway | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 67 | 12"x12" Beige w/Tan Floor Tile Mastic | | | Third Floor Hallway | NO_ACBM | MISC | | | | | | | | |
| 68 | 12"x12" Red Floor Tile | 500 | SF | Third Floor Hallway | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 69 | 12"x12" Red Floor Tile Mastic | 500 | SF | Third Floor Hallway | ASSUMED | MISC | N | NONE | | | Yes | ACBM with the potential for damage | | LOW |
| 7 | 4' x 4' Ceiling Panels | 2,800 | SF | Throughout Complex | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 70 | 12"x12" Grey w/Blue Specks Floor Tile | 15,000 | SF | Third Floor Classrooms | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 71 | 12"x12" Grey w/Blue Specks Floor Tile Mastic | 15,000 | SF | Third Floor Classrooms | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 72 | Drywall | 25,000 | SF | Throughout Academic Building | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|--------|---|-------------------|----------------|----------------------------------|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|--|---------------|-----------------------|
| | | | | "A" | | | | | | | | | | |
| 73 | Drywall Tape and Joint Compound | 60,000 | LF | Throughout Academic Building "A" | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 8 | Hard Plaster | 100,000 | SF | Throughout Complex | ASSUMED | SURFACE | Y | NONE | 0 | | Yes | Any remaining friable ACBM or friable suspect ACBM | | LOW |
| 9 | 12" x 12" White w/Reddish Brown Streaks FT Mastic | 3,000 | SF | Fine Arts Rooms and Basement | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| HA-100 | 12"x12" red pattern design VFT | 72 | SF | Detention room storage | ASSUMED | MISC | N | None | | | | | | Low |
| HA-101 | Adhesive for 12"x12" red pattern design VFT | 72 | SF | Detention room storage | ASSUMED | MISC | N | None | | | | | | Low |
| HA-102 | Interior lining of the Kiln | 15 | SF | | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| |
|---|
| Reinspection Date 3/8/2013 |
| Inspector Name Jesus Delgado |
| 100-11170 5/15/2013 |
| Inspector's IDPH License Number / Expiration Date |

Inspector's Comments

| HA Number: | Inspector Comments: |
|------------|------------------------------|
| 051 | |
| 1 | |
| 10 | Material not observed - 2013 |
| 103 | |
| 104 | |
| 105 | |
| 106 | |
| 107 | |
| 108 | |
| 109 | |
| 11 | Material not observed - 2013 |
| 110 | |
| 111 | |
| 112 | |
| 113 | |
| 114 | |
| 115 | |
| 116 | |
| 117 | |
| 118 | |
| 119 | |
| 12 | |
| 13 | |
| 139 | Material not observed |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|------------------------------|
| 14 | |
| 15 | |
| 16 | |
| 17 | |
| 18 | Material not observed - 2013 |
| 19 | Material not observed - 2013 |
| 2 | Material not observed - 2013 |
| 20 | |
| 206 | Material not observed - 2013 |
| 207 | |
| 208 | |
| 209 | |
| 21 | |
| 210 | |
| 211 | |
| 212 | |
| 213 | |
| 214 | |
| 215 | |
| 216 | |
| 217 | |
| 218 | |
| 219 | |
| 22 | Material not observed - 2013 |
| 220 | |
| 221 | |
| 222 | |
| 23 | Material not observed - 2013 |
| 24 | |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---|
| 25 | |
| 26 | Material not observed - 2013 |
| 27 | |
| 27 M | |
| 28 | Material not observed - 2013 |
| 29 | |
| 3 | Material not observed - 2013 |
| 30 | |
| 31 | Material not observed - 2013 |
| 32 | |
| 33 | |
| 34 | |
| 35 | |
| 36 | |
| 37 | |
| 38 | |
| 39 | |
| 4 | |
| 40 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | Material not observed - 2013 |
| 47 | Material not observed - 2013 |
| 48 | Material not observed in Room 300 and 305 |
| 49 | |
| 5 | Material not observed - 2013 |

Chicago Public Schools

School Collins High School Unit 46411 Building ID 1880

Address 1313 S. Sacramento Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|--|
| 50 | |
| 51 | Material not observed in room 305 |
| 52 | Material not observed in room 312 or attendance office |
| 53 | Material not observed in room 312 or attendance office |
| 54 | Material not observed - 2013 |
| 55 | Material not observed - 2013 |
| 56 | |
| 57 | |
| 58 | |
| 59 | |
| 6 | |
| 60 | |
| 61 | |
| 62 | |
| 63 | |
| 64 | |
| 65 | |
| 66 | |
| 67 | |
| 68 | |
| 69 | |
| 7 | |
| 70 | |
| 71 | |
| 72 | |
| 73 | |
| 8 | |
| 9 | |
| HA-100 | Material not observed - 2013 |

Chicago Public Schools

School Collins High School **Unit** 46411 **Building ID** 1880

Address 1313 S. Sacramento **Region** 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|------------------------------|
| HA-101 | Material not observed - 2013 |
| HA-102 | |

Table II

Management Planner's Review

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|---|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|----------------------------|
| 051 | Vibration Absorber | 10 | LF | Kitchen | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 1 | 12" x 12" White w/Reddish Brown Streaks Floor Tile | 3,000 | SF | Fine Arts Building and Basement | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 10 | 12" x 12" Brown Floor Tile Mastic - ABATED | | | Coach Love's Office, Weight Room, and Drivers Ed (Now ROTC Classroom), Rooms 176 & 177 | Abated | MISC | | | | 6 ACBM with the potential for damage | |
| 103 | Carpet Mastic | 8,175 | SF | Building B: First Floor - Auditorium, 134, 136, 140, 140A | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 104 | 2'x4' Ceiling Tile | 15,350 | SF | Building B: 1st Floor - 122, 130, 130A-C, 132, 132A-B, 133, 135, 136B, 137, 140, 1410A-F, 144, 144A-B, 146, 146A, 148 and Office 1 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 105 | 12"x12" Off-White with Grey Specs Floor Tile | 7,850 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 106 | 12"x12" Off-White with Grey Specs Floor Tile Mastic | 7,850 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 107 | 12"x12" Dark Brown Floor Tile | 2,150 | SF | Building B: 1st Floor - 130, 122, 132, 144, 146, and 148 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 108 | 12"x12" Dark Brown Floor Tile Mastic | 2,150 | SF | Building B: 1st Floor - 130, 122, 132, 144, 146, and 148 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 109 | 4" Vinyl Baseboard | 2,200 | LF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 11 | 12" x 12" Beige Floor Tile Mastic | | | Consumer Science and Music Complexes | No ACBM | MISC | | | | | |
| 110 | 4" Vinyl Baseboard Mastic | 2,200 | LF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 111 | 4'x4' Ceiling Tile | 2,800 | SF | Building B: 1st Floor - 134 and 136 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 112 | 12"x12" Off-White with Blue Patterns Floor Tile | 830 | SF | Building B: 1st Floor - 140B and 140C | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|----------------------------|
| 113 | 12"x12" Off-White with Blue Patterns Floor Tile Mastic | 830 | SF | Building B: 1st Floor - 140B and 140C | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 114 | White Sink Undercoat | 1 | Sink | Building B: 1st Floor - Room 144 | Assumed | MISC | No | 0 | Sink | 6 ACBM with the potential for damage | Operations and Maintenance |
| 115 | Drywall | 10,000 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 116 | Drywall Joint Compound | 48,000 | SF | Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 117 | Fire Caulk | 2,000 | LF | Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 118 | Flo-Tech Insulation Wrap | | | Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1 | No ACBM | MISC | | | | | |
| 119 | Duct Sealant | | | Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1 | No ACBM | MISC | | | | | |
| 12 | 12" x 12" Gray Floor Tile Mastic | 150 | SF | 3rd Floor Lunch Room | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 13 | Interior Window Glazing | | | Throughout Complex | No ACBM | MISC | | | | | |
| 139 | Brown Carpet Mastic | | | 10th Floor Corridor, 1039, 1236, 1339, 1700, 1720, 500, & 522 | Assumed | MISC | No | | | | |
| 14 | Interior Brick | | | Throughout Complex | No ACBM | MISC | | | | | |
| 15 | Interior Brick Mortar | | | Throughout Complex | No ACBM | MISC | | | | | |
| 16 | Terrazzo Flooring | | | Throughout Complex | No ACBM | MISC | | | | | |
| 17 | Green Linoleum | | | 3rd Floor Hall | No ACBM | MISC | | | | | |
| 18 | Clay Tile | | | 2nd and 3rd Floor Kitchen, 3rd Floor Hall | No ACBM | MISC | | | | | |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|----------------------------|
| 19 | Clay Tile Mortar | | | 2nd and 3rd Floor Kitchen, 3rd Floor Hall | No ACBM | MISC | | | | | |
| 2 | 12" x 12" Brown Floor Tile - ABATED | | | Coach Love's Office, Weight Room and Driver's Ed (Now ROTC Classroom) | Abated | MISC | | | | | |
| 20 | Black Baseboard | | | Throughout Complex | No ACBM | MISC | | | | | |
| 206 | 4" Gray Vinyl Baseboard Mastic - Installed in 1998 | | | Throughout Building | Assumed | MISC | | | | | |
| 207 | Beige W/White Streak Linoleum | 6,500 | SF | Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 208 | Beige W/White Streak Linoleum Mastic | 6,500 | SF | Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 209 | Yellow Linoleum | 4,300 | SF | Room 200, 200 b, 203, 205, 205A | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 21 | Black Baseboard Mastic | | | Throughout Complex | No ACBM | MISC | | | | | |
| 210 | Yellow Linoleum Mastic | 4,300 | SF | Room 200, 200 b, 203, 205, 205A | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 211 | Brown Carpet W/Grey Pattern Adhesive | 200 | SF | Room 329 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 212 | Red Vinyl Base Cove | 2,000 | LF | Throughout 3rd Floor Classrooms | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 213 | Red Vinyl Base Cove Mastic | 2,000 | LF | Throughout 3rd Floor Classrooms | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 214 | Yellow Vinyl Base Cove | 2,750 | LF | Throughout 2nd & 3rd Floor Hallway | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 215 | Yellow Vinyl Base Cove Mastic | 2,750 | LF | Throughout 2nd and 3rd Floor Hallways | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 216 | Blue W/Gold Lines Carpet Adhesive | 7,000 | SF | Library, and Library Offices 100 to 105 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 217 | Gray W/Blue & Yellow Specs. Carpet Adhesive | 800 | SF | Room 140-142, 145, 120, 121, 126, 128-130 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 218 | Brown w/ Yellow & Green Specs Carpet Adhesive | 800 | SF | 132, 134-136 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 219 | Blue Vinyl Base Cove | 2,250 | LF | Throughout 1st Floor A-Building | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 22 | Blue Baseboard | | | Third Floor Hall | No ACBM | MISC | | | | | |
| 220 | Blue Vinyl Base Cove Mastic | 2,250 | LF | Throughout 1st A-Building | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 221 | 2' X 2' Grey & Dark Grey Tile Carpet Adhesive | 3,500 | SF | B-Building B140 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 222 | Tan Carpet Adhesive | 7,000 | SF | B-Building Adhesive Auditorium | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 23 | Blue Baseboard Mastic | | | Third Floor Corridor | No ACBM | MISC | | | | | |
| 24 | White Wall Tile Grout | | | Kitchens and Washrooms | No ACBM | SURFACE | | | | | |
| 25 | Gray Carpet Mastic | | | Throughout Complex | No ACBM | MISC | | | | | |
| 26 | Linoleum | | | 2nd Floor Hall | No ACBM | MISC | | | | | |
| 27 | Cinder Block | | | Throughout Complex | No ACBM | MISC | | | | | |
| 27 M | Cinder Block Mortar | | | Throughout Complex | No ACBM | MISC | | | | | |
| 28 | Blue Carpet Mastic | | | Room 120 | No ACBM | MISC | | | | | |
| 29 | Brown Ceramic Tile Grout | | | Washrooms and Locker Rooms | No ACBM | SURFACE | | | | | |

Chicago Public Schools

School Collins High School

Unit 46411

Building ID 1880

Address 1313 S. Sacramento

Chicago, IL, 60623

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|---|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|----------------------------|
| 3 | 12" x 12" Beige Floor Tile | | | Consumer Science and Music Complexes | Assumed | MISC | | | | | |
| 30 | Insulation Inside Fire Doors | | | Throughout Complex | No ACBM | TSI | | | | | |
| 31 | Striped Carpet Mastic | | | Auditorium | No ACBM | MISC | | | | | |
| 32 | Brown and Green Carpet Mastic | | | Auditorium | No ACBM | MISC | | | | | |
| 33 | Exterior Brick - Not AHERA | | | Throughout Complex | No ACBM | MISC | | | | | |
| 34 | Exterior Brick Mortar - Not AHERA | | | Throughout Complex | No ACBM | MISC | | | | | |
| 35 | Exterior Door Caulk - Not AHERA | | | Throughout Complex | No ACBM | MISC | | | | | |
| 36 | Exterior Window Caulk - Not AHERA | | | Throughout Complex | No ACBM | MISC | | | | | |
| 37 | Tank Insulation | | | Pool Basement | No ACBM | TSI | | | | | |
| 38 | Tank Wrap | | | Pool Basement | No ACBM | MISC | | | | | |
| 39 | Fiberglass Pipe Insulation | | | Throughout Complex | No ACBM | TSI | | | | | |
| 4 | 12" x 12" Gray Floor Tile | 1,500 | SF | 3rd Floor Lunchroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 40 | Hard Joint Compound on Fiberglass Pipe Insulation | | | Throughout Complex | No ACBM | TSI | | | | | |
| 41 | Cover on Hard Joint Compound on Fiberglass Lag | | | Throughout Complex | No ACBM | TSI | | | | | |
| 42 | Duct Insulation | | | Hall by Kitchen | No ACBM | TSI | | | | | |
| 43 | Tank Insulation | | | Pump Room | No ACBM | TSI | | | | | |
| 44 | Roofing Material - Not AHERA | 210,050 | SF | Roof | Assumed | MISC | | | SF | | |
| 45 | Roof Flashing - Not AHERA | 5,000 | SF | Roof | Assumed | MISC | No | | SF | | |
| 46 | Purple Carpet Mastic | 2,400 | SF | Rooms 208, 210, 212, 213, 214, and 215 | Assumed | MISC | | | SF | | |
| 47 | Brown Carpet Mastic | | | Library and Office | Assumed | MISC | | | | | |
| 48 | Lab Tops | 600 | SF | Rooms 300, 305, and 310, 307, 313, and Commercial Arts | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 49 | Blue Ceramic Tile Grout | 2,350 | SF | Locker Rooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 5 | 12" x 12" Ceiling Tile and Mastic | | | Classrooms and Hallways | Assumed | MISC | | | | | |
| 50 | Terrazzo Basins | | | 2nd & 3rd Floor Slop Rooms and Boys Locker Room | No ACBM | MISC | | | | | |
| 51 | Lab Hood Transite | 100 | SF | Rooms 305 & 310 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 52 | 12" x 12" Beige w/White Speckle Floor Tile | 2,200 | SF | 1st Floor Attendance Office and Room 312 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 53 | 12" x 12" Beige w/White Speckle Floor Tile Mastic | 2,200 | SF | 1st Floor Attendance Office and Room 312 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 54 | 12" x 12" Tan with Brown Streaks Floor Tile | 2,200 | SF | 2nd Floor Lunch Room | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--|----------------------------|
| 55 | 12" x 12" Tan with Brown Streak Floor Tile Mastic | 2,200 | SF | 2nd Floor Lunchroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | |
| 56 | White & Red Ceramic Floor Tile and Grout | 2,100 | SF | 2nd & 3rd Floor Boys and Girls Bathroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 57 | White & Red Ceramic Floor Tile Mastic | 2,100 | SF | 2nd & 3rd Floor Boys and Girls Bathroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 58 | Grey Ceramic Floor Tile | 3,500 | SF | 1st Floor Boys and Girls Bathrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 59 | Grey Ceramic Floor Tile Mastic | 3,500 | SF | 1st Floor Boys and Girls Bathroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 6 | 2' x 4' Ceiling Panels | 200,000 | SF | Throughout Complex | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 60 | 12"x12" White w/Multi Colored Specks Floor Tile | 12,000 | SF | First and Second Floor Hallways and Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 61 | 12"x12" White w/Multi Colored Specks Floor Tile Mastic | 12,000 | SF | First and Second Floor Hallways and Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 62 | 12"x12" Dark Blue w/Light Blue Floor Tile | 1,500 | SF | First Floor Hallways and Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 63 | 12"x12" Dark Blue w/Light Blue Floor Tile Mastic | 1,500 | SF | First Floor Hallways and Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 64 | 12"x12" Yellow w/Light Yellow Floor Tile | 3,000 | SF | Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 65 | 12"x12" Yellow w/Light Yellow Floor Tile Mastic | 3,000 | SF | Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 66 | 12"x12" Beige w/Tan Floor Tile | 6,000 | SF | Third Floor Hallway | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 67 | 12"x12" Beige w/Tan Floor Tile Mastic | | | Third Floor Hallway | No ACBM | MISC | | | | | |
| 68 | 12"x12" Red Floor Tile | 500 | SF | Third Floor Hallway | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 69 | 12"x12" Red Floor Tile Mastic | 500 | SF | Third Floor Hallway | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 7 | 4' x 4' Ceiling Panels | 2,800 | SF | Throughout Complex | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 70 | 12"x12" Grey w/Blue Specks Floor Tile | 15,000 | SF | Third Floor Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 71 | 12"x12" Grey w/Blue Specks Floor Tile Mastic | 15,000 | SF | Third Floor Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 72 | Drywall | 25,000 | SF | Throughout Academic Building "A" | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 73 | Drywall Tape and Joint Compound | 60,000 | LF | Throughout Academic Building "A" | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 8 | Hard Plaster | 100,000 | SF | Throughout Complex | Assumed | SURFACE | Yes | 0 | SF | 7 Any remaining friable ACBM or friable suspect ACBM | Operations and Maintenance |
| 9 | 12" x 12" White w/Reddish Brown Streaks FT Mastic | 3,000 | SF | Fine Arts Rooms and Basement | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| HA-100 | 12"x12" red pattern design VFT | 72 | SF | Detention room storage | Assumed | MISC | No | | SF | | |
| HA-101 | Adhesive for 12"x12" red pattern design VFT | 72 | SF | Detention room storage | Assumed | MISC | No | | SF | | |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|-----------------------------|-------------------|----------------|-------------------|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|----------------------------|
| HA-102 | Interior lining of the Kiln | 15 | SF | | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |

| | |
|----------------------|---------------|
| Review Date | 3/24/2013 |
| Manager Planner Name | Daniel Juneau |
| 100-03613 | 5/15/2014 |

| HA Number | Management Comments |
|-----------|----------------------------|
| 051 | |
| 1 | |
| 10 | Material not observed 2013 |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Manager IDPH License No/Expiration

| HA Number | Management Comments |
|-----------|----------------------------|
| 103 | |
| 104 | |
| 105 | |
| 106 | |
| 107 | |
| 108 | |
| 109 | |
| 11 | |
| 110 | |
| 111 | |
| 112 | |
| 113 | |
| 114 | |
| 115 | |
| 116 | |
| 117 | |
| 118 | |
| 119 | |
| 12 | |
| 13 | |
| 139 | Material not observed 2013 |
| 14 | |
| 15 | |
| 16 | |
| 17 | |
| 18 | |
| 19 | |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|----------------------------|
| 2 | Material not observed 2013 |
| 20 | |
| 206 | Material not observed 2013 |
| 207 | |
| 208 | |
| 209 | |
| 21 | |
| 210 | |
| 211 | |
| 212 | |
| 213 | |
| 214 | |
| 215 | |
| 216 | |
| 217 | |
| 218 | |
| 219 | |
| 22 | |
| 220 | |
| 221 | |
| 222 | |
| 23 | |
| 24 | |
| 25 | |
| 26 | |
| 27 | |
| 27 M | |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|----------------------------|
| 28 | |
| 29 | |
| 3 | Material not observed 2013 |
| 30 | |
| 31 | |
| 32 | |
| 33 | |
| 34 | |
| 35 | |
| 36 | |
| 37 | |
| 38 | |
| 39 | |
| 4 | |
| 40 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | Material not observed 2013 |
| 47 | Material not observed 2013 |
| 48 | |
| 49 | |
| 5 | Material not observed 2013 |
| 50 | |
| 51 | |

Chicago Public Schools

School Collins High School
Address 1313 S. Sacramento

Unit 46411
 Chicago, IL, 60623

Building ID 1880
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|----------------------------|
| 52 | |
| 53 | |
| 54 | Material not observed 2013 |
| 55 | Material not observed 2013 |
| 56 | |
| 57 | |
| 58 | |
| 59 | |
| 6 | |
| 60 | |
| 61 | |
| 62 | |
| 63 | |
| 64 | |
| 65 | |
| 66 | |
| 67 | |
| 68 | |
| 69 | |
| 7 | |
| 70 | |
| 71 | |
| 72 | |
| 73 | |
| 8 | |
| 9 | |
| HA-100 | Material not observed 2013 |

Chicago Public Schools

School Collins High School

Unit 46411

Building ID 1880

Address 1313 S. Sacramento

Chicago, IL, 60623

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|----------------------------|
| HA-101 | Material not observed 2013 |
| HA-102 | |

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **051**
MATERIAL DESCRIPTION: **Vibration Absorber**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **051**
MATERIAL DESCRIPTION: **Vibration Absorber**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12" x 12" White w/Reddish Brown Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Fine Arts Building and Basement**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

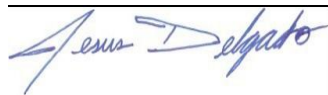

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12" x 12" White w/Reddish Brown Streaks Floor Tile**
MATERIAL LOCATION: **Fine Arts Building and Basement**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic - ABATED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Coach Love's Office, Weight Room, and Drivers Ed (Now ROTC Classroom), Rooms 176 & 177**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

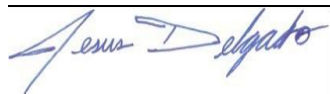

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic - ABATED**

MATERIAL LOCATION: **Coach Love's Office, Weight Room, and Drivers Ed (Now ROTC Classroom), Rooms 176 & 177**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Building B: First Floor - Auditorium, 134, 136, 140, 140A**
MATERIAL QUANTITY: **8175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Building B: First Floor - Auditorium, 134, 136, 140, 140A**
MATERIAL QUANTITY: **8175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Building B: 1st Floor - 122, 130, 130A-C, 132, 132A-B, 133, 135, 136B, 137, 140, 1410A-F, 144, 144A-B, 146, 146A, 148 and Office 1**

MATERIAL QUANTITY: **15350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**
MATERIAL LOCATION: **Building B: 1st Floor - 122, 130, 130A-C, 132, 132A-B, 133, 135, 136B, 137, 140, 1410A-F, 144, 144A-B, 146, 146A, 148 and Office 1**
MATERIAL QUANTITY: **15350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: 03/24/2013

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **12"x12" Off-White with Grey Specs Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1**

MATERIAL QUANTITY: **7850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

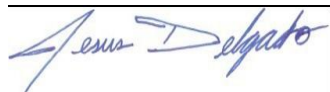

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **12"x12" Off-White with Grey Specs Floor Tile**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1**
MATERIAL QUANTITY: **7850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **12"x12" Off-White with Grey Specs Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1**

MATERIAL QUANTITY: **7850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

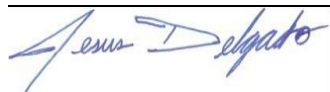

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **12"x12" Off-White with Grey Specs Floor Tile Mastic**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134B, 134D, 135, 136B, 137, 140D-F, 144, 144A-B, 146, 146A, 148 and Office 1**
MATERIAL QUANTITY: **7850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **12"x12" Dark Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Building B: 1st Floor - 130, 122, 132, 144, 146, and 148**

MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **12"x12" Dark Brown Floor Tile**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 122, 132, 144, 146, and 148**
MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **12"x12" Dark Brown Florr Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 122, 132, 144, 146, and 148**

MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

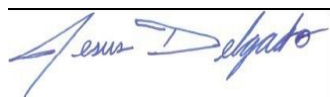

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **12"x12" Dark Brown Florr Tile Mastic**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 122, 132, 144, 146, and 148**
MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **4" Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

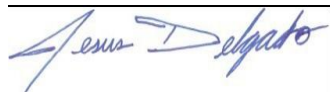

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **4" Vinyl Baseboard**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

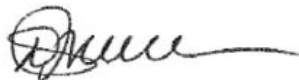

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Consumer Science and Music Complexes**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**

MATERIAL LOCATION: **Consumer Science and Music Complexes**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **4" Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

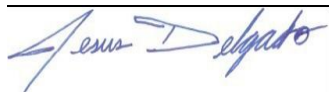

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **4" Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148 and Office 1**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

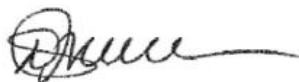

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **4'x4' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Building B: 1st Floor - 134 and 136**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **4'x4' Ceiling Tile**
MATERIAL LOCATION: **Building B: 1st Floor - 134 and 136**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

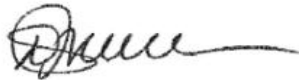

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **12"x12" Off-White with Blue Patterns Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Building B: 1st Floor - 140B and 140C**

MATERIAL QUANTITY: **830**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **12"x12" Off-White with Blue Patterns Floor Tile**
MATERIAL LOCATION: **Building B: 1st Floor - 140B and 140C**
MATERIAL QUANTITY: **830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **12"x12" Off-White with Blue Patterns Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Building B: 1st Floor - 140B and 140C**

MATERIAL QUANTITY: **830**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

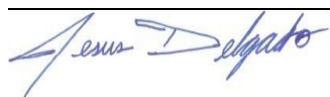

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **12"x12" Off-White with Blue Patterns Floor Tile Mastic**
MATERIAL LOCATION: **Building B: 1st Floor - 140B and 140C**
MATERIAL QUANTITY: **830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **White Sink Undercoat**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Building B: 1st Floor - Room 144**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **Sink**
DAMAGE QUANTITY: DAMAGE UNITS: **Sink**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **White Sink Undercoat**
MATERIAL LOCATION: **Building B: 1st Floor - Room 144**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **Sink**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **Sink**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**

MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

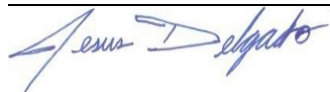

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

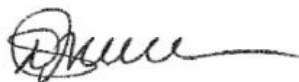

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **116**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**

MATERIAL QUANTITY: **48000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **116**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Building B: 1st Floor - 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**
MATERIAL QUANTITY: **48000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

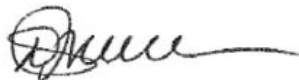

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **117**
MATERIAL DESCRIPTION: **Fire Caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

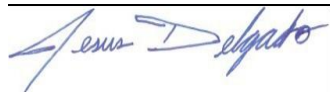

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **117**
MATERIAL DESCRIPTION: **Fire Caulk**
MATERIAL LOCATION: **Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

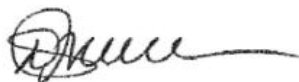

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **118**
MATERIAL DESCRIPTION: **Flo-Tech Insulation Wrap**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

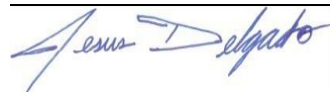

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **118**
MATERIAL DESCRIPTION: **Flo-Tech Insulation Wrap**
MATERIAL LOCATION: **Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **119**
MATERIAL DESCRIPTION: **Duct Sealant**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

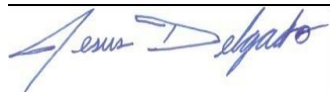

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **119**
MATERIAL DESCRIPTION: **Duct Sealant**
MATERIAL LOCATION: **Building B: 1st Floor - Auditorium, 130, 130A-C, 132, 132A-B, 133, 134, 134B, 134D, 135, 136, 136B, 137, 140, 140A-F, 144, 144A-B, 146, 146A, 148, and Office 1**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

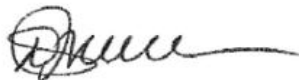

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Lunch Room**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile Mastic**
MATERIAL LOCATION: **3rd Floor Lunch Room**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Interior Window Glazing**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Interior Window Glazing**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **139**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **10th Floor Corridor, 1039, 1236, 1339, 1700, 1720, 500, & 522**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **139**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
MATERIAL LOCATION: **10th Floor Corridor, 1039, 1236, 1339, 1700, 1720, 500, & 522**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Interior Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Interior Brick**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Interior Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Interior Brick Mortar**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Terrazzo Flooring**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

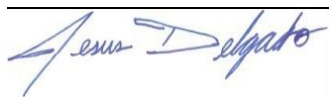

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Terrazzo Flooring**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Green Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Green Linoleum**

MATERIAL LOCATION: **3rd Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Clay Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd and 3rd Floor Kitchen, 3rd Floor Hall**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Clay Tile**

MATERIAL LOCATION: **2nd and 3rd Floor Kitchen, 3rd Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Clay Tile Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd and 3rd Floor Kitchen, 3rd Floor Hall**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Clay Tile Mortar**

MATERIAL LOCATION: **2nd and 3rd Floor Kitchen, 3rd Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile - ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Coach Love's Office, Weight Room and Driver's Ed (Now ROTC Classroom)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile - ABATED**

MATERIAL LOCATION: **Coach Love's Office, Weight Room and Driver's Ed (Now ROTC Classroom)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Black Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Black Baseboard**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **206**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Mastic - Installed in 1998**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

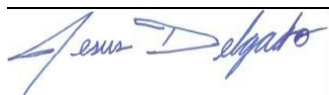

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **206**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Mastic - Installed in 1998**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013

Management Planner's Signature: _____

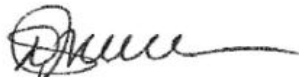

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Black Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Black Baseboard Mastic**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Blue Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Third Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Blue Baseboard**

MATERIAL LOCATION: **Third Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Blue Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Third Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Blue Baseboard Mastic**

MATERIAL LOCATION: **Third Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **White Wall Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchens and Washrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **White Wall Tile Grout**

MATERIAL LOCATION: **Kitchens and Washrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Gray Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Gray Carpet Mastic**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Linoleum**

MATERIAL LOCATION: **2nd Floor Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Cinder Block**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Cinder Block**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27 M**
MATERIAL DESCRIPTION: **Cinder Block Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **27 M**

MATERIAL DESCRIPTION: **Cinder Block Mortar**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Blue Carpet Mastic**

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Brown Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Washrooms and Locker Rooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Brown Ceramic Tile Grout**

MATERIAL LOCATION: **Washrooms and Locker Rooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Consumer Science and Music Complexes**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **3**

MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**

MATERIAL LOCATION: **Consumer Science and Music Complexes**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013

Management Planner's Signature: _____

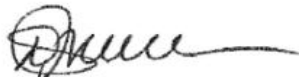

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Insulation Inside Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Insulation Inside Fire Doors**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Striped Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **Striped Carpet Mastic**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Brown and Green Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

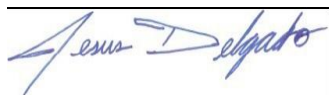

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Brown and Green Carpet Mastic**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

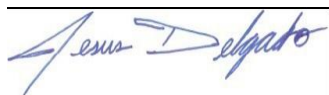

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Exterior Door Caulk - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Exterior Door Caulk - Not AHERA**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Exterior Window Caulk - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

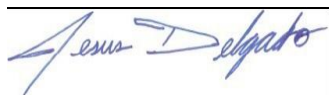

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **Exterior Window Caulk - Not AHERA**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:
DISTURBANCE POTENTIAL:
MATERIAL LOCATION: **Pool Basement**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:
COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Pool Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Tank Wrap**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Pool Basement**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

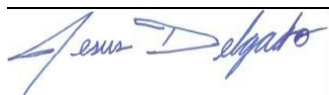

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Tank Wrap**

MATERIAL LOCATION: **Pool Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

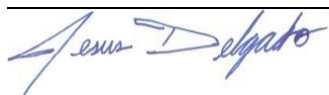

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Lunchroom**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

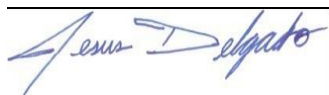

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile**
MATERIAL LOCATION: **3rd Floor Lunchroom**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

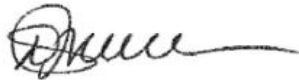

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Hard Joint Compound on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Hard Joint Compound on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Cover on Hard Joint Compound on Fiberglass Lag**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

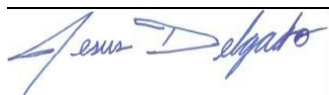

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Cover on Hard Joint Compound on Fiberglass Lag**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Hall by Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Duct Insulation**

MATERIAL LOCATION: **Hall by Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Pump Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Pump Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Roofing Material - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **210050**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **Roofing Material - Not AHERA**

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **210050**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 208, 210, 212, 213, 214, and 215**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

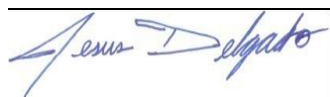

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
MATERIAL LOCATION: **Rooms 208, 210, 212, 213, 214, and 215**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____

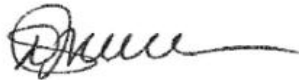

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Library and Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **Brown Carpet Mastic**

MATERIAL LOCATION: **Library and Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Lab Tops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 300, 305, and 310, 307, 313, and Commercial Arts**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Material not observed in Room 300 and 305**

Inspector's Signature:

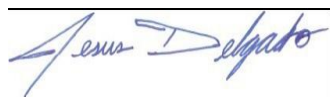

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Lab Tops**
MATERIAL LOCATION: **Rooms 300, 305, and 310, 307, 313, and Commercial Arts**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Blue Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Locker Rooms**
MATERIAL QUANTITY: **2350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **Blue Ceramic Tile Grout**

MATERIAL LOCATION: **Locker Rooms**

MATERIAL QUANTITY: **2350**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile and Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Classrooms and Hallways**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **5**

MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile and Mastic**

MATERIAL LOCATION: **Classrooms and Hallways**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Terrazzo Basins**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **2nd & 3rd Floor Slop Rooms and Boys Locker Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **Terrazzo Basins**

MATERIAL LOCATION: **2nd & 3rd Floor Slop Rooms and Boys Locker Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Lab Hood Transite**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 305 & 310**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Material not observed in room 305**

Inspector's Signature:

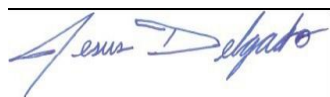

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Lab Hood Transite**
MATERIAL LOCATION: **Rooms 305 & 310**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Beige w/White Speckle Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Attendance Office and Room 312**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Material not observed in room 312 or attendance office**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Beige w/White Speckle Floor Tile**
MATERIAL LOCATION: **1st Floor Attendance Office and Room 312**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" Beige w/White Speckle Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Attendance Office and Room 312**

MATERIAL QUANTITY: **2200**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed in room 312 or attendance office**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" Beige w/White Speckle Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Attendance Office and Room 312**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" Tan with Brown Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Lunch Room**

MATERIAL QUANTITY: **2200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" Tan with Brown Streaks Floor Tile**
MATERIAL LOCATION: **2nd Floor Lunch Room**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" x 12" Tan with Brown Streak Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **2nd Floor Lunchroom**

MATERIAL QUANTITY: **2200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" x 12" Tan with Brown Streak Floor Tile Mastic**
MATERIAL LOCATION: **2nd Floor Lunchroom**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____

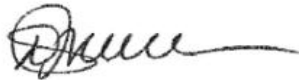

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **White & Red Ceramic Floor Tile and Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd & 3rd Floor Boys and Girls Bathroom**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **White & Red Ceramic Floor Tile and Grout**
MATERIAL LOCATION: **2nd & 3rd Floor Boys and Girls Bathroom**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **White & Red Ceramic Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd & 3rd Floor Boys and Girls Bathroom**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

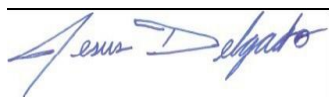

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **White & Red Ceramic Floor Tile Mastic**
MATERIAL LOCATION: **2nd & 3rd Floor Boys and Girls Bathroom**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Grey Ceramic Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Boys and Girls Bathrooms**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

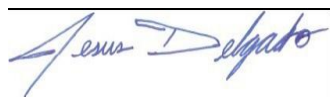

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Grey Ceramic Floor Tile**
MATERIAL LOCATION: **1st Floor Boys and Girls Bathrooms**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Grey Ceramic Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Boys and Girls Bathroom**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

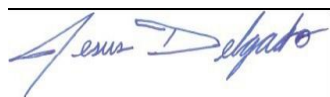

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Grey Ceramic Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Boys and Girls Bathroom**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Complex**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels**
MATERIAL LOCATION: **Throughout Complex**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Colored Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **First and Second Floor Hallways and Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Colored Specks Floor Tile**
MATERIAL LOCATION: **First and Second Floor Hallways and Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

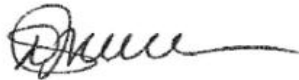

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Colored Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First and Second Floor Hallways and Classrooms**

MATERIAL QUANTITY: **12000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

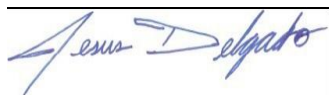

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12"x12" White w/Multi Colored Specks Floor Tile Mastic**
MATERIAL LOCATION: **First and Second Floor Hallways and Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

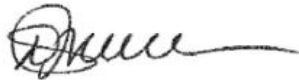

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Light Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Hallways and Classrooms**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Light Blue Floor Tile**
MATERIAL LOCATION: **First Floor Hallways and Classrooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Light Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Hallways and Classrooms**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **12"x12" Dark Blue w/Light Blue Floor Tile Mastic**
MATERIAL LOCATION: **First Floor Hallways and Classrooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12"x12" Yellow w/Light Yellow Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115**

MATERIAL QUANTITY: **3000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

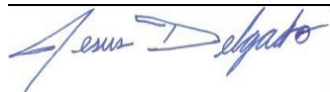

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12"x12" Yellow w/Light Yellow Floor Tile**
MATERIAL LOCATION: **Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" Yellow w/Light Yellow Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115**

MATERIAL QUANTITY: **3000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

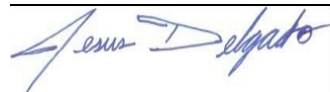

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" Yellow w/Light Yellow Floor Tile Mastic**
MATERIAL LOCATION: **Second Floor Hallways and Classrooms, Third Floor Classrooms, First Floor Rms - 112, 113, 114, 115**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

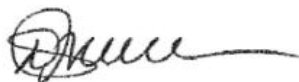

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12"x12" Beige w/Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Third Floor Hallway**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12"x12" Beige w/Tan Floor Tile**
MATERIAL LOCATION: **Third Floor Hallway**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12"x12" Beige w/Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Third Floor Hallway**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **12"x12" Beige w/Tan Floor Tile Mastic**

MATERIAL LOCATION: **Third Floor Hallway**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Third Floor Hallway**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

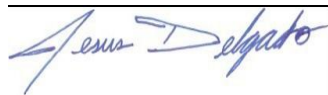

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile**
MATERIAL LOCATION: **Third Floor Hallway**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

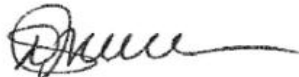

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Third Floor Hallway**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile Mastic**
MATERIAL LOCATION: **Third Floor Hallway**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

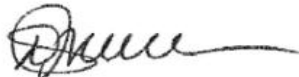

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **4' x 4' Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Complex**

MATERIAL QUANTITY: **2800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

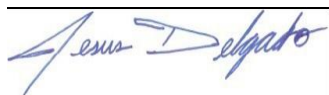

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **4' x 4' Ceiling Panels**
MATERIAL LOCATION: **Throughout Complex**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **12"x12" Grey w/Blue Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Third Floor Classrooms**

MATERIAL QUANTITY: **15000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **12"x12" Grey w/Blue Specks Floor Tile**
MATERIAL LOCATION: **Third Floor Classrooms**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

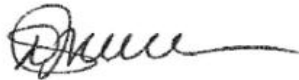

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12"x12" Grey w/Blue Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Third Floor Classrooms**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12"x12" Grey w/Blue Specks Floor Tile Mastic**
MATERIAL LOCATION: **Third Floor Classrooms**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

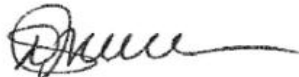

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Academic Building "A"**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Academic Building "A"**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Drywall Tape and Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Academic Building "A"**

MATERIAL QUANTITY: **60000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Drywall Tape and Joint Compound**
MATERIAL LOCATION: **Throughout Academic Building "A"**
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **Hard Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Complex**
MATERIAL QUANTITY: **100000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

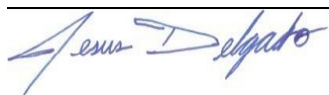

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **Hard Plaster**
MATERIAL LOCATION: **Throughout Complex**
MATERIAL QUANTITY: **100000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

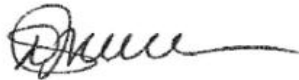

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12" x 12" White w/Reddish Brown Streaks FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Fine Arts Rooms and Basement**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **12" x 12" White w/Reddish Brown Streaks FT Mastic**

MATERIAL LOCATION: **Fine Arts Rooms and Basement**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-100**
MATERIAL DESCRIPTION: **12"x12" red pattern design VFT**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Detention room storage**

MATERIAL QUANTITY: **72**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **HA-100**
MATERIAL DESCRIPTION: **12"x12" red pattern design VFT**
MATERIAL LOCATION: **Detention room storage**
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-101**
MATERIAL DESCRIPTION: **Adhesive for 12"x12" red pattern design VFT**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Detention room storage**

MATERIAL QUANTITY: **72**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **HA-101**

MATERIAL DESCRIPTION: **Adhesive for 12"x12" red pattern design VFT**

MATERIAL LOCATION: **Detention room storage**

MATERIAL QUANTITY: **72**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material not observed 2013

Management Planner's Signature: _____

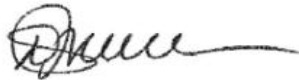

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-102**
MATERIAL DESCRIPTION: **Interior lining of the Kiln**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION:

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **HA-102**

MATERIAL DESCRIPTION: **Interior lining of the Kiln**

MATERIAL LOCATION:

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **215**
MATERIAL DESCRIPTION: **Yellow Vinyl Base Cove Mastic**
MATERIAL LOCATION: **Throughout 2nd and 3rd Floor Hallways**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

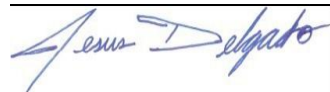

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **215**

MATERIAL DESCRIPTION: **Yellow Vinyl Base Cove Mastic**

MATERIAL LOCATION: **Throughout 2nd and 3rd Floor Hallways**

MATERIAL QUANTITY: **2750** MATERIAL UNITS: **LF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____



Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Drawings Region 3-Collins High School/Collins Main Bldg Second Floor.dwg

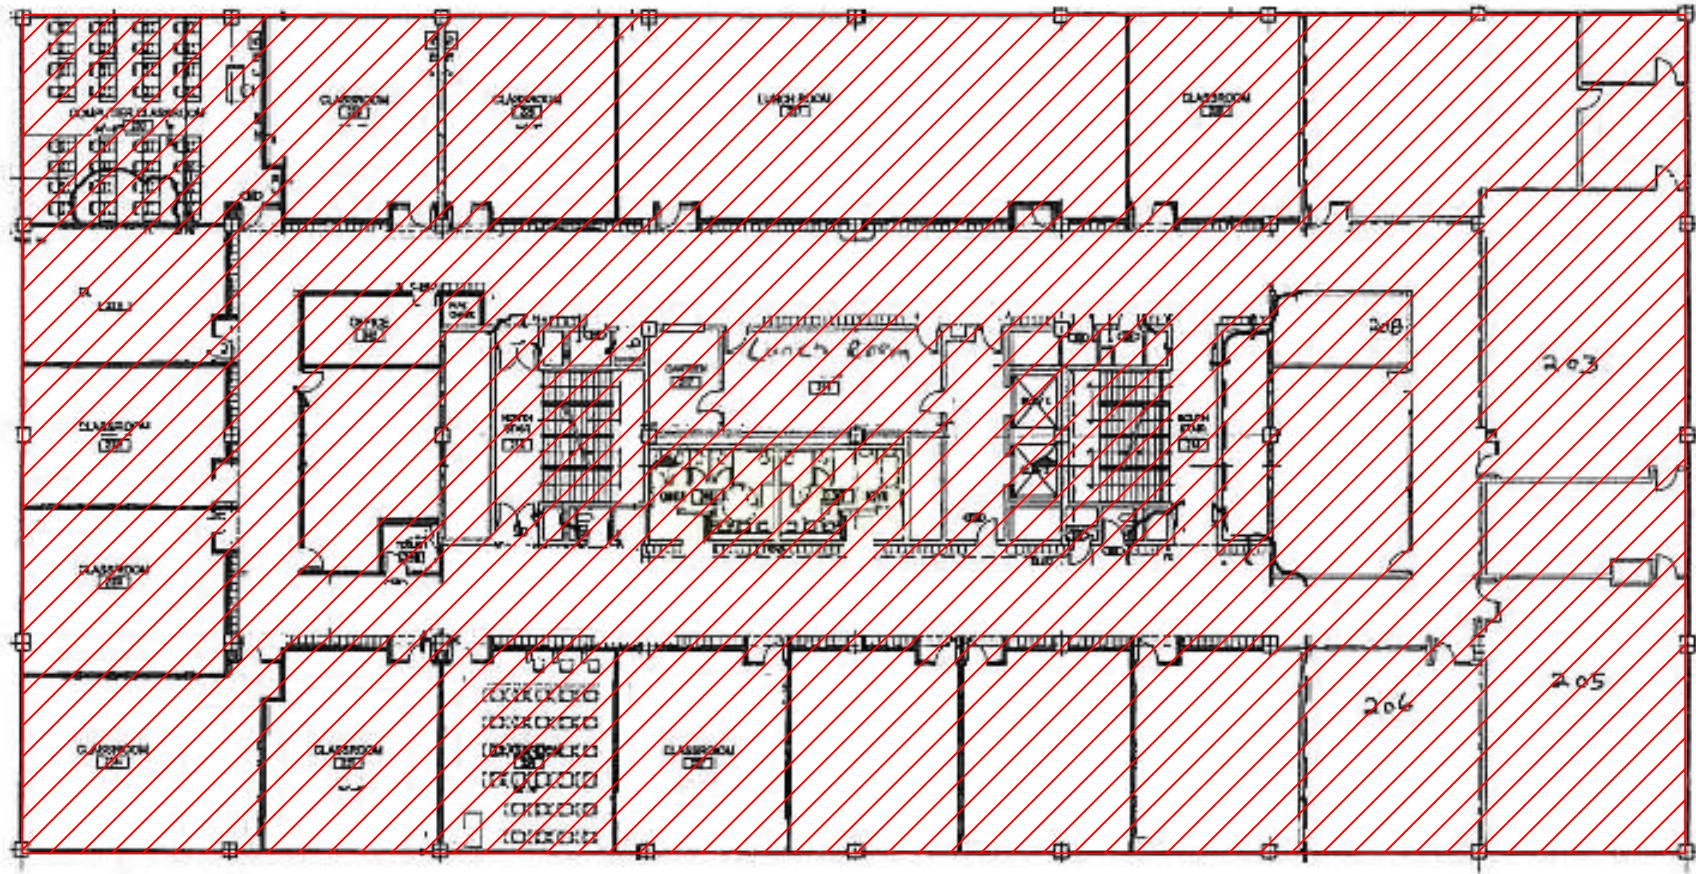

ASBESTOS REINSPECTION KEY NOTES:

HA-215 Mastic Associated with Yellow Vinyl Cove Base

Collins Main Bldg Second Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Second
Floor - HA-215
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |


IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com


**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-215


KCPSS 2011-2013 Three Year AHERA Drawings Region 3/Collins High School/Collins Main Bldg Third Floor.dwg

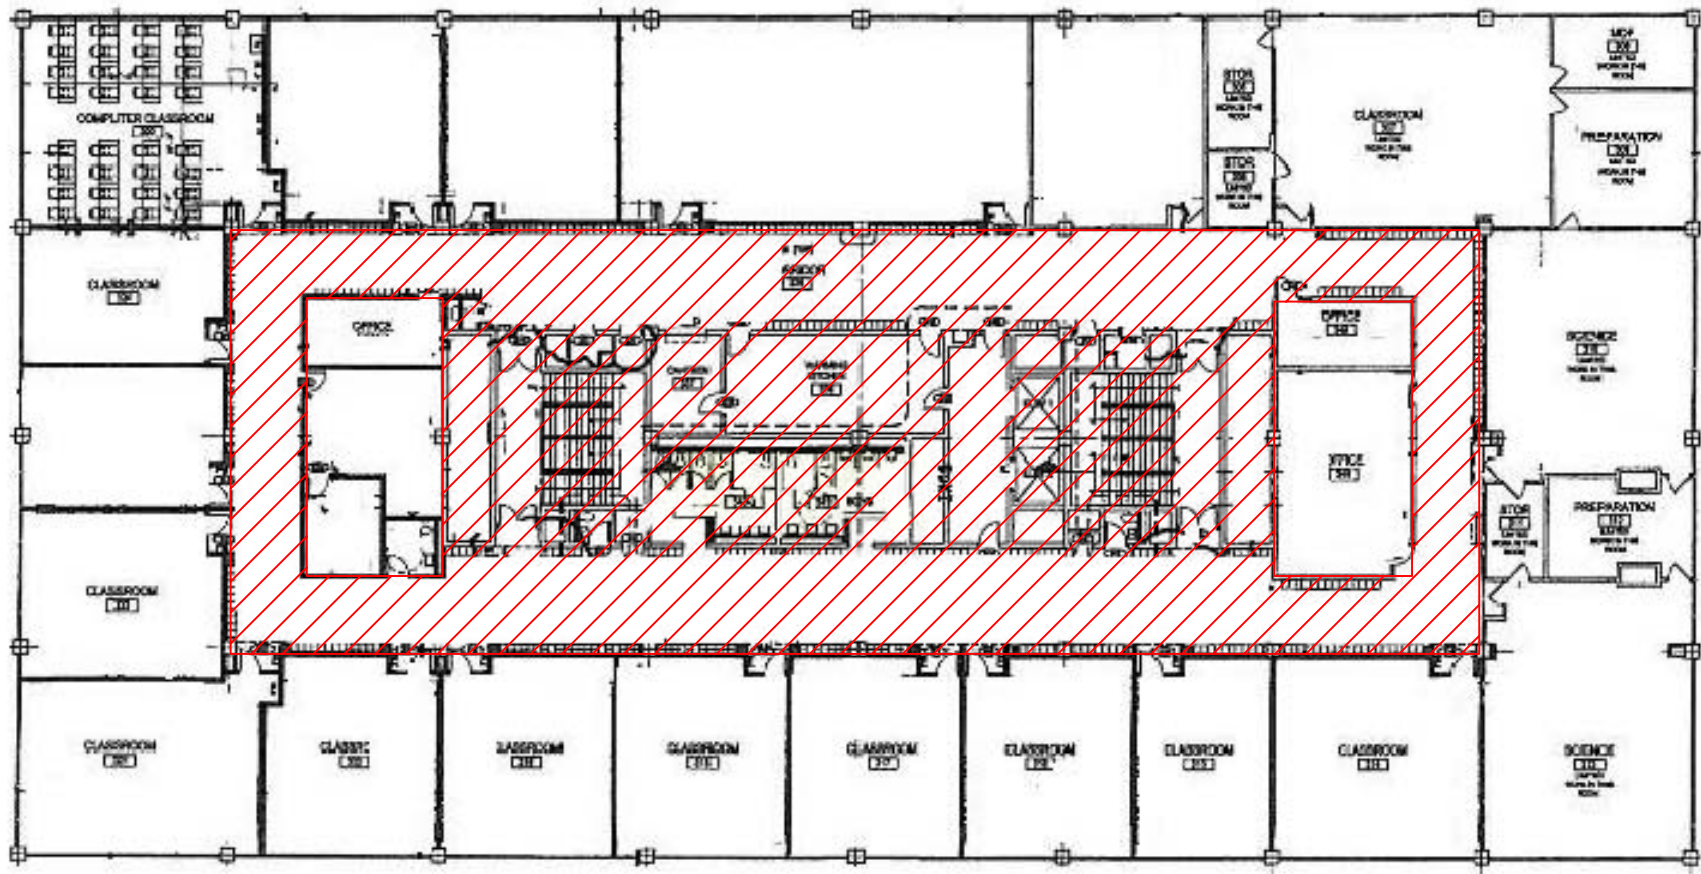

ASBESTOS REINSPECTION KEY NOTES:

 HA-215 Mastic Associated with Yellow Vinyl Cove Base

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-215
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-215

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **221**
MATERIAL DESCRIPTION: **2' X 2' Grey & Dark Grey Tile Carpet Adhesive**
MATERIAL LOCATION: **B-Building B140**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

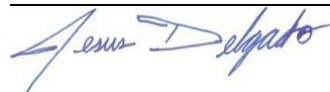

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **221**
MATERIAL DESCRIPTION: **2' X 2' Grey & Dark Grey Tile Carpet Adhesive**
MATERIAL LOCATION: **B-Building B140**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **03/24/2013**

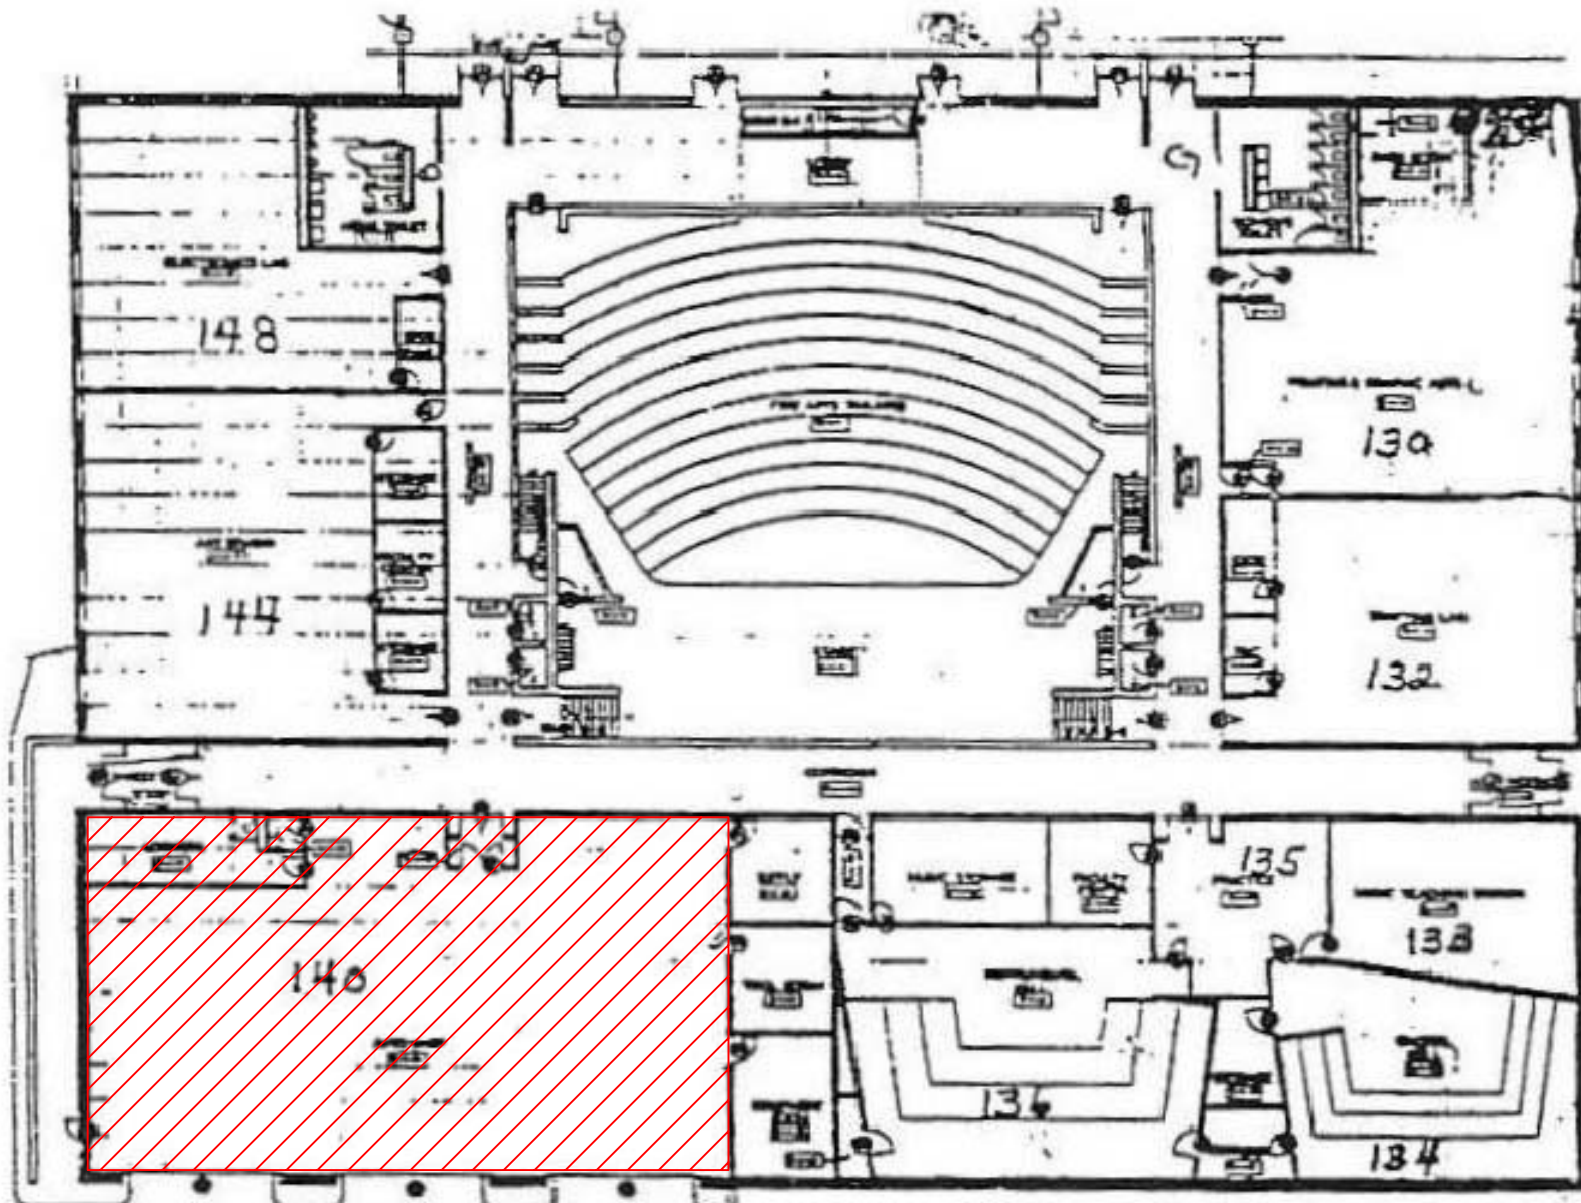

ASBESTOS REINSPECTION KEY NOTES:

 HA-221 Mastic Associated with Grey and Dark Grey Carpet

Collins Fine Arts Bldg
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Fine Arts Bldg -
HA-221

INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

CCA PROJECT NUMBER
A320130001-19

DATE
03/08/2013

SHEET NUMBER

**CARNOW
CONIBEAR** HA-221

K:\CPS 2011\2013 Three Year\AHERA\Region 3\C-Collins High School\Collins Fine Arts Building

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **222**
MATERIAL DESCRIPTION: **Tan Carpet Adhesive**
MATERIAL LOCATION: **B-Building Adhesive Auditorium**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **222**
MATERIAL DESCRIPTION: **Tan Carpet Adhesive**
MATERIAL LOCATION: **B-Building Adhesive Auditorium**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **03/24/2013**

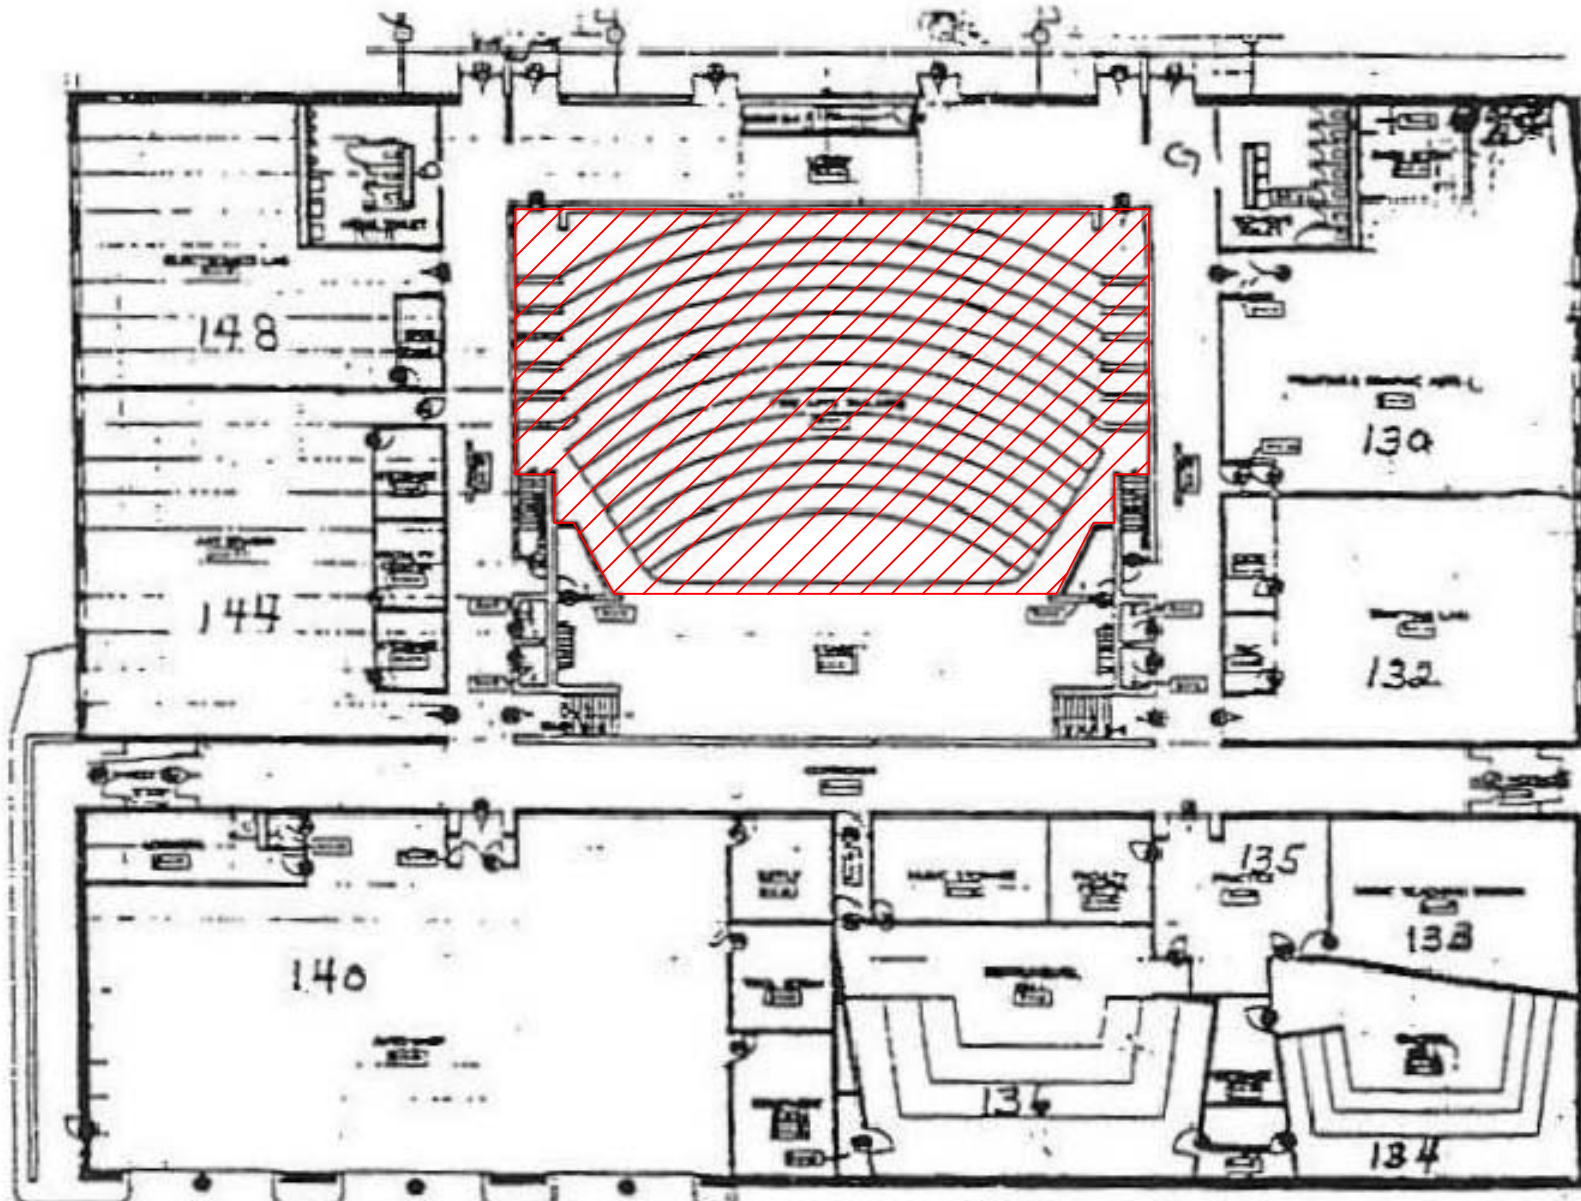


ASBESTOS REINSPECTION KEY NOTES:



HA-222 Mastic Associated with Tan Carpet

Collins Fine Arts Bldg
2013 Asbestos Reinspection



NOT TO SCALE

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Fine Arts Bldg -
HA-222

INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

CCA PROJECT NUMBER
A320130001-19

DATE
03/08/2013

SHEET NUMBER

**CARNOW
CONIBEAR** HA-222

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **208**
MATERIAL DESCRIPTION: **Beige W/White Streak Linoleum Mastic**
MATERIAL LOCATION: **Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

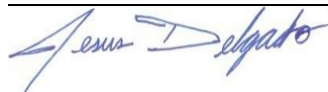

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **208**
MATERIAL DESCRIPTION: **Beige W/White Streak Linoleum Mastic**
MATERIAL LOCATION: **Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____




Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Drawings Region 3/Collins High School/Collins Main Bldg Third Floor.dwg

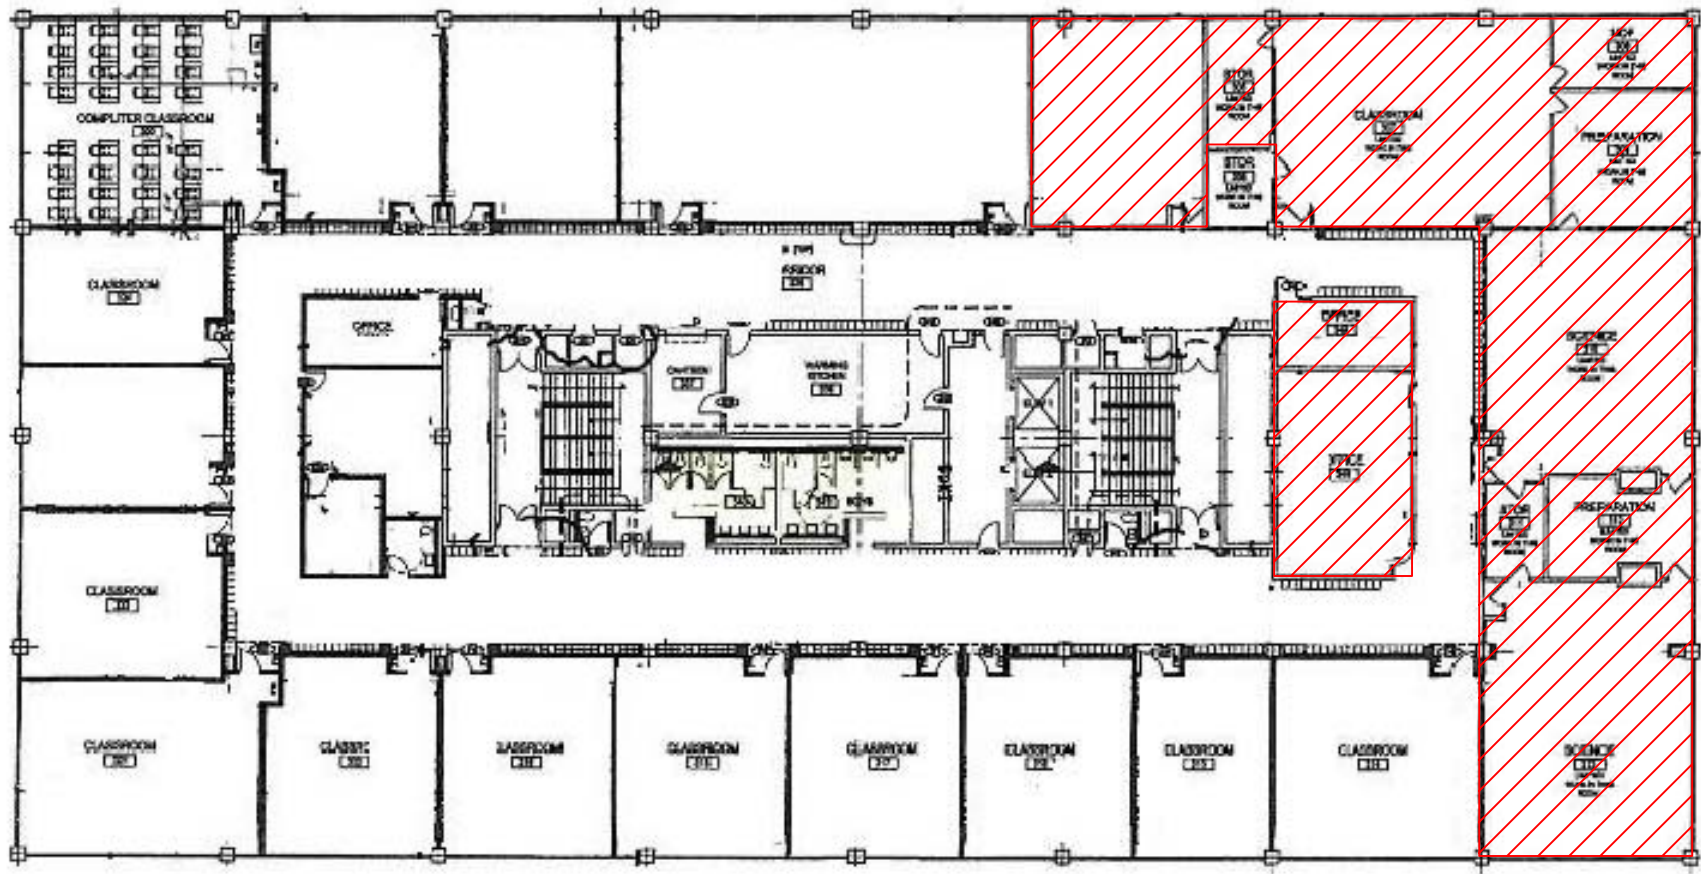

ASBESTOS REINSPECTION KEY NOTES:

 HA-208 Mastic Associated with Beige with White Streaks Linoleum

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-208
INSPECTED BY:
Jesus Delgado

| | | |
|---------------------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| IDPH License #:100- 11170 | | |

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER



Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **214**
MATERIAL DESCRIPTION: **Yellow Vinyl Base Cove**
MATERIAL LOCATION: **Throughout 2nd & 3rd Floor Hallway**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

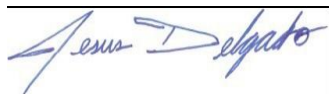

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **214**
MATERIAL DESCRIPTION: **Yellow Vinyl Base Cove**
MATERIAL LOCATION: **Throughout 2nd & 3rd Floor Hallway**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____



Date: **03/24/2013**


K:\CPS 2011\2013 Three Year\A\Collins Academy High School\Collins High Bldg Second Floor.dwg

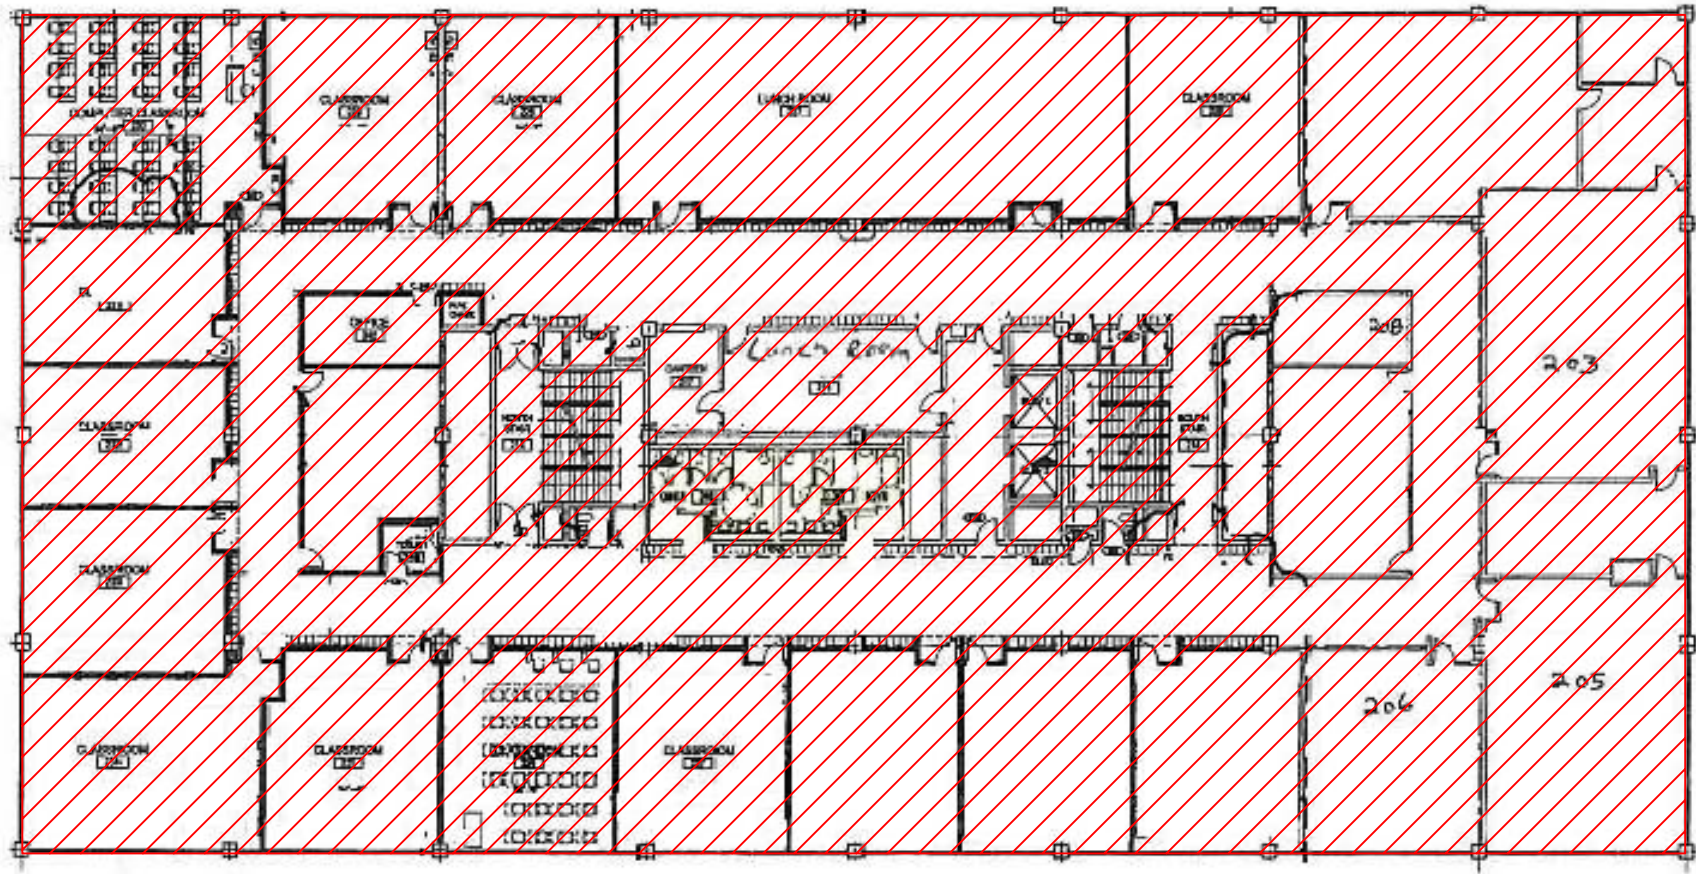

ASBESTOS REINSPECTION KEY NOTES:

 HA-214 Yellow Vinyl Cove Base

Collins Main Bldg Second Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Second
Floor - HA-214
INSPECTED BY:
Jesus Delgado


| | | |
|---------------------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| IDPH License #:100- 11170 | | |

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-214


KCPSS 2011-2013 Three Year AHERA Drawings Region 3-Collins High School/Collins Main Bldg Third Floor.dwg

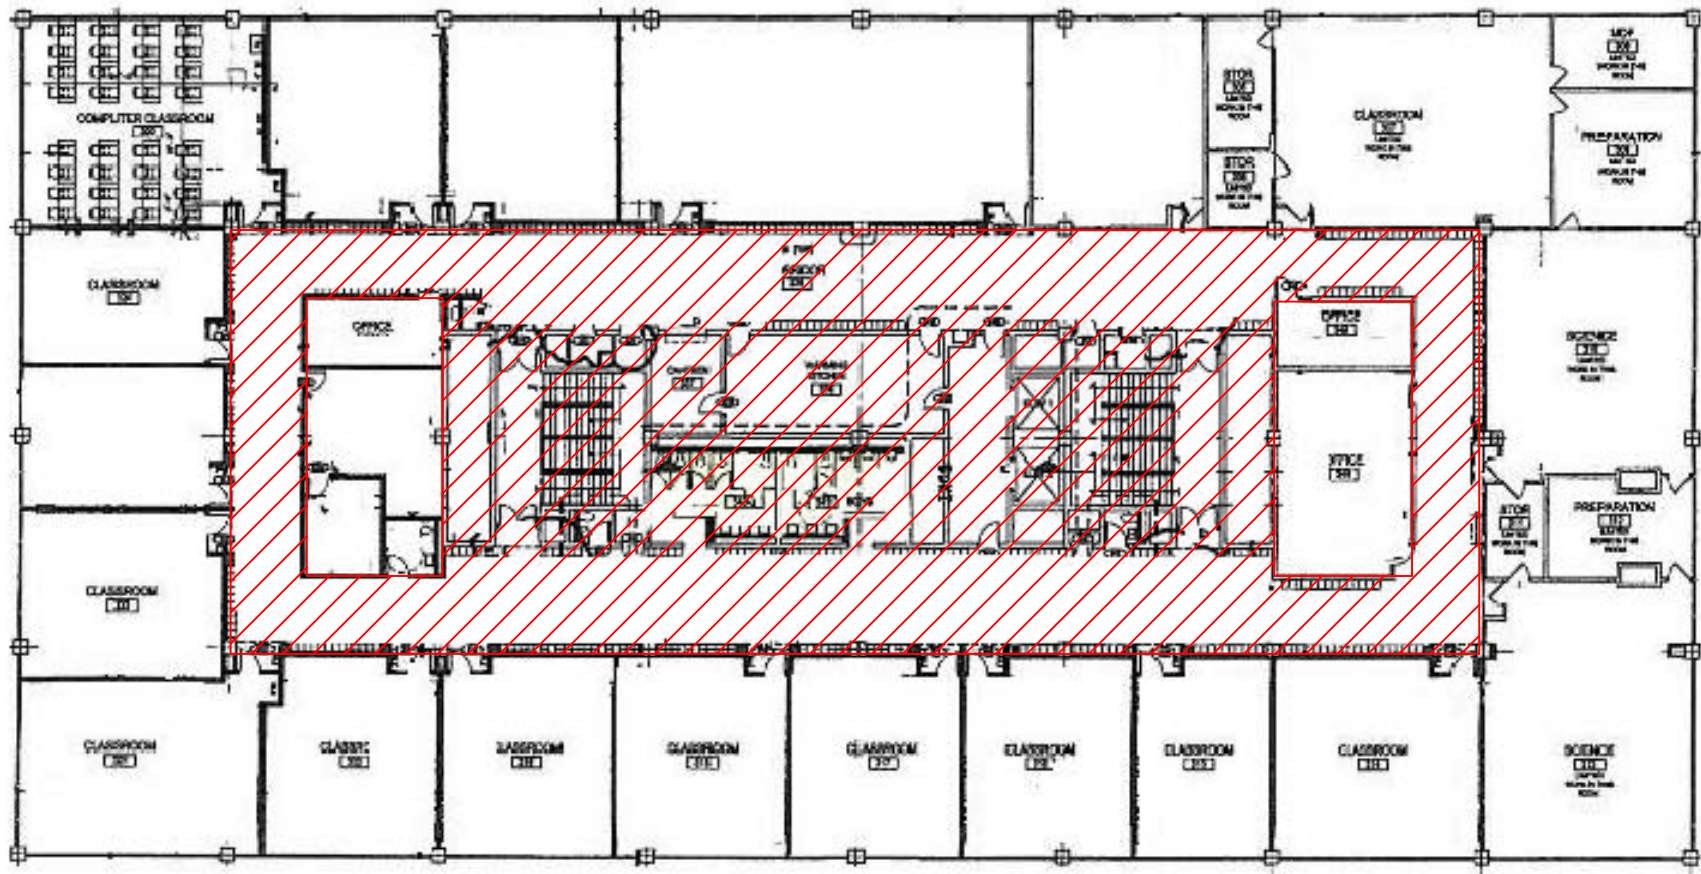

ASBESTOS REINSPECTION KEY NOTES:

HA-214 Yellow Vinyl Cove Base

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-214
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-214

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **207**
MATERIAL DESCRIPTION: **Beige W/White Streak Linoleum**
MATERIAL LOCATION: **Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

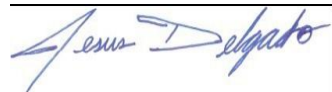

Date: 03/08/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **207**
MATERIAL DESCRIPTION: **Beige W/White Streak Linoleum**
MATERIAL LOCATION: **Rooms 304, 305, 307, 308, 309, 310, 312, 311, 313, 348, 348A**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature:  _____ Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Reinspection Region 3/Collins High School/Collins Main Bldg Third Floor.dwg

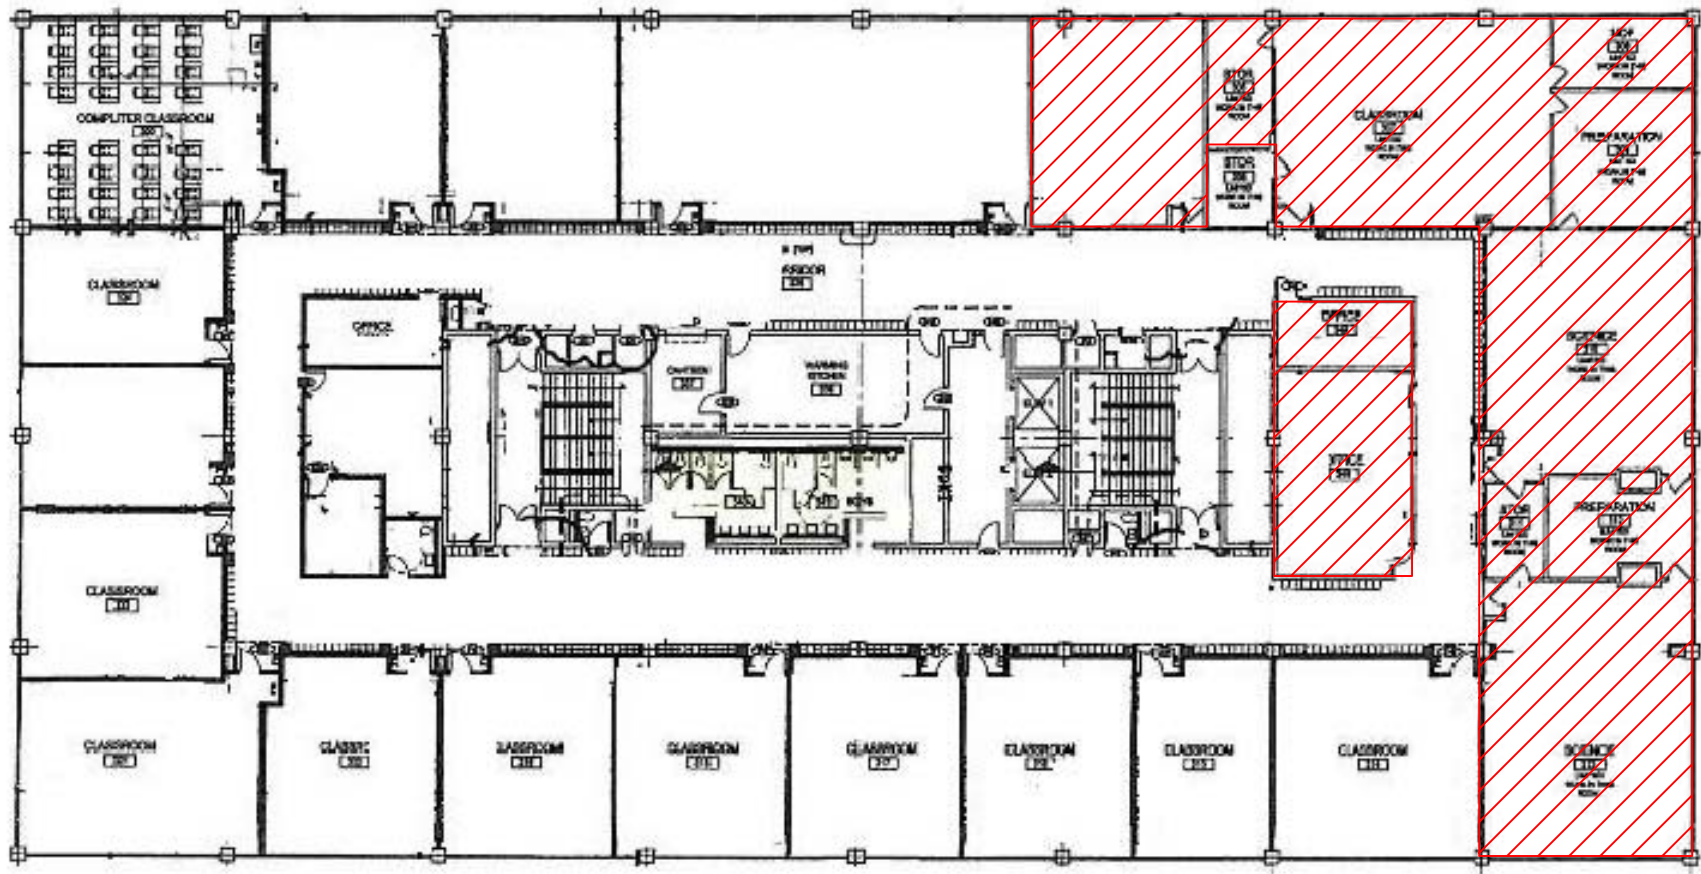

ASBESTOS REINSPECTION KEY NOTES:

 HA-207 Beige with White Streaks Linoleum

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-207

INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

INSPECTED BY:
Jesus Delgado

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatl.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-207

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **209**
MATERIAL DESCRIPTION: **Yellow Linoleum**
MATERIAL LOCATION: **Room 200, 200 b, 203, 205, 205A**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

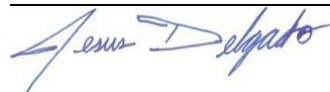

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **209**
MATERIAL DESCRIPTION: **Yellow Linoleum**
MATERIAL LOCATION: **Room 200, 200 b, 203, 205, 205A**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **03/24/2013**

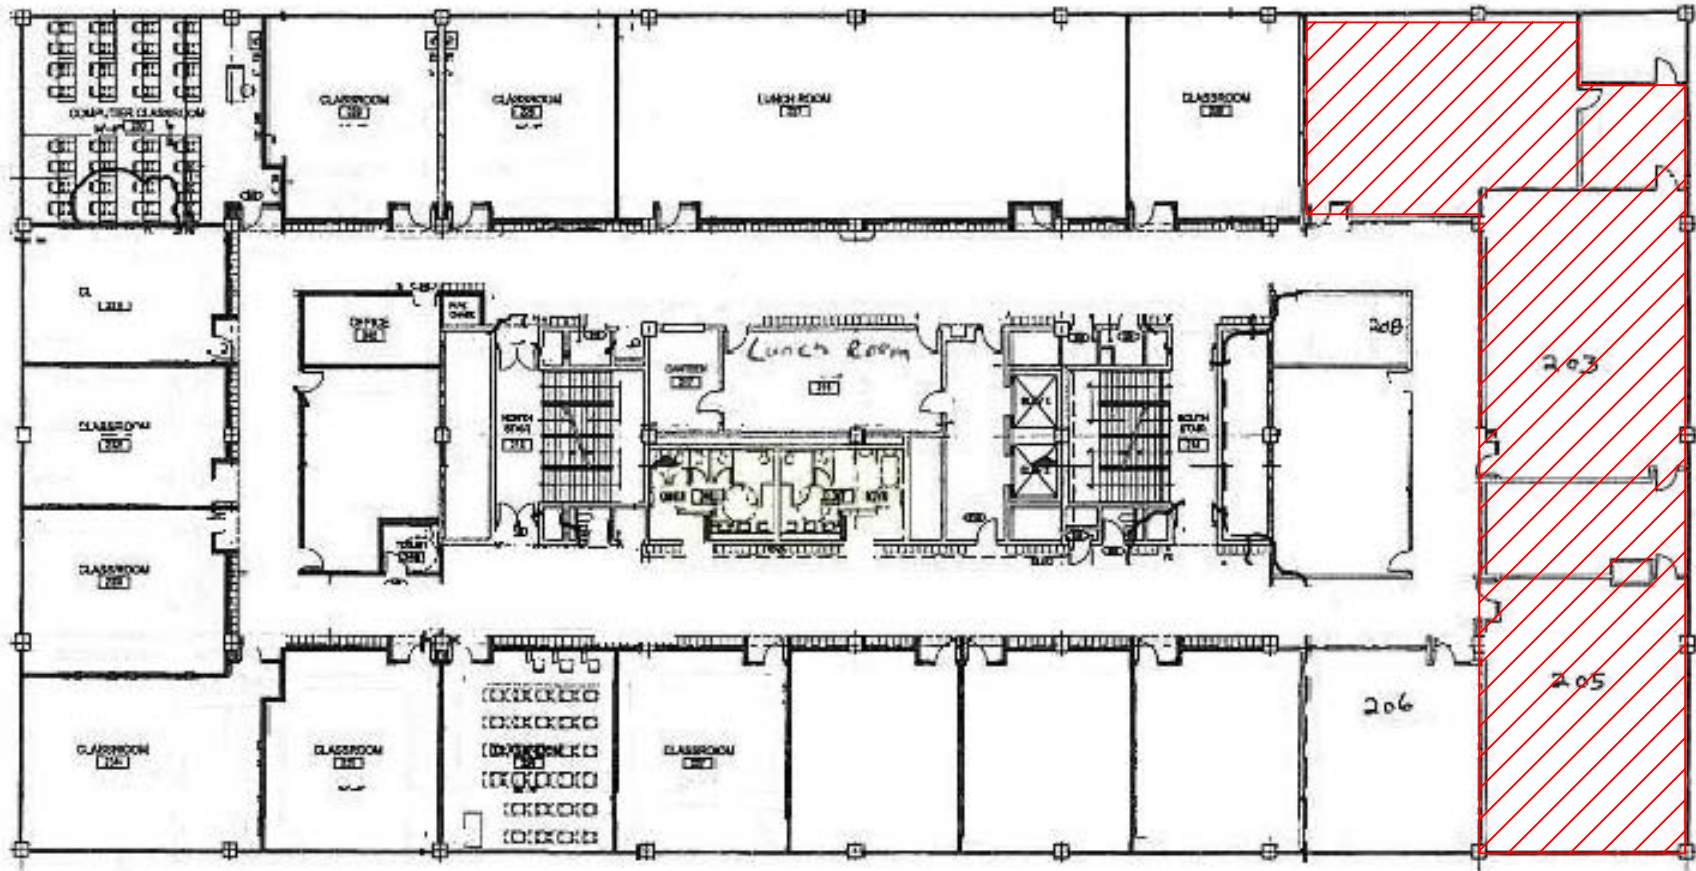

ASBESTOS REINSPECTION KEY NOTES:

 HA-209 Yellow Linoleum

Collins Main Bldg Second Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Second
Floor - HA-209

INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR** HA-209

CCA PROJECT NUMBER
A320130001-19

DATE
03/08/2013

SHEET NUMBER

K:\CPS 2011\2013 Three Year\AHERA Reinspection\Region 3\C\Collins High School\Collins Main Bldg Second Floor.dwg

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **213**
MATERIAL DESCRIPTION: **Red Vinyl Base Cove Mastic**
MATERIAL LOCATION: **Throughout 3rd Floor Classrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

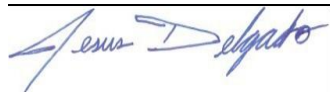

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **213**

MATERIAL DESCRIPTION: **Red Vinyl Base Cove Mastic**

MATERIAL LOCATION: **Throughout 3rd Floor Classrooms**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____




Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Reinspection Region 3-Collins High School/Collins Main Bldg Third Floor.dwg

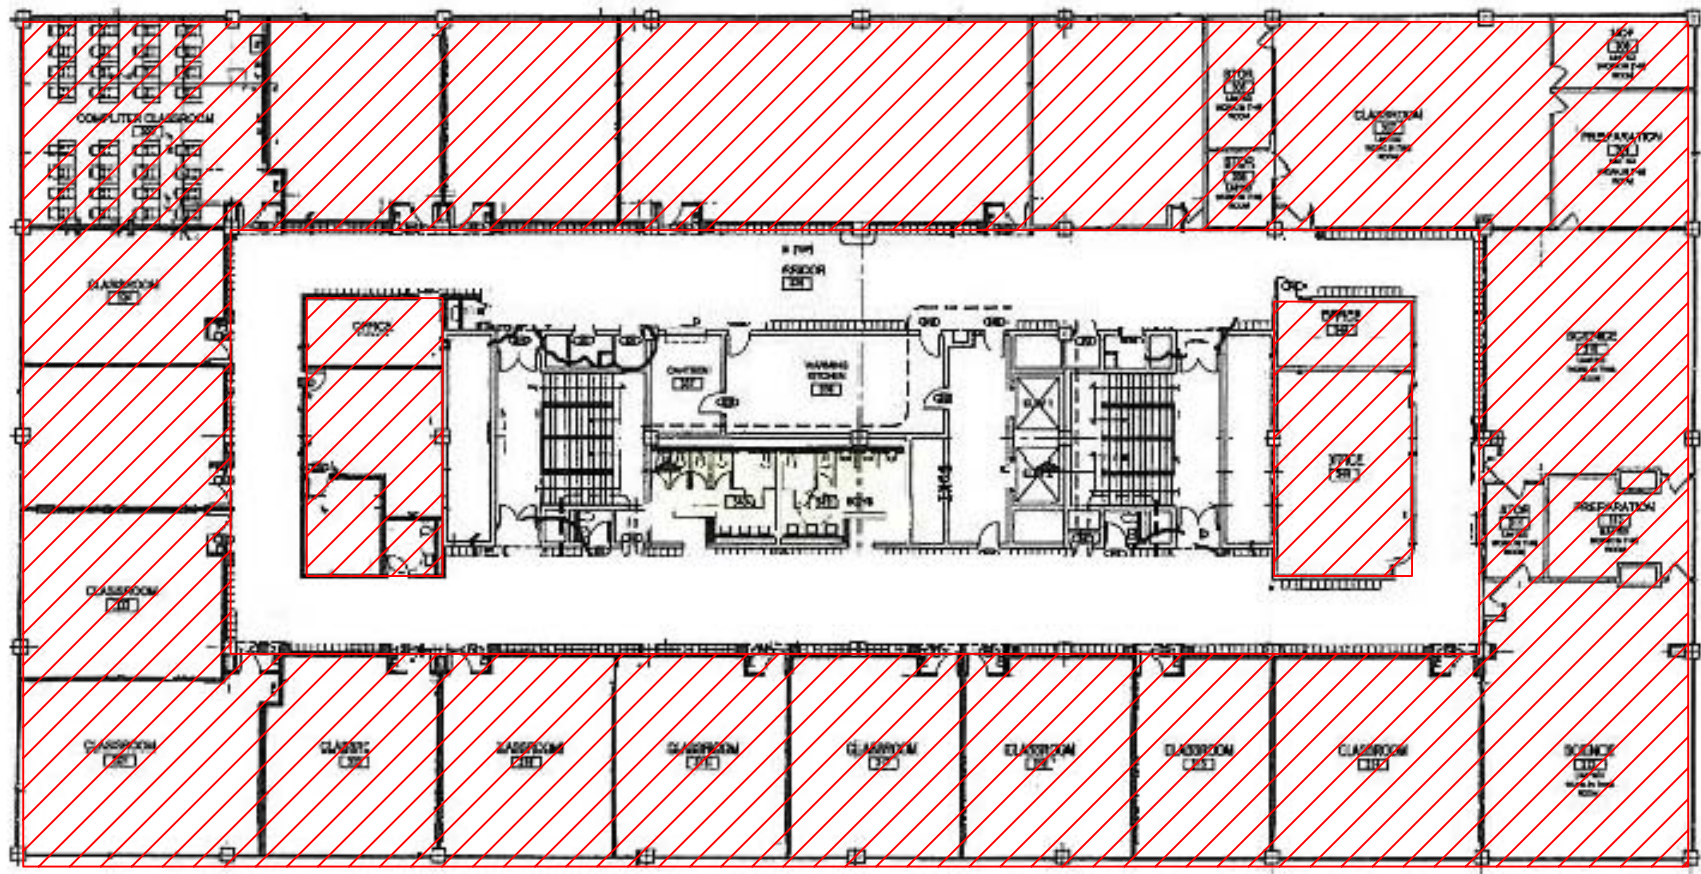

ASBESTOS REINSPECTION KEY NOTES:

 HA-213 Mastic Associated with Red Vinyl Cove Base

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-213
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

INSPECTED BY:
Jesus Delgado

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-213

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **210**
MATERIAL DESCRIPTION: **Yellow Linoleum Mastic**
MATERIAL LOCATION: **Room 200, 200 b, 203, 205, 205A**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

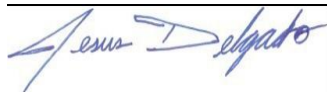

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **210**
MATERIAL DESCRIPTION: **Yellow Linoleum Mastic**
MATERIAL LOCATION: **Room 200, 200 b, 203, 205, 205A**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **03/24/2013**

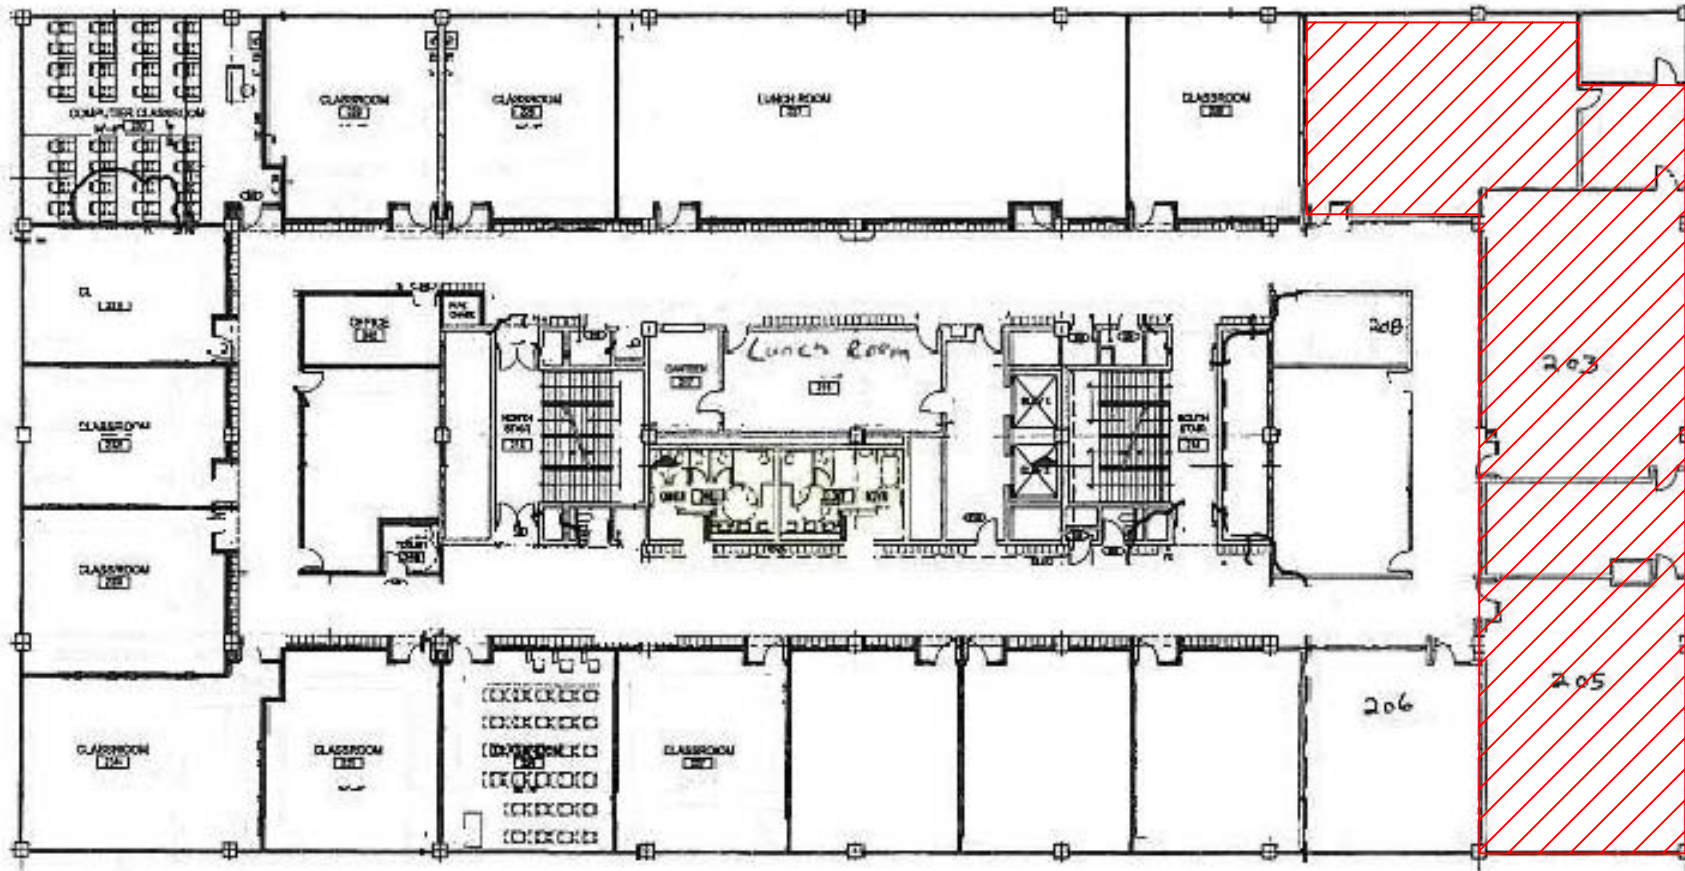

ASBESTOS REINSPECTION KEY NOTES:

 HA-210 Mastic Associated with Yellow Linoleum

Collins Main Bldg Second Floor
2013 Asbestos Reinspection



K:\CPS 2011\2013 Three Year\A\Collins High School\Collins High Bldg Second Floor.dwg

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Second
Floor - HA-210
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

INSPECTED BY:
Jesus Delgado

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-210

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **219**
MATERIAL DESCRIPTION: **Blue Vinyl Base Cove**
MATERIAL LOCATION: **Throughout 1st Floor A-Building**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

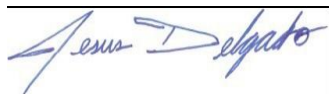

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **219**
MATERIAL DESCRIPTION: **Blue Vinyl Base Cove**
MATERIAL LOCATION: **Throughout 1st Floor A-Building**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____



Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Reinspection Region 3-Collins High School/Collins Main Bldg First Floor

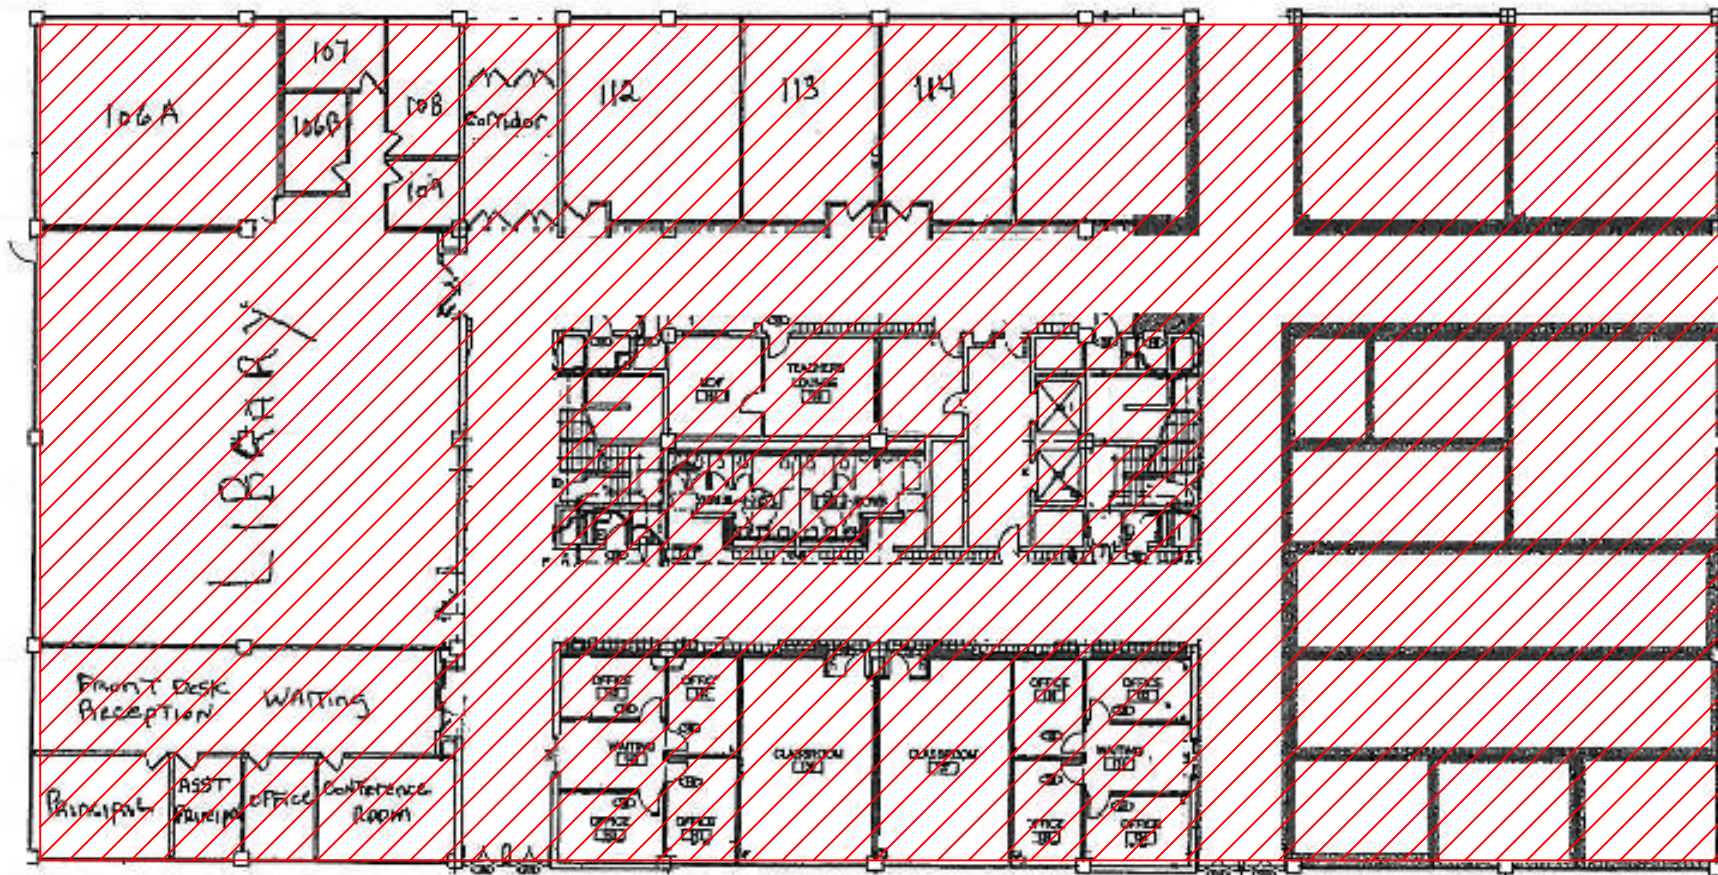

ASBESTOS REINSPECTION KEY NOTES:

HA-219 Blue Vinyl Cove Base

Collins Main Bldg First Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg First Floor -
HA-219
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-219

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **220**
MATERIAL DESCRIPTION: **Blue Vinyl Base Cove Mastic**
MATERIAL LOCATION: **Throughout 1st A-Building**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

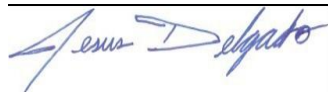

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **220**
MATERIAL DESCRIPTION: **Blue Vinyl Base Cove Mastic**
MATERIAL LOCATION: **Throughout 1st A-Building**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Reinspection Region 3-Collins High School/Collins Main Bldg First Floor

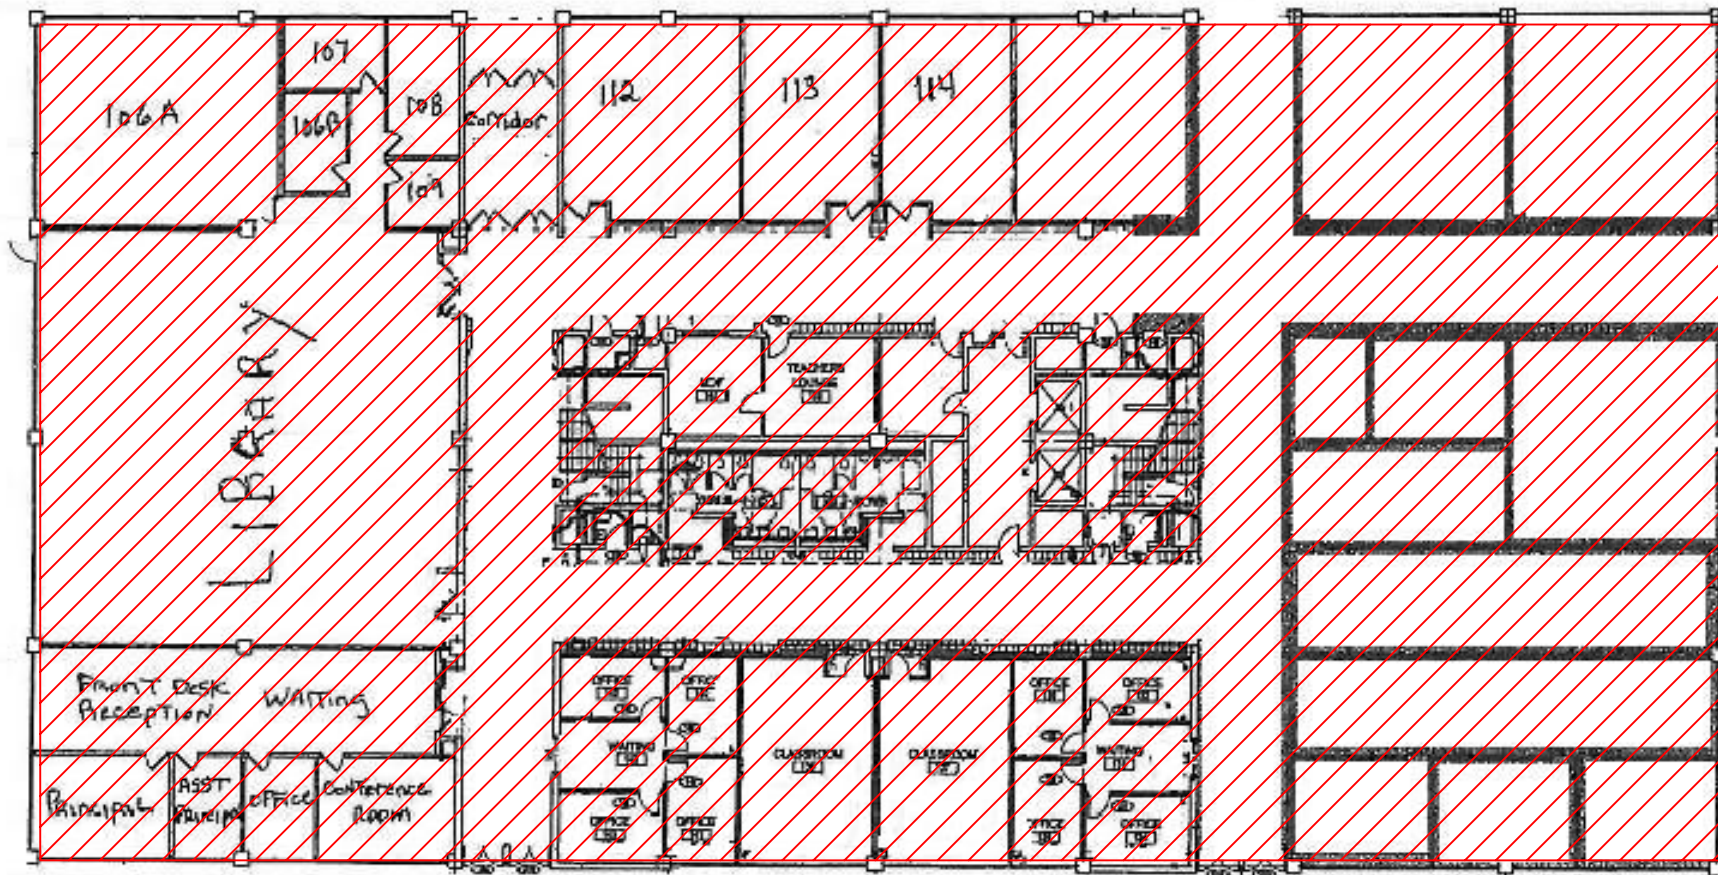

ASBESTOS REINSPECTION KEY NOTES:

HA-220 Mastic Associated with Blue Vinyl Cove Base

Collins Main Bldg First Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg First Floor -
HA-220
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-220

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **217**
MATERIAL DESCRIPTION: **Gray W/Blue & Yellow Specs. Carpet Adhesive**
MATERIAL LOCATION: **Room 140-142, 145, 120, 121, 126, 128-130**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

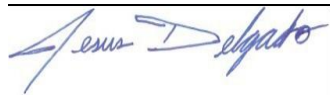

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **217**
MATERIAL DESCRIPTION: **Gray W/Blue & Yellow Specs. Carpet Adhesive**
MATERIAL LOCATION: **Room 140-142, 145, 120, 121, 126, 128-130**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Reinspection Region 3-Collins High School/Collins Main Bldg First Floor.dwg



ASBESTOS REINSPECTION KEY NOTES:

HA-217 Mastic Associated with Grey Carpet with Blue and Yellow Specs

Collins Main Bldg First Floor
2013 Asbestos Reinspection



NOT TO SCALE

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg First Floor -
HA-217
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-217

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **211**
MATERIAL DESCRIPTION: **Brown Carpet W/Grey Pattern Adhesive**
MATERIAL LOCATION: **Room 329**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

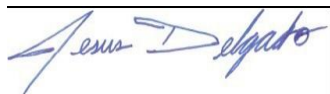

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **211**

MATERIAL DESCRIPTION: **Brown Carpet W/Grey Pattern Adhesive**

MATERIAL LOCATION: **Room 329**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____




Date: **03/24/2013**


MCPSS 2011-2013 Three Year AHERA Drawings Region 3/Collins High School/Collins Main Bldg Third Floor.dwg

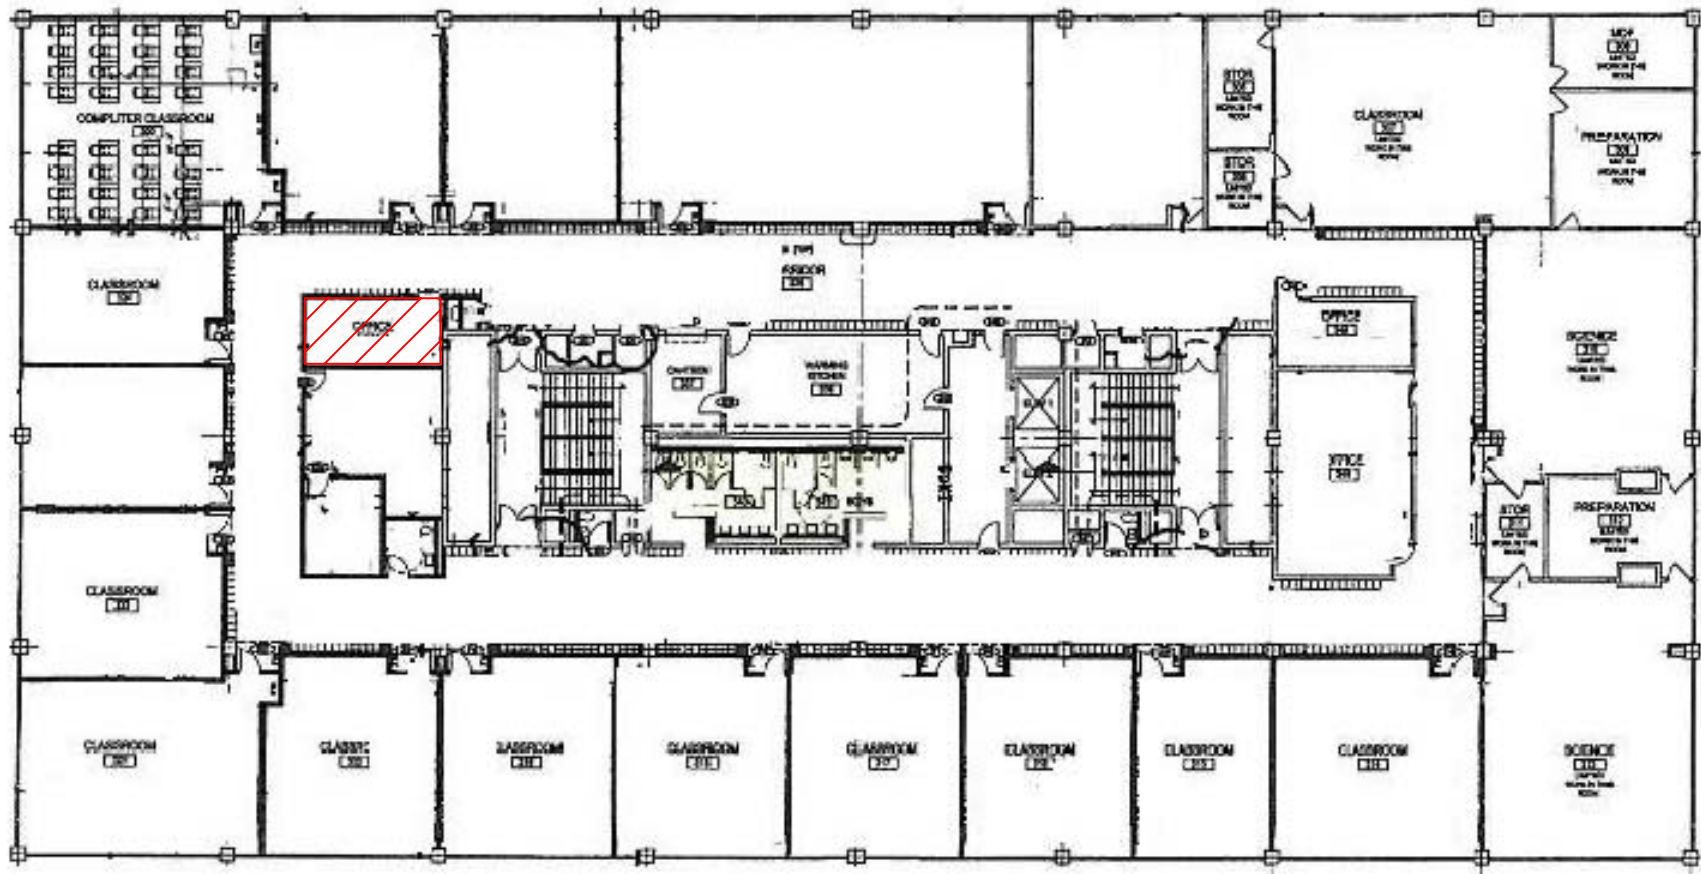

ASBESTOS REINSPECTION KEY NOTES:

 HA-211 Mastic Associated with Carpet with Brown and Grey pattern

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-211
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

INSPECTED BY:
Jesus Delgado

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-211

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **212**
MATERIAL DESCRIPTION: **Red Vinyl Base Cove**
MATERIAL LOCATION: **Throughout 3rd Floor Classrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **212**
MATERIAL DESCRIPTION: **Red Vinyl Base Cove**
MATERIAL LOCATION: **Throughout 3rd Floor Classrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____




Date: **03/24/2013**


K:\CPS 2011\2013 Three Year\A\Gad Drawings\Region 3\C-Collins High School\Collins Main Bldg Third Floor.dwg

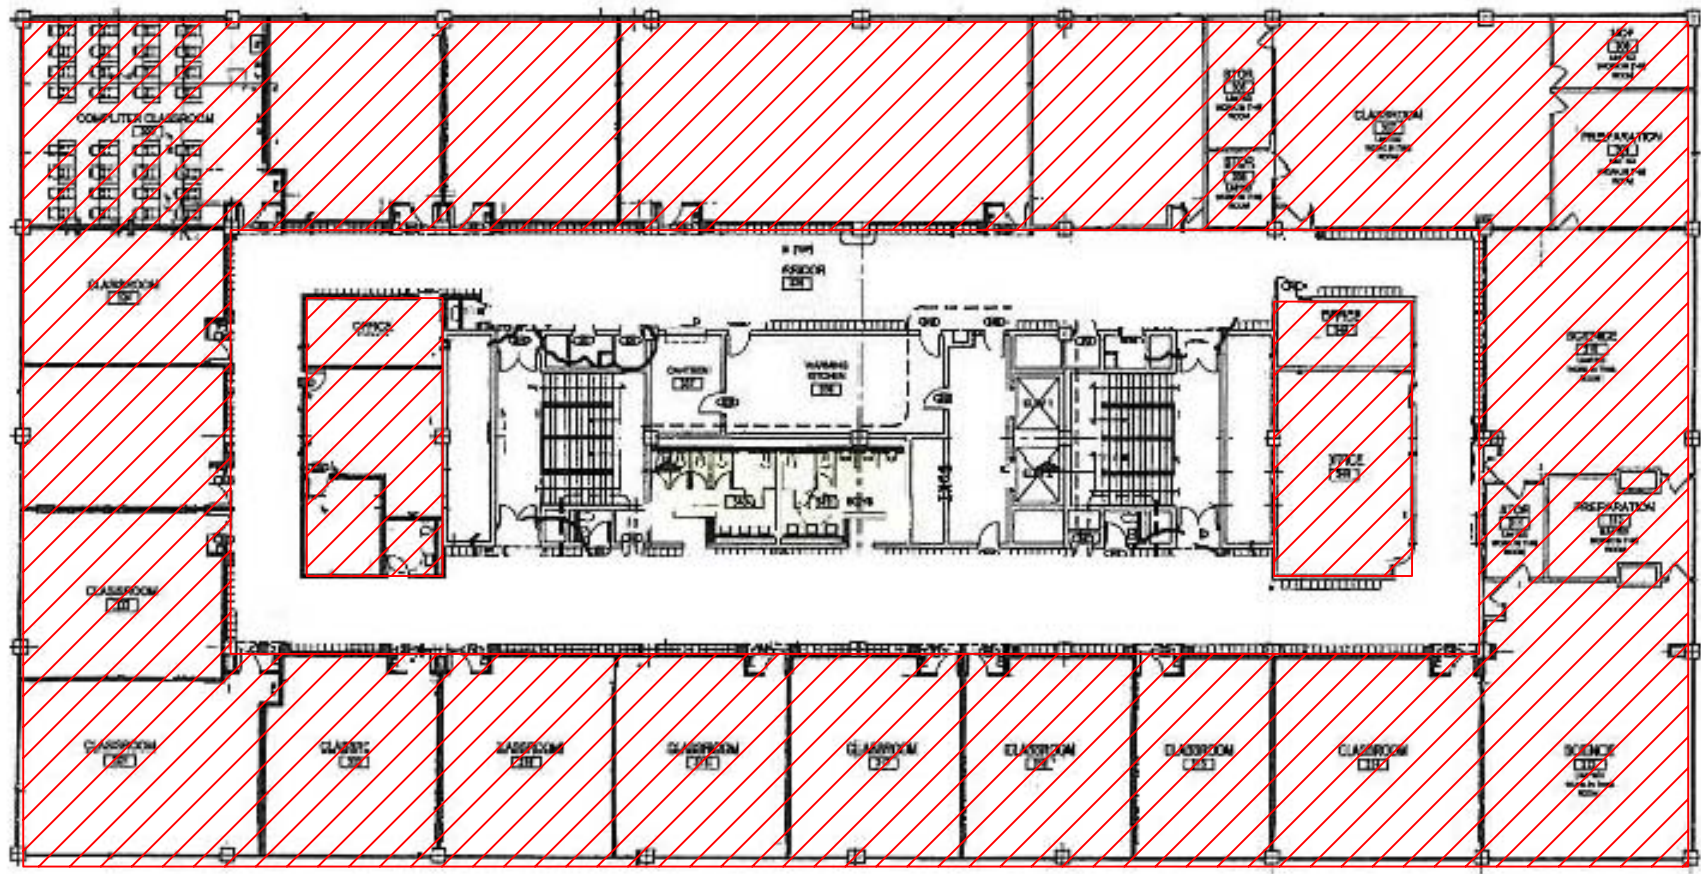

ASBESTOS REINSPECTION KEY NOTES:

 HA-212 Red Vinyl Cove Base

Collins Main Bldg Third Floor
2013 Asbestos Reinspection



NOT TO SCALE

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg Third Floor
- HA-212
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

INSPECTED BY:
Jesus Delgado

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-212

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **216**
MATERIAL DESCRIPTION: **Blue W/Gold Lines Carpet Adhesive**
MATERIAL LOCATION: **Library, and Library Offices 100 to 105**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

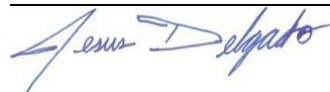

Date: **03/08/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **216**
MATERIAL DESCRIPTION: **Blue W/Gold Lines Carpet Adhesive**
MATERIAL LOCATION: **Library, and Library Offices 100 to 105**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature: _____



Date: **03/24/2013**


KCPSS 2011-2013 Three Year AHERA Reinspection Region 3/Collins High School/Collins Main Bldg First Floor.dwg

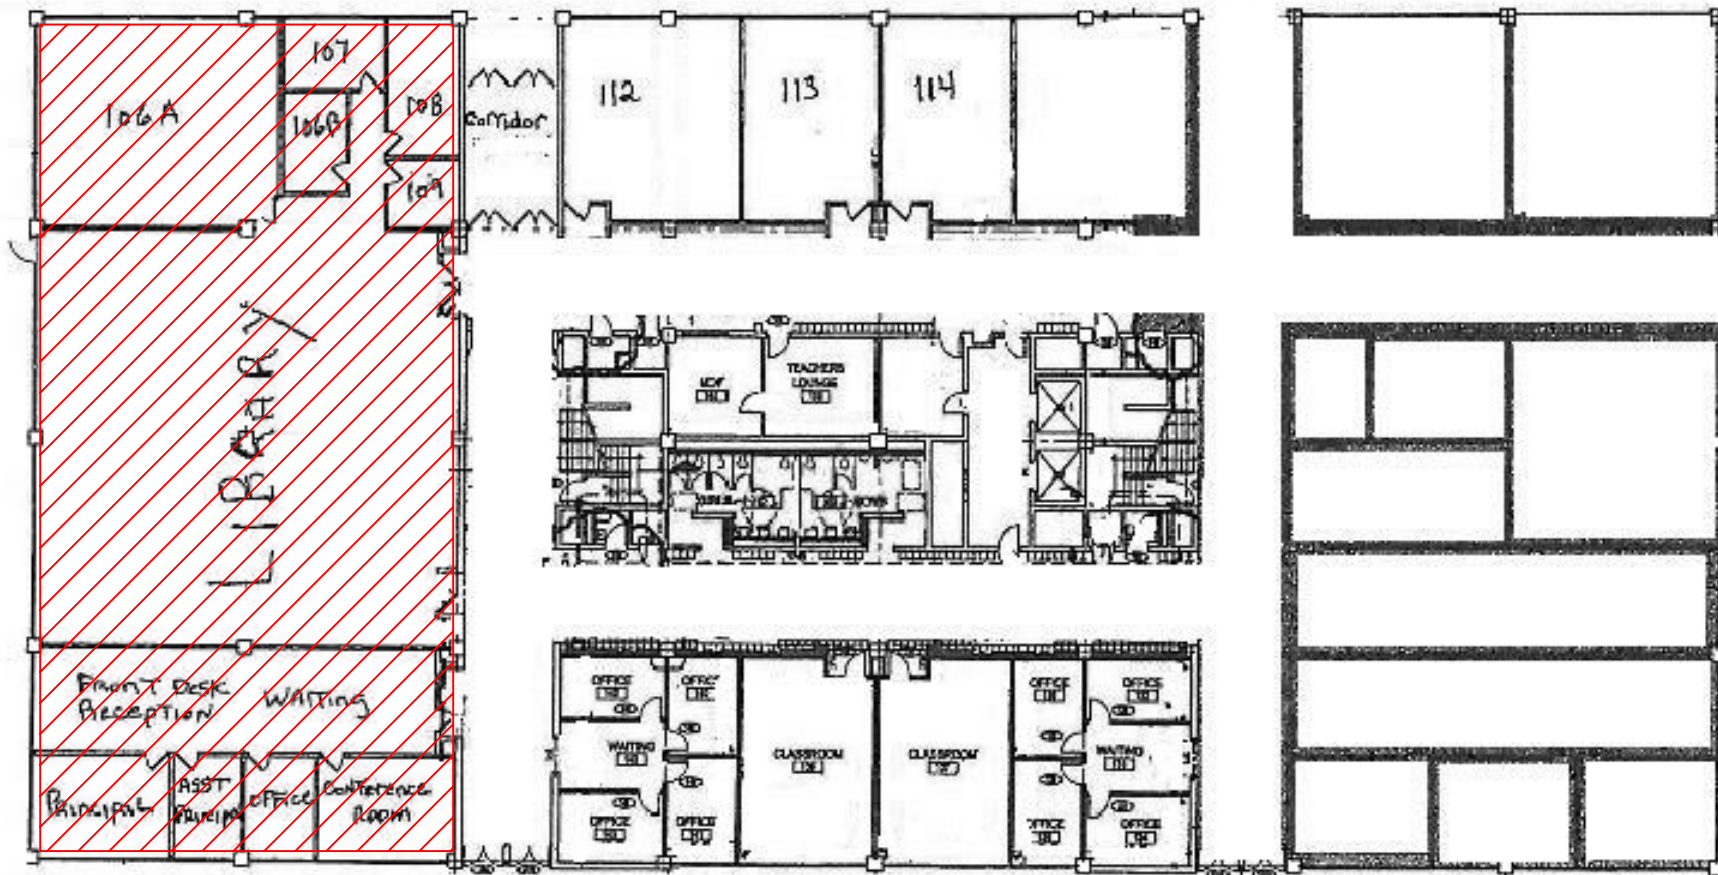

ASBESTOS REINSPECTION KEY NOTES:

HA-216 Mastic Associated with Blue Carpet with Gold Lines

Collins Main Bldg First Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg First Floor -
HA-216
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-216

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUIDLING ID: **1880**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Collins High School** INSPECTION DATE: **3/8/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **218**
MATERIAL DESCRIPTION: **Brown w/ Yellow & Green Specs Carpet Adhesive**
MATERIAL LOCATION: **132, 134-136**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

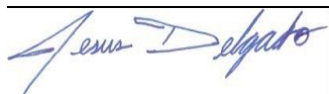

Date: 03/08/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46411** BUILDING ID: **1880**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Collins High School** REVIEW DATE: **3/24/2013**
ADDRESS: **1313 S. Sacramento** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **218**
MATERIAL DESCRIPTION: **Brown w/ Yellow & Green Specs Carpet Adhesive**
MATERIAL LOCATION: **132, 134-136**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **03/24/2013**


MCPSS 2011-2013 Three Year AHERA Reinspection Region 3-Collins High School/Collins High Bldg First Floor.dwg



ASBESTOS REINSPECTION KEY NOTES:

 HA-218 Mastic Associated with Brown Carpet with Yellow and Green Specks

Collins Main Bldg First Floor
2013 Asbestos Reinspection



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Collins Academy High School
1313 S Sacramento Dr
Chicago, IL 60623

SHEET NAME:
Collins Main Bldg First Floor -
HA-218
INSPECTED BY:
Jesus Delgado

| | | |
|---------------|-----------------|-------------|
| DRAWN BY: MJW | DATE: 3/27/2013 | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |
| REVISED BY: | DATE: | CHECKED BY: |

IDPH License #:100- 11170


Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-19
DATE
03/08/2013
SHEET NUMBER
HA-218

APPENDIX B

Inspector and Management Planner Licenses

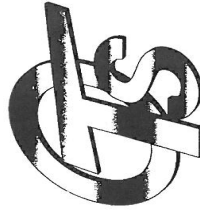

Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Jesus Delgado


has successfully completed the 4 hour Asbestos Building Inspector Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1301040034

Exam Date: 1/4/2013

Course Date: 1/4/2013

Expiration Date: 1/4/2014


Kathy DeSalvo, Director

2013



Pat Quinn, Governor

525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.state.il.us

2/7/2013

JESUS M DELGADO
5256 HARCOURT ST
OAK FOREST, IL 60452

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11170


Enclosed is your Asbestos Professional License that expires 05/15/2014


CERTIFICATE EXPIRATION DATE

INSPECTOR 1/4/2014

PROJECT MANAGER 11/2/2013
AIR SAMPLING PROFESSIONAL

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897. Our WEB address is <http://www.idph.state.il.us/envhealth/ehhome.htm>

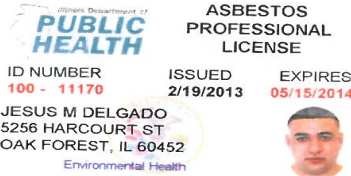

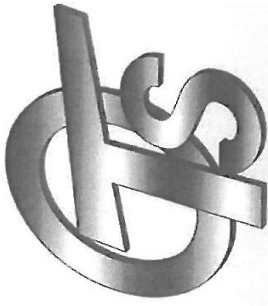

Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

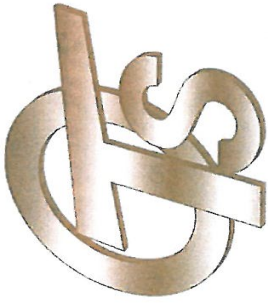

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013


Course Date: 2/25/2013

Expiration Date: 2/25/2014

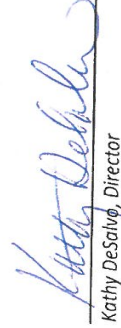

Kathy DeSalvo, Director

2013

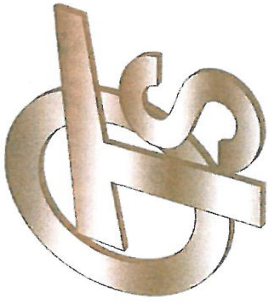

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

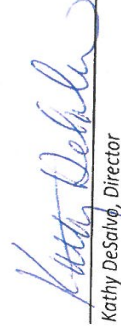

Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

| | CODE | KEY |
|--------------------------|-------------|--|
| MATERIAL | | |
| | ACBM | Asbestos Containing Building Materials |
| MATERIAL CATEGORY | | |
| | MISC | Miscellaneous |
| | SURF | Surfacing |
| | TSI | Thermal System Insulation |
| MATERIAL UNITS | | |
| | LF | Linear Feet |
| | SF | Square Feet |
| | CF | Cubic Feet |
| DAMAGE TYPE | | |
| | Loc | Localized |
| | Dist | Distributed |