

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-432XD
SCHOOL NAME: Chicago International Charter - Washington Park
ADDRESS OF SCHOOL: 6105 S. Michigan Ave.
CITY: Chicago, IL, 60637

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/9/2010**


If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/26/2013 ENROLLMENT 429
IDPH INSPECTOR LICENSE NUMBER: 100-02950
IDPH LICENSED INSPECTOR NAME (Please Print): Keith Clough
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113

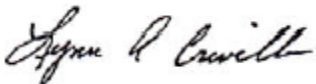

4/26/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Chicago International Charter - Washington Park

6105 S. Michigan Ave.
Chicago, IL, 60637

Unit: 66181
Building ID: 2290

IDPH ID Number: 14-016-2990-432XD

REPORT DATE:

Friday, April 26, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 27, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66181 Region: 02 IDPH ID: 14-016-2990-432XD

School: Chicago International Charter - Washington Park Building ID: 2290

Address: 6105 S. Michigan Ave.

Chicago, IL, 60637

Building Contact: Contact Phone:


Current Building Owners: Chicago Public Schools

Review Date: 4/26/2013

Inspector: Keith Clough Inspector IDPH License: 100-02950
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 27, 2013

RE: Chicago International Charter - Washington Park, Unit 66181
6105 S. Michigan Ave.
Chicago, IL, 60637

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Chicago International Charter - Washington Park , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Chicago International Charter - Washington Park, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Chicago International Charter - Washington Park Unit: 66181 Region: 02
Address: 6105 S. Michigan Ave. Chicago, IL, 60637
IDPH ID: 14-016-2990-432XD Building ID: 2290
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 429

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Keith Clough




Inspector IDPH license # 100-02950

Signature:
Date: 3/27/2013

6. Management Planner

Management Planner Name: Daniel Juneau

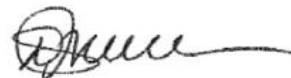

Management Planner IDPH license # 100-03613

Signature:
Date: 4/26/2013

7. Review Date: 4/26/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/26/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Chicago International Charter - Washington Park. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2290:

B. The following new homogenous areas have been identified for Building 2290:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

12A	9x9 white floor tile mastic
16	Grey and black Terrazzo flooring
17	12x12 grey ceramic pattern floor tile
18	Mastic for 12x12 gray ceramic pattern floor tile
19	12x12 lt blue with dark blue and white floor tile
2	9x9 brown with beige floor tile
20	Mastic for 12x12 lt blue floor tile with blue and white
21	Blue carpet adhesive
22	2' x 4' ceiling tile
A	12"x12" White w/Brown Specks Floor Tile
A-M	12"x12" White w/Brown Specks Floor Tile Adhesive
C	12"x 12" Light Brown with Dark Specks Floor Tile
C-M	12"x12" Lt Brn with Dark Specks Floor Tile Mastic
D	12"x 12" Lt. Brown w/Brown Specks Floor Tile
D-M	12"x 12" Lt. Brown w/Brn Specks Floor Tile Mastic
F	12"x 12" Pink Floor Tile
F-M	12"x 12" Pink Floor Tile Adhesive
G	1'x 1' Spline Ceiling Tile
H	Plaster Walls and Ceilings

The following areas were deemed to be inaccessible:

12A	9x9 white floor tile mastic
18	Mastic for 12x12 gray ceramic pattern floor tile
20	Mastic for 12x12 lt blue floor tile with blue and white
21	Blue carpet adhesive
22	2' x 4' ceiling tile
A-M	12"x12" White w/Brown Specks Floor Tile Adhesive
B-M	9"x 9" Brown w/Beige Specks Floor Tile Mastic
C-M	12"x12" Lt Brn with Dark Specks Floor Tile Mastic
D-M	12"x 12" Lt. Brown w/Brn Specks Floor Tile Mastic
F-M	12"x 12" Pink Floor Tile Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Keith Clough, IDPH License # 100-02950. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Chicago International Charter - Washington Park Building 2290 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Chicago International Charter - Washington Park Unit 66181 Building ID 2290

Address 6105 S. Michigan Ave. Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	12x12 brown w/beige			Basement		MISC	N	None						
12A	9x9 white floor tile mastic	920	SF	1st floor art room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Grey and black Terrazzo flooring	6,000	SF	Basement North Building	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12x12 grey ceramic pattern floor tile	300	SF	Nurse's office north building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	Mastic for 12x12 gray ceramic pattern floor tile	300	SF	Nurse's office North building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12x12 lt blue with dark blue and white floor tile	1,200	SF	Rooms 204 and 205 North building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
2	9x9 brown with beige floor tile	8,600	SF	Hallway, Classrooms 100, 101, 102	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
20	Mastic for 12x12 lt blue floor tile with blue and white	1,200	SF	Rooms 204 and 205 North Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Blue carpet adhesive	2,200	SF	1st and 2nd floor office, 206, and 207	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	2' x 4' ceiling tile	4,000	SF	2nd floor Classrooms and offices	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	12"x12" White w/Brown Specks Floor Tile	6,000	SF	First Floor Lunch Room south building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A-M	12"x12" White w/Brown Specks Floor Tile Adhesive	6,000	SF	First Floor Lunchroom south building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B	9"x 9" Brown w/Beige Specks Floor Tile	12,000	SF	First Floor Corridor, Rooms 100, 101, 102	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B-M	9"x 9" Brown w/Beige Specks Floor Tile Mastic	12,000	SF	First Floor Corridor, Rooms 100, 101, 102	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C	12"x 12" Light Brown with Dark Specks Floor Tile	400	SF	Basement Church Offices South Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C-M	12"x12" Lt Brn with Dark Specks Floor Tile Mastic	400	SF	Basement Church Offices South Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
D	12"x 12" Lt. Brown w/Brown Specks Floor Tile	3,000	SF	Basement Church Offices and hall of south building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
D-M	12"x 12" Lt. Brown w/Brn Specks Floor Tile Mastic	1,500	SF	Basement Church Offices and hall of south building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Chicago International Charter - Washington Park Unit 66181 Building ID 2290
 Address 6105 S. Michigan Ave. Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
E-1	Linear Pipe Insulation	450	LF	Basement and Boiler Room	CHR	TSI	Y	DIST	40		No	Damaged or significantly damaged friable thermal system insulating ACBM		MODERATE
E-2	Cementitious Pipe Joint Insulation	45	LF	Basement/Boiler Room	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	12"x 12" Pink Floor Tile	14,000	SF	Classrooms and Hallways in Church Area south building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F-M	12"x 12" Pink Floor Tile Adhesive	14,000	SF	Classrooms and Hallways in Church Area south building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	1'x 1' Spline Ceiling Tile	14,000	SF	First Floor	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
H	Plaster Walls and Ceilings	40,000	SF	First Floor and Basement	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Chicago International Charter - Washington Park Unit 66181 Building ID 2290
Address 6105 S. Michigan Ave. Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/27/2013
Inspector Name Keith Clough
100-02950 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	Not Observed, has been removed.
12A	
16	
17	
18	
19	
2	
20	
21	
22	
A	
A-M	
B	
B-M	
C	
C-M	
D	
D-M	
E-1	
E-2	
F	
F-M	
G	
H	

Chicago Public Schools

School Chicago International Charter - Washington Park **Unit** 66181 **Building ID** 2290

Address 6105 S. Michigan Ave. **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Chicago International
Charter - Washington Park

Unit 66181

Building ID 2290

Address 6105 S. Michigan Ave.

Chicago, IL, 60637

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	12x12 brown w/beige			Basement		MISC	No				
12A	9x9 white floor tile mastic	920	SF	1st floor art room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	Grey and black Terrazzo flooring	6,000	SF	Basement North Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
17	12x12 grey ceramic pattern floor tile	300	SF	Nurse's office north building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
18	Mastic for 12x12 gray ceramic pattern floor tile	300	SF	Nurse's office North building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
19	12x12 lt blue with dark blue and white floor tile	1,200	SF	Rooms 204 and 205 North building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
2	9x9 brown with beige floor tile	8,600	SF	Hallway, Classrooms 100, 101, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
20	Mastic for 12x12 lt blue floor tile with blue and white	1,200	SF	Rooms 204 and 205 North Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
21	Blue carpet adhesive	2,200	SF	1st and 2nd floor office, 206, and 207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
22	2' x 4' ceiling tile	4,000	SF	2nd floor Classrooms and offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
A	12"x12" White w/Brown Specks Floor Tile	6,000	SF	First Floor Lunch Room south building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
A-M	12"x12" White w/Brown Specks Floor Tile Adhesive	6,000	SF	First Floor Lunchroom south building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
B	9"x 9" Brown w/Beige Specks Floor Tile	12,000	SF	First Floor Corridor, Rooms 100, 101, 102	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
B-M	9"x 9" Brown w/Beige Specks Floor Tile Mastic	12,000	SF	First Floor Corridor, Rooms 100, 101, 102	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
C	12"x 12" Light Brown with Dark Specks Floor Tile	400	SF	Basement Church Offices South Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
C-M	12"x12" Lt Brn with Dark Specks Floor Tile Mastic	400	SF	Basement Church Offices South Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
D	12"x 12" Lt. Brown w/Brown Specks Floor Tile	3,000	SF	Basement Church Offices and hall of south building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
D-M	12"x 12" Lt. Brown w/Brn Specks Floor Tile Mastic	1,500	SF	Basement Church Offices and hall of south building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
E-1	Linear Pipe Insulation	450	LF	Basement and Boiler Room	Chrysotile	TSI	Yes	40	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
E-2	Cementitious Pipe Joint Insulation	45	LF	Basement/Boiler Room	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
F	12"x 12" Pink Floor Tile	14,000	SF	Classrooms and Hallways in Church Area south building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
F-M	12"x 12" Pink Floor Tile Adhesive	14,000	SF	Classrooms and Hallways in Church Area south building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
G	1'x 1' Spline Ceiling Tile	14,000	SF	First Floor	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
H	Plaster Walls and Ceilings	40,000	SF	First Floor and Basement	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Chicago International
Charter - Washington Park
Address 6105 S. Michigan Ave.

Unit 66181
Chicago, IL, 60637

Building ID 2290
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/26/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
12A	
16	
17	
18	
19	

Chicago Public Schools

School Chicago International
Charter - Washington Park

Unit 66181

Building ID 2290

Address 6105 S. Michigan Ave.

Chicago, IL, 60637

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
2	
20	
21	
22	
A	
A-M	
B	
B-M	
C	
C-M	
D	
D-M	
E-1	
E-2	
F	
F-M	
G	
H	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12x12 brown w/beige**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed, has been removed.**

Inspector's Signature:



Date: **03/27/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**


HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12x12 brown w/beige**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

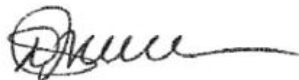

Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **9x9 white floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st floor art room**

MATERIAL QUANTITY: **920**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **9x9 white floor tile mastic**
MATERIAL LOCATION: **1st floor art room**
MATERIAL QUANTITY: **920** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Grey and black Terrazzo flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement North Building**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Grey and black Terrazzo flooring**
MATERIAL LOCATION: **Basement North Building**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12x12 grey ceramic pattern floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Nurse's office north building**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12x12 grey ceramic pattern floor tile**
MATERIAL LOCATION: **Nurse's office north building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Mastic for 12x12 gray ceramic pattern floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Nurse's office North building**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Mastic for 12x12 gray ceramic pattern floor tile**
MATERIAL LOCATION: **Nurse's office North building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12x12 lt blue with dark blue and white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 204 and 205 North building**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12x12 lt blue with dark blue and white floor tile**
MATERIAL LOCATION: **Rooms 204 and 205 North building**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **9x9 brown with beige floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Hallway, Classrooms 100, 101, 102**

MATERIAL QUANTITY: **8600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **9x9 brown with beige floor tile**
MATERIAL LOCATION: **Hallway, Classrooms 100, 101, 102**
MATERIAL QUANTITY: **8600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature:



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Mastic for 12x12 lt blue floor tile with blue and white**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 204 and 205 North Building**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Mastic for 12x12 lt blue floor tile with blue and white**
MATERIAL LOCATION: **Rooms 204 and 205 North Building**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Blue carpet adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd floor office, 206, and 207**

MATERIAL QUANTITY: **2200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Blue carpet adhesive**
MATERIAL LOCATION: **1st and 2nd floor office, 206, and 207**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **2' x 4' ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd floor Classrooms and offices**

MATERIAL QUANTITY: **4000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **2' x 4' ceiling tile**
MATERIAL LOCATION: **2nd floor Classrooms and offices**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Lunch Room south building**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Specks Floor Tile**
MATERIAL LOCATION: **First Floor Lunch Room south building**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A-M**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Specks Floor Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Lunchroom south building**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **A-M**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Specks Floor Tile Adhesive**
MATERIAL LOCATION: **First Floor Lunchroom south building**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **9"x 9" Brown w/Beige Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Corridor, Rooms 100, 101, 102**

MATERIAL QUANTITY: **12000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **9"x 9" Brown w/Beige Specks Floor Tile**
MATERIAL LOCATION: **First Floor Corridor, Rooms 100, 101, 102**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B-M**
MATERIAL DESCRIPTION: **9"x 9" Brown w/Beige Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Corridor, Rooms 100, 101, 102**

MATERIAL QUANTITY: **12000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **B-M**
MATERIAL DESCRIPTION: **9"x 9" Brown w/Beige Specks Floor Tile Mastic**
MATERIAL LOCATION: **First Floor Corridor, Rooms 100, 101, 102**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **12"x 12" Light Brown with Dark Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Church Offices South Building**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **12"x 12" Light Brown with Dark Specks Floor Tile**
MATERIAL LOCATION: **Basement Church Offices South Building**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C-M**
MATERIAL DESCRIPTION: **12"x12" Lt Brn with Dark Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Church Offices South Building**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **C-M**
MATERIAL DESCRIPTION: **12"x12" Lt Brn with Dark Specks Floor Tile Mastic**
MATERIAL LOCATION: **Basement Church Offices South Building**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **12"x 12" Lt. Brown w/Brown Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Church Offices and hall of south building**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **12"x 12" Lt. Brown w/Brown Specks Floor Tile**
MATERIAL LOCATION: **Basement Church Offices and hall of south building**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D-M**
MATERIAL DESCRIPTION: **12"x 12" Lt. Brown w/Brn Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Church Offices and hall of south building**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **D-M**
MATERIAL DESCRIPTION: **12"x 12" Lt. Brown w/Brn Specks Floor Tile Mastic**
MATERIAL LOCATION: **Basement Church Offices and hall of south building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E-1**
MATERIAL DESCRIPTION: **Linear Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Repair Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Basement and Boiler Room**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/27/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **E-1**
MATERIAL DESCRIPTION: **Linear Pipe Insulation**
MATERIAL LOCATION: **Basement and Boiler Room**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **40** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair
Operations and Maintenance**

Comments:

Management Planner's Signature:  Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E-2**
MATERIAL DESCRIPTION: **Cementitious Pipe Joint Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement/Boiler Room**

MATERIAL QUANTITY: **45**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **E-2**
MATERIAL DESCRIPTION: **Cementitious Pipe Joint Insulation**
MATERIAL LOCATION: **Basement/Boiler Room**
MATERIAL QUANTITY: **45** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **12"x 12" Pink Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms and Hallways in Church Area south building**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **12"x 12" Pink Floor Tile**
MATERIAL LOCATION: **Classrooms and Hallways in Church Area south building**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F-M**
MATERIAL DESCRIPTION: **12"x 12" Pink Floor Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms and Hallways in Church Area south building**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **F-M**
MATERIAL DESCRIPTION: **12"x 12" Pink Floor Tile Adhesive**
MATERIAL LOCATION: **Classrooms and Hallways in Church Area south building**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **1'x 1' Spline Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **First Floor**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **1'x 1' Spline Ceiling Tile**
MATERIAL LOCATION: **First Floor**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUIDLING ID: **2290**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Chicago International Charter - Washington Park** INSPECTION DATE: **3/27/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Plaster Walls and Ceilings**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor and Basement**

MATERIAL QUANTITY: **40000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/27/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66181** BUILDING ID: **2290**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Chicago International Charter - Washington Park** REVIEW DATE: **4/26/2013**
ADDRESS: **6105 S. Michigan Ave.** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Plaster Walls and Ceilings**
MATERIAL LOCATION: **First Floor and Basement**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/26/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Approved by the Illinois Department of Public Health and Indiana Department of Environmental Management

This is to certify that KEITH CLOUGH
has completed the Contractor/Supervisor Recertification course and passed the examination
on 04/30/2012 with a minimum score of 70% or better. Training was in accordance with U.S.
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA and Indiana Rule 326 IAC
18-2.



Handwritten signature

04/30/2012

Course Dates:

04/30/2013

Expires:

1204CSR19

Certificate Number:


Phone Number: (312) 491-0081

Director of Training

Nicholas J. Peneff

Director of Public Health

FORM # A-008

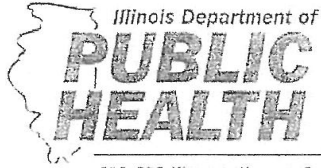

525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.state.il.us

Pat Quinn, Governor

4/10/2012

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02950

Enclosed is your Asbestos Professional License that expires 05/15/2013

CERTIFICATE EXPIRATION DATE

INSPECTOR 3/21/2013

PROJECT MANAGER 4/29/2012
AIR SAMPLING PROFESSIONAL

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897. Our WEB address is <http://www.idph.state.il.us/envhealth/ehhome.htm>



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER ISSUED EXPIRES
100 - 02950 4/10/2012 05/15/2013

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443



Environmental Health

1003



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

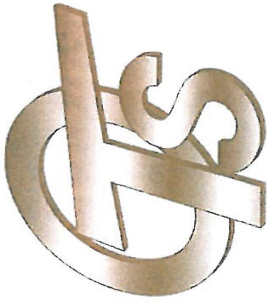

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013

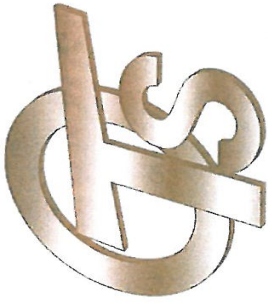

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed