

ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-0010  
SCHOOL NAME: Englewood Academy  
ADDRESS OF SCHOOL: 6201 S. Stewart  
CITY: Chicago, IL, 60621

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/22/2010

**If the address on this form is different than the address of the building, submit a written explanation.**

**SECTION II** (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 3/22/2013 ENROLLMENT 0  
IDPH INSPECTOR LICENSE NUMBER: 100-02950  
IDPH LICENSED INSPECTOR NAME (Please Print): Keith Clough  
IDPH MP LICENSE NUMBER: 100-03613  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



3/22/2013

Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Englewood Academy**

6201 S. Stewart  
Chicago, IL, 60621

Unit: 46351  
Building ID: 1680

IDPH ID Number: 14-016-2990-0010

**REPORT DATE:**

Friday, March 22, 2013

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

March 12, 2013

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 46351                      Region: 05                      IDPH ID: 14-016-2990-0010

School: Englewood Academy                      Building ID: 1680

Address: 6201 S. Stewart  
Chicago, IL, 60621

Building Contact:                      Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 3/22/2013

Inspector: Keith Clough                      Inspector IDPH License: 100-02950  
Management Planner: Daniel Juneau                      Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Daniel Juneau  
100-03613

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 12, 2013

RE: Englewood Academy, Unit 46351  
6201 S. Stewart  
Chicago, IL, 60621

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Englewood Academy , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Englewood Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Englewood Academy Unit: 46351 Region: 05  
Address: 6201 S. Stewart Chicago, IL, 60621  
IDPH ID: 14-016-2990-0010 Building ID: 1680  
Contact: Phone:

### 2. Description of Facility

Original Construction: Additional Construction:  
Total Square Footage: No of Floors:  
Current Occupancy: 0

### 3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Dan Juneau  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Keith Clough


Inspector IDPH license # 100-02950

  
Signature:  
Date: 3/12/2013

### 6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

  
Signature:  
Date: 3/22/2013

### 7. Review Date: 3/22/2013

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

  
Signature:

Date: 3/22/2013

Name: Ms. Lynn Crivello

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Englewood Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1680:

04	tectum sheets
06A	12x12 black w/white speck FT mastic
07	black baseboard
08	black baseboard mastic
15	12x12 tan FT
16	12x12 tan FT mastic
HA-1003	1'x1' ceiling tile

B. The following new homogenous areas have been identified for Building 1680:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01B	12x12 off white FT
01C	12x12 varigated brown FT
04	tectum sheets
06A	12x12 black w/white speck FT mastic
06B	12x12 off white Floor Tile mastic
06C	12x12 varigated brown FT mastic
07	black baseboard
08	black baseboard mastic
09	drywall
09A	drywall mud
10	lab tops
11	transite hoods
12	firedoors
13	incinerator - inaccessible
14	2'x2' metal pan peg ceiling tile
15	12x12 tan FT
16	12x12 tan FT mastic
18B	blue carpet mastic
18C	Blue carpet mastic
20	brown carpet mastic
21	brown with multicolored specks carpet mastic
22	beige with purple specks linoleum
23	beige with purple streaks linoleum mastic
24	transite countertops
25	12x12 gray floor tile
26	12x12 gray floor tile mastic
27	12x12 brown with white specks floor tile
28	12x12 brown with white specks floor tile mastic
29	purple carpet mastic
30	light brown carpet mastic
31	12"x12" White w/Black and Grey Floor Tile
31M	12"x12" White w/Black and Grey Floor Tile Mastic
C	duct insulation
D	elbows and joints
E	elbows and joints
F	elbows
G	FLOOR TILE BLK/WHITE/BRN.CARPET/MASTIC
HA-1000	New table tops
HA-1001	2'x2' ceiling tile with long fissures
HA-1002	2'x2' ceiling tile with small fissures and pinhole
HA-1003	1'x1' ceiling tile
HA-1004	Glue for 1'x1' white ceiling tile
HA-1005	Lt. Beige sheet flooring
HA-1006	Glue associated with new Lt. Beige sheet flooring

HA-1007	12"X12" white VFT with gray specks
HA-1008	Mastic associated with 12"x12" wh VFTwith gr. Spec
HA-1009	12"X12" wh. VFT with tan specks
HA-1010	Mastic associated with 12"x12" wh VFT with tan specks
HA-1011	12"x12" white VFT with black and tan specks
HA-1012	Mastic assoc. with 12"x12"wh VFT with bl & tan sp
HA-1013	Mastic/glue assoc. with maroon rubber floorig
HA-1014	Stage lighting cords
HA-1015	White fiber board panels

The following areas were deemed to be inaccessible:

06A	12x12 black w/white speck FT mastic
06B	12x12 off white Floor Tile mastic
06C	12x12 varigated brown FT mastic
13	incinerator - inaccessible
16	12x12 tan FT mastic
20	brown carpet mastic
21	brown with multicolored specks carpet mastic
23	beige with purple streaks linoleum mastic
26	12x12 gray floor tile mastic
31M	12"x12" White w/Black and Grey Floor Tile Mastic
C	duct insulation
G	FLOOR TILE BLK/WHITE/BRN.CARPET/MASTIC
HA-1004	Glue for 1'x1' white ceiling tile
HA-1006	Glue associated with new lt. Beige sheet flooring
HA-1008	Mastic associated with 12"x12" wh VFTwith gr. Spec
HA-1010	Mastic associated with 12"x12" wh VFT with tan specks
HA-1012	Mastic assoc. with 12"x12"wh VFT with bl & tan sp
HA-1013	Mastic/glue assoc. with maroon rubber floorig

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Keith Clough, IDPH License # 100-02950. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Englewood Academy Building 1680 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---



# Chicago Public Schools

School Englewood Academy Unit 46351 Building ID 1680

Address 6201 S. Stewart Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
18B	blue carpet mastic			social room	ASSUMED	MISC								
18C	Blue carpet mastic			rooms 344, 343, 342, 341, 341-2, 341-3, downstairs library	ASSUMED	MISC	N							
19	incinerator gasket - Removed			incinerator door	ABATED	TSI								
20	brown carpet mastic	3,600	SF	rooms 338, 335, 332	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	brown with multicolored specks carpet mastic	700	SF	upstairs section of library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	beige with purple specks linoleum	600	SF	room 338	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	beige with purple streaks linoleum mastic	600	SF	room 338	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	transite countertops	200	SF	room 338	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
25	12x12 gray floor tile	500	SF	room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12x12 gray floor tile mastic	500	SF	room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12x12 brown with white specks floor tile			room 231	ASSUMED	MISC								
28	12x12 brown with white specks floor tile mastic			room 231	ASSUMED	MISC								
29	purple carpet mastic			room 220	ASSUMED	MISC								
30	light brown carpet mastic			room 103	ASSUMED	MISC								
31	12"x12" White w/Black and Grey Floor Tile	3,000	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31M	12"x12" White w/Black and Grey Floor Tile Mastic	3,000	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C	duct insulation	40	SF	kitchen/serving area	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
D	elbows and joints	30	LF	pump room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
E	elbows and joints	25	LF	boiler room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
F	elbows	15	LF	pool pump room	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
G	FLOOR TILE BLK/WHITE/BRN.CARPET/MASTIC	1,000	SF	THOUGHOUT BLD. SEE NOTES FOR RMS.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1000	New table tops	3,500	SF	Rms. 215, 216, 217, 218, 219	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Englewood Academy Unit 46351 Building ID 1680

Address 6201 S. Stewart Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
HA-1001	2'x2' ceiling tile with long fissures	4,200	SF	Rms. 204, 211, 223, 232, 326,329,330	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1002	2'x2' ceiling tile with small fissures and pinhole	17,000	SF	rm 338, hallways	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1003	1'x1' ceiling tile	24,500	SF	1st, 2nd, 3rd floor classrooms, library	ASSUMED	MISC	Y	LOC	7		Yes	Damaged or significantly damaged friable misc. ACBM	10	HIGH
HA-1004	Glue for 1'x1' white ceiling tile	24,500	SF	1st, 2nd, 3rd floor classrooms, library	ASSUMED	MISC	N	LOC	7		No	ACBM with the potential for damage	10	MODERATE
HA-1005	Lt. Beige sheet flooring	5,400	SF	2nd fl. Laboratories: 215, 216, 217, 218, 219	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1006	Glue associated with new lt. Beige sheet flooring	5,400	SF	rms. 215, 216, 217, 218, 219	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1007	12"x12" white VFT with gray specks	1,170	SF	Rm. 231	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1008	Mastic associated with 12"x12" wh VFT with gr. Spec	1,170	SF	Rm. 231	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1009	12"x12" wh. VFT with tan specks	2,400	SF	Rms. 326, 335	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1010	Mastic associated with 12"x12" wh VFT with tan specks	2,400	SF	Rms. 326, 325	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1011	12"x12" white VFT with black and tan specks	1,170	SF	Rm. 325	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1012	Mastic assoc. with 12"x12"wh VFT with bl & tan sp	1,170	SF	Rm. 325	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1013	Mastic/glue assoc. with maroon rubber flooring	3,000	SF	Pool area	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1014	Stage lighting cords	500	LF	Cat walk and storage above the Auditorium	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1015	White fiber board panels	300	SF	Rm. 235	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW

# Chicago Public Schools

School Englewood Academy Unit 46351 Building ID 1680

Address 6201 S. Stewart Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>3/12/2013</b>
Inspector Name <b>Keith Clough</b>
<b>100-02950</b> <b>5/15/2013</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01A	
01B	
01C	
04	
06A	
06B	
06C	
07	
08	
09	
09A	
10	
11	Material Not Observed 2013
12	
13	Material Inaccessible
14	Material Not Observed 2013
15	
16	
17	
18A	
18B	Material Not Observed 2013
18C	Material Not Observed 2013
19	
20	



# Chicago Public Schools

School Englewood Academy Unit 46351 Building ID 1680

Address 6201 S. Stewart Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
21	
22	
23	
24	
25	
26	
27	Material Not Observed 2013
28	Material Not Observed 2013
29	Material Not Observed 2013
30	Material Not Observed 2013
31	
31M	
C	
D	
E	
F	
G	
HA-1000	
HA-1001	
HA-1002	
HA-1003	
HA-1004	
HA-1005	
HA-1006	
HA-1007	
HA-1008	
HA-1009	
HA-1010	
HA-1011	

# Chicago Public Schools

School Englewood Academy Unit 46351 Building ID 1680

Address 6201 S. Stewart Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
HA-1012	
HA-1013	
HA-1014	
HA-1015	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School Englewood Academy

Unit 46351

Building ID 1680

Address 6201 S. Stewart

Chicago, IL, 60621

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	12x12 black w/white speck FT	14,665	SF	1st,2nd,3rd fl corridors & locker rooms, rooms 340, 335, 232-2	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
01B	12x12 off white FT	20,000	SF	1st, 2nd & 3rd fl classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
01C	12x12 varigated brown FT	50	SF	patches on 3rd floor, room 335	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
04	tectum sheets	2,000	SF	music rm, 102,101,103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
06A	12x12 black w/white speck FT mastic	14,665	SF	1st,2nd,3rd fl corridors & locker rooms, rooms 340, 335, 232-2	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
06B	12x12 off white Floor Tile mastic	20,000	SF	2nd & 3rd fl classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
06C	12x12 varigated brown FT mastic	50	SF	patches on 3rd floor, room 335	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
07	black baseboard	3,500	LF	throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
08	black baseboard mastic	3,500	LF	throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
09	drywall	7,500	SF	upper 4' in corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
09A	drywall mud	7,500	SF	upper 4' in corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
10	lab tops	3,000	SF	rm: 219,217,216,215,218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11	transite hoods			rm 217,218	Assumed	MISC					
12	firedoors	12	EA	4 sets of 2 doors per floor plus engineer garage	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Operations and Maintenance
13	incinerator - inaccessible			incinerator (interior door)	Assumed	TSI	No			7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
14	2'x2' metal pan peg ceiling tile			kitchen	Assumed	MISC					
15	12x12 tan FT	750	SF	driver's ed. Mobile unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	12x12 tan FT mastic	750	SF	driver's ed. Mobile unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
17	fireboard ceiling			driver's ed. Mobile unit	No ACBM	MISC					
18A	purple carpet mastic			main office	No ACBM	MISC					
18B	blue carpet mastic			social room	Assumed	MISC					
18C	Blue carpet mastic			rooms 344, 343, 342, 341, 341-2, 341-3, downstairs library	Assumed	MISC	No				
19	incinerator gasket - Removed			incinerator door	Abated	TSI					
20	brown carpet mastic	3,600	SF	rooms 338, 335, 332	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
21	brown with multicolored specks carpet mastic	700	SF	upstairs section of library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
22	beige with purple specks linoleum	600	SF	room 338	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
23	beige with purple streaks linoleum mastic	600	SF	room 338	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
24	transite countertops	200	SF	room 338	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
25	12x12 gray floor tile	500	SF	room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
26	12x12 gray floor tile mastic	500	SF	room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

# Chicago Public Schools

School Englewood Academy

Unit 46351

Building ID 1680

Address 6201 S. Stewart

Chicago, IL, 60621

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
27	12x12 brown with white specks floor tile			room 231	Assumed	MISC					
28	12x12 brown with white specks floor tile mastic			room 231	Assumed	MISC					
29	purple carpet mastic			room 220	Assumed	MISC					
30	light brown carpet mastic			room 103	Assumed	MISC					
31	12"x12" White w/Black and Grey Floor Tile	3,000	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31M	12"x12" White w/Black and Grey Floor Tile Mastic	3,000	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
C	duct insulation	40	SF	kitchen/serving area	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
D	elbows and joints	30	LF	pump room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
E	elbows and joints	25	LF	boiler room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
F	elbows	15	LF	pool pump room	Assumed	TSI	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
G	FLOOR TILE BLK/WHITE/BRN.CARPET/MASTIC	1,000	SF	THOUGHOUT BLD. SEE NOTES FOR RMS.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1000	New table tops	3,500	SF	Rms. 215, 216, 217, 218, 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1001	2'x2' ceiling tile with long fissures	4,200	SF	Rms. 204, 211, 223, 232, 326,329,330	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1002	2'x2' ceiling tile with small fissures and pinhole	17,000	SF	rm 338, hallways	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1003	1'x1' ceiling tile	24,500	SF	1st, 2nd, 3rd floor classrooms, library	Assumed	MISC	Yes	7	SF	4 Damaged or significantly damaged friable misc. ACBM	Operations and Maintenance
HA-1004	Glue for 1'x1' white ceiling tile	24,500	SF	1st, 2nd, 3rd floor classrooms, library	Assumed	MISC	No	7	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1005	Lt. Beige sheet flooring	5,400	SF	2nd fl. Laboratories: 215, 216, 217, 218, 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1006	Glue associated with new Lt. Beige sheet flooring	5,400	SF	rms. 215, 216, 217, 218, 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1007	12"X12" white VFT with gray specks	1,170	SF	Rm. 231	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1008	Mastic associated with 12"x12" wh VFTwith gr. Spec	1,170	SF	Rm. 231	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1009	12"X12" wh. VFT with tan specks	2,400	SF	Rms. 326, 335	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1010	Mastic associated with 12"x12" wh VFT with tan specks	2,400	SF	Rms. 326, 325	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

# Chicago Public Schools

**School** Englewood Academy  
**Address** 6201 S. Stewart

**Unit** 46351  
 Chicago, IL, 60621

**Building ID** 1680  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
HA-1011	12"x12" white VFT with black and tan specks	1,170	SF	Rm. 325	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1012	Mastic assoc. with 12"x12"wh VFT with bl & tan sp	1,170	SF	Rm. 325	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1013	Mastic/glue assoc. with maroon rubber floorig	3,000	SF	Pool area	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1014	Stage lighting cords	500	LF	Cat walk and storage above the Auditorium	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1015	White fiber board panels	300	SF	Rm. 235	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance

# Chicago Public Schools

**School** Englewood Academy  
**Address** 6201 S. Stewart

**Unit** 46351  
 Chicago, IL, 60621

**Building ID** 1680  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

Review Date	3/22/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
01B	
01C	
04	
06A	
06B	
06C	
07	
08	
09	
09A	
10	
11	Material not observed 2013 re-inspection
12	
13	
14	Material not observed 2013 Re-Inspection
15	
16	
17	
18A	
18B	Material not observed 2013 Re-Inspection
18C	Material not observed 2013 Re-Inspection
19	
20	
21	
22	

# Chicago Public Schools

**School** Englewood Academy

**Unit** 46351

**Building ID** 1680

**Address** 6201 S. Stewart

Chicago, IL, 60621

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
23	
24	
25	
26	
27	Material not observed 2013 Re-Inspection
28	Material not observed 2013 Re-Inspection
29	Material not observed 2013 Re-Inspection
30	Material not observed 2013 Re-Inspection
31	
31M	
C	
D	
E	
F	
G	
HA-1000	
HA-1001	
HA-1002	
HA-1003	
HA-1004	
HA-1005	
HA-1006	
HA-1007	
HA-1008	
HA-1009	
HA-1010	
HA-1011	



# Chicago Public Schools

**School** Englewood Academy

**Unit** 46351

**Building ID** 1680

**Address** 6201 S. Stewart

Chicago, IL, 60621

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
HA-1012	
HA-1013	
HA-1014	
HA-1015	

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12x12 black w/white speck FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd,3rd fl corridors & locker rooms, rooms 340, 335, 232-2**

MATERIAL QUANTITY: **14665** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12x12 black w/white speck FT**  
MATERIAL LOCATION: **1st,2nd,3rd fl corridors & locker rooms, rooms 340, 335, 232-2**  
MATERIAL QUANTITY: **14665** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12x12 off white FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd & 3rd fl classrooms**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12x12 off white FT**  
MATERIAL LOCATION: **1st, 2nd & 3rd fl classrooms**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

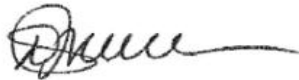

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01C**  
MATERIAL DESCRIPTION: **12x12 varigated brown FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **patches on 3rd floor, room 335**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **01C**  
MATERIAL DESCRIPTION: **12x12 varigated brown FT**  
MATERIAL LOCATION: **patches on 3rd floor, room 335**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **tectum sheets**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **music rm, 102,101,103**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **tectum sheets**

MATERIAL LOCATION: **music rm, 102,101,103**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **12x12 black w/white speck FT mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st,2nd,3rd fl corridors & locker rooms, rooms 340, 335, 232-2**  
MATERIAL QUANTITY: **14665** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **12x12 black w/white speck FT mastic**  
MATERIAL LOCATION: **1st,2nd,3rd fl corridors & locker rooms, rooms 340, 335, 232-2**  
MATERIAL QUANTITY: **14665** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

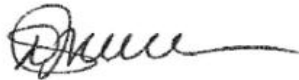

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **12x12 off white Floor Tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd & 3rd fl classrooms**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **12x12 off white Floor Tile mastic**  
MATERIAL LOCATION: **2nd & 3rd fl classrooms**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06C**  
MATERIAL DESCRIPTION: **12x12 varigated brown FT mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **patches on 3rd floor, room 335**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **06C**  
MATERIAL DESCRIPTION: **12x12 varigated brown FT mastic**  
MATERIAL LOCATION: **patches on 3rd floor, room 335**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **black baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **throughout**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **black baseboard**  
MATERIAL LOCATION: **throughout**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

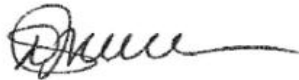

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **black baseboard mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **throughout**

MATERIAL QUANTITY: **3500**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **black baseboard mastic**  
MATERIAL LOCATION: **throughout**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

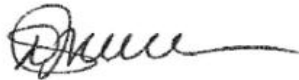

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **upper 4' in corridors**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **drywall**  
MATERIAL LOCATION: **upper 4' in corridors**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **drywall mud**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **upper 4' in corridors**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **drywall mud**  
MATERIAL LOCATION: **upper 4' in corridors**  
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **lab tops**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **rm: 219,217,216,215,218**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **lab tops**  
MATERIAL LOCATION: **rm: 219,217,216,215,218**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **transite hoods**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **rm 217,218**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **transite hoods**

MATERIAL LOCATION: **rm 217,218**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 re-inspection

Management Planner's Signature: \_\_\_\_\_

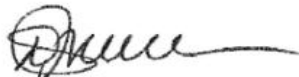

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **firedoors**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **4 sets of 2 doors per floor plus engineer garage**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: DAMAGE UNITS: **EA**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **firedoors**  
MATERIAL LOCATION: **4 sets of 2 doors per floor plus engineer garage**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **incinerator - inaccessible**  
HISTORICAL AHERA DAMAGE CATEGORY **7**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **incinerator (interior door)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Inaccessible**

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **incinerator - inaccessible**

MATERIAL LOCATION: **incinerator (interior door)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **2'x2' metal pan peg ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **2'x2' metal pan peg ceiling tile**

MATERIAL LOCATION: **kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

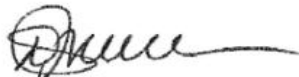

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12x12 tan FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **driver's ed. Mobile unit**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12x12 tan FT**  
MATERIAL LOCATION: **driver's ed. Mobile unit**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

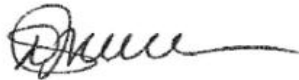

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **12x12 tan FT mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **driver's ed. Mobile unit**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **12x12 tan FT mastic**  
MATERIAL LOCATION: **driver's ed. Mobile unit**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

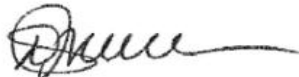

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **fireboard ceiling**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **driver's ed. Mobile unit**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **fireboard ceiling**

MATERIAL LOCATION: **driver's ed. Mobile unit**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18A**  
MATERIAL DESCRIPTION: **purple carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **main office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/12/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **18A**

MATERIAL DESCRIPTION: **purple carpet mastic**

MATERIAL LOCATION: **main office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18B**  
MATERIAL DESCRIPTION: **blue carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **social room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **18B**

MATERIAL DESCRIPTION: **blue carpet mastic**

MATERIAL LOCATION: **social room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

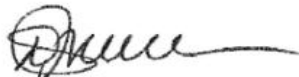

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18C**  
MATERIAL DESCRIPTION: **Blue carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **rooms 344, 343, 342, 341, 341-2, 341-3, downstairs library**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **18C**

MATERIAL DESCRIPTION: **Blue carpet mastic**

MATERIAL LOCATION: **rooms 344, 343, 342, 341, 341-2, 341-3, downstairs library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

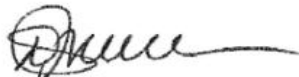

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **incinerator gasket - Removed**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **incinerator door**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **incinerator gasket - Removed**

MATERIAL LOCATION: **incinerator door**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **brown carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **rooms 338, 335, 332**  
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **brown carpet mastic**  
MATERIAL LOCATION: **rooms 338, 335, 332**  
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **brown with multicolored specks carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **upstairs section of library**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **brown with multicolored specks carpet mastic**  
MATERIAL LOCATION: **upstairs section of library**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **beige with purple specks linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **room 338**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **beige with purple specks linoleum**

MATERIAL LOCATION: **room 338**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **beige with purple streaks linoleum mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **room 338**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **beige with purple streaks linoleum mastic**

MATERIAL LOCATION: **room 338**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **transite countertops**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **room 338**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **transite countertops**

MATERIAL LOCATION: **room 338**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **12x12 gray floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **room 201**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12x12 gray floor tile**

MATERIAL LOCATION: **room 201**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **12x12 gray floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **room 201**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12x12 gray floor tile mastic**

MATERIAL LOCATION: **room 201**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

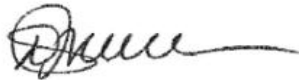

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12x12 brown with white specks floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 231**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12x12 brown with white specks floor tile**

MATERIAL LOCATION: **room 231**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

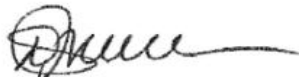

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12x12 brown with white specks floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 231**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12x12 brown with white specks floor tile mastic**

MATERIAL LOCATION: **room 231**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

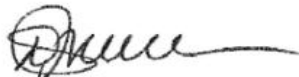

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **purple carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 220**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUILDING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **purple carpet mastic**

MATERIAL LOCATION: **room 220**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

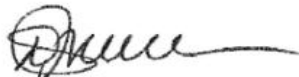

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **light brown carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 103**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013**

Inspector's Signature:



Date: **03/12/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **light brown carpet mastic**

MATERIAL LOCATION: **room 103**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed 2013 Re-Inspection

Management Planner's Signature: \_\_\_\_\_

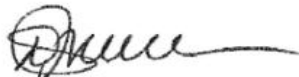

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12"x12" White w/Black and Grey Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12"x12" White w/Black and Grey Floor Tile**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31M**  
MATERIAL DESCRIPTION: **12"x12" White w/Black and Grey Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **31M**  
MATERIAL DESCRIPTION: **12"x12" White w/Black and Grey Floor Tile Mastic**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

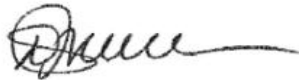

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **duct insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **kitchen/serving area**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUILDING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **duct insulation**  
MATERIAL LOCATION: **kitchen/serving area**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **elbows and joints**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **pump room**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **elbows and joints**

MATERIAL LOCATION: **pump room**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

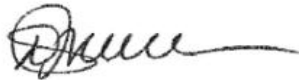

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **elbows and joints**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **boiler room**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **elbows and joints**

MATERIAL LOCATION: **boiler room**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **elbows**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **pool pump room**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **elbows**  
MATERIAL LOCATION: **pool pump room**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

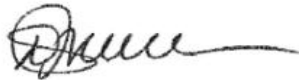

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **FLOOR TILE BLK/WHITE/BRN.CARPET/MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **THOUGHOUT BLD. SEE NOTES FOR RMS.**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **FLOOR TILE BLK/WHITE/BRN.CARPET/MASTIC**  
MATERIAL LOCATION: **THOUGHOUT BLD. SEE NOTES FOR RMS.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1000**  
MATERIAL DESCRIPTION: **New table tops**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Rms. 215, 216, 217, 218, 219**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1000**  
MATERIAL DESCRIPTION: **New table tops**  
MATERIAL LOCATION: **Rms. 215, 216, 217, 218, 219**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1001**  
MATERIAL DESCRIPTION: **2'x2' ceiling tile with long fissures**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rms. 204, 211, 223, 232, 326,329,330**  
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1001**  
MATERIAL DESCRIPTION: **2'x2' ceiling tile with long fissures**  
MATERIAL LOCATION: **Rms. 204, 211, 223, 232, 326,329,330**  
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1002**  
MATERIAL DESCRIPTION: **2'x2' ceiling tile with small fissures and pinhole**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **rm 338, hallways**  
MATERIAL QUANTITY: **17000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1002**

MATERIAL DESCRIPTION: **2'x2' ceiling tile with small fissures and pinhole**

MATERIAL LOCATION: **rm 338, hallways**

MATERIAL QUANTITY: **17000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1003**  
MATERIAL DESCRIPTION: **1'x1' ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **4 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Water**  
HISTORICAL RESPONSE ACTION: **Remove**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Water**  
DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **1st, 2nd, 3rd floor classrooms, library**  
MATERIAL QUANTITY: **24500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1003**  
MATERIAL DESCRIPTION: **1'x1' ceiling tile**  
MATERIAL LOCATION: **1st, 2nd, 3rd floor classrooms, library**  
MATERIAL QUANTITY: **24500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **7** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Remove**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1004**  
MATERIAL DESCRIPTION: **Glue for 1'x1' white ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Water**  
HISTORICAL RESPONSE ACTION: **Remove**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Water**  
DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1st, 2nd, 3rd floor classrooms, library**  
MATERIAL QUANTITY: **24500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1004**  
MATERIAL DESCRIPTION: **Glue for 1'x1' white ceiling tile**  
MATERIAL LOCATION: **1st, 2nd, 3rd floor classrooms, library**  
MATERIAL QUANTITY: **24500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **7** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Remove**

Comments:

Management Planner's Signature: \_\_\_\_\_

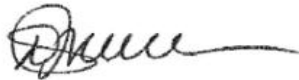

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1005**  
MATERIAL DESCRIPTION: **Lt. Beige sheet flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd fl. Laboratories: 215, 216, 217, 218, 219**

MATERIAL QUANTITY: **5400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1005**

MATERIAL DESCRIPTION: **Lt. Beige sheet flooring**

MATERIAL LOCATION: **2nd fl. Laboratories: 215, 216, 217, 218, 219**

MATERIAL QUANTITY: **5400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1006**  
MATERIAL DESCRIPTION: **Glue associated with new lt. Beige sheet flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rms. 215, 216, 217, 218, 219**

MATERIAL QUANTITY: **5400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1006**

MATERIAL DESCRIPTION: **Glue associated with new lt. Beige sheet flooring**

MATERIAL LOCATION: **rms. 215, 216, 217, 218, 219**

MATERIAL QUANTITY: **5400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1007**  
MATERIAL DESCRIPTION: **12"X12" white VFT with gray specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm. 231**  
MATERIAL QUANTITY: **1170** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1007**

MATERIAL DESCRIPTION: **12"X12" white VFT with gray specks**

MATERIAL LOCATION: **Rm. 231**

MATERIAL QUANTITY: **1170**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

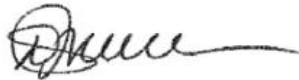

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1008**  
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" wh VFTwith gr. Spec**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm. 231**  
MATERIAL QUANTITY: **1170** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1008**

MATERIAL DESCRIPTION: **Mastic associated with 12"x12" wh VFTwith gr. Spec**

MATERIAL LOCATION: **Rm. 231**

MATERIAL QUANTITY: **1170**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1009**  
MATERIAL DESCRIPTION: **12"X12" wh. VFT with tan specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rms. 326, 335**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1009**

MATERIAL DESCRIPTION: **12"X12" wh. VFT with tan specks**

MATERIAL LOCATION: **Rms. 326, 335**

MATERIAL QUANTITY: **2400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1010**  
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" wh VFT with tan specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms. 326, 325**

MATERIAL QUANTITY: **2400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1010**  
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" wh VFT with tan specks**  
MATERIAL LOCATION: **Rms. 326, 325**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1011**  
MATERIAL DESCRIPTION: **12"x12" white VFT with black and tan specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm. 325**  
MATERIAL QUANTITY: **1170** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1011**

MATERIAL DESCRIPTION: **12"x12" white VFT with black and tan specks**

MATERIAL LOCATION: **Rm. 325**

MATERIAL QUANTITY: **1170**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

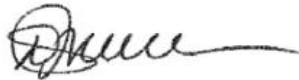

Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1012**  
MATERIAL DESCRIPTION: **Mastic assoc. with 12"x12"wh VFT with bl & tan sp**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rm. 325**

MATERIAL QUANTITY: **1170**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1012**

MATERIAL DESCRIPTION: **Mastic assoc. with 12"x12"wh VFT with bl & tan sp**

MATERIAL LOCATION: **Rm. 325**

MATERIAL QUANTITY: **1170**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1013**  
MATERIAL DESCRIPTION: **Mastic/glue assoc. with maroon rubber floorig**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Pool area**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1013**

MATERIAL DESCRIPTION: **Mastic/glue assoc. with maroon rubber floorig**

MATERIAL LOCATION: **Pool area**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1014**  
MATERIAL DESCRIPTION: **Stage lighting cords**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Cat walk and storage above the Auditorium**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1014**

MATERIAL DESCRIPTION: **Stage lighting cords**

MATERIAL LOCATION: **Cat walk and storage above the Auditorium**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**  
SCHOOL NAME: **Englewood Academy** INSPECTION DATE: **3/12/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1015**  
MATERIAL DESCRIPTION: **White fiber board panels**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm. 235**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/12/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46351** BUIDLING ID: **1680**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Englewood Academy** REVIEW DATE: **3/22/2013**  
ADDRESS: **6201 S. Stewart** IDPH LICENSE NO: **100-02950**

---

HOMOGENEOUS AREA: **HA-1015**

MATERIAL DESCRIPTION: **White fiber board panels**

MATERIAL LOCATION: **Rm. 235**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/22/2013**

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2013 AHERA REINSPECTION***

# APPENDIX B

## Inspector and Management Planner Licenses

---

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Approved by the Illinois Department of Public Health and Indiana Department of Environmental Management

This is to certify that KEITH CLOUGH  
has completed the Contractor/Supervisor Recertification course and passed the examination  
on 04/30/2012 with a minimum score of 70% or better. Training was in accordance with U.S.  
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model  
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA and Indiana Rule 326 IAC  
18-2.



*Nicholas J. Peneff*

04/30/2012

Course Dates:

04/30/2013

Expires:

1204CSR19

Certificate Number:


Phone Number: (312) 491-0081

Director of Training

Nicholas J. Peneff

Director of Public Health

FORM # A-008

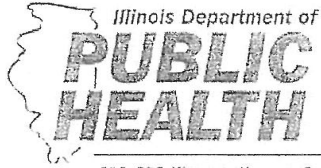

525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.state.il.us

Pat Quinn, Governor

4/10/2012

KEITH CLOUGH  
524 HOMELAND RD  
MATTESON, IL 60443

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02950

Enclosed is your Asbestos Professional License that expires 05/15/2013

CERTIFICATE EXPIRATION DATE

INSPECTOR 3/21/2013

PROJECT MANAGER 4/29/2012  
AIR SAMPLING PROFESSIONAL

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897. Our WEB address is <http://www.idph.state.il.us/envhealth/ehhome.htm>



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER 100 - 02950 ISSUED 4/10/2012 EXPIRES 05/15/2013

KEITH CLOUGH  
524 HOMELAND RD  
MATTESON, IL 60443



Environmental Health

1003



# Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

## Asbestos Building Inspector Refresher

*Occupational Training and Supply, Inc. certifies that*

# Daniel Juneau

**has successfully completed the 4 hour Asbestos Building Inspector Refresher Course**  
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

*Certificate:* BIR1212042319

*Exam Date:* 12/4/2012


*Course Date:* 12/4/2012

*Expiration Date:* 12/4/2013

Kathy DeSalvo, Director

2012



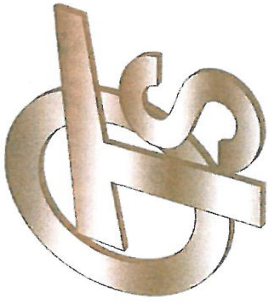

# Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Management Planner Refresher

*Occupational Training and Supply, Inc. certifies that*

# Daniel Juneau

**has successfully completed the 4 hour Asbestos Management Planner Refresher Course** and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

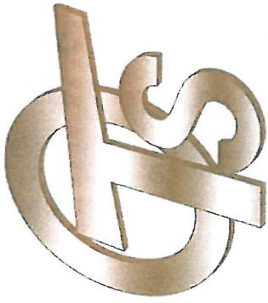

# Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Management Planner Refresher

*Occupational Training and Supply, Inc. certifies that*

# Daniel Juneau

**has successfully completed the 4 hour Asbestos Management Planner Refresher Course**  
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

# Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,  
Project Manager, and Air Sampling Professional



## ASBESTOS PROFESSIONAL LICENSE

ID NUMBER  
**100 - 03613**

ISSUED  
**4/11/2013**

EXPIRES  
**05/15/2014**

DANIEL J JUNEAU  
1408 OAKWOOD AVENUE  
DES PLAINES, IL 60016

Environmental Health



### ENDORSEMENTS

### TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

**CARNOW  
CONIBEAR**

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed