

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-
SCHOOL NAME: The Academy for Global Citizenship NEW
ADDRESS OF SCHOOL: 4647 West 47th Street
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED


If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/14/2013 ENROLLMENT 349
IDPH INSPECTOR LICENSE NUMBER: 100-11460
IDPH LICENSED INSPECTOR NAME (Please Print): Marcus Tsilimos
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113

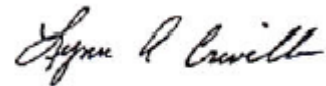

5/14/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

The Academy for Global Citizenship NEW

4647 West 47th Street
Chicago, IL, 60632

Unit: 63011
Building ID: 2025

IDPH ID Number: 14-016-2990-

REPORT DATE:

Tuesday, May 14, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

April 29, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 63011 Region: 04 IDPH ID: 14-016-2990-

School: The Academy for Global Citizenship NEW Building ID: 2025

Address: 4647 West 47th Street
Chicago, IL, 60632

Building Contact: Contact Phone:


Current Building Owners: Chicago Public Schools

Review Date: 5/14/2013

Inspector: Marcus Tsilimos Inspector IDPH License: 100-11460
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: April 29, 2013

RE: The Academy for Global Citizenship NEW, Unit 63011
4647 West 47th Street
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at The Academy for Global Citizenship NEW , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at The Academy for Global Citizenship NEW, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: The Academy for Global Citizenship NEW Unit: 63011 Region: 04
Address: 4647 West 47th Street Chicago, IL, 60632
IDPH ID: 14-016-2990- Building ID: 2025
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 349

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Marcus Tsilimos


Inspector IDPH license # 100-11460

Signature: 
Date: 4/29/2013

6. Management Planner

Management Planner Name: Daniel Juneau


Management Planner IDPH license # 100-03613

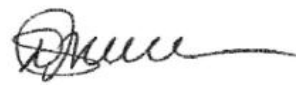Signature: 
Date: 5/14/2013

7. Review Date: 5/14/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/14/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the The Academy for Global Citizenship NEW. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2025:

B. The following new homogenous areas have been identified for Building 2025:

1	12" x 12" Gray w/ White Floor Tile
10	12" x 12" Beige Mix Floor Tile Mastic
11	4" Beige Vinyl Baseboard
12	4" Beige Vinyl Baseboard Mastic
13	4" White (Painted Brown) Vinyl Baseboard
14	4" White (Painted Brown) Vinyl Baseboard Mastic
15	Carpet Mastic
16	2' x 2' Lightly Textured Ceiling Tile
17	2' x 4' Fissured Pinhole Ceiling Tiles
18	Red Pipe Sealant
19	Interior Door Caulk
2	12" x 12" Gray w/ White Floor Tile Mastic
20	Drywall
21	Drywall Compound
22	Drywall Tape
3	12" x 12" Off-White w/ Gray Specks Floor Tile
4	12" x 12" Off-White w/ Gray Specks Floor Tile Mastic
5	12" x 12" Gray Marbled Floor Tile
6	12" x 12" Gray Marbled Floor Tile Mastic
7	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile
8	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic
9	12" x 12" Beige Mix Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	12" x 12" Gray w/ White Floor Tile
10	12" x 12" Beige Mix Floor Tile Mastic
11	4" Beige Vinyl Baseboard
12	4" Beige Vinyl Baseboard Mastic
13	4" White (Painted Brown) Vinyl Baseboard
14	4" White (Painted Brown) Vinyl Baseboard Mastic
15	Carpet Mastic
16	2' x 2' Lightly Textured Ceiling Tile
17	2' x 4' Fissured Pinhole Ceiling Tiles
18	Red Pipe Sealant
19	Interior Door Caulk
2	12" x 12" Gray w/ White Floor Tile Mastic
20	Drywall
21	Drywall Compound
22	Drywall Tape
3	12" x 12" Off-White w/ Gray Specks Floor Tile
4	12" x 12" Off-White w/ Gray Specks Floor Tile Mastic
5	12" x 12" Gray Marbled Floor Tile
6	12" x 12" Gray Marbled Floor Tile Mastic
7	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile
8	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic
9	12" x 12" Beige Mix Floor Tile

The following areas were deemed to be inaccessible:

10	12" x 12" Beige Mix Floor Tile Mastic
12	4" Beige Vinyl Baseboard Mastic
14	4" White (Painted Brown) Vinyl Baseboard Mastic
15	Carpet Mastic
2	12" x 12" Gray w/ White Floor Tile Mastic
4	12" x 12" Off-White w/ Gray Specks Floor Tile Mastic
6	12" x 12" Gray Marbled Floor Tile Mastic
8	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Marcus Tsilimos, IDPH License # 100-11460. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The The Academy for Global Citizenship NEW Building 2025 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School The Academy for Global Citizenship NEW Unit 63011 Building ID 2025
 Address 4647 West 47th Street Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	12" x 12" Gray w/ White Floor Tile	4,000	SF	Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
10	12" x 12" Beige Mix Floor Tile Mastic	100	SF	East Entrance Vestibule	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
11	4" Beige Vinyl Baseboard	1,200	LF	Throughout Classrooms, Offices, and Hallways	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
12	4" Beige Vinyl Baseboard Mastic	1,200	LF	Throughout Classrooms, Offices, and Hallways	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
13	4" White (Painted Brown) Vinyl Baseboard	200	LF	Multi-Purpose Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
14	4" White (Painted Brown) Vinyl Baseboard Mastic	200	LF	Multi-Purpose Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
15	Carpet Mastic	500	SF	Office's A, B, C	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
16	2' x 2' Lightly Textured Ceiling Tile	5,000	SF	Rms. 101-103, Multi-Purpose Room, Reception Area, and Hallways	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
17	2' x 4' Fissured Pinhole Ceiling Tiles	600	SF	Office's A, B, C & South Hallway	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
18	Red Pipe Sealant	50	LF	Throughout Building Above Drop Ceilings	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
19	Interior Door Caulk	100	LF	All Doors	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
2	12" x 12" Gray w/ White Floor Tile Mastic	4,000	SF	Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
20	Drywall	120,000	SF	Throughout Building	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		MODERATE

Chicago Public Schools

School The Academy for Global Citizenship NEW Unit 63011 Building ID 2025
 Address 4647 West 47th Street Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
21	Drywall Compound	60,000	LF	Throughout Building	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		MODERATE
22	Drywall Tape	60,000	LF	Throughout Building	ASSUMED	MISC	Y	NONE	0			Any remaining friable ACBM or friable suspect ACBM		LOW
3	12" x 12" Off-White w/ Gray Specks Floor Tile	5,000	SF	Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
4	12" x 12" Off-White w/ Gray Specks Floor Tile Mastic	5,000	SF	Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
5	12" x 12" Gray Marbled Floor Tile	350	SF	Multi-Purpose Room Storage	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
6	12" x 12" Gray Marbled Floor Tile Mastic	350	SF	Multi-Purpose Room Storage	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
7	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile	50	SF	Kitchen (Patching under sinks)	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
8	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic	50	SF	Kitchen (Patching under sinks)	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
9	12" x 12" Beige Mix Floor Tile	100	SF	East Entrance Vestibule	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE

Chicago Public Schools

School The Academy for Global Citizenship NEW Unit 63011 Building ID 2025
Address 4647 West 47th Street Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **4/29/2013**
Inspector Name **Marcus Tsilimos**
100-11460 **5/15/2013**
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
3	
4	
5	
6	
7	
8	
9	

Chicago Public Schools

School The Academy for Global Citizenship NEW Unit 63011 **Building ID** 2025
Address 4647 West 47th Street **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

The Academy for Global
Citizenship NEW

Unit 63011

Building ID 2025

School Address 4647 West 47th Street

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 762-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	12" x 12" Gray w/ White Floor Tile	4,000	SF	Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
10	12" x 12" Beige Mix Floor Tile Mastic	100	SF	East Entrance Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11	4" Beige Vinyl Baseboard	1,200	LF	Throughout Classrooms, Offices, and Hallways	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
12	4" Beige Vinyl Baseboard Mastic	1,200	LF	Throughout Classrooms, Offices, and Hallways	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
13	4" White (Painted Brown) Vinyl Baseboard	200	LF	Multi-Purpose Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
14	4" White (Painted Brown) Vinyl Baseboard Mastic	200	LF	Multi-Purpose Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
15	Carpet Mastic	500	SF	Office's A, B, C	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	2' x 2' Lightly Textured Ceiling Tile	5,000	SF	Rms. 101-103, Multi-Purpose Room, Reception Area, and Hallways	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
17	2' x 4' Fissured Pinhole Ceiling Tiles	600	SF	Office's A, B, C & South Hallway	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
18	Red Pipe Sealant	50	LF	Throughout Building Above Drop Ceilings	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
19	Interior Door Caulk	100	LF	All Doors	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
2	12" x 12" Gray w/ White Floor Tile Mastic	4,000	SF	Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
20	Drywall	120,000	SF	Throughout Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
21	Drywall Compound	60,000	LF	Throughout Building	Assumed	MISC	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
22	Drywall Tape	60,000	LF	Throughout Building	Assumed	MISC	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
3	12" x 12" Off-White w/ Gray Specks Floor Tile	5,000	SF	Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
4	12" x 12" Off-White w/ Gray Specks Floor Tile Mastic	5,000	SF	Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5	12" x 12" Gray Marbled Floor Tile	350	SF	Multi-Purpose Room Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
6	12" x 12" Gray Marbled Floor Tile Mastic	350	SF	Multi-Purpose Room Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School The Academy for Global
Citizenship NEW
Address 4647 West 47th Street

Unit 63011
Chicago, IL, 60632

Building ID 2025
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 762-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
7	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile	50	SF	Kitchen (Patching under sinks)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
8	12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic	50	SF	Kitchen (Patching under sinks)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
9	12" x 12" Beige Mix Floor Tile	100	SF	East Entrance Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School The Academy for Global
Citizenship NEW
Address 4647 West 47th Street

Unit 63011
Chicago, IL, 60632

Building ID 2025
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500

Phone: (312) 762-2900 **Fax:** (312) 762-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	5/14/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
3	
4	
5	
6	
7	
8	
9	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Floor Tile**

MATERIAL LOCATION: **Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **MODERATE** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **04/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Floor Tile**
MATERIAL LOCATION: **Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/ Dark Gray Specks Floor Tile**
MATERIAL LOCATION: **Kitchen (Patching under sinks)**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**


HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/ Dark Gray Specks Floor Tile**
MATERIAL LOCATION: **Kitchen (Patching under sinks)**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

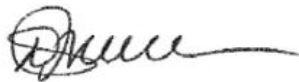

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **2' x 4' Fissured Pinhole Ceiling Tiles**
MATERIAL LOCATION: **Office's A, B, C & South Hallway**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **2' x 4' Fissured Pinhole Ceiling Tiles**

MATERIAL LOCATION: **Office's A, B, C & South Hallway**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

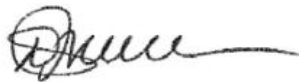

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Drywall Compound**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**


HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Drywall Compound**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

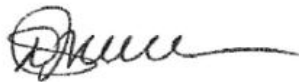

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Floor Tile Mastic**

MATERIAL LOCATION: **Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE REASON:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Floor Tile Mastic**
MATERIAL LOCATION: **Rms. 104-106, Storage by 106, Conference Room A, Rm. 107 and B, Rm. 108, Office B (under carpet), Reception Area by Office B**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/ Gray Specks Floor Tile**
MATERIAL LOCATION: **Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/ Gray Specks Floor Tile**
MATERIAL LOCATION: **Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/ Gray Specks Floor Tile Mastic**
MATERIAL LOCATION: **Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**


HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/ Gray Specks Floor Tile Mastic**
MATERIAL LOCATION: **Rms. 101-103, Multi-Purpose Room, Kitchen, and Hallways**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

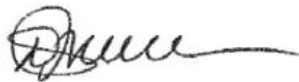

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard**
MATERIAL LOCATION: **Throughout Classrooms, Offices, and Hallways**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard**
MATERIAL LOCATION: **Throughout Classrooms, Offices, and Hallways**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **4" White (Painted Brown) Vinyl Baseboard**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **4" White (Painted Brown) Vinyl Baseboard**

MATERIAL LOCATION: **Multi-Purpose Room**

MATERIAL QUANTITY: **200**

MATERIAL UNITS:

LF

DAMAGE QUANTITY: **0**

DAMAGE UNITS:


LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

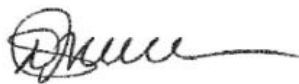

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Drywall Tape**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**


HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Drywall Tape**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

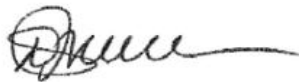

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUIDLING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Gray Marbled Floor Tile**
MATERIAL LOCATION: **Multi-Purpose Room Storage**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**


HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Gray Marbled Floor Tile**
MATERIAL LOCATION: **Multi-Purpose Room Storage**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

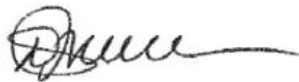

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Office's A, B, C**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Office's A, B, C**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **2' x 2' Lightly Textured Ceiling Tile**
MATERIAL LOCATION: **Rms. 101-103, Multi-Purpose Room, Reception Area, and Hallways**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**

ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **2' x 2' Lightly Textured Ceiling Tile**

MATERIAL LOCATION: **Rms. 101-103, Multi-Purpose Room, Reception Area, and Hallways**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

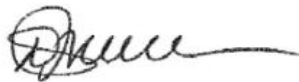

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic**
MATERIAL LOCATION: **Kitchen (Patching under sinks)**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/ Dark Gray Specks Floor Tile Mastic**
MATERIAL LOCATION: **Kitchen (Patching under sinks)**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" x 12" Gray Marbled Floor Tile Mastic**
MATERIAL LOCATION: **Multi-Purpose Room Storage**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" x 12" Gray Marbled Floor Tile Mastic**
MATERIAL LOCATION: **Multi-Purpose Room Storage**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUIDLING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile**
MATERIAL LOCATION: **East Entrance Vestibule**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile**
MATERIAL LOCATION: **East Entrance Vestibule**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global
Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout Classrooms, Offices, and Hallways**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout Classrooms, Offices, and Hallways**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **4" White (Painted Brown) Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **4" White (Painted Brown) Vinyl Baseboard Mastic**

MATERIAL LOCATION: **Multi-Purpose Room**

MATERIAL QUANTITY: **200**

MATERIAL UNITS:

LF

DAMAGE QUANTITY: **0**

DAMAGE UNITS:


LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

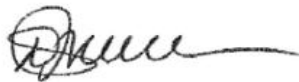

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Interior Door Caulk**
MATERIAL LOCATION: **All Doors**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **04/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**


HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Interior Door Caulk**
MATERIAL LOCATION: **All Doors**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

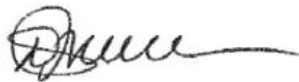

Date: **05/14/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12" x 12" Beige Mix Floor Tile Mastic**
MATERIAL LOCATION: **East Entrance Vestibule**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcus Tsilimos**
SCHOOL NAME: **The Academy for Global Citizenship NEW** INSPECTION DATE: **4/29/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Red Pipe Sealant**
MATERIAL LOCATION: **Throughout Building Above Drop Ceilings**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 04/29/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **63011** BUILDING ID: **2025**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **The Academy for Global Citizenship NEW** REVIEW DATE: **5/14/2013**
ADDRESS: **4647 West 47th Street** IDPH LICENSE NO: **100-11460**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Red Pipe Sealant**
MATERIAL LOCATION: **Throughout Building Above Drop Ceilings**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **05/14/2013** _____

APPENDIX B

Inspector and Management Planner Licenses

Marcus Tsilimos

Illinois Licensed Asbestos Inspector, Project Manager, and
Air Sampling Professional


Illinois Department of
PUBLIC HEALTH

**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER	ISSUED	EXPIRES
100 - 11460	4/4/2012	05/15/2013

MARCUS J TSILIMOS
2126 WEST CHICAGO AVE, 1R
CHICAGO, IL 60622

Environmental Health



ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/8/2012
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/15/2012

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Marcus Tsilimos

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course and has passed the competency exam with a minimum score of 70%. This course is accredited by the Illinois Department of Public Health and the Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II. This training course complies with the requirements of TSCA Title II and is accredited by the state of Wisconsin Department of Health Services under CH.DHS159, Wisconsin Administration Code.

Asbestos Abatement Building Inspector Refresher

Certificate: BIRWI1301110188

Location: 12304 75th Street Kenosha, WI 53142

Course Date: 1/11/2013

Examination Date: 1/11/2013

Expiration Date: 1/11/2014



Kathy DeSalvo/Director

2013



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319

Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013


Kathy DeSalvo, Director

2012



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed