

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2055
SCHOOL NAME: Altgeld School & Annex
ADDRESS OF SCHOOL: 1340 W. 71st St./7007 S. Loomis Blvd (outdated:
1426 W. 71st St.)
CITY: Chicago, IL, 60636

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 3/15/2016

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 428
IDPH INSPECTOR LICENSE NUMBER: 100-04208
IDPH LICENSED INSPECTOR NAME(Please Print): James Lehnhardt
IDPH MP LICENSE NUMBER: 100-00440
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Shawn Brown

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Altgeld School & Annex

1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)
Chicago, IL, 60636

Unit: 25811
Building ID: 2050 & 8708

IDPH ID Number: 14-016-2990-2055

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 03, 2019

RE: Altgeld School & Annex, Unit 25811
1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)
Chicago, IL, 60636

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Altgeld School & Annex, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Altgeld School & Annex, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Altgeld School & Annex Unit: 22051 Region: 05
Address: 1340 W. 71st St./7007 S. Chicago, IL, 60636
Loomis Blvd (outdated: 1426 W. 71st St.)
IDPH ID: 14-016-2990-2055 Building ID: 2050 & 8708
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 428

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880 Fax: 630-790-0882

5. Inspector

Inspector Name: James Lehnhardt

Inspector IDPH license # 100-04208

Signature:
Date: 9/3/2019

6. Management Planner

Management Planner Name: Shawn Brown

Management Planner IDPH license # 100-00440

Signature:
Date: 10/02/2019

7. Review Date: 10/02/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Altgeld School & Annex. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2050 & 8708:

03	Hard Coat Plaster
06	1'x1' Ceiling Tile
10	Ceiling Plaster
19	Insulation Inside of Vault Door
20	Insulation Inside of Fire Rated Doors
20A	Insulation Inside of Fire Rated Doors
G-1	12x12 Cream w/Beige Spots Floor Tile
G-2	12x12 Cream w/Beige Spots Floor Tile Mastic

B. The following new homogenous areas have been identified for Building 2050 & 8708:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01A	12x12 Dark Tan Floor Tile
01B	12x12 Off-White Vinyl Floor Tile
01C	12x12 Tan Speckled Floor Tile
03	Hard Coat Plaster
04	Burlap on Walls
04A	Burlap Wall Covering
05A	Green Linoleum - Not Observed
05AA	Green Linoleum Mastic - Not Observed
05B	Tan Linoleum - Not Observed
05BB	Tan Linoleum Mastic - Not Observed
06	1'x1' Ceiling Tile
06A	1'x1' Ceiling Tile Adhesive
07	2'x4' Wormy Patterned Lay-In Ceiling Tile
08	2'x4' Perferated Lay-In Ceiling Tile
09	Spray-On Fireproofing - Not Observed
12	Cardboard Pipe Insulation
13	Sink Undercoat
14	Sink Undercoat
15	Ceramic Tile Floor Tile Grout
16	Ceramic Floor Tile Adhesive
17	Ceramic Floor Tile Grout
18	Ceramic Floor Tile Adhesive
19	Insulation Inside of Vault Door
20	Insulation Inside of Fire Rated Doors
20A	Insulation Inside of Fire Rated Doors
21	Chalkboards
22	Chalkboard Adhesive
23	Chalkboards
24	Chalkboard Adhesive
25	Terrazzo
26	2'x4' Lay In Ceiling Tile
27	Linoleum on Shelves
28	Linoleum Adhesive on Shelves
A-1	12x12 Cream w/Beige Spots Floor Tile
A-2	12x12 Cream w/Beige Spots Floor Tile Mastic
B-1	12x12 Cream w/Beige Spots Floor Tile
B-2	12x12 Cream w/Beige Spots Floor Tile Mastic
C-1	12x12 Cream w/Beige Spots Floor Tile
C-2	12x12 Cream w/Beige Spots Floor Tile Mastic
CM-1	Tan Carpet Mastic
CM-2	Green Carpet Mastic - Not Observed
CM-3	Blue Carpet Adhesive - Not Observed

D	Pipe Joint Insulation on Cardboard Insulated Piping
D-1	12x12 Cream w/Beige Spots Floor Tile
D-2	12x12 Cream w/Beige Spots Floor Tile Mastic
E-1	12x12 Cream w/Beige Spots Floor Tile (114); 9x9 Floor Tile Library
E-2	12x12 Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1
F-1	12x12 Cream w/Beige Spots Floor Tile
F-2	12x12 Cream w/Beige Spots Floor Tile Mastic
G	Mag Block Pipe Insulation
G-1	12x12 Cream w/Beige Spots Floor Tile
G-2	12x12 Cream w/Beige Spots Floor Tile Mastic
H	Pipe Fitting Insulation on Mag Block Insulated Piping
K	12x12 Brown & White Floor Tile
K2	12x12 Brown and White Floor Tile Mastic

The following areas were deemed to be inaccessible:

02A1	9x9 Tan Speckled Floor Tile
B-2	12x12 Cream w/Beige Spots Floor Tile Mastic
C-2	12x12 Cream w/Beige Spots Floor Tile Mastic
D-2	12x12 Cream w/Beige Spots Floor Tile Mastic
E-2	12x12 Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1
F	Pipe Fitting Insulation on Aircell Insulated Piping
FT-1	9x9 Black Vinyl Floor Tile
FTM-1	9x9 Black Vinyl Floor Tile Mastic
K2	12x12 Brown and White Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by James Lehnhardt, IDPH License # 100-04208. The Management Plan was updated by Shawn Brown, IDPH License # 100-00440. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Altgeld School & Annex Building 2050 & 8708 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708
 Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				and Washroom										
02AA-1	9x9 Tan Speckled Floor Tile - Not Observed			Engineer's Office, Library and Library Office	CHR	MISC								
02B	9x9 Tan w/Streaks Floor Tile - Not Observed			Annex Building-Principal's Office and Classrooms 124, 223, 220, 229	CHR	MISC								
02BB	9x9 Tan w/Streaks Floor Tile Mastic - Not Observed			Annex Building-Principal's Office and Classrooms 124, 223, 220, and 229	CHR	MISC								
02C	9x9 Off-White Floor Tile - Not Observed			Annex Building-Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	CHR	MISC								
02CC	9x9 Off-White Floor Tile Mastic - Not Observed			Annex Building-Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	CHR	MISC								
02D	9x9 Olive Green Floor Tile - Not Observed			Annex Building-Throughout 1st & 2nd Floor Corridors	CHR	MISC								
02DD	9x9 Olive Green Floor Tile - Not Observed			Annex Building-Throughout 1st & 2nd Floor Corridors	CHR	MISC								
02E	9x9 Off-White w/Specks Floor Tile - Not Observed			Annex Building-Throughout 1st & 2nd Floor Corridors	CHR	MISC								
02EE	9x9 Off-White Floor Tile Mastic - Not Observed			Annex building-Throughout 1st & 2nd Floor Corridors	CHR	MISC								
03	Hard Coat Plaster	120,000	SF	Throughout Main Building	ASSUMED	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
04	Burlap on Walls	500	SF	Library, 3rd Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04A	Burlap Wall Covering	100	SF	Annex Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708
 Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
05A	Green Linoleum - Not Observed			Main Building-Room 101	ASSUMED	MISC								
05AA	Green Linoleum Mastic - Not Observed			Main Building-Room 101	ASSUMED	MISC								
05B	Tan Linoleum - Not Observed			Main Building-Room 203 and Storage	ASSUMED	MISC								
05BB	Tan Linoleum Mastic - Not Observed			Main Building-Room 203 and Storage Room	ASSUMED	MISC								
06	1'x1' Ceiling Tile	900	SF	Main Building-Room 202	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
06A	1'x1' Ceiling Tile Adhesive	900	SF	Main Building-Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	2'x4' Wormy Patterned Lay-In Ceiling Tile	12	SF	Main Building-Lunchroom	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
08	2'x4' Perferated Lay-In Ceiling Tile	525	SF	Main Building-Kitchen	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
09	Spray-On Fireproofing - Not Observed			Throughout Annex	ASSUMED	SURFACE								
10	Ceiling Plaster	300	SF	Annex Washrooms	CHR	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11	Troweled-On Ceiling Plaster	1,200	SF	Throughout Annex Mechanical Areas and Janitor Closets	CHR	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
12	Cardboard Pipe Insulation	410	LF	Main Building-Basement (Patched 2018)	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
13	Sink Undercoat	3	SF	Main Building-Library Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Sink Undercoat	9	SF	Annex Building-Classrooms 120, 124, & 125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Ceramic Tile Floor Tile Grout	900	SF	Main Building-Girl's and Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Ceramic Floor Tile Adhesive	900	SF	Main Building-Girl's & Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Ceramic Floor Tile Grout	600	SF	Annex Building-Girl's & Boy's	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708
 Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Washrooms										
18	Ceramic Floor Tile Adhesive	600	SF	Annex Building-Girls' & Boys' Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Insulation Inside of Vault Door	56	SF	Annex Building-Main Office and 2nd Floor Corridor	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		LOW
20	Insulation Inside of Fire Rated Doors	102	SF	Annex Building-Entrances and Speech Room	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		LOW
20A	Insulation Inside of Fire Rated Doors	204	SF	Main Building-Entrances	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		LOW
21	Chalkboards	2,500	SF	Main Building-Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Chalkboard Adhesive	2,500	SF	Main Building-Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Chalkboards	1,500	SF	Annex Building-Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Chalkboard Adhesive	1,500	SF	Annex Building-Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Terrazzo	600	SF	Annex Building-Stairways and Foyer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	2'x4' Lay In Ceiling Tile	25,000	SF	Annex Building-Classrooms, Corridors and Offices	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
27	Linoleum on Shelves	1,650	SF	Annex Building-Classrooms & Assistant Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Linoleum Adhesive on Shelves	1,650	SF	Annex Building-Classrooms and Assistant Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A-1	12x12 Cream w/Beige Spots Floor Tile	4,705	SF	Annex Building-Principal's Office and Classrooms 124, 223, 220 & 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A-2	12x12 Cream w/Beige Spots Floor Tile Mastic	4,705	SF	Annex Building-Principal's Office and Classrooms 124, 223, 220, and 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B-1	12x12 Cream w/Beige Spots Floor Tile	6,040	SF	Annex Building-Rooms 227, 230,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708
 Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom										
B-2	12x12 Cream w/Beige Spots Floor Tile Mastic	6,040	SF	Annex Building-Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C-1	12x12 Cream w/Beige Spots Floor Tile	1,872	SF	Annex Building-Throughout 1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C-2	12x12 Cream w/Beige Spots Floor Tile Mastic	1,872	SF	Annex Building-Throughout 1st & 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-1	Tan Carpet Mastic	500	SF	Main Building-Principal's Office and Adjustment Center	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-2	Green Carpet Mastic - Not Observed			Main Building-Room 202	ASSUMED	MISC								
CM-3	Blue Carpet Adhesive - Not Observed			Main Building-Classrooms 201 and 202	ASSUMED	MISC								
D	Pipe Joint Insulation on Cardboard Insulated Piping	50	SF	Main Building-Basement	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
D-1	12x12 Cream w/Beige Spots Floor Tile	1,320	SF	Annex Building-Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
D-2	12x12 Cream w/Beige Spots Floor Tile Mastic	1,320	SF	Annex Building-Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
E	Aircell Pipe Insulation	20	LF	Main Building-Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
E-1	12x12 Cream w/Beige Spots Floor Tile (114); 9x9 Floor Tile Library	1,500	SF	Engineer's Office and Main Building Library 9x9 Floor Tile- Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
E-2	12x12 Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1	1,500	SF	Engineers Office and Main Building Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F	Pipe Fitting Insulation on Aircell Insulated Piping	3	FITTING	Main Building-Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable		LOW

Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708
 Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												suspect ACBM		
F-1	12x12 Cream w/Beige Spots Floor Tile	1,872	SF	Annex Building- Throughout 1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F-2	12x12 Cream w/Beige Spots Floor Tile Mastic	1,872	SF	Annex Building- Throughout 1st & 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-1	9x9 Black Vinyl Floor Tile	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-2	9x9 Tan Floor Tile	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-1	9x9 Black Vinyl Floor Tile Mastic	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-2	9x9 Tan Floor Tile Mastic	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	Mag Block Pipe Insulation	5	LF	Main Building- Boiler Room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
G-1	12x12 Cream w/Beige Spots Floor Tile	16,000	SF	1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123-127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220-226, 229-231	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
G-2	12x12 Cream w/Beige Spots Floor Tile Mastic	16,000	SF	1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet,	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708
 Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Teachers' Washroom, Rooms 123 - 127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220 - 226, 229 - 231										
H	Pipe Fitting Insulation on Mag Block Insulated Piping			Main Building-Boiler Room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
J	Mag Block Insulation on Boiler			Main Building-Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
K	12x12 Brown & White Floor Tile	520	SF	Main Building-Main Office & Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
K2	12x12 Brown and White Floor Tile Mastic	520	SF	Main Building-Main Office, Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708
Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 9/3/2019
Inspector Name James Lehnhardt
100-04208 5/15/2017
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01A	
01AA	
01B	
01BB	
01C	
01CC	
01D	
01DD	
02A	Not Observed 2019
02A1	Library is Carpeted
02AA	Not Observed 2019
02AA-1	Not Observed 2019
02B	Not Observed 2019
02BB	Not Observed 2019
02C	Not Observed 2019. Walk-In Freezer had 9x9 Removed Inadvertently, Now 12x12 Freezer
02CC	Not Observed 2019
02D	Not Observed 2019
02DD	Not Observed 2019
02E	Not Observed 2019
02EE	Not Observed 2019
03	
04	
04A	Not Observed 2019

Chicago Public Schools

School Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708
Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
05A	Not Observed 2019. Removed Floor Contains Wood
05AA	Not Observed 2019. Wood Floors Only.
05B	Not Observed 2019. Only Wood Floors
05BB	Not Observed 2019. Wood Floors Only
06	
06A	
07	
08	
09	Not Observed 2019
10	
11	
12	Repaired 2018
13	
14	
15	
16	
17	
18	
19	
20	
20A	
21	
22	
23	
24	
25	
26	
27	
28	

Chicago Public Schools

School Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708
Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
A-1	
A-2	
B-1	
B-2	
C-1	
C-2	
CM-1	
CM-2	Not Observed 2019
CM-3	Not Observed 2019
D	Repaired 2018
D-1	Not Observed 2016 & 2019-leave; same tile throughout
D-2	
E	Repaired 2018
E-1	
E-2	
F	Repaired 2018
F-1	
F-2	
FT-1	
FT-2	
FTM-1	
FTM-2	
G	Repaired 2018
G-1	Tile could be present under this HA
G-2	Tile/Mastic Could Be Present under this HA
H	Repaired 2018
J	Repaired 2018
K	
K2	

Chicago Public Schools

School Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Altgeld School & Annex

Unit 22051

Building ID 2050 & 8708

1340 W. 71st St./7007 S. Loomis

Address Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	12x12 Dark Tan Floor Tile	225	SF	Main Office, Restroom, Closet- Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01AA	12x12 Dark Tan Floor Tile Mastic	225	SF	Main Office, Restroom and Closet- Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01B	12x12 Off-White Vinyl Floor Tile	225	SF	Main Building- Main Office, Restroom and Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01BB	12x12 Off-White Floor Tile Mastic	225	SF	Main Building- Main Office, Restroom and Closet	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01C	12x12 Tan Speckled Floor Tile	240	SF	Main Building- Entry to 1st Floor Girls' & Boys' Restroom; 1st & 2nd Floor Teachers' Restrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01CC	12x12 Tan Speckled Floor Tile Mastic	240	SF	Main Building- Entry to 1st Floor Girls' & Boys' Restroom; 1st & 2nd Floor Teachers' Restrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01D	12x12 Tan Streaked Vinyl Floor Tile	1,320	SF	Annex Building- Room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01DD	12x12 Tan Streaked Floor Tile Mastic	1,320	SF	Annex Building- Room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02A	9x9 Gray w/White Streaks Floor Tile - Not Observed			Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom	Chrysotile	MISC					
02A1	9x9 Tan Speckled Floor Tile	1,500	SF	Main Building- Library (Carpeted) and Library Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02AA	9x9 Gray w/White Streaks Floor Tile Mastic - Not Observed			Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom	Chrysotile	MISC					
02AA-1	9x9 Tan Speckled Floor Tile - Not Observed			Engineer's Office, Library and Library Office	Chrysotile	MISC					
02B	9x9 Tan w/Streaks Floor Tile - Not Observed			Annex Building- Principal's Office and Classrooms 124, 223, 220, 229	Chrysotile	MISC					
02BB	9x9 Tan w/Streaks Floor Tile Mastic - Not Observed			Annex Building- Principal's Office and Classrooms 124, 223, 220, and 229	Chrysotile	MISC					
02C	9x9 Off-White Floor Tile - Not Observed			Annex Building- Lunchroom and Restroom, Office Restroom, Teacher	Chrysotile	MISC					

Chicago Public Schools

School Altgeld School & Annex
 1340 W. 71st St./7007 S. Loomis
Address Blvd (outdated: 1426 W. 71st St.)

Unit 22051
 Chicago, IL, 60636

Building ID 2050 & 8708
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Restroom, and Room 125							
02CC	9x9 Off-White Floor Tile Mastic - Not Observed			Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	Chrysotile	MISC					
02D	9x9 Olive Green Floor Tile - Not Observed			Annex Building- Throughout 1st & 2nd Floor Corridors	Chrysotile	MISC					
02DD	9x9 Olive Green Floor Tile - Not Observed			Annex Building- Throughout 1st & 2nd Floor Corridors	Chrysotile	MISC					
02E	9x9 Off-White w/Specks Floor Tile - Not Observed			Annex Building- Throughout 1st & 2nd Floor Corridors	Chrysotile	MISC					
02EE	9x9 Off-White Floor Tile Mastic - Not Observed			Annex building- Throughout 1st & 2nd Floor Corridors	Chrysotile	MISC					
03	Hard Coat Plaster	120,000	SF	Throughout Main Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	Burlap on Walls	500	SF	Library, 3rd Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04A	Burlap Wall Covering	100	SF	Annex Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A	Green Linoleum - Not Observed			Main Building- Room 101	Assumed	MISC					
05AA	Green Linoleum Mastic - Not Observed			Main Building- Room 101	Assumed	MISC					
05B	Tan Linoleum - Not Observed			Main Building- Room 203 and Storage	Assumed	MISC					
05BB	Tan Linoleum Mastic - Not Observed			Main Building- Room 203 and Storage Room	Assumed	MISC					
06	1'x1' Ceiling Tile	900	SF	Main Building- Room 202	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
06A	1'x1' Ceiling Tile Adhesive	900	SF	Main Building- Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	2'x4' Wormy Patterned Lay-In Ceiling Tile	12	SF	Main Building- Lunchroom	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
08	2'x4' Perferated Lay-In Ceiling Tile	525	SF	Main Building- Kitchen	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
09	Spray-On Fireproofing - Not Observed			Throughout Annex	Assumed	SURFACE					
10	Ceiling Plaster	300	SF	Annex Washrooms	Chrysotile	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Troweled-On Ceiling Plaster	1,200	SF	Throughout Annex Mechanical Areas and Janitor Closets	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Altgeld School & Annex

Unit 22051

Building ID 2050 & 8708

1340 W. 71st St./7007 S. Loomis

Address Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
12	Cardboard Pipe Insulation	410	LF	Main Building Basement (Patched 2018)	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
13	Sink Undercoat	3	SF	Main Building- Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Sink Undercoat	9	SF	Annex Building- Classrooms 120, 124, & 125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Ceramic Tile Floor Tile Grout	900	SF	Main Building- Girl's and Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Ceramic Floor Tile Adhesive	900	SF	Main Building- Girl's & Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Ceramic Floor Tile Grout	600	SF	Annex Building- Girl's & Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	Ceramic Floor Tile Adhesive	600	SF	Annex Building- Girls' & Boys' Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Insulation Inside of Vault Door	56	SF	Annex Building- Main Office and 2nd Floor Corridor	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Insulation Inside of Fire Rated Doors	102	SF	Annex Building- Entrances and Speech Room	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	Insulation Inside of Fire Rated Doors	204	SF	Main Building- Entrances	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Chalkboards	2,500	SF	Main Building- Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Chalkboard Adhesive	2,500	SF	Main Building- Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Chalkboards	1,500	SF	Annex Building- Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Chalkboard Adhesive	1,500	SF	Annex Building- Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Terrazzo	600	SF	Annex Building- Stairways and Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	2'x4' Lay In Ceiling Tile	25,000	SF	Annex Building- Classrooms, Corridors and Offices	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
27	Linoleum on Shelves	1,650	SF	Annex Building- Classrooms & Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Linoleum Adhesive on Shelves	1,650	SF	Annex Building- Classrooms and Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A-1	12x12 Cream w/Beige Spots Floor Tile	4,705	SF	Annex Building- Principal's Office and Classrooms 124, 223, 220 & 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A-2	12x12 Cream w/Beige Spots Floor Tile Mastic	4,705	SF	Annex Building- Principal's Office and Classrooms 124, 223, 220, and 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Altgeld School & Annex

Unit 22051

Building ID 2050 & 8708

1340 W. 71st St./7007 S. Loomis

Address Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
B-1	12x12 Cream w/Beige Spots Floor Tile	6,040	SF	Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B-2	12x12 Cream w/Beige Spots Floor Tile Mastic	6,040	SF	Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C-1	12x12 Cream w/Beige Spots Floor Tile	1,872	SF	Annex Building- Throughout 1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C-2	12x12 Cream w/Beige Spots Floor Tile Mastic	1,872	SF	Annex Building- Throughout 1st & 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-1	Tan Carpet Mastic	500	SF	Main Building- Principal's Office and Adjustment Center	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-2	Green Carpet Mastic - Not Observed			Main Building- Room 202	Assumed	MISC					
CM-3	Blue Carpet Adhesive - Not Observed			Main Building- Classrooms 201 and 202	Assumed	MISC					
D	Pipe Joint Insulation on Cardboard Insulated Piping	50	SF	Main Building- Basement	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
D-1	12x12 Cream w/Beige Spots Floor Tile	1,320	SF	Annex Building- Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
D-2	12x12 Cream w/Beige Spots Floor Tile Mastic	1,320	SF	Annex Building- Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	20	LF	Main Building- Boiler Room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E-1	12x12 Cream w/Beige Spots Floor Tile (114); 9x9 Floor Tile Library	1,500	SF	Engineer's Office and Main Building Library 9x9 Floor Tile- Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E-2	12x12 Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1	1,500	SF	Engineers Office and Main Building Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F	Pipe Fitting Insulation on Aircell Insulated Piping	3	FITTING	Main Building- Boiler Room	Chrysotile	TSI	Yes	0	FITTING	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F-1	12x12 Cream w/Beige Spots Floor Tile	1,872	SF	Annex Building- Throughout 1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F-2	12x12 Cream w/Beige Spots Floor Tile Mastic	1,872	SF	Annex Building- Throughout 1st & 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-1	9x9 Black Vinyl Floor Tile	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-2	9x9 Tan Floor Tile	250	SF	Main Building- Under Carpet in	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Altgeld School & Annex

Unit 22051

Building ID 2050 & 8708

1340 W. 71st St./7007 S. Loomis

Address Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Principal's and Adjoining Office							
FTM-1	9x9 Black Vinyl Floor Tile Mastic	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-2	9x9 Tan Floor Tile Mastic	250	SF	Main Building- Under Carpet in Principal's and Adjoining Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Mag Block Pipe Insulation	5	LF	Main Building- Boiler Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
G-1	12x12 Cream w/Beige Spots Floor Tile	16,000	SF	1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123-127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220-226, 229-231	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G-2	12x12 Cream w/Beige Spots Floor Tile Mastic	16,000	SF	1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123 - 127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220 - 226, 229 - 231	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
H	Pipe Fitting Insulation on Mag Block Insulated Piping			Main Building- Boiler Room	Assumed	TSI	Yes	0		7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
J	Mag Block Insulation on Boiler			Main Building- Boiler Room	Chrysotile	TSI	Yes	0		7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
K	12x12 Brown & White Floor Tile	520	SF	Main Building- Main Office & Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K2	12x12 Brown and White Floor Tile Mastic	520	SF	Main Building- Main Office, Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Altgeld School & Annex
 1340 W. 71st St./7007 S. Loomis
Address Blvd (outdated: 1426 W. 71st St.)

Unit 22051
 Chicago, IL, 60636

Building ID 2050 & 8708
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.
 174 N. Brandon Drive Glendale Heights, IL, 60139
 Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	10/02/2019
Manager Planner Name	Shawn Brown
100-00440	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
01AA	
01B	
01BB	
01C	
01CC	
01D	
01DD	
02A	
02A1	
02AA	
02AA-1	

Chicago Public Schools

School Altgeld School & Annex
 1340 W. 71st St./7007 S. Loomis
Address Blvd (outdated: 1426 W. 71st St.)

Unit 22051
 Chicago, IL, 60636

Building ID 2050 & 8708
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.
 174 N. Brandon Drive Glendale Heights, IL, 60139
 Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
02B	
02BB	
02C	
02CC	
02D	
02DD	
02E	
02EE	
03	
04	
04A	
05A	
05AA	
05B	
05BB	
06	
06A	
07	
08	
09	
10	
11	
12	
13	
14	

Chicago Public Schools

School Altgeld School & Annex
 1340 W. 71st St./7007 S. Loomis
Address Blvd (outdated: 1426 W. 71st St.)

Unit 22051
 Chicago, IL, 60636

Building ID 2050 & 8708
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.
 174 N. Brandon Drive Glendale Heights, IL, 60139
 Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
15	
16	
17	
18	
19	
20	
20A	
21	
22	
23	
24	
25	
26	
27	
28	
A-1	
A-2	
B-1	
B-2	
C-1	
C-2	
CM-1	
CM-2	
CM-3	
D	

Chicago Public Schools

School Altgeld School & Annex
 1340 W. 71st St./7007 S. Loomis
Address Blvd (outdated: 1426 W. 71st St.)

Unit 22051
 Chicago, IL, 60636

Building ID 2050 & 8708
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.
 174 N. Brandon Drive Glendale Heights, IL, 60139
 Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
D-1	
D-2	
E	
E-1	
E-2	
F	
F-1	
F-2	
FT-1	
FT-2	
FTM-1	
FTM-2	
G	
G-1	
G-2	
H	
J	
K	
K2	

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**
MATERIAL DESCRIPTION: **12x12 Dark Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office, Restroom, Closet- Main Building**
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01A**
MATERIAL DESCRIPTION: **12x12 Dark Tan Floor Tile**
MATERIAL LOCATION: **Main Office, Restroom, Closet- Main Building**
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01AA**
MATERIAL DESCRIPTION: **12x12 Dark Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office, Restroom and Closet- Main Building**

MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01AA**
MATERIAL DESCRIPTION: **12x12 Dark Tan Floor Tile Mastic**
MATERIAL LOCATION: **Main Office, Restroom and Closet- Main Building**
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01B**
MATERIAL DESCRIPTION: **12x12 Off-White Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Main Office, Restroom and Closet**

MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01B**
MATERIAL DESCRIPTION: **12x12 Off-White Vinyl Floor Tile**
MATERIAL LOCATION: **Main Building- Main Office, Restroom and Closet**
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01BB**
MATERIAL DESCRIPTION: **12x12 Off-White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Main Office, Restroom and Closet**

MATERIAL QUANTITY: **225**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01BB**
MATERIAL DESCRIPTION: **12x12 Off-White Floor Tile Mastic**
MATERIAL LOCATION: **Main Building- Main Office, Restroom and Closet**
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01C**
MATERIAL DESCRIPTION: **12x12 Tan Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Entry to 1st Floor Girls' & Boys' Restroom; 1st & 2nd Floor Teachers' Restrooms**

MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01C**
MATERIAL DESCRIPTION: **12x12 Tan Speckled Floor Tile**
MATERIAL LOCATION: **Main Building- Entry to 1st Floor Girls' & Boys' Restroom; 1st & 2nd Floor Teachers' Restrooms**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01CC**
MATERIAL DESCRIPTION: **12x12 Tan Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Entry to 1st Floor Girls' & Boys' Restroom; 1st & 2nd Floor Teachers' Restrooms**

MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01CC**
MATERIAL DESCRIPTION: **12x12 Tan Speckled Floor Tile Mastic**
MATERIAL LOCATION: **Main Building- Entry to 1st Floor Girls' & Boys' Restroom; 1st & 2nd Floor Teachers' Restrooms**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01D**
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Room 120**

MATERIAL QUANTITY: **1320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01D**
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile**
MATERIAL LOCATION: **Annex Building- Room 120**
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01DD**
MATERIAL DESCRIPTION: **12x12 Tan Streaked Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Room 120**

MATERIAL QUANTITY: **1320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01DD**
MATERIAL DESCRIPTION: **12x12 Tan Streaked Floor Tile Mastic**
MATERIAL LOCATION: **Annex Building- Room 120**
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A**
MATERIAL DESCRIPTION: **9x9 Gray w/White Streaks Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: **09/03/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02A**
MATERIAL DESCRIPTION: **9x9 Gray w/White Streaks Floor Tile - Not Observed**
MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A1**
MATERIAL DESCRIPTION: **9x9 Tan Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Library (Carpeted) and Library Office**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS: **Library is Carpeted**

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02A1**
MATERIAL DESCRIPTION: **9x9 Tan Speckled Floor Tile**
MATERIAL LOCATION: **Main Building- Library (Carpeted) and Library Office**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02AA**
MATERIAL DESCRIPTION: **9x9 Gray w/White Streaks Floor Tile Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: **09/03/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02AA**
MATERIAL DESCRIPTION: **9x9 Gray w/White Streaks Floor Tile Mastic - Not Observed**
MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02AA-1**
MATERIAL DESCRIPTION: **9x9 Tan Speckled Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's Office, Library and Library Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02AA-1**
MATERIAL DESCRIPTION: **9x9 Tan Speckled Floor Tile - Not Observed**
MATERIAL LOCATION: **Engineer's Office, Library and Library Office**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **9x9 Tan w/Streaks Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220, 229**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **9x9 Tan w/Streaks Floor Tile - Not Observed**
MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220, 229**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02BB**
MATERIAL DESCRIPTION: **9x9 Tan w/Streaks Floor Tile Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220, and 229**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02BB**
MATERIAL DESCRIPTION: **9x9 Tan w/Streaks Floor Tile Mastic - Not Observed**
MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220, and 229**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02C**
MATERIAL DESCRIPTION: **9x9 Off-White Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019. Walk-In Freezer had 9x9 Removed Inadvertently, Now 12x12 Freezer**

Inspector's Signature: _____ Date: **09/03/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02C**
MATERIAL DESCRIPTION: **9x9 Off-White Floor Tile - Not Observed**
MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02CC**
MATERIAL DESCRIPTION: **9x9 Off-White Floor Tile Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: **09/03/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02CC**
MATERIAL DESCRIPTION: **9x9 Off-White Floor Tile Mastic - Not Observed**
MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02D**
MATERIAL DESCRIPTION: **9x9 Olive Green Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02D**
MATERIAL DESCRIPTION: **9x9 Olive Green Floor Tile - Not Observed**
MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02DD**
MATERIAL DESCRIPTION: **9x9 Olive Green Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02DD**
MATERIAL DESCRIPTION: **9x9 Olive Green Floor Tile - Not Observed**
MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02E**
MATERIAL DESCRIPTION: **9x9 Off-White w/Specks Floor Tile - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02E**
MATERIAL DESCRIPTION: **9x9 Off-White w/Specks Floor Tile - Not Observed**
MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02EE**
MATERIAL DESCRIPTION: **9x9 Off-White Floor Tile Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex building- Throughout 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02EE**
MATERIAL DESCRIPTION: **9x9 Off-White Floor Tile Mastic - Not Observed**
MATERIAL LOCATION: **Annex building- Throughout 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Main Building**

MATERIAL QUANTITY: **120000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout Main Building**
MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Burlap on Walls**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library, 3rd Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Burlap on Walls**
MATERIAL LOCATION: **Library, 3rd Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04A**
MATERIAL DESCRIPTION: **Burlap Wall Covering**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Office**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **04A**
MATERIAL DESCRIPTION: **Burlap Wall Covering**
MATERIAL LOCATION: **Annex Office**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**
MATERIAL DESCRIPTION: **Green Linoleum - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building- Room 101**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed 2019. Removed Floor Contains Wood**

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **05A**
MATERIAL DESCRIPTION: **Green Linoleum - Not Observed**
MATERIAL LOCATION: **Main Building- Room 101**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05AA**
MATERIAL DESCRIPTION: **Green Linoleum Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building- Room 101**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed 2019. Wood Floors Only.**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **05AA**
MATERIAL DESCRIPTION: **Green Linoleum Mastic - Not Observed**
MATERIAL LOCATION: **Main Building- Room 101**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05B**
MATERIAL DESCRIPTION: **Tan Linoleum - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building- Room 203 and Storage**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019. Only Wood Floors**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **05B**
MATERIAL DESCRIPTION: **Tan Linoleum - Not Observed**
MATERIAL LOCATION: **Main Building- Room 203 and Storage**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05BB**
MATERIAL DESCRIPTION: **Tan Linoleum Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building- Room 203 and Storage Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019. Wood Floors Only**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **05BB**
MATERIAL DESCRIPTION: **Tan Linoleum Mastic - Not Observed**
MATERIAL LOCATION: **Main Building- Room 203 and Storage Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Room 202**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**
MATERIAL LOCATION: **Main Building- Room 202**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Room 202**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **06A**
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Adhesive**
MATERIAL LOCATION: **Main Building- Room 202**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **2'x4' Wormy Patterned Lay-In Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Lunchroom**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **2'x4' Wormy Patterned Lay-In Ceiling Tile**
MATERIAL LOCATION: **Main Building- Lunchroom**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **2'x4' Perferated Lay-In Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Kitchen**
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **2'x4' Perferated Lay-In Ceiling Tile**
MATERIAL LOCATION: **Main Building- Kitchen**
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Spray-On Fireproofing - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Spray-On Fireproofing - Not Observed**
MATERIAL LOCATION: **Throughout Annex**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Ceiling Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Washrooms**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Ceiling Plaster**
MATERIAL LOCATION: **Annex Washrooms**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Troweled-On Ceiling Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Annex Mechanical Areas and Janitor Closets**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Troweled-On Ceiling Plaster**
MATERIAL LOCATION: **Throughout Annex Mechanical Areas and Janitor Closets**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building Basement (Patched 2018)**
MATERIAL QUANTITY: **410** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS: **Repaired 2018**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Main Building Basement (Patched 2018)**
MATERIAL QUANTITY: **410** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Sink Undercoat**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Library Office**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Sink Undercoat**
MATERIAL LOCATION: **Main Building- Library Office**
MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Sink Undercoat**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Classrooms 120, 124, & 125**

MATERIAL QUANTITY: **9** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Sink Undercoat**
MATERIAL LOCATION: **Annex Building- Classrooms 120, 124, & 125**
MATERIAL QUANTITY: **9** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Ceramic Tile Floor Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Girl's and Boy's Washrooms**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Ceramic Tile Floor Tile Grout**
MATERIAL LOCATION: **Main Building- Girl's and Boy's Washrooms**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Girl's & Boy's Washrooms**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**
MATERIAL LOCATION: **Main Building- Girl's & Boy's Washrooms**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Girl's & Boy's Washrooms**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Grout**
MATERIAL LOCATION: **Annex Building- Girl's & Boy's Washrooms**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Girls' & Boys' Washrooms**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**
MATERIAL LOCATION: **Annex Building- Girls' & Boys' Washrooms**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Insulation Inside of Vault Door**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Main Office and 2nd Floor Corridor**
MATERIAL QUANTITY: **56** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Insulation Inside of Vault Door**
MATERIAL LOCATION: **Annex Building- Main Office and 2nd Floor Corridor**
MATERIAL QUANTITY: **56** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Entrances and Speech Room**

MATERIAL QUANTITY: **102** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**
MATERIAL LOCATION: **Annex Building- Entrances and Speech Room**
MATERIAL QUANTITY: **102** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**
HISTORICAL AHERA DAMAGE CATEGORY: **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Entrances**
MATERIAL QUANTITY: **204** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**
MATERIAL LOCATION: **Main Building- Entrances**
MATERIAL QUANTITY: **204** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Chalkboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Classrooms**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Chalkboards**
MATERIAL LOCATION: **Main Building- Classrooms**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Chalkboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Classrooms**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Chalkboard Adhesive**
MATERIAL LOCATION: **Main Building- Classrooms**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Chalkboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Classrooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Chalkboards**
MATERIAL LOCATION: **Annex Building- Classrooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Chalkboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Classrooms**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Chalkboard Adhesive**
MATERIAL LOCATION: **Annex Building- Classrooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Stairways and Foyer**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Annex Building- Stairways and Foyer**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **2'x4' Lay In Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Classrooms, Corridors and Offices**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **2'x4' Lay In Ceiling Tile**
MATERIAL LOCATION: **Annex Building- Classrooms, Corridors and Offices**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Linoleum on Shelves**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Classrooms & Assistant Principal's Office**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Linoleum on Shelves**
MATERIAL LOCATION: **Annex Building- Classrooms & Assistant Principal's Office**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Linoleum Adhesive on Shelves**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Classrooms and Assistant Principal's Office**

MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Linoleum Adhesive on Shelves**
MATERIAL LOCATION: **Annex Building- Classrooms and Assistant Principal's Office**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220 & 229**
MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **A-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220 & 229**
MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220, and 229**

MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **A-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
MATERIAL LOCATION: **Annex Building- Principal's Office and Classrooms 124, 223, 220, and 229**
MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**

MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **B-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**
MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**

MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **B-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
MATERIAL LOCATION: **Annex Building- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**
MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Throughout 1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **C-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
MATERIAL LOCATION: **Annex Building- Throughout 1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **C-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **Tan Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Principal's Office and Adjustment Center**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **Tan Carpet Mastic**
MATERIAL LOCATION: **Main Building- Principal's Office and Adjustment Center**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **Green Carpet Mastic - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building- Room 202**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **Green Carpet Mastic - Not Observed**
MATERIAL LOCATION: **Main Building- Room 202**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **Blue Carpet Adhesive - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building- Classrooms 201 and 202**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **Blue Carpet Adhesive - Not Observed**
MATERIAL LOCATION: **Main Building- Classrooms 201 and 202**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Pipe Joint Insulation on Cardboard Insulated Piping**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Basement**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Repaired 2018**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Pipe Joint Insulation on Cardboard Insulated Piping**
MATERIAL LOCATION: **Main Building- Basement**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Room 120**

MATERIAL QUANTITY: **1320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS: **Not Observed 2016 & 2019-leave; same tile throughout**

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **D-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
MATERIAL LOCATION: **Annex Building- Room 120**
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Room 120**

MATERIAL QUANTITY: **1320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **D-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
MATERIAL LOCATION: **Annex Building- Room 120**
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Boiler Room**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS: **Repaired 2018**

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Main Building- Boiler Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile (114); 9x9 Floor Tile Library**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office and Main Building Library 9x9 Floor Tile- Library**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **E-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile (114); 9x9 Floor Tile Library**
MATERIAL LOCATION: **Engineer's Office and Main Building Library 9x9 Floor Tile- Library**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineers Office and Main Building Library**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **E-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1**
MATERIAL LOCATION: **Engineers Office and Main Building Library**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Aircell Insulated Piping**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Boiler Room**
MATERIAL QUANTITY: **3** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**
COMMENTS: **Repaired 2018**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Aircell Insulated Piping**
MATERIAL LOCATION: **Main Building- Boiler Room**
MATERIAL QUANTITY: **3** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Annex Building- Throughout 1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **F-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
MATERIAL LOCATION: **Annex Building- Throughout 1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **F-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
MATERIAL LOCATION: **Annex Building- Throughout 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-1**
MATERIAL DESCRIPTION: **9x9 Black Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **FT-1**
MATERIAL DESCRIPTION: **9x9 Black Vinyl Floor Tile**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-2**
MATERIAL DESCRIPTION: **9x9 Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **FT-2**
MATERIAL DESCRIPTION: **9x9 Tan Floor Tile**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-1**
MATERIAL DESCRIPTION: **9x9 Black Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **FTM-1**
MATERIAL DESCRIPTION: **9x9 Black Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-2**
MATERIAL DESCRIPTION: **9x9 Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **FTM-2**
MATERIAL DESCRIPTION: **9x9 Tan Floor Tile Mastic**
MATERIAL LOCATION: **Main Building- Under Carpet in Principal's and Adjoining Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Boiler Room**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS: **Repaired 2018**

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
MATERIAL LOCATION: **Main Building- Boiler Room**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123-127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220-226, 229-231**

MATERIAL QUANTITY: **16000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Tile could be present under this HA**

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **G-1**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile**
MATERIAL LOCATION: **1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123-127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220-226, 229-231**
MATERIAL QUANTITY: **16000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123 - 127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220 - 226, 229 - 231**

MATERIAL QUANTITY: **16000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Tile/Mastic Could Be Present under this HA**

Inspector's Signature: _____ Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **G-2**
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile Mastic**
MATERIAL LOCATION: **1st & 2nd Floor Hallways, Engineer's Office, Main Office, Kitchen, 1st Floor Janitor's Closet, Teachers' Washroom, Rooms 123 - 127, Teachers' Lounge, Janitor's Closet, Computer Lab, Rooms 210, 220 - 226, 229 - 231**
MATERIAL QUANTITY: **16000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Mag Block Insulated Piping**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

COMMENTS: **Repaired 2018**

Inspector's Signature: _____

Date: **09/03/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Mag Block Insulated Piping**
MATERIAL LOCATION: **Main Building- Boiler Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Mag Block Insulation on Boiler**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

COMMENTS: **Repaired 2018**

Inspector's Signature: _____

Date: **09/03/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Mag Block Insulation on Boiler**
MATERIAL LOCATION: **Main Building- Boiler Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **12x12 Brown & White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Main Office & Restroom**

MATERIAL QUANTITY: **520**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **12x12 Brown & White Floor Tile**
MATERIAL LOCATION: **Main Building- Main Office & Restroom**
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **9/3/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-04208**
(outdated: 1426 W. 71st St.)

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K2**
MATERIAL DESCRIPTION: **12x12 Brown and White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building- Main Office, Restroom**

MATERIAL QUANTITY: **520**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 09/03/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **10/2/2019**
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **K2**
MATERIAL DESCRIPTION: **12x12 Brown and White Floor Tile Mastic**
MATERIAL LOCATION: **Main Building- Main Office, Restroom**
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/02/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

2018



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

James Lehnhardt

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/29/2018

Exam Date: 10/29/2018

Expiration Date: 10/29/2019

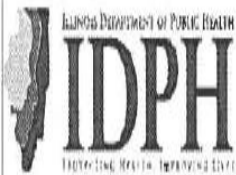


Certificate Number: BIR1810292878

Kathy DeSalvo, Director

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

	ASBESTOS PROFESSIONAL LICENSE	ENDORSEMENTS	TC EXPIRES
		INSPECTOR	11/30/2018
ID NUMBER	ISSUED	EXPIRES	
100 - 04208	4/23/2019	05/15/2020	
JAMES D LEHNHARDT 15301 KILPATRICK AVE, APT. OAK FOREST, IL 60452 Environmental Health			PROJECT MANAGER
			12/5/2018
			AIR SAMPLING PROFESSIONAL
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/18/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903BIR03

Certificate Number:



PUBLIC HEALTH & SAFETY Inc.

Environmental and Occupational Services
37 S. Ashland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2901

Director of Training

Nicholas J. Penelf

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN
has completed the Asbestos Management Planner Refresher course and passed the examination
on 03/18/2019 with a minimum score of 70% or better. Training was in accordance with U.S.
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903MPR01

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
371 S. Ashland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2501

Director of Training

Nicholas J. Peneff

Doctor of Public Health

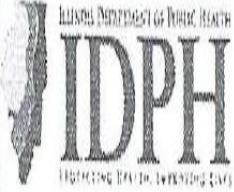


Phone: 312-491-0081

FORM # A-011

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

	ASBESTOS PROFESSIONAL LICENSE	ENDORSEMENTS	TC EXPIRES	
ID NUMBER	ISSUED	EXPIRES	INSPECTOR	3/19/2019
100 - 02950	3/6/2019	05/15/2020	PROJECT MANAGER	4/9/2019
KEITH CLOUGH			AIR SAMPLING PROFESSIONAL	Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.
524 HOMELAND RD				
MATTESON, IL 60443				
Environmental Health				

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed