

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2062  
SCHOOL NAME: Audubon School  
ADDRESS OF SCHOOL: 3500 N Hoyne Avenue  
CITY: Chicago, IL, 60618

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **6/3/2019**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/14/2022 ENROLLMENT 575  
IDPH INSPECTOR LICENSE NUMBER: 100-20530  
IDPH LICENSED INSPECTOR NAME (Please Print): Colin Hendrickson  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah  
  
DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

*Richard J. Schleyer*

5/4/2022

Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Audubon School**

3500 N Hoyne Avenue  
Chicago, IL, 60618

Unit: 22091  
Building ID: 2110

IDPH ID Number: 14-016-2990-2062

**REPORT DATE:**

Wednesday, May 04, 2022

**Prepared for:**

**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

**Specialty Consulting, Inc.**

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

05/04/2022

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 22091                      Region: 01                      IDPH ID: 14-016-2990-2062

School: Audubon School                      Building ID: 2110

Address: 3500 N Hoyne Avenue

Chicago, IL, 60618

Building Contact: Naudziunas, Joseph

Contact Phone: 7737094560

Current Building Owners: Chicago Public Schools

Reinspection Date: 4/14/2022

Review Date: 05/04/2022

Inspector: Colin Hendrickson

Inspector IDPH License: 100-20530

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,  
Specialty Consulting, Inc.



Jigar Shah  
100-07342

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: May 04, 2022

RE: Audubon School, Unit 22091  
3500 N Hoyne Avenue  
Chicago, IL, 60618

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Audubon School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Audubon School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Audubon School Unit: 22091 Region: 01  
Address: 3500 N Hoyne Avenue Chicago, IL, 60618  
IDPH ID: 14-016-2990-2062 Building ID: 2110  
Contact: Naudziunas, Joseph Phone: 7737094560

### 2. Description of Facility

Original Construction: 1894 Additional Construction: 1906  
Total Square Footage: 47449 No of Floors: 3  
Current Occupancy: 575

### 3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602


### 4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.  
Contact: Jigar Shah  
Address 2942 W. Van Buren Street  
Phone: (312) 319-7575 Fax: (312) 319-7580

### 5. Inspector

Inspector Name: Colin Hendrickson


Inspector IDPH license # 100-20530  
Reinspection Date: 4/14/2022

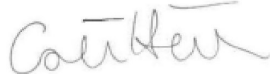Signature:   
Date: 4/14/2022

### 6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342

Signature:   
Date: 05/04/2022

### 7. Review Date: 05/04/2022

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/4/2022

Name: Richard J.Schleyer

## II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Audubon School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2110:

15	Aircell Pipe Insulation
16	Aircell Pipe Insulation
K	MJP E/F/V on Aircell Pipe Insulation
L	MJP E/F/V on Aircell Pipe Insulation
M	MJP E/F/V on Cardboard Pipe Insulation
N	MJP E/F/V on Cardboard Pipe Insulation

B. The following new homogenous areas have been identified for Building 2110:

28	2' x 2' white Ceiling Tile w/pinholes and grooves
29	2' x 4' white ceiling tile w/ pinholes and grooves
30	2' x 2' smooth ceiling tile
31	12" x 12" white w/dark specs
31M	VFT and Mastic
32	Carpet Mastic
33	12" x 12" Light blue w/ blue specs
33M	VFT and Mastic



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

20	Grey w/Colored Swirls Linoleum
20A	Grey w/Colored Swirls Linoleum Mastic
21	Wood Laminate Flooring over 12"x12" White w/Light brown Speck VFT
21A	Wood Laminate Flooring over 12"x12" White w/light brown speck Mastic
22	12"x12" Light Brown w/Brown Speckles VFT
22A	12"x12" Light Brown w/Brown Speckles VFT Mastic
23	12"x12" Peach w/White Speckles VFT
23A	12"x12" Peach w/White Speckles VFT Mastic
24	12"x12" White w/Light Brown Speckles VFT
24A	12"x12" White w/Light Brown Speckles VFT Mastic
26	2' x 2' Ceiling Tile
27	Blue Flame Retardent Draperies
28	2' x 2' white Ceiling Tile w/pinholes and grooves
29	2' x 4' white ceiling tile w/ pinholes and grooves
30	2' x 2' smooth ceiling tile
31	12" x 12" white w/dark specs
31M	VFT and Mastic
32	Carpet Mastic
33	12" x 12" Light blue w/ blue specs
33M	VFT and Mastic

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Colin Hendrickson , IDPH License # 100-20530. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 4/14/2020

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Audubon School Building 2110 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Audubon School Unit 22091 Building ID 2110

Address 3500 N Hoyne Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
02	Hard Coat Plaster			Throughout - 1893 Bldg.	NO_ACBM	SURFACE								
05	Hard Coat Plaster			Throughout - 1906 Bldg.	NO_ACBM	SURFACE								
06	2'x4' White Ceiling Tile			Throughout Fieldhouse - 1893 Bldg.	NO_ACBM	MISC								
06A	2'x4' White Ceiling Tile			Basement Luchroom #2 - 1906 Bldg.	NO_ACBM	MISC								
07	MJP E/F/V on Fiberglass Pipe Insulation			Tank Room, Boiler Room, Lunchroom #1 Heating Coil Cage, Boy's Toilet - 1893 Bldg.	NO_ACBM	TSI								
15	Aircell Pipe Insulation	30	LF	Basement Corridor, Teachers Toilet, Basement Girls Toilet - 1893 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with potential for significant damage		MODERATE
16	Aircell Pipe Insulation	25	LF	Basement Main Corridor, 001 (Abated) - 1906 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with potential for significant damage		MODERATE
17	Cardboard Pipe Insulation	687	LF	Basement Passages, Corridors, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with potential for significant damage		MODERATE
18	Cardboard Pipe Insulation	245	LF	Basement: Main Corridor - 1906 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with potential for significant damage		MODERATE
19	Green Linoleum (painted gray)	850	SF	3rd Floor Assembly Hall/ Gymnasium Stage - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
19A	Green Linoleum Mastic (Painted gray)	850	SF	3rd Floor Assembly Hall /Gymnasium Stage - 1893 Bldg.	CHR	MISC	N	None	0		No	ACBM with the potential for damage		LOW
20	Grey w/Colored Swirls Linoleum	1,400	SF	Rooms 206A, 206 & Closet - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20A	Grey w/Colored Swirls Linoleum Mastic	1,400	SF	Rooms 206A, 206 & Closet - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Wood Laminate Flooring over 12"x12" White w/Light brown Speck VFT	600	SF	2nd Floor Teacher's Lounge - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
21A	Wood Laminate Flooring over 12"x12" White w/light brown speck Mastic	600	SF	2nd Floor Teacher's Lounge - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Audubon School Unit 22091 Building ID 2110

Address 3500 N Hoyne Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
22	12"x12" Light Brown w/Brown Speckles VFT	550	SF	Main Office - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
22A	12"x12" Light Brown w/Brown Speckles VFT Mastic	550	SF	Main Office - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" Peach w/White Speckles VFT	600	SF	Basement Room 006 - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
23A	12"x12" Peach w/White Speckles VFT Mastic	600	SF	Basement Room 006 - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12"x12" White w/Light Brown Speckles VFT	700	SF	Room 203 - 1906 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
24A	12"x12" White w/Light Brown Speckles VFT Mastic	700	SF	Room 203 - 1906 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Aircell Duct Insulation			Basement Lunchroom #2 - 1906 Bldg. (above ceiling tiles).	ABATED	TSI	Y	NONE	0		No			
26	2' x 2' Ceiling Tile	1,600	SF	Rooms 105 - 1893 Bldg.	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
27	Blue Flame Retardent Draperies	800	SF	Auditorium - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	2' x 2' white Ceiling Tile w/pinholes and grooves	400	SF	3rd Floor Corridor (1898 building)	ASSUMED	MISC	Y	NONE				ACBM with the potential for damage		LOW
29	2' x 4' white ceiling tile w/ pinholes and grooves	1,200	SF	Rooms 301, 201, 101 (1906 building)	ASSUMED	MISC	Y	NONE				ACBM with the potential for damage		LOW
30	2' x 2' smooth ceiling tile	400	SF	Room 308 (1898 Building)	ASSUMED	MISC	Y	NONE				ACBM with the potential for damage		LOW
31	12" x 12" white w/dark specs	400	SF	Room 001 (Community Room - 1906 Building)	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		LOW
31M	VFT and Mastic	400	SF	Room 001 (Community Room - 1906 Building)	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
32	Carpet Mastic	500	SF	Annex / Hut Building	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		LOW
33	12" x 12" Light blue w/ blue specs	800	SF	Throughout Fieldhouse	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		LOW
33M	VFT and Mastic	800	SF	Throughout Fieldhouse	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
D	White w/Brown Streaks Linoleum Mastic	3,400	SF	3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F	12"x12" Pale Green w/White & Dk Green Speckles VFT	2,000	SF	Basement: Room 004, Engineer's	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Audubon School Unit 22091 Building ID 2110

Address 3500 N Hoyne Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Storage, Lunchroom #1 - 1893 Bldg.										
G	12"x12" Pale Green w/White & Dk Green Speckles VFT	2,150	SF	Basement Lunchroom #2, Kitchen - 1906 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
H	12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic	2,000	SF	Basement: Room 004, Engineer's Storage, Lunchroom #1, Room 005 - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
I	12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic	2,150	SF	Basement Lunchroom #2, Kitchen - 1906 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
J	White w/Brown Streaks Linoleum	3,400	SF	3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
K	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Basement Corridor, Teachers Toilet, Baement Girls Toilet - 1893 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with potential for significant damage		MODERATE
L	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Basement Main Corridor, Community Room (Room 001) - 1906 Bldg	CHR	TSI	Y	NONE	0		Yes	ACBM with potential for significant damage		MODERATE
M	MJP E/F/V on Cardboard Pipe Insulation	37	FITTING	Basement Passages, 004, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg	CHR	TSI	Y	NONE	0		Yes	ACBM with potential for significant damage		MODERATE
N	MJP E/F/V on Cardboard Pipe Insulation	19	FITTING	Basement: Main Corridor, Lunchroom #2 & Room 001 (Library) - 1906 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with potential for significant damage		MODERATE
O	Acoustical Plaster Ceiling	80	SF	Basement Cold Air Chamber (Fresh Air Intake) - 1893 Bldg.	CHR	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Audubon School Unit 22091 Building ID 2110

Address 3500 N Hoyne Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date **4/14/2022**  
Inspector Name **Colin Hendrickson**  
**100-20530** **5/15/2022**  
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
02	
05	
06	
06A	
07	
15	
16	
17	
18	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	
26	
27	

# Chicago Public Schools

**School** Audubon School **Unit** 22091 **Building ID** 2110

**Address** 3500 N Hoyne Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
28	
29	
30	
31	
31M	
32	
33	
33M	
D	
F	
G	
H	
I	
J	
K	
L	
M	
N	
O	



**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Audubon School  
**Address** 3500 N Hoyne Avenue

**Unit** 22091  
Chicago, IL, 60618

**Building ID** 2110  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02	Hard Coat Plaster			Throughout - 1893 Bldg.	No ACBM	SURFACE					
05	Hard Coat Plaster			Throughout - 1906 Bldg.	No ACBM	SURFACE					
06	2'x4' White Ceiling Tile			Throughout Fieldhouse - 1893 Bldg.	No ACBM	MISC					
06A	2'x4' White Ceiling Tile			Basement Lunchroom #2 - 1906 Bldg	No ACBM	MISC					
07	MJP E/F/V on Fiberglass Pipe Insulation			Tank Room, Boiler Room, Lunchroom #1 Heating Coil Cage, Boy's Toilet - 1893 Bldg.	No ACBM	TSI					
15	Aircell Pipe Insulation	30	LF	Basement Corridor, Teachers Toilet, Basement Girls Toilet - 1893 Bldg.	Chrysotile	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Follow O&M Plan
16	Aircell Pipe Insulation	25	LF	Basement Main Corridor, 001 (Abated) - 1906 Bldg	Chrysotile	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Follow O&M Plan
17	Cardboard Pipe Insulation	687	LF	Basement Passages, Corridors, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg	Chrysotile	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Follow O&M Plan
18	Cardboard Pipe Insulation	245	LF	Basement: Main Corridor - 1906 Bldg.	Chrysotile	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Follow O&M Plan
19	Green Linoleum (painted gray)	850	SF	3rd Floor Assembly Hall/ Gymnasium Stage - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A	Green Linoleum Mastic (Painted gray)	850	SF	3rd Floor Assembly Hall /Gymnasium Stage - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Grey w/Colored Swirls Linoleum	1,400	SF	Rooms 206A, 206 & Closet - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	Grey w/Colored Swirls Linoleum Mastic	1,400	SF	Rooms 206A, 206 & Closet - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Wood Laminate Flooring over 12"x12" White w/Light brown Speck VFT	600	SF	2nd Floor Teacher's Lounge - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21A	Wood Laminate Flooring over 12"x12" White w/light brown speck Mastic	600	SF	2nd Floor Teacher's Lounge - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Light Brown w/Brown Speckles VFT	550	SF	Main Office - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22A	12"x12" Light Brown w/Brown Speckles VFT Mastic	550	SF	Main Office - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" Peach w/White Speckles VFT	600	SF	Basement Room 006 - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	12"x12" Peach w/White Speckles VFT Mastic	600	SF	Basement Room 006 - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" White w/Light Brown Speckles VFT	700	SF	Room 203 - 1906 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24A	12"x12" White w/Light Brown Speckles VFT Mastic	700	SF	Room 203 - 1906 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Aircell Duct Insulation			Basement Lunchroom #2 - 1906 Bldg. (above ceiling tiles).	Abated	TSI	Yes	0			

# Chicago Public Schools

**School** Audubon School  
**Address** 3500 N Hoyne Avenue

**Unit** 22091  
Chicago, IL, 60618

**Building ID** 2110  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
26	2' x 2' Ceiling Tile	1,600	SF	Rooms 105 - 1893 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	Blue Flame Retardent Draperies	800	SF	Auditorium - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	2' x 2' white Ceiling Tile w/pinholes and grooves	400	SF	3rd Floor Corridor (1898 building)	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
29	2' x 4' white ceiling tile w/ pinholes and grooves	1,200	SF	Rooms 301, 201, 101 (1906 building)	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
30	2' x 2' smooth ceiling tile	400	SF	Room 308 (1898 Building)	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12" x 12" white w/dark specs	400	SF	Room 001 (Community Room - 1906 Building)	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
31M	VFT and Mastic	400	SF	Room 001 (Community Room - 1906 Building)	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Carpet Mastic	500	SF	Annex / Hut Building	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12" x 12" Light blue w/ blue specs	800	SF	Throughout Fieldhouse	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
33M	VFT and Mastic	800	SF	Throughout Fieldhouse	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
D	White w/Brown Streaks Linoleum Mastic	3,400	SF	3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F	12"x12" Pale Green w/White & Dk Green Speckles VFT	2,000	SF	Basement: Room 004, Engineer's Storage, Lunchroom #1 - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	12"x12" Pale Green w/White & Dk Green Speckles VFT	2,150	SF	Basement Lunchroom #2, Kitchen - 1906 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
H	12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic	2,000	SF	Basement: Room 004, Engineer's Storage, Lunchroom #1, Room 005 - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
I	12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic	2,150	SF	Basement Lunchroom #2, Kitchen - 1906 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
J	White w/Brown Streaks Linoleum	3,400	SF	3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Basement Corridor, Teachers Toilet, Baement Girls Toilet - 1893 Bldg.	Chrysotile	TSI	Yes	0	FITTING	5 ACBM with potential for significant damage	Follow O&M Plan
L	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Basement Main Corridor, Community Room (Room 001) - 1906 Bldg	Chrysotile	TSI	Yes	0	FITTING	5 ACBM with potential for significant damage	Follow O&M Plan
M	MJP E/F/V on Cardboard Pipe Insulation	37	FITTING	Basement Passages, 004, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg	Chrysotile	TSI	Yes	0	FITTING	5 ACBM with potential for significant damage	Follow O&M Plan
N	MJP E/F/V on Cardboard Pipe Insulation	19	FITTING	Basement: Main Corridor, Lunchroom #2 & Room 001 (Library) - 1906 Bldg.	Chrysotile	TSI	Yes	0	FITTING	5 ACBM with potential for significant damage	Follow O&M Plan
O	Acoustical Plaster Ceiling	80	SF	Basement Cold Air Chamber (Fresh Air Intake) - 1893 Bldg.	Chrysotile	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Audubon School  
**Address** 3500 N Hoyne Avenue

**Unit** 22091  
 Chicago, IL, 60618

**Building ID** 2110  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

*Management Planner's Comments Summarized at the End of the Report*

Review Date	5/4/2022
Manager Planner Name	Jigar Shah
100-07342	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
02	
05	
06	
06A	
07	
15	
16	

# Chicago Public Schools

**School** Audubon School  
**Address** 3500 N Hoyne Avenue

**Unit** 22091  
 Chicago, IL, 60618

**Building ID** 2110  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
17	
18	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	
26	
27	
28	
29	
30	
31	
31M	
32	
33	
33M	
D	
F	

# Chicago Public Schools

**School** Audubon School  
**Address** 3500 N Hoyne Avenue

**Unit** 22091  
Chicago, IL, 60618

**Building ID** 2110  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
G	
H	
I	
J	
K	
L	
M	
N	
O	

# APPENDIX A

## Assessment Sheets, Drawings and Photos

---

# Chicago Public Schools

Specialty Consulting, Inc.  
*2022 AHERA REINSPECTION*



# Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout - 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

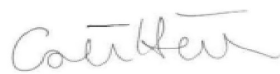

Date: **04/14/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout - 1893 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1906 Bldg.**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

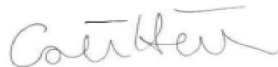

Date: **04/14/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout - 1906 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout Fieldhouse - 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

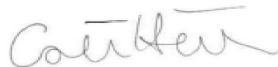

Date: **04/14/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**

MATERIAL LOCATION: **Throughout Fieldhouse - 1893 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Luchroom #2 - 1906 Bldg**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

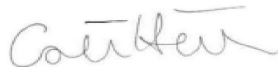

Date: **04/14/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**  
MATERIAL LOCATION: **Basement Luchroom #2 - 1906 Bldg**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Tank Room, Boiler Room, Lunchroom #1 Heating Coil Cage, Boy's Toilet - 1893 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

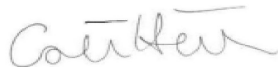

Date: **04/14/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
MATERIAL LOCATION: **Tank Room, Boiler Room, Lunchroom #1 Heating Coil Cage, Boy's Toilet - 1893 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACM**  
HISTORICAL DAMAGE REASON: **Delamination  
Deterioration**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Basement Corridor, Teachers Toilet, Basement Girls Toilet - 1893 Bldg.**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

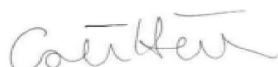

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Basement Corridor, Teachers Toilet, Basement Girls Toilet - 1893 Bldg.**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACM**  
HISTORICAL DAMAGE REASON: **Delamination  
Deterioration**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Basement Main Corridor, 001 (Abated) - 1906 Bldg**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:

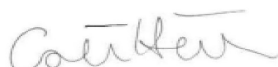

Date: **04/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Basement Main Corridor, 001 (Abated) - 1906 Bldg**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Basement Passages, Corridors, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg**

MATERIAL QUANTITY: **687** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

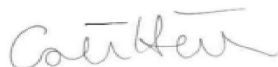

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Basement Passages, Corridors, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg**  
MATERIAL QUANTITY: **687** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACM**  
HISTORICAL DAMAGE REASON: **Delamination  
Deterioration**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Basement: Main Corridor - 1906 Bldg.**

MATERIAL QUANTITY: **245**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

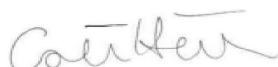

Date: **04/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Basement: Main Corridor - 1906 Bldg.**  
MATERIAL QUANTITY: **245** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Green Linoleum (painted gray)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **3rd Floor Assembly Hall/ Gymnasium Stage - 1893 Bldg.**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

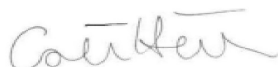

Date: **04/14/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Green Linoleum (painted gray)**  
MATERIAL LOCATION: **3rd Floor Assembly Hall/ Gymnasium Stage - 1893 Bldg.**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**  
MATERIAL DESCRIPTION: **Green Linoleum Mastic (Painted gray)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **3rd Floor Assembly Hall /Gymnasium Stage - 1893 Bldg.**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

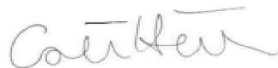

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **19A**  
MATERIAL DESCRIPTION: **Green Linoleum Mastic (Painted gray)**  
MATERIAL LOCATION: **3rd Floor Assembly Hall /Gymnasium Stage - 1893 Bldg.**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Grey w/Colored Swirls Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 206A, 206 & Closet - 1893 Bldg.**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

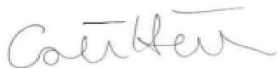

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Grey w/Colored Swirls Linoleum**  
MATERIAL LOCATION: **Rooms 206A, 206 & Closet - 1893 Bldg.**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**  
MATERIAL DESCRIPTION: **Grey w/Colored Swirls Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 206A, 206 & Closet - 1893 Bldg.**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

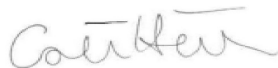

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **20A**  
MATERIAL DESCRIPTION: **Grey w/Colored Swirls Linoleum Mastic**  
MATERIAL LOCATION: **Rooms 206A, 206 & Closet - 1893 Bldg.**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Wood Laminate Flooring over 12"x12" White w/Light brown Speck VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **2nd Floor Teacher's Lounge - 1893 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

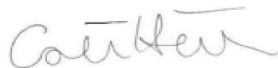

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Wood Laminate Flooring over 12"x12" White w/Light brown Speck VFT**  
MATERIAL LOCATION: **2nd Floor Teacher's Lounge - 1893 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**  
MATERIAL DESCRIPTION: **Wood Laminate Flooring over 12"x12" White w/light brown speck Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Teacher's Lounge - 1893 Bldg.**

MATERIAL QUANTITY: **600**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

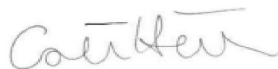

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **21A**  
MATERIAL DESCRIPTION: **Wood Laminate Flooring over 12"x12" White w/light brown speck Mastic**  
MATERIAL LOCATION: **2nd Floor Teacher's Lounge - 1893 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Brown Speckles VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Office - 1893 Bldg.**

MATERIAL QUANTITY: **550**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

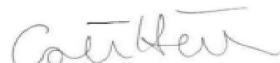

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Brown Speckles VFT**  
MATERIAL LOCATION: **Main Office - 1893 Bldg.**  
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

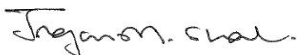

Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**  
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Brown Speckles VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office - 1893 Bldg.**  
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

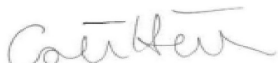

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **22A**  
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Brown Speckles VFT Mastic**  
MATERIAL LOCATION: **Main Office - 1893 Bldg.**  
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12"x12" Peach w/White Speckles VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Basement Room 006 - 1893 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

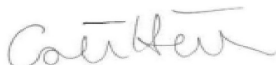

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12"x12" Peach w/White Speckles VFT**  
MATERIAL LOCATION: **Basement Room 006 - 1893 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23A**  
MATERIAL DESCRIPTION: **12"x12" Peach w/White Speckles VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Room 006 - 1893 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

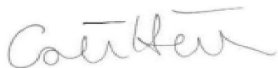

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **23A**  
MATERIAL DESCRIPTION: **12"x12" Peach w/White Speckles VFT Mastic**  
MATERIAL LOCATION: **Basement Room 006 - 1893 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12"x12" White w/Light Brown Speckles VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 203 - 1906 Bldg.**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

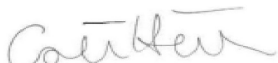

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12"x12" White w/Light Brown Speckles VFT**  
MATERIAL LOCATION: **Room 203 - 1906 Bldg.**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24A**  
MATERIAL DESCRIPTION: **12"x12" White w/Light Brown Speckles VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 203 - 1906 Bldg.**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

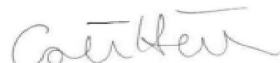

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **24A**  
MATERIAL DESCRIPTION: **12"x12" White w/Light Brown Speckles VFT Mastic**  
MATERIAL LOCATION: **Room 203 - 1906 Bldg.**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Aircell Duct Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Abated** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Basement Lunchroom #2 - 1906 Bldg. (above ceiling tiles).**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

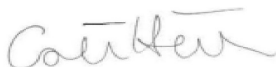

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Aircell Duct Insulation**  
MATERIAL LOCATION: **Basement Lunchroom #2 - 1906 Bldg. (above ceiling tiles).**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: **0** DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 105 - 1893 Bldg**  
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

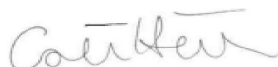

Date: 04/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile**  
MATERIAL LOCATION: **Rooms 105 - 1893 Bldg**  
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Blue Flame Retardent Draperies**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium - 1893 Bldg.**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

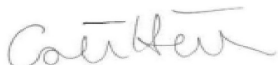

Date: 04/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Blue Flame Retardent Draperies**  
MATERIAL LOCATION: **Auditorium - 1893 Bldg.**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

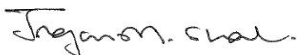

Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **White w/Brown Streaks Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.**

MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

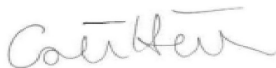

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **White w/Brown Streaks Linoleum Mastic**  
MATERIAL LOCATION: **3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/White & Dk Green Speckles VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Basement: Room 004, Engineer's Storage, Lunchroom #1 - 1893 Bldg.**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

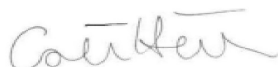

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/White & Dk Green Speckles VFT**  
MATERIAL LOCATION: **Basement: Room 004, Engineer's Storage, Lunchroom #1 - 1893 Bldg.**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

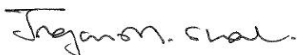

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/White & Dk Green Speckles VFT**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Deterioration**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Basement Lunchroom #2, Kitchen - 1906 Bldg.**

MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **2150** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

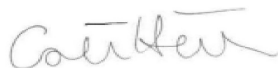

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/White & Dk Green Speckles VFT**  
MATERIAL LOCATION: **Basement Lunchroom #2, Kitchen - 1906 Bldg.**  
MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement: Room 004, Engineer's Storage, Lunchroom #1, Room 005 - 1893 Bldg.**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

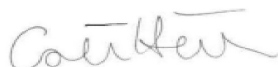

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic**  
MATERIAL LOCATION: **Basement: Room 004, Engineer's Storage, Lunchroom #1, Room 005 - 1893 Bldg.**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Deterioration**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Basement Lunchroom #2, Kitchen - 1906 Bldg.**

MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

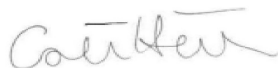

Date: 04/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **12"x12" Pale Green w/Wht & Dk Grn Spckls VFT Mastic**  
MATERIAL LOCATION: **Basement Lunchroom #2, Kitchen - 1906 Bldg.**  
MATERIAL QUANTITY: **2150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **White w/Brown Streaks Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

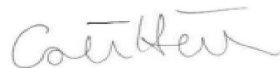

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **White w/Brown Streaks Linoleum**  
MATERIAL LOCATION: **3rd Floor Gymnasium & Assembly Hall - 1893 Bldg.**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Delamination**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Basement Corridor, Teachers Toilet, Baement Girls Toilet - 1893 Bldg.**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

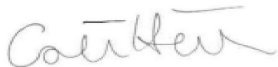

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
MATERIAL LOCATION: **Basement Corridor, Teachers Toilet, Baement Girls Toilet - 1893 Bldg.**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Delamination**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Basement Main Corridor, Community Room (Room 001) - 1906 Bldg**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

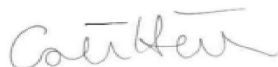

Date: 04/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
MATERIAL LOCATION: **Basement Main Corridor, Community Room (Room 001) - 1906 Bldg**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

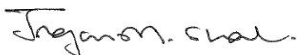

Date: **05/04/2022**



# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY: **5 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Delamination**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Basement Passages, 004, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg**

MATERIAL QUANTITY: **37** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **37** DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

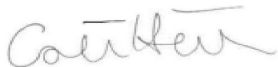

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Basement Passages, 004, 006, 009, Sprinkler Room, Girls Hallway - 1893 Bldg**  
MATERIAL QUANTITY: **37** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY: **5 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Delamination**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Basement: Main Corridor, Lunchroom #2 & Room 001 (Library) - 1906 Bldg.**

MATERIAL QUANTITY: **19** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

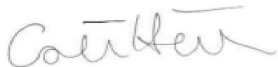

Date: 04/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Basement: Main Corridor, Lunchroom #2 & Room 001 (Library) - 1906 Bldg.**  
MATERIAL QUANTITY: **19** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School** INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Acoustical Plaster Ceiling**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Cold Air Chamber (Fresh Air Intake) - 1893 Bldg.**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

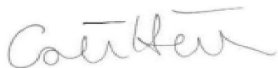

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUIDLING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

---

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Acoustical Plaster Ceiling**  
MATERIAL LOCATION: **Basement Cold Air Chamber (Fresh Air Intake) - 1893 Bldg.**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/04/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)


LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **22091**    BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School**    INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue**    IDPH LICENSE NO: **100-20530**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" white w/dark specs**  
MATERIAL LOCATION: **Room 001 (Community Room - 1906 Building)**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY:    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

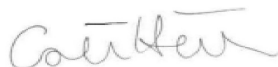

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" white w/dark specs**  
MATERIAL LOCATION: **Room 001 (Community Room - 1906 Building)**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 05/04/2022





# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **33M**  
MATERIAL DESCRIPTION: **VFT and Mastic**  
MATERIAL LOCATION: **Throughout Fieldhouse**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/04/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)


LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **22091**      BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School**      INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue**      IDPH LICENSE NO: **100-20530**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **2' x 4' white ceiling tile w/ pinholes and grooves**  
MATERIAL LOCATION: **Rooms 301, 201, 101 (1906 building)**  
MATERIAL QUANTITY: **1200**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

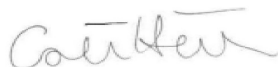

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **22091**      BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School**      REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue**      IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **2' x 4' white ceiling tile w/ pinholes and grooves**  
MATERIAL LOCATION: **Rooms 301, 201, 101 (1906 building)**  
MATERIAL QUANTITY: **1200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **05/04/2022**



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **22091**      BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School**      REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue**      IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
MATERIAL LOCATION: **Annex / Hut Building**  
MATERIAL QUANTITY: **500**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **05/04/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)


LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **22091**    BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Colin Hendrickson**  
SCHOOL NAME: **Audubon School**    INSPECTION DATE: **4/14/2022**  
ADDRESS: **3500 N Hoyne Avenue**    IDPH LICENSE NO: **100-20530**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **31M**  
MATERIAL DESCRIPTION: **VFT and Mastic**  
MATERIAL LOCATION: **Room 001 (Community Room - 1906 Building)**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL:    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY:    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

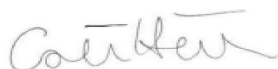

Date: 04/14/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **22091**      BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School**      REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue**      IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **31M**  
MATERIAL DESCRIPTION: **VFT and Mastic**  
MATERIAL LOCATION: **Room 001 (Community Room - 1906 Building)**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **05/04/2022**





# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **22091**      BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School**      REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue**      IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **2' x 2' smooth ceiling tile**  
MATERIAL LOCATION: **Room 308 (1898 Building)**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:      DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_

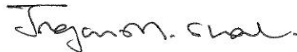

Date: 05/04/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **22091**      BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School**      REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue**      IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **2' x 2' white Ceiling Tile w/pinholes and grooves**  
MATERIAL LOCATION: **3rd Floor Corridor (1898 building)**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **05/04/2022**



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22091** BUILDING ID: **2110**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Audubon School** REVIEW DATE: **5/4/2022**  
ADDRESS: **3500 N Hoyne Avenue** IDPH LICENSE NO: **100-20530**

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12" x 12" Light blue w/ blue specs**  
MATERIAL LOCATION: **Throughout Fieldhouse**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 05/04/2022

# APPENDIX B

## Inspector and Management Planner Licenses

---



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

COLIN T HENDRICKSON  
2936 W PALMER ST, APT 100  
CHICAGO, IL 60647

9/23/2021

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 20530

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER	ISSUED	EXPIRES	INSPECTOR	12/17/2021
100 - 20530	9/23/2021	05/15/2022		
<b>COLIN T HENDRICKSON</b> 2936 W PALMER ST, APT 100 CHICAGO, IL 60647 <small>Environmental Health</small>			<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

A physical license card cannot be issued for this licensee due to backorder of supplies from the contracted vendor. Therefore, this letter shall meet the requirements of Section 855.100 o). A license card will be generated upon completion of a subsequent renewal application.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH. IMPROVING LIVES  
Nationally Accredited by PHAB



## OCCUPATIONAL TRAINING & SUPPLY, INC.



# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that  
**Colin T. Hendrickson**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021


Expiration Date: 11/1/2022

Certificate Number: BIR2111012556

  
Kathy DeSalvo, Director

7233 S. Adams Street | Willowbrook, IL 60527  
(630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2023

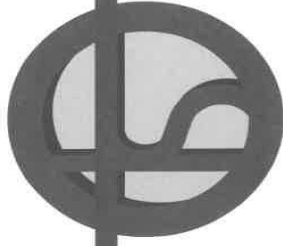

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

---

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

## Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

---

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois



**ASBESTOS PROFESSIONAL LICENSE**

ID NUMBER  
**100 - 07342**

ISSUED  
**4/1/2022**

EXPIRES  
**05/15/2023**

**JIGAR M SHAH**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612



Environmental Health

**JIGAR M SHAH**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

 <p><b>ASBESTOS PROFESSIONAL LICENSE</b></p>			<p><b>ENDORSEMENTS</b></p>		<p><b>TC EXPIRES</b></p>
<p>ID NUMBER <b>100 - 07342</b></p>	<p>ISSUED <b>4/1/2022</b></p>	<p>EXPIRES <b>05/15/2023</b></p>	<p>INSPECTOR</p>	<p>3/9/2023</p>	
<p><b>JIGAR M SHAH</b> 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p>			<p>PROJECT DESIGNER</p>	<p>3/24/2023</p>	
			<p>MANAGEMENT PLANNER</p>	<p>3/9/2023</p>	
			<p>PROJECT MANAGER</p>	<p>3/2/2023</p>	
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p><b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**

Nationally Accredited by PHAB

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---



## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed