

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2118
SCHOOL NAME: Cameron School
ADDRESS OF SCHOOL: 1234 N. Monticello
CITY: Chicago, IL, 60651

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **10/26/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 8/10/2022 ENROLLMENT 592
IDPH INSPECTOR LICENSE NUMBER: 100-11089
IDPH LICENSED INSPECTOR NAME (Please Print): Panfilo Carrazco
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer

9/9/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Cameron School

1234 N. Monticello
Chicago, IL, 60651

Unit: 22531
Building ID: 2610

IDPH ID Number: 14-016-2990-2118

REPORT DATE:

Friday, September 09, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

09/09/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 22531 Region: 02 IDPH ID: 14-016-2990-2118

School: Cameron School Building ID: 2610

Address: 1234 N. Monticello
Chicago, IL, 60651

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 8/10/2022

Review Date: 09/09/2022

Inspector: Panfilo Carrazco Inspector IDPH License: 100-11089
Management Planner: Arturo Saenz Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 09, 2022

RE: Cameron School, Unit 22531
1234 N. Monticello
Chicago, IL, 60651

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Cameron School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Cameron School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Cameron School
Address: 1234 N. Monticello
IDPH ID: 14-016-2990-2118
Contact:

Unit: 22531
Chicago, IL, 60651
Building ID: 2610
Phone:

Region: 02

2. Description of Facility

Original Construction:
Total Square Footage:
Current Occupancy: 592

Additional Construction:
No of Floors:

3. LEA Designated Person

Contact: Richard J.Schleyer
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 251-7074

4. Managing Environmental Consultant


MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575

Fax: (312) 319-7580

5. Inspector

Inspector Name: Panfilo Carrazco


Inspector IDPH license # 100-11089
Reinspection Date: 8/10/2022

Signature: 
Date: 8/10/2022

6. Management Planner

Management Planner Name: Arturo Saenz

Management Planner IDPH license # 100-04019


Signature: 
Date: 09/09/2022

7. Review Date: 09/09/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

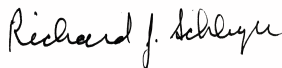

Date: 9/9/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Cameron School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2610:

C	Aircell Pipe Insulation
D	MJP E/F/V on Aircell Pipe Insulation
F	MJP E/F/V on Cardboard Pipe Insulation
G	Mag Block Pipe Insulation
H	MJP E/F/V on Mag Block Pipe Insulation
J	Tank Insulation
K	Aircell Duct Insulation
P	Aircell Pipe Insulation
Q	MJPE/F/V on Aircell Pipe Insulation

B. The following new homogenous areas have been identified for Building 2610:

R	12"x12" Yellow with Yellow Specks VFT
S	12"x12" Blue with Blue Specks VFT
T	12"x12" White with Blue & Gray Specks VFT
U	12"x12" Beige VFT

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01A	Hard Coat Plaster
02	2'x4' White Speckled Ceiling Tile
10A	12"x12" White w/ Light Brown Streaks VFT Mastic
11A	12"x12" White w/ Long Tan Streaks VFT Mastic
19	12"x12" Brown w/ Dark Brown Streaks VFT
25A	12"x12" Off White w/ Tan Streaks VFT Mastic
29	12"x12' Coffee w/ Beige & Brown Streaks VFT
30A	12"x12" Light Tan VFT Mastic
31	Canvas (Not Observed)
33	12"x12" Brown, White, & Tan Streaked VFT
33A	12"x12" Brown, White, & Tan Streaked VFT Mastic
34	12"x12" Gray VFT
35	12"x12" Gray VFT Mastic
36	2'x4' White w/ Grooves Ceiling Tile
37	Gray Vinyl Baseboards
38	Gray Vinyl Baseboard Mastic
39	Drywall
40	Drywall Compound
41	Terrazzo
42	12 x 12 Off White with blue Specks VFT
43	12 X 12 Off White with Blue Specks Mastic
44	12 x 12 Blue Speckled VFT
45	12 X 12 Blue Speckled Mastic
46	12 x 12 Off-white with Beige Specks VFT
47	12 x 12 Offwhite with Beige Mastic
48	12 x 12 Off White with Beige Streaks VFT
49	12 x 12 Off White With Beige Streaks Mastic
50	12 x 12 Off White with Beige Specks VFT
51	12 x 12 Off White with Beige Specks Mastic
52	Carpet Mastic
53	12 x 12 Light Green with White VFT
54	12 X 12 Light Green With White Specks Mastic
55	12 x 12 Green with White Specks VFT
56	12 x 12 Green with White Specks Mastic
57	Carpet Mastic
58	12 x 12 Light Green w/ Black Spotted Slip Resistant VFT
59	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic
60	12 x 12 Light Green with Black Spotted Slip Resistant VFT
61	12 x 12 Light Green w/ Black Spotted Slip Resistant

	Mastic
62	12 x 12 Blue with Dark Blue Specks VFT
63	12 x 12 Blue with Dark Blue Specks Mastic
64	12 x 12 White w/ Multi Color Specks VFT
65	12 x 12 White w/ Multi Color Specks Mastic
66	12 x 12 White w/ Blue & Red Specks VFT
67	12 x 12 White w/ Blue & Red Specks Mastic
68	2 x 4 White Smooth Ceiling Tile
L	MJP E/F/V on Fiberglass Pipe Insulation
M	MJP E/F/V on Fiberglass Pipe Insulation
N	12"x12" Ceiling Tile
R	12"x12" Yellow with Yellow Specks VFT
S	12"x12" Blue with Blue Specks VFT
T	12"x12" White with Blue & Gray Specks VFT
U	12"x12" Beige VFT

The following areas were deemed to be inaccessible:

10A	12"x12" White w/ Light Brown Streaks VFT Mastic
11A	12"x12" White w/ Long Tan Streaks VFT Mastic
30A	12"x12" Light Tan VFT Mastic
33A	12"x12" Brown, White, & Tan Streaked VFT Mastic
35	12"x12" Gray VFT Mastic
38	Gray Vinyl Baseboard Mastic
45	12 X 12 Blue Speckled Mastic
47	12 x 12 Offwhite with Beige Mastic
49	12 x 12 Off White With Beige Streaks Mastic
51	12 x 12 Off White with Beige Specks Mastic
54	12 X 12 Light Green With White Specks Mastic
56	12 x 12 Green with White Specks Mastic
59	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic
61	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic
63	12 x 12 Blue with Dark Blue Specks Mastic
65	12 x 12 White w/ Multi Color Specks Mastic
67	12 x 12 White w/ Blue & Red Specks Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Panfilo Carrazco, IDPH License # 100-11089. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:	7/17/2020
	7/20/2020
	7/28/2021
	4/18/2022

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Cameron School Building 2610 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Hard Coat Plaster			Throughout 1897	NO_ACBM	SURFACE								
01A	Hard Coat Plaster	100,000	SF	Throughout 1923	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
02	2'x4' White Speckled Ceiling Tile	1,000	SF	Lunchroom - 1897	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
05	9"x9" Maroon VFT - NOT OBSERVED			Room 012 - 1897	CHR	MISC					No	ACBM with the potential for damage		
08	9"x9" Maroon VFT Mastic - NOT OBSERVED			Room 012 - 1897	CHR	MISC					No			
10	12"x12" White w/ Light Brown Streaks VFT	8,500	SF	Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
10A	12"x12" White w/ Light Brown Streaks VFT Mastic	8,500	SF	Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12"x12" White w/ Long Tan Streaks VFT	9,500	SF	Room 207 - Bldg 1897	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
11A	12"x12" White w/ Long Tan Streaks VFT Mastic	9,500	SF	Rm 207 - Bldg 1897	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12"x12" White w/ Light Brown & Black Streaks VFT (NOT OBSERVED)	3,200	SF	2nd Floor Corridor & Rooms 208 & 211 - 1897 NOT OBSERVED	CHR	MISC	N	None	0		No	ACBM with the potential for damage		Low
12A	12"x12" White w/ Lt Brn & Black Streaks VFT Mastic (NOT OBSERVED)	3,200	SF	2nd Floor Corridor, Rooms 208 & 211 Bldg 1897 NOT OBSERVED	CHR	MISC	N	None	0		No	ACBM with the potential for damage		Low
13	9"x9" Black VFT (ABATED 2003)			Waiting Room and Clinic - 1897	ABATED	MISC					No			
13A	9"x9" Black VFT Mastic (ABATED 2003)			Waiting Room and Clinic- 1897	ABATED	MISC					No			
14	9"x9" Green VFT (ABATED 2003)			1st Floor Main Office - 1897	ABATED	MISC					No			
14A	9"x9" Green VFT Mastic (ABATED 2003)			1st Floor Main Office - 1897	ABATED	MISC					No			
15	12"x12" Beige w/ White Streaks VFT	650	SF	Room 008 - 1897	CHR	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
15A	12"x12" Beige w/ White Streaks VFT Mastic	650	SF	Room 008 - 1897	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	9"x9" Brown w/ Brown & Beige Streaks VFT (ABATED)			Room 001 - 1923	ABATED	MISC								
16A	9"x9" Brown w/ Brown & Beige Streaks VFT Mastic (ABATED)			Room 001 - 1923	ABATED	MISC								
17	9"x9" White w/ Light Brown Streaks VFT	150	SF	Engineer's Office - 1897	CHR	MISC	N	LOC	14		No	ACBM with the potential for damage	5	MODERATE
17A	9"x9" White w/ Light Brown Streaks VFT Mastic	150	SF	Engineer's Office - 1897	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	9"x9" Green w/ Beige Streaks VFT (ABATED)			1st Floor Corridor & Teacher's Lounge (Not Observed) - 1923	ABATED	MISC								
18A	9"x9" Green w/ Beige Streaks VFT Mastic (ABATED)			1st Floor Corridor & Teacher's Lounge (Not Observed) - Bldg 1923	ABATED	MISC								
19	12"x12" Brown w/ Dark Brown Streaks VFT	1,400	SF	Room 101, 103 - Bldg 1923	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
19A	12"x12" Brown w/ Dark Brown Streaks VFT Mastic	1,400	SF	Room 101, 103 - Bldg 1923	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	9"x9" Blue Green w/ Beige Streaks VFT (ABATED)			2nd Floor Corridor - 1923	ABATED	MISC								
20A	9"x9" Blue Green w/ Beige Streaks VFT Mastic (Abated)			2nd Floor Corridor - 1923	ABATED	MISC								
21	9"x9" Tan w/ Beige Streaks VFT (ABATED)			3rd Floor Corridor - 1923	ABATED	MISC								
21A	9"x9" Tan w/ Beige Streaks VFT Mastic (Abated)			3rd Floor Corridor - 1923	ABATED	MISC								
22	12"x12" Brown w/ White & Black Streaks VFT (Abated)			2nd Floor Corridor - 1923	ABATED	MISC								
22A	12"x12" Brown w/ White & Black Streaks VFT Mastic (Abated)			2nd Floor Corridor - 1923	ABATED	MISC								
23	9"x9" Tan w/ Brown Streaks VFT	5,800	SF	1st Floor Corridor (Abated), 3rd Floor Corridor and Room 205 (Not Observed)-1923	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
23A	9"x9" Tan w/ Brown Streaks VFT Mastic	5,800	SF	1st Floor Corridor (ABATED), 3rd Floor Corridor and Room 205 (NOT	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				OBSERVED)- 1923										
24	9"x9" Black w/ Beige Streaks VFT (ABATED)			1st Floor Corridor, 2nd Floor Corridor Above Auditorium, and 3rd Floor Corridor - 1923	ABATED	MISC								
24A	9"x9" Black w/ Beige Streaks VFT Mastic (ABATED)			1st Floor Corridor, 2nd Floor Corridor Above Auditorium, 3rd Floor Corridor - 1923	ABATED	MISC								
25	12"x12" Off White w/ Tan Streaks VFT	1,150	SF	IRIP Room 303A & 303B - 1923	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
25A	12"x12" Off White w/ Tan Streaks VFT Mastic	1,150	SF	IRIP Room 303A & 303B - 1923	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	9"x9" Gray VFT (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	ABATED	MISC								
26A	9"x9" Gray VFT Mastic (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	ABATED	MISC								
27	6"x18" Black VFT (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	ABATED	MISC								
27A	6"x18" Black VFT Mastic (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	ABATED	MISC								
28	Brown Floor Covering (ABATED)			Library (Under Carpet) - 1923	ABATED	MISC								
28A	Brown Floor Covering Mastic (ABATED)			Library (Under Carpet) - 1923	ABATED	MISC					No			
29	12"x12" Coffee w/ Beige & Brown Streaks VFT	650	SF	Room 001 and 003 - 1923	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
29A	12"x12" Coffee w/ Beige & Brown Streaks VFT Mastic	650	SF	Room 001 & 003 - 1923	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12"x12" Light Tan VFT	1,400	SF	Lunchroom & Teacher's Lunchroom - 1923	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
30A	12"x12" Light Tan VFT Mastic	1,400	SF	Lunchroom & Teacher's	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Lunchroom - 1923										
31	Canvas (Not Observed)			3rd Floor Corridor - 1923	ASSUMED	MISC					No			
33	12"x12" Brown, White, & Tan Streaked VFT	800	SF	Room 210 and 210 wardrobe - 1897	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
33A	12"x12" Brown, White, & Tan Streaked VFT Mastic	800	SF	Room 210 and 210 wardrobe - 1897	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12"x12" Gray VFT	12,000	SF	Throughout - 1996	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
35	12"x12" Gray VFT Mastic	12,000	SF	Throughout - 1996	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	2'x4' White w/ Grooves Ceiling Tile	12,000	SF	Throughout - 1996	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
37	Gray Vinyl Baseboards	2,200	LF	Throughout - 1996	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	Gray Vinyl Baseboard Mastic	2,200	LF	Throughout - 1996	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	Drywall	20,000	SF	Throughout - 1996	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
40	Drywall Compound	20,000	SF	Throughout - 1996	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
41	Terrazzo	3,000	SF	Rest Rooms, Stairs and Stair Landings, 1st, 2nd, and 3rd Floor Corridors Bldg 1923	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
42	12 x 12 Off White with blue Specks VFT	4,800	SF	1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor Basement - Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
43	12 X 12 Off White with Blue Specks Mastic	4,800	SF	1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor Basement - Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
44	12 x 12 Blue Speckled VFT	360	SF	1st, 2nd, 3rd Floor Corridors	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
45	12 X 12 Blue Speckled Mastic	360	SF	1st, 2nd, 3rd Corridors	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
46	12 x 12 Off-white with Beige Specks VFT	3,300	SF	312 & 312A, 213, 210 Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
47	12 x 12 Offwhite with Beige Mastic	3,300	SF	312, 312A, 213, 210 Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
48	12 x 12 Off White with Beige Streaks VFT	250	SF	315 Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
49	12 x 12 Off White With Beige Streaks Mastic	250	SF	315 Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
50	12 x 12 Off White with Beige Specks VFT	700	SF	205 Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
51	12 x 12 Off White with Beige Specks Mastic	700	SF	Rm 205 Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
52	Carpet Mastic	2,900	SF	Library, Teacher Lounge, Auditorium Bldg 1923	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
53	12 x 12 Light Green with White VFT	500	SF	Main Office Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
54	12 X 12 Light Green With White Specks Mastic	500	SF	Main Office Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
55	12 x 12 Green with White Specks VFT	200	SF	Main Office Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
56	12 x 12 Green with White Specks Mastic	200	SF	Main Office Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
57	Carpet Mastic	1,000	SF	Rm 108 (c/cm office) Bldg 1897	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
58	12 x 12 Light Green w/ Black Spotted Slip Resistant VFT	800	SF	Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
59	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic	800	SF	Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
60	12 x 12 Light Green with Black Spotted Slip Resistant VFT	600	SF	Basement Near Door G	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
61	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic	600	SF	Basement Near Door G Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
62	12 x 12 Blue with Dark Blue Specks VFT	400	SF	Rm 012 Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
63	12 x 12 Blue with Dark Blue Specks Mastic	400	SF	Rm 012 Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the		LOW

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
64	12 x 12 White w/ Multi Color Specks VFT	300	SF	Rm 012 Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
65	12 x 12 White w/ Multi Color Specks Mastic	300	SF	Rm 012 Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
66	12 x 12 White w/ Blue & Red Specks VFT	2,200	SF	Rm 011, Basement Corridor Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
67	12 x 12 White w/ Blue & Red Specks Mastic	2,200	SF	Rm 011, Basement Corridor Bldg 1897	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
68	2 x 4 White Smooth Ceiling Tile	3,200	SF	Lunchroom A & B, Kitchen Bldg 1923	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
C	Aircell Pipe Insulation	1,420	LF	Tank room, Engine Room, Boiler Room, Room 008, North Corridor Basement - 1897	CHR	TSI	Y	LOC	4		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	MODERATE
D	MJP E/F/V on Aircell Pipe Insulation	200	LF	Tank room, Boiler Room, Room 008 - 1897	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage	5	MODERATE
F	MJP E/F/V on Cardboard Pipe Insulation	210	LF	Room 008 - 1897	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		
G	Mag Block Pipe Insulation	203	LF	Basement Corridor, Break Room, Engineers Office - 1897	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage	10	MODERATE
H	MJP E/F/V on Mag Block Pipe Insulation	11	LF	Receiving Room - 1897	CHR	TSI	Y	DIST	5		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	MODERATE
J	Tank Insulation	400	SF	Boiler Room & Tank Room - 1897	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		
K	Aircell Duct Insulation	950	SF	North Corridor, Tank Room, Boiler Room, Room 008 and 014- 1897	CHR	TSI	Y	LOC	50		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	MODERATE
L	MJP E/F/V on Fiberglass Pipe Insulation	100	LF	3rd Floor Boys Toilet, Engine Room, Boiler Room, Receiving Room - 1897	ASSUMED	TSI	Y	LOC	2		No	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
M	MJP E/F/V on Fiberglass Pipe Insulation	50	SF	Assembly Hall - 1923	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
N	12"x12" Ceiling Tile	800	SF	Room 307 - 1897	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
O	Paperwrap Pipe Insulation	150	LF	Room 008 - 1897	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
P	Aircell Pipe Insulation	175	LF	Throughout (See Hatching Map) - 1923	CHR	TSI	Y	NONE			Yes	ACBM with the potential for damage	5	MODERATE
Q	MJPE/F/V on Aircell Pipe Insulation	55	LF	Throughout (See Hatching Map) - 1923	CHR	TSI	Y	NONE			Yes	ACBM with the potential for damage	5	MODERATE
R	12"x12" Yellow with Yellow Specks VFT	200	SF	Room 008	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
S	12"x12" Blue with Blue Specks VFT	200	SF	Room 008	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
T	12"x12" White with Blue & Gray Specks VFT	200	SF	Room 008	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
U	12"x12" Beige VFT	150	SF	Room 037 (Next to Engineers Office)	ASSUMED	MISC	N	LOC	30			ACBM with the potential for damage	5	MODERATE

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 8/10/2022
Inspector Name Panfilo Carrazco
100-11089 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
01A	
02	
05	
08	
10	
10A	
11	
11A	
12	
12A	
13	
13A	
14	
14A	
15	
15A	
16	
16A	
17	Engineers Office (next to receiving room) - 1897 Bldg.
17A	
18	
18A	
19	

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	
25A	
26	
26A	
27	
27A	
28	
28A	
29	
29A	
30	
30A	
31	
33	
33A	
34	
35	
36	

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	

Chicago Public Schools

School Cameron School Unit 22531 Building ID 2610

Address 1234 N. Monticello Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
66	
67	
68	
C	
D	
F	
G	
H	
J	
K	
L	
M	
N	
O	
P	
Q	
R	
S	
T	
U	Room 037 (Next to Engineers Office)

Table II

Management Planner's Review

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Hard Coat Plaster			Throughout 1897	No ACBM	SURFACE					Follow O&M Plan
01A	Hard Coat Plaster	100,000	SF	Throughout 1923	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	2'x4' White Speckled Ceiling Tile	1,000	SF	Lunchroom - 1897	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	9"x9" Maroon VFT - NOT OBSERVED			Room 012 - 1897	Chrysotile	MISC				6 ACBM with the potential for damage	Follow O&M Plan
08	9"x9" Maroon VFT Mastic - NOT OBSERVED			Room 012 - 1897	Chrysotile	MISC					
10	12"x12" White w/ Light Brown Streaks VFT	8,500	SF	Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A	12"x12" White w/ Light Brown Streaks VFT Mastic	8,500	SF	Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12"x12" White w/ Long Tan Streaks VFT	9,500	SF	Room 207 - Bldg 1897	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A	12"x12" White w/ Long Tan Streaks VFT Mastic	9,500	SF	Rm 207 - Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12"x12" White w/ Light Brown & Black Streaks VFT (NOT OBSERVED)	3,200	SF	2nd Floor Corridor & Rooms 208 & 211 - 1897 NOT OBSERVED	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12A	12"x12" White w/ Lt Brn & Black Streaks VFT Mastic (NOT OBSERVED)	3,200	SF	2nd Floor Corridor, Rooms 208 & 211 Bldg 1897 NOT OBSERVED	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	9"x9" Black VFT (ABATED 2003)			Waiting Room and Clinic - 1897	Abated	MISC					
13A	9"x9" Black VFT Mastic (ABATED 2003)			Waiting Room and Clinic - 1897	Abated	MISC					
14	9"x9" Green VFT (ABATED 2003)			1st Floor Main Office - 1897	Abated	MISC					
14A	9"x9" Green VFT Mastic (ABATED 2003)			1st Floor Main Office - 1897	Abated	MISC					
15	12"x12" Beige w/ White Streaks VFT	650	SF	Room 008 - 1897	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	12"x12" Beige w/ White Streaks VFT Mastic	650	SF	Room 008 - 1897	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9"x9" Brown w/ Brown & Beige Streaks VFT (ABATED)			Room 001 - 1923	Abated	MISC					
16A	9"x9" Brown w/ Brown & Beige Streaks VFT Mastic (ABATED)			Room 001 - 1923	Abated	MISC					
17	9"x9" White w/ Light Brown Streaks VFT	150	SF	Engineer's Office - 1897	Chrysotile	MISC	No	14	SF	6 ACBM with the potential for damage	Remove
17A	9"x9" White w/ Light Brown Streaks VFT Mastic	150	SF	Engineer's Office - 1897	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	9"x9" Green w/ Beige Streaks VFT (ABATED)			1st Floor Corridor & Teacher's Lounge (Not Observed) - 1923	Abated	MISC					
18A	9"x9" Green w/ Beige Streaks VFT Mastic (ABATED)			1st Floor Corridor & Teacher's Lounge (Not Observed) - Bldg 1923	Abated	MISC					
19	12"x12" Brown w/ Dark Brown Streaks VFT	1,400	SF	Room 101, 103 - Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
19A	12"x12" Brown w/ Dark Brown Streaks VFT Mastic	1,400	SF	Room 101, 103 - Bldg 1923	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	9"x9" Blue Green w/ Beige Streaks VFT (ABATED)			2nd Floor Corridor - 1923	Abated	MISC					
20A	9"x9" Blue Green w/ Beige Streaks VFT Mastic (Abated)			2nd Floor Corridor - 1923	Abated	MISC					
21	9"x9" Tan w/ Beige Streaks VFT (ABATED)			3rd Floor Corridor - 1923	Abated	MISC					
21A	9"x9" Tan w/ Beige Streaks VFT Mastic (Abated)			3rd Floor Corridor - 1923	Abated	MISC					
22	12"x12" Brown w/ White & Black Streaks VFT (Abated)			2nd Floor Corridor - 1923	Abated	MISC					
22A	12"x12" Brown w/ White & Black Streaks VFT Mastic (Abated)			2nd Floor Corridor - 1923	Abated	MISC					
23	9"x9" Tan w/ Brown Streaks VFT	5,800	SF	1st Floor Corridor (Abated), 3rd Floor Corridor and Room 205 (Not Observed) - 1923	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	9"x9" Tan w/ Brown Streaks VFT Mastic	5,800	SF	1st Floor Corridor (ABATED), 3rd Floor Corridor and Room 205 (NOT OBSERVED)- 1923	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	9"x9" Black w/ Beige Streaks VFT (ABATED)			1st Floor Corridor, 2nd Floor Corridor Above Auditorium, and 3rd Floor Corridor - 1923	Abated	MISC					
24A	9"x9" Black w/ Beige Streaks VFT Mastic (ABATED)			1st Floor Corridor, 2nd Floor Corridor Above Auditorium, 3rd Floor Corridor - 1923	Abated	MISC					
25	12"x12" Off White w/ Tan Streaks VFT	1,150	SF	IRIP Room 303A & 303B - 1923	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	12"x12" Off White w/ Tan Streaks VFT Mastic	1,150	SF	IRIP Room 303A & 303B - 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	9"x9" Gray VFT (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	Abated	MISC					
26A	9"x9" Gray VFT Mastic (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	Abated	MISC					
27	6"x18" Black VFT (ABATED)			Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923	Abated	MISC					
27A	6"x18" Black VFT Mastic (ABATED)			Teacher's Room (Not Observed)& 2nd Floor Corridor - 1923	Abated	MISC					
28	Brown Floor Covering (ABATED)			Library (Under Carpet) - 1923	Abated	MISC					
28A	Brown Floor Covering Mastic (ABATED)			Library (Under Carpet) - 1923	Abated	MISC					
29	12"x12' Coffee w/ Beige & Brown Streaks VFT	650	SF	Room 001 and 003 - 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29A	12"x12' Coffee w/ Beige & Brown Streaks VFT	650	SF	Room 001 & 003 - 1923	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
30	Mastic 12"x12" Light Tan VFT	1,400	SF	Lunchroom & Teacher's Lunchroom - 1923	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30A	12"x12" Light Tan VFT Mastic	1,400	SF	Lunchroom & Teacher's Lunchroom - 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Canvas (Not Observed)			3rd Floor Corridor - 1923	Assumed	MISC					
33	12"x12" Brown, White, & Tan Streaked VFT	800	SF	Room 210 and 210 wardrobe - 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33A	12"x12" Brown, White, & Tan Streaked VFT Mastic	800	SF	Room 210 and 210 wardrobe - 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" Gray VFT	12,000	SF	Throughout - 1996	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12"x12" Gray VFT Mastic	12,000	SF	Throughout - 1996	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	2'x4' White w/ Grooves Ceiling Tile	12,000	SF	Throughout - 1996	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Gray Vinyl Baseboards	2,200	LF	Throughout - 1996	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
38	Gray Vinyl Baseboard Mastic	2,200	LF	Throughout - 1996	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
39	Drywall	20,000	SF	Throughout - 1996	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	Drywall Compound	20,000	SF	Throughout - 1996	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Terrazzo	3,000	SF	Rest Rooms, Stairs and Stair Landings, 1st, 2nd, and 3rd Floor Corridors Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12 x 12 Off White with blue Specks VFT	4,800	SF	1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor Basement - Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12 X 12 Off White with Blue Specks Mastic	4,800	SF	1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor Basement - Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12 x 12 Blue Speckled VFT	360	SF	1st, 2nd, 3rd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12 X 12 Blue Speckled Mastic	360	SF	1st, 2nd, 3rd Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12 x 12 Off-white with Beige Specks VFT	3,300	SF	312 & 312A, 213, 210 Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12 x 12 Offwhite with Beige Mastic	3,300	SF	312, 312A, 213, 210 Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	12 x 12 Off White with Beige Streaks VFT	250	SF	315 Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12 x 12 Off White With Beige Streaks Mastic	250	SF	315 Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12 x 12 Off White with Beige Specks VFT	700	SF	205 Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12 x 12 Off White with Beige Specks Mastic	700	SF	Rm 205 Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Carpet Mastic	2,900	SF	Library, Teacher Lounge, Auditorium Bldg 1923	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12 x 12 Light Green with White VFT	500	SF	Main Office Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
54	12 X 12 Light Green With White Specks Mastic	500	SF	Main Office Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12 x 12 Green with White Specks VFT	200	SF	Main Office Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	12 x 12 Green with White Specks Mastic	200	SF	Main Office Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Carpet Mastic	1,000	SF	Rm 108 (c/cm office) Bldg 1897	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12 x 12 Light Green w/ Black Spotted Slip Resistant VFT	800	SF	Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic	800	SF	Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12 x 12 Light Green with Black Spotted Slip Resistant VFT	600	SF	Basement Near Door G	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic	600	SF	Basement Near Door G Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12 x 12 Blue with Dark Blue Specks VFT	400	SF	Rm 012 Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	12 x 12 Blue with Dark Blue Specks Mastic	400	SF	Rm 012 Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	12 x 12 White w/ Multi Color Specks VFT	300	SF	Rm 012 Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	12 x 12 White w/ Multi Color Specks Mastic	300	SF	Rm 012 Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	12 x 12 White w/ Blue & Red Specks VFT	2,200	SF	Rm 011, Basement Corridor Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	12 x 12 White w/ Blue & Red Specks Mastic	2,200	SF	Rm 011, Basement Corridor Bldg 1897	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	2 x 4 White Smooth Ceiling Tile	3,200	SF	Lunchroom A & B, Kitchen Bldg 1923	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Aircell Pipe Insulation	1,420	LF	Tank room, Engine Room, Boiler Room, Room 008, North Corridor Basement - 1897	Chrysotile	TSI	Yes	4	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
D	MJP E/F/V on Aircell Pipe Insulation	200	LF	Tank room, Boiler Room, Room 008 - 1897	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
F	MJP E/F/V on Cardboard Pipe Insulation	210	LF	Room 008 - 1897	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
G	Mag Block Pipe Insulation	203	LF	Basement Corridor, Break Room, Engineers Office - 1897	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	MJP E/F/V on Mag Block Pipe Insulation	11	LF	Receiving Room - 1897	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
J	Tank Insulation	400	SF	Boiler Room & Tank Room - 1897	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K	Aircell Duct Insulation	950	SF	North Corridor, Tank Room, Boiler Room, Room 008 and 014- 1897	Chrysotile	TSI	Yes	50	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
L	MJP E/F/V on Fiberglass Pipe Insulation	100	LF	3rd Floor Boys Toilet, Engine Room, Boiler Room, Receiving Room - 1897	Assumed	TSI	Yes	2	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
 Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
M	MJP E/F/V on Fiberglass Pipe Insulation	50	SF	Assembly Hall - 1923	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
N	12"x12" Ceiling Tile	800	SF	Room 307 - 1897	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O	Paperwrap Pipe Insulation	150	LF	Room 008 - 1897	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
P	Aircell Pipe Insulation	175	LF	Throughout (See Hatching Map) - 1923	Chrysotile	TSI	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
Q	MJPE/F/V on Aircell Pipe Insulation	55	LF	Throughout (See Hatching Map) - 1923	Chrysotile	TSI	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
R	12"x12" Yellow with Yellow Specks VFT	200	SF	Room 008	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
S	12"x12" Blue with Blue Specks VFT	200	SF	Room 008	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
T	12"x12" White with Blue & Gray Specks VFT	200	SF	Room 008	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
U	12"x12" Beige VFT	150	SF	Room 037 (Next to Engineers Office)	Assumed	MISC	No	30	SF	6 ACBM with the potential for damage	Remove

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
 Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	9/9/2022
Manager Planner Name	Arturo Saenz
100-04019	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
01A	
02	
05	
08	
10	
10A	
11	
11A	
12	
12A	
13	
13A	
14	
14A	
15	
15A	
16	
16A	
17	Remove damaged ACM ASAP
17A	
18	
18A	
19	

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	
25A	
26	
26A	
27	
27A	
28	
28A	
29	
29A	
30	
30A	
31	
33	
33A	
34	

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
 Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
62	
63	
64	
65	
66	
67	
68	
C	repair damaged ACM ASAP
D	
F	
G	
H	repair damaged ACM ASAP
J	
K	repair damaged ACM ASAP
L	repair damaged ACM ASAP
M	
N	
O	
P	
Q	
R	
S	
T	
U	Sample material, Remove damaged ACM ASAP

Chicago Public Schools

School Cameron School
Address 1234 N. Monticello

Unit 22531
Chicago, IL, 60651

Building ID 2610
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.
2942 W. Van Buren Street
Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1897**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1923**
MATERIAL QUANTITY: **100000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **01A**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout 1923**
MATERIAL QUANTITY: **100000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **2'x4' White Speckled Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom - 1897**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **2'x4' White Speckled Ceiling Tile**
MATERIAL LOCATION: **Lunchroom - 1897**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **9"x9" Maroon VFT - NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 012 - 1897**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **9"x9" Maroon VFT - NOT OBSERVED**

MATERIAL LOCATION: **Room 012 - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **9"x9" Maroon VFT Mastic - NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 012 - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **9"x9" Maroon VFT Mastic - NOT OBSERVED**

MATERIAL LOCATION: **Room 012 - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg**

MATERIAL QUANTITY: **8500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown Streaks VFT**
MATERIAL LOCATION: **Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg**
MATERIAL QUANTITY: **8500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10A**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg**

MATERIAL QUANTITY: **8500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **10A**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 306, 307, 308, 310, 309, 311, 313, 212, 211, 209, 208, 206, 106, 107, 108, 109, Nurses Office, 111, 112, 113 - 1897 Bldg**
MATERIAL QUANTITY: **8500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12"x12" White w/ Long Tan Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 207 - Bldg 1897**

MATERIAL QUANTITY: **9500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12"x12" White w/ Long Tan Streaks VFT**
MATERIAL LOCATION: **Room 207 - Bldg 1897**
MATERIAL QUANTITY: **9500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **12"x12" White w/ Long Tan Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 207 - Bldg 1897**
MATERIAL QUANTITY: **9500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **12"x12" White w/ Long Tan Streaks VFT Mastic**
MATERIAL LOCATION: **Rm 207 - Bldg 1897**
MATERIAL QUANTITY: **9500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown & Black Streaks VFT (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**
MATERIAL LOCATION: **2nd Floor Corridor & Rooms 208 & 211 - 1897 NOT OBSERVED**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown & Black Streaks VFT (NOT OBSERVED)**
MATERIAL LOCATION: **2nd Floor Corridor & Rooms 208 & 211 - 1897 NOT OBSERVED**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **12"x12" White w/ Lt Brn & Black Streaks VFT Mastic (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**
MATERIAL LOCATION: **2nd Floor Corridor, Rooms 208 & 211 Bldg 1897 NOT OBSERVED**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **12"x12" White w/ Lt Brn & Black Streaks VFT Mastic (NOT OBSERVED)**
MATERIAL LOCATION: **2nd Floor Corridor, Rooms 208 & 211 Bldg 1897 NOT OBSERVED**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **9"x9" Black VFT (ABATED 2003)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Waiting Room and Clinic - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **9"x9" Black VFT (ABATED 2003)**

MATERIAL LOCATION: **Waiting Room and Clinic - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13A**
MATERIAL DESCRIPTION: **9"x9" Black VFT Mastic (ABATED 2003)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Waiting Room and Clinic- 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **13A**
MATERIAL DESCRIPTION: **9"x9" Black VFT Mastic (ABATED 2003)**
MATERIAL LOCATION: **Waiting Room and Clinic- 1897**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **9"x9" Green VFT (ABATED 2003)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Main Office - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **9"x9" Green VFT (ABATED 2003)**

MATERIAL LOCATION: **1st Floor Main Office - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14A**
MATERIAL DESCRIPTION: **9"x9" Green VFT Mastic (ABATED 2003)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Main Office - 1897**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **14A**
MATERIAL DESCRIPTION: **9"x9" Green VFT Mastic (ABATED 2003)**
MATERIAL LOCATION: **1st Floor Main Office - 1897**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9"x9" Brown w/ Brown & Beige Streaks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 001 - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **9"x9" Brown w/ Brown & Beige Streaks VFT (ABATED)**

MATERIAL LOCATION: **Room 001 - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **9"x9" Brown w/ Brown & Beige Streaks VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 001 - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **9"x9" Brown w/ Brown & Beige Streaks VFT Mastic (ABATED)**
MATERIAL LOCATION: **Room 001 - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9"x9" White w/ Light Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Engineer's Office - 1897**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Engineers Office (next to receiving room) - 1897 Bldg.**

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9"x9" White w/ Light Brown Streaks VFT**
MATERIAL LOCATION: **Engineer's Office - 1897**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **14** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Remove damaged ACM ASAP

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **9"x9" White w/ Light Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office - 1897**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **9"x9" White w/ Light Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Engineer's Office - 1897**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9"x9" Green w/ Beige Streaks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor & Teacher's Lounge (Not Observed) - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **9"x9" Green w/ Beige Streaks VFT (ABATED)**

MATERIAL LOCATION: **1st Floor Corridor & Teacher's Lounge (Not Observed) - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **9"x9" Green w/ Beige Streaks VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor & Teacher's Lounge (Not Observed) - Bldg 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **9"x9" Green w/ Beige Streaks VFT Mastic (ABATED)**
MATERIAL LOCATION: **1st Floor Corridor & Teacher's Lounge (Not Observed) - Bldg 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 101, 103 - Bldg 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT**
MATERIAL LOCATION: **Room 101, 103 - Bldg 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 101, 103 - Bldg 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Room 101, 103 - Bldg 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9"x9" Blue Green w/ Beige Streaks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9"x9" Blue Green w/ Beige Streaks VFT (ABATED)**
MATERIAL LOCATION: **2nd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **9"x9" Blue Green w/ Beige Streaks VFT Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **9"x9" Blue Green w/ Beige Streaks VFT Mastic (Abated)**
MATERIAL LOCATION: **2nd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Beige Streaks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Beige Streaks VFT (ABATED)**
MATERIAL LOCATION: **3rd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Beige Streaks VFT Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Beige Streaks VFT Mastic (Abated)**
MATERIAL LOCATION: **3rd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White & Black Streaks VFT (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White & Black Streaks VFT (Abated)**

MATERIAL LOCATION: **2nd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White & Black Streaks VFT Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White & Black Streaks VFT Mastic (Abated)**
MATERIAL LOCATION: **2nd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st Floor Corridor (Abated), 3rd Floor Corridor and Room 205 (Not Observed)- 1923**

MATERIAL QUANTITY: **5800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Brown Streaks VFT**
MATERIAL LOCATION: **1st Floor Corridor (Abated), 3rd Floor Corridor and Room 205 (Not Observed)- 1923**
MATERIAL QUANTITY: **5800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridor (ABATED), 3rd Floor Corridor and Room 205 (NOT OBSERVED)-1923**

MATERIAL QUANTITY: **5800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **9"x9" Tan w/ Brown Streaks VFT Mastic**
MATERIAL LOCATION: **1st Floor Corridor (ABATED), 3rd Floor Corridor and Room 205 (NOT OBSERVED)- 1923**
MATERIAL QUANTITY: **5800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **9"x9" Black w/ Beige Streaks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor, 2nd Floor Corridor Above Auditorium, and 3rd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: 

Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **9"x9" Black w/ Beige Streaks VFT (ABATED)**

MATERIAL LOCATION: **1st Floor Corridor, 2nd Floor Corridor Above Auditorium, and 3rd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **9"x9" Black w/ Beige Streaks VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor, 2nd Floor Corridor Above Auditorium, 3rd Floor Corridor - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **9"x9" Black w/ Beige Streaks VFT Mastic (ABATED)**
MATERIAL LOCATION: **1st Floor Corridor, 2nd Floor Corridor Above Auditorium, 3rd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **IRIP Room 303A & 303B - 1923**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Streaks VFT**
MATERIAL LOCATION: **IRIP Room 303A & 303B - 1923**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **IRIP Room 303A & 303B - 1923**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Streaks VFT Mastic**
MATERIAL LOCATION: **IRIP Room 303A & 303B - 1923**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **9"x9" Gray VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **9"x9" Gray VFT (ABATED)**

MATERIAL LOCATION: **Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **9"x9" Gray VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **9"x9" Gray VFT Mastic (ABATED)**
MATERIAL LOCATION: **Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **6"x18" Black VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **6"x18" Black VFT (ABATED)**

MATERIAL LOCATION: **Teacher's Room (Not Observed) & 2nd Floor Corridor - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **6"x18" Black VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Room (Not Observed)& 2nd Floor Corridor - 1923**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **6"x18" Black VFT Mastic (ABATED)**
MATERIAL LOCATION: **Teacher's Room (Not Observed)& 2nd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Brown Floor Covering (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Library (Under Carpet) - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Brown Floor Covering (ABATED)**

MATERIAL LOCATION: **Library (Under Carpet) - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **Brown Floor Covering Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Library (Under Carpet) - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **Brown Floor Covering Mastic (ABATED)**
MATERIAL LOCATION: **Library (Under Carpet) - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12"x12' Coffee w/ Beige & Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 001 and 003 - 1923**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12"x12' Coffee w/ Beige & Brown Streaks VFT**
MATERIAL LOCATION: **Room 001 and 003 - 1923**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29A**
MATERIAL DESCRIPTION: **12"x12' Coffee w/ Beige & Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 001 & 003 - 1923**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **29A**
MATERIAL DESCRIPTION: **12"x12' Coffee w/ Beige & Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Room 001 & 003 - 1923**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12"x12" Light Tan VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Lunchroom & Teacher's Lunchroom - 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12"x12" Light Tan VFT**
MATERIAL LOCATION: **Lunchroom & Teacher's Lunchroom - 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30A**
MATERIAL DESCRIPTION: **12"x12" Light Tan VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom & Teacher's Lunchroom - 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **30A**
MATERIAL DESCRIPTION: **12"x12" Light Tan VFT Mastic**
MATERIAL LOCATION: **Lunchroom & Teacher's Lunchroom - 1923**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Canvas (Not Observed)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Corridor - 1923**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Canvas (Not Observed)**
MATERIAL LOCATION: **3rd Floor Corridor - 1923**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12"x12" Brown, White, & Tan Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 210 and 210 wardrobe - 1897**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12"x12" Brown, White, & Tan Streaked VFT**
MATERIAL LOCATION: **Room 210 and 210 wardrobe - 1897**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **12"x12" Brown, White, & Tan Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 210 and 210 wardrobe - 1897**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **12"x12" Brown, White, & Tan Streaked VFT Mastic**
MATERIAL LOCATION: **Room 210 and 210 wardrobe - 1897**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" Gray VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" Gray VFT**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12"x12" Gray VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12"x12" Gray VFT Mastic**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **2'x4' White w/ Grooves Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **2'x4' White w/ Grooves Ceiling Tile**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboards**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Drywall Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Drywall Compound**
MATERIAL LOCATION: **Throughout - 1996**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rest Rooms, Stairs and Stair Landings, 1st, 2nd, and 3rd Floor Corridors Bldg 1923**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Rest Rooms, Stairs and Stair Landings, 1st, 2nd, and 3rd Floor Corridors Bldg 1923**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12 x 12 Off White with blue Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor
Basement - Bldg 1923**

MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12 x 12 Off White with blue Specks VFT**
MATERIAL LOCATION: **1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor Basement - Bldg 1923**
MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12 X 12 Off White with Blue Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor
Basement - Bldg 1923**

MATERIAL QUANTITY: **4800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12 X 12 Off White with Blue Specks Mastic**
MATERIAL LOCATION: **1st Flr, 2nd, 3rd Corridors, Lunchroom A & B, Elevator Lobby 1st, 2nd, 3rd Floor Basement - Bldg 1923**
MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12 x 12 Blue Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12 x 12 Blue Speckled VFT**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12 X 12 Blue Speckled Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Corridors**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12 X 12 Blue Speckled Mastic**
MATERIAL LOCATION: **1st, 2nd, 3rd Corridors**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12 x 12 Off-white with Beige Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **312 & 312A, 213, 210 Bldg 1897**
MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12 x 12 Off-white with Beige Specks VFT**
MATERIAL LOCATION: **312 & 312A, 213, 210 Bldg 1897**
MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12 x 12 Offwhite with Beige Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **312, 312A, 213, 210 Bldg 1897**
MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12 x 12 Offwhite with Beige Mastic**
MATERIAL LOCATION: **312, 312A, 213, 210 Bldg 1897**
MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12 x 12 Off White with Beige Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **315 Bldg 1923**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12 x 12 Off White with Beige Streaks VFT**
MATERIAL LOCATION: **315 Bldg 1923**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12 x 12 Off White With Beige Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **315 Bldg 1923**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12 x 12 Off White With Beige Streaks Mastic**
MATERIAL LOCATION: **315 Bldg 1923**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12 x 12 Off White with Beige Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **205 Bldg 1923**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12 x 12 Off White with Beige Specks VFT**
MATERIAL LOCATION: **205 Bldg 1923**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12 x 12 Off White with Beige Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 205 Bldg 1923**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12 x 12 Off White with Beige Specks Mastic**
MATERIAL LOCATION: **Rm 205 Bldg 1923**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library, Teacher Lounge, Auditorium Bldg 1923**
MATERIAL QUANTITY: **2900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Library, Teacher Lounge, Auditorium Bldg 1923**
MATERIAL QUANTITY: **2900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12 x 12 Light Green with White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Office Bldg 1897**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12 x 12 Light Green with White VFT**
MATERIAL LOCATION: **Main Office Bldg 1897**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12 X 12 Light Green With White Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office Bldg 1897**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12 X 12 Light Green With White Specks Mastic**
MATERIAL LOCATION: **Main Office Bldg 1897**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12 x 12 Green with White Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Office Bldg 1897**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12 x 12 Green with White Specks VFT**
MATERIAL LOCATION: **Main Office Bldg 1897**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12 x 12 Green with White Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office Bldg 1897**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12 x 12 Green with White Specks Mastic**
MATERIAL LOCATION: **Main Office Bldg 1897**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 108 (c/cm office) Bldg 1897**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Rm 108 (c/cm office) Bldg 1897**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **12 x 12 Light Green w/ Black Spotted Slip Resistant VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **12 x 12 Light Green w/ Black Spotted Slip Resistant VFT**
MATERIAL LOCATION: **Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic**
MATERIAL LOCATION: **Corridor Near Auditorium Balcony, Auditorium, Elevator Basement Lobby Bldg 1923**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12 x 12 Light Green with Black Spotted Slip Resistant VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Near Door G**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12 x 12 Light Green with Black Spotted Slip Resistant VFT**
MATERIAL LOCATION: **Basement Near Door G**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement Near Door G Bldg 1897**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12 x 12 Light Green w/ Black Spotted Slip Resistant Mastic**
MATERIAL LOCATION: **Basement Near Door G Bldg 1897**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **12 x 12 Blue with Dark Blue Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **12 x 12 Blue with Dark Blue Specks VFT**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **12 x 12 Blue with Dark Blue Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **12 x 12 Blue with Dark Blue Specks Mastic**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12 x 12 White w/ Multi Color Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12 x 12 White w/ Multi Color Specks VFT**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12 x 12 White w/ Multi Color Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12 x 12 White w/ Multi Color Specks Mastic**
MATERIAL LOCATION: **Rm 012 Bldg 1897**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12 x 12 White w/ Blue & Red Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rm 011, Basement Corridor Bldg 1897**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12 x 12 White w/ Blue & Red Specks VFT**
MATERIAL LOCATION: **Rm 011, Basement Corridor Bldg 1897**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12 x 12 White w/ Blue & Red Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 011, Basement Corridor Bldg 1897**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12 x 12 White w/ Blue & Red Specks Mastic**
MATERIAL LOCATION: **Rm 011, Basement Corridor Bldg 1897**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **2 x 4 White Smooth Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom A & B, Kitchen Bldg 1923**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **2 x 4 White Smooth Ceiling Tile**
MATERIAL LOCATION: **Lunchroom A & B, Kitchen Bldg 1923**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Tank room, Engine Room, Boiler Room, Room 008, North Corridor Basement - 1897**
MATERIAL QUANTITY: **1420** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Tank room, Engine Room, Boiler Room, Room 008, North Corridor Basement - 1897**
MATERIAL QUANTITY: **1420** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **4** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
repair damaged ACM ASAP

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Tank room, Boiler Room, Room 008 - 1897**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Tank room, Boiler Room, Room 008 - 1897**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 008 - 1897**

MATERIAL QUANTITY: **210**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Water**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Basement Corridor, Break Room, Engineers Office - 1897**
MATERIAL QUANTITY: **203** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
MATERIAL LOCATION: **Basement Corridor, Break Room, Engineers Office - 1897**
MATERIAL QUANTITY: **203** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Receiving Room - 1897**
MATERIAL QUANTITY: **11** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**
MATERIAL LOCATION: **Receiving Room - 1897**
MATERIAL QUANTITY: **11** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
repair damaged ACM ASAP

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room & Tank Room - 1897**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room & Tank Room - 1897**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Aircell Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **North Corridor, Tank Room, Boiler Room, Room 008 and 014- 1897**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Aircell Duct Insulation**
MATERIAL LOCATION: **North Corridor, Tank Room, Boiler Room, Room 008 and 014- 1897**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
repair damaged ACM ASAP

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Boys Toilet, Engine Room, Boiler Room, Receiving Room - 1897**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **3rd Floor Boys Toilet, Engine Room, Boiler Room, Receiving Room - 1897**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **2** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

repair damaged ACM ASAP

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1923**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Assembly Hall - 1923**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **12"x12" Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 307 - 1897**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **12"x12" Ceiling Tile**
MATERIAL LOCATION: **Room 307 - 1897**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation**
MATERIAL LOCATION: **Room 008 - 1897**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout (See Hatching Map) - 1923**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Throughout (See Hatching Map) - 1923**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUIDLING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **MJPE/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout (See Hatching Map) - 1923**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **08/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **MJPE/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Throughout (See Hatching Map) - 1923**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **U**
MATERIAL DESCRIPTION: **12"x12" Beige VFT**
MATERIAL LOCATION: **Room 037 (Next to Engineers Office)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **30** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
Room 037 (Next to Engineers Office)

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **U**
MATERIAL DESCRIPTION: **12"x12" Beige VFT**
MATERIAL LOCATION: **Room 037 (Next to Engineers Office)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:
Sample material, Remove damaged ACM ASAP

Management Planner's Signature:  _____ Date: **09/09/2022** _____

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **S**
MATERIAL DESCRIPTION: **12"x12" Blue with Blue Specks VFT**
MATERIAL LOCATION: **Room 008**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **S**
MATERIAL DESCRIPTION: **12"x12" Blue with Blue Specks VFT**
MATERIAL LOCATION: **Room 008**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **R**
MATERIAL DESCRIPTION: **12"x12" Yellow with Yellow Specks VFT**
MATERIAL LOCATION: **Room 008**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **R**
MATERIAL DESCRIPTION: **12"x12" Yellow with Yellow Specks VFT**
MATERIAL LOCATION: **Room 008**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **09/09/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Cameron School** INSPECTION DATE: **8/10/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **T**
MATERIAL DESCRIPTION: **12"x12" White with Blue & Gray Specks VFT**
MATERIAL LOCATION: **Room 008**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22531** BUILDING ID: **2610**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Cameron School** REVIEW DATE: **9/9/2022**
ADDRESS: **1234 N. Monticello** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **T**
MATERIAL DESCRIPTION: **12"x12" White with Blue & Gray Specks VFT**
MATERIAL LOCATION: **Room 008**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **09/09/2022** _____

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER: 100 - 11089
ISSUED: 2/28/2022
EXPIRES: 05/15/2023

PANFILO CARRAZCO
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



PANFILO CARRAZCO
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

<p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p> <p>INSPECTOR</p> <p>PROJECT MANAGER</p> <p>AIR SAMPLING PROFESSIONAL</p>	<p>TC EXPIRES</p> <p>1/15/2023</p> <p>1/22/2023</p>
<p>ID NUMBER 100 - 11089</p> <p>PANFILO CARRAZCO 2942 W VAN BUREN ST CHICAGO, IL 60612</p> <p>Environmental Health</p>	<p>ISSUED 2/28/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/28/2023 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II; Authorized by both AHERA & ASHARA.

01/28/2023

Course Dates:

01/28/2024

Expires:

2301BIR14

Certificate Number:



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

A handwritten signature in black ink, appearing to read "N Peneff".

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/15/2022

Course Dates:

01/15/2023

Expires:

2201BIR02

Certificate Number:



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

A handwritten signature in black ink, appearing to read "N Peneff", is written over a light-colored rectangular background.

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: BIR2111012562

A handwritten signature in cursive script that reads 'Kathy DeSalvo'.

Kathy DeSalvo, Director



Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012583

A handwritten signature in cursive script that reads 'Kathy DeSalvo'.

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

ARTURO SAENZ
 2942 W VAN BUREN ST
 CHICAGO, IL 60612

2/28/2022



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
 100 - 04019

ISSUED
 2/28/2022

EXPIRES
 05/15/2023

ARTURO SAENZ
 2942 W VAN BUREN ST
 CHICAGO, IL 60612



Environmental Health

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

<p>ASBESTOS PROFESSIONAL LICENSE</p>			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 04019	ISSUED 2/28/2022	EXPIRES 05/15/2023	INSPECTOR	11/1/2022
ARTURO SAENZ 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			MANAGEMENT PLANNER	11/1/2022
			AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed