

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2139
SCHOOL NAME: Cook School
ADDRESS OF SCHOOL: 8150 S. Bishop
CITY: Chicago, IL, 60620

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **8/16/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/17/2022 ENROLLMENT 325
IDPH INSPECTOR LICENSE NUMBER: 100-11070
IDPH LICENSED INSPECTOR NAME (Please Print): Mallory Jones
IDPH MP LICENSE NUMBER: 100-01784
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Steven Geneser

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer

11/15/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Cook School

8150 S. Bishop
Chicago, IL, 60620

Unit: 22801
Building ID: 2860

IDPH ID Number: 14-016-2990-2139

REPORT DATE:

Tuesday, November 15, 2022

Prepared for:

**Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

11/14/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 22801 Region: 05 IDPH ID: 14-016-2990-2139

School: Cook School Building ID: 2860

Address: 8150 S. Bishop
Chicago, IL, 60620

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 10/17/2022

Review Date: 11/14/2022

Inspector: Mallory Jones


Inspector IDPH License: 100-11070

Management Planner: Steven Geneser

Management Planner IDPH License: 100-01784

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

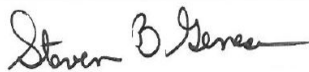

Steven Geneser
100-01784

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: November 15, 2022

RE: Cook School, Unit 22801
8150 S. Bishop
Chicago, IL, 60620

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Cook School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Cook School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Cook School
Address: 8150 S. Bishop
IDPH ID: 14-016-2990-2139
Contact:

Unit: 22801
Chicago, IL, 60620
Building ID: 2860
Phone:

Region: 05

2. Description of Facility

Original Construction:
Total Square Footage:
Current Occupancy: 325

Additional Construction:
No of Floors:

3. LEA Designated Person

Contact: Richard J.Schleyer
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 251-7074


4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Phone: 630-790-0880

Fax: 630-790-0882

5. Inspector

Inspector Name: Mallory Jones

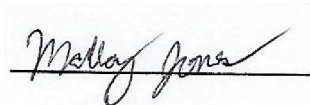


Inspector IDPH license # 100-11070
Reinspection Date: 10/17/2022

Signature:
Date: 10/17/2022

6. Management Planner

Management Planner Name: Steven Geneser

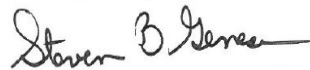

Management Planner IDPH license # 100-01784

Signature:
Date: 11/14/2022

7. Review Date: 11/14/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 11/15/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Cook School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2860:

48	Hard Coat Plaster
56	12"x12" Light Blue Floor Tile
56A	Mastic associated with 12"x12" Light Blue Floor Tile
57	12"x12" Dark Blue Floor Tile
57A	Mastic associated with 12"x12" Dark Blue Floor Tile
58	12"x12" Beige w/Specks Floor Tile
58A	Mastic associated with 12"x12" Beige w/Specks Floor Tile
59	12"x12" Brown w/Specks Floor Tile

59A	Mastic associated with 12"x12" Brown w/Specks Floor Tile
60	12"x12" Grey w/Specks Floor Tile
60A	Mastic associated with 12"x12" Grey w/Specks Floor Tile
61	12"x12" Ash Blue w/Specks Floor Tile
61A	Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile
A	Aircell Pipe Insulation
NEW	Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 2860:

56	12"x12" Light Blue Floor Tile
56A	Mastic associated with 12"x12" Light Blue Floor Tile
57	12"x12" Dark Blue Floor Tile
57A	Mastic associated with 12"x12" Dark Blue Floor Tile
58	12"x12" Beige w/Specks Floor Tile
58A	Mastic associated with 12"x12" Beige w/Specks Floor Tile
59	12"x12" Brown w/Specks Floor Tile
59A	Mastic associated with 12"x12" Brown w/Specks Floor Tile
60	12"x12" Grey w/Specks Floor Tile
60A	Mastic associated with 12"x12" Grey w/Specks Floor Tile
61	12"x12" Ash Blue w/Specks Floor Tile
61A	Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile
NEW	Newly Installed Suspect ACM

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

03	12"x12" White Floor Tile
07	12"x12" Brown Floor Tile
12	12"x12" Beige Floor Tile
14	12"x12" White Floor Tile
16	Fire Doors
18	Transite Lab Tables
19	Baseboard Mastic
20	Fire Doors
21	Baseboard Mastic
22	Baseboard
24	9"x9" Beige Floor Tile Mastic
30	12"x12" Tan Floor Tile Mastic
32	12"x12" Beige Floor Tile Mastic
33	12"x12" Purple Floor Tile
34	12"x12" Purple Floor Tile Mastic
35	12"x12" Tan Floor Tile
37	Brown Linoleum
38	Brown Linoleum Mastic
39	Purple Carpet Mastic
40	Orange Carpet Mastic
41	Brown Carpet Mastic
43	12"x12" Beige with Specks Floor Tile Mastic
44	Multicolor Carpet Adhesive
45	12"x12" Tan w/Specks Floor Tile
46	Purple Carpet
47	2'x4' Ceiling Tile w/Chicken Scratch
48	Hard Coat Plaster
49	Hard Coat Plaster
50	12x12 Dark Brown Floor Tile
51	12"x12" Dark Brown Floor Tile Mastic
52	1'x1' Acoustical Ceiling Tile
53	1'x1' Acoustical Ceiling Tile Glue Dots
54	12"x12" Light Beige w/Tan Specks Floor Tile
55	12"x12" Light Beige w/Tan Specks Floor Tile Mastic
56	12"x12" Light Blue Floor Tile
56A	Mastic associated with 12"x12" Light Blue Floor Tile
57	12"x12" Dark Blue Floor Tile
57A	Mastic associated with 12"x12" Dark Blue Floor Tile
58	12"x12" Beige w/Specks Floor Tile

58A	Mastic associated with 12"x12" Beige w/Specks Floor Tile
59	12"x12" Brown w/Specks Floor Tile
59A	Mastic associated with 12"x12" Brown w/Specks Floor Tile
60	12"x12" Grey w/Specks Floor Tile
60A	Mastic associated with 12"x12" Grey w/Specks Floor Tile
61	12"x12" Ash Blue w/Specks Floor Tile
61A	Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile
B	Paper Wrap Pipe Insulation
E	Tank Insulation
I	Fittings on Aircell
K	Whiteboard Mastic
L	Old Chalkboards
NEW	Newly Installed Suspect ACM

The following areas were deemed to be inaccessible:

19	Baseboard Mastic
21	Baseboard Mastic
24	9"x9" Beige Floor Tile Mastic
25	12"x12" Orange Floor Tile Mastic
26	12"x12" Brown Floor Tile Mastic
27	12"x12" White Floor Tile Mastic
28	12"x12" Brown Floor Tile Mastic
29	12"x12" White Floor Tile Mastic
30	12"x12" Tan Floor Tile Mastic
31	12"x12" Medium Brown Floor Tile Mastic
32	12"x12" Beige Floor Tile Mastic
34	12"x12" Purple Floor Tile Mastic
36	12"x12" Tan Floor Tile Mastic
39	Purple Carpet Mastic
40	Orange Carpet Mastic
41	Brown Carpet Mastic
44	Multicolor Carpet Adhesive
51	12"x12" Dark Brown Floor Tile Mastic
52	1'x1' Acoustical Ceiling Tile
53	1'x1' Acoustical Ceiling Tile Glue Dots
55	12"x12" Light Beige w/Tan Specks Floor Tile Mastic
A	Aircell Pipe Insulation
I	Fittings on Aircell
K	Whiteboard Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Mallory Jones, IDPH License # 100-11070. The Management Plan was updated by Steven Geneser, IDPH License # 100-01784. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:	7/6/2020
	8/2/2021
	8/2/2021
	8/2/2021

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Cook School Building 2860 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
03	12"x12" White Floor Tile	2,250	SF	1925 Building-Room 102 & 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage	5	LOW
04	9"x9" Beige Floor Tile	750	SF	1925 Building-Room 104	CHR	MISC	N	LOC	0		No	ACBM with the potential for damage	5	LOW
05	12"x12" Tan Floor Tile	1,150	SF	1925 Building-Room 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	12"x12" Brown Floor Tile	1,950	SF	Room 110 & 112	ASSUMED	MISC	N	LOC	0		No	ACBM with the potential for damage	5	LOW
08	12"x12" Beige with Specks Floor Tile	750	SF	1925 Building-Room 111	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	12"x12" Brown Floor Tile	3,520	SF	1974 Building- Store Rooms, Eng. Office, 1st & 2nd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12"x12" Beige Floor Tile	1,950	SF	1974 Building-Room 224 & 228	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12"x12" White Floor Tile	5,600	SF	1974 Building-Room 119, 121, Lunchroom, Teachers' Lunchroom & Corridor	ASSUMED	MISC	N	LOC	25		No	ACBM with the potential for damage	5	LOW
16	Fire Doors	2	EA	1925 Building-Boiler Room, Boiler Room Tunnel	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Boiler Room Gasket ABATED			1925 Building-Boiler Room	ABATED	TSI								
18	Transite Lab Tables	30	SF	1925 Building-Room 207	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Baseboard Mastic	70	LF	1925 Building-Rooms 115A, 216A, 1st Floor Boys' Toilet & Adjacent Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Fire Doors	2	EA	1974 Building-Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Baseboard Mastic	2,940	LF	Throughout 1974 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Baseboard	70	LF	1925 Building-Rooms 115A & 216A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Baseboard	2,940	LF	Throughout 1974 Building	ANT	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	9"x9" Beige Floor Tile Mastic	750	SF	Room 104	ASSUMED	MISC	N	LOC	0		No	ACBM with the	5	LOW

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
25	12"x12" Orange Floor Tile Mastic	8,650	SF	1st & 2nd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12"x12" Brown Floor Tile Mastic	1,950	SF	1925 Building-Room 110 & 112	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12"x12" White Floor Tile Mastic	5,600	SF	1974 Building-Room 119, 121, Teachers' Lunchroom, Lunchroom & Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	12"x12" Brown Floor Tile Mastic	3,520	SF	1974 Building-Storerooms, Electrical Room, Engineer's Office, 1st & 2nd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	12"x12" White Floor Tile Mastic	2,250	SF	1925 Building-Rooms 102 & 112	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12"x12" Tan Floor Tile Mastic	1,150	SF	1925 Building-Room 113	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12"x12" Medium Brown Floor Tile Mastic	750	SF	1925 Building-Rooms 111 & 115A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12"x12" Beige Floor Tile Mastic	1,950	SF	1974 Building-Rooms 224 & 228	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	12"x12" Purple Floor Tile	420	SF	1925 Building- Main Office, Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12"x12" Purple Floor Tile Mastic	420	SF	1925 Building- Main Office, Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12"x12" Tan Floor Tile	625	SF	1974 Annex Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12"x12" Tan Floor Tile Mastic	625	SF	1974 Annex Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Brown Linoleum			1925 Building-Storeroom	ASSUMED	MISC								
38	Brown Linoleum Mastic			1925 Building-Storeroom	ASSUMED	MISC								
39	Purple Carpet Mastic	80	SF	1925 Building- Main Office Storeroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	Orange Carpet Mastic	1,125	SF	1925 Building- Teachers' Restroom & Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
41	Brown Carpet Mastic	1,500	SF	Principal's Office, Annex Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	Orange Carpet Mastic NOT OBSERVED	6,000		1974 Building-Rooms 120, 122, 124, 126, Storeroom & Library; Rooms 217, 219-223, 226, Teachers' Lounge, Library Office & AV Room		MISC			0					
43	12"x12" Beige with Specks Floor Tile Mastic	375	SF	1925 Building-Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	Multicolor Carpet Adhesive	1,125	SF	Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12"x12" Tan w/Specks Floor Tile	9,000	SF	Rooms 124, 126, 219 & 226	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	Purple Carpet	2,000	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	2'x4' Ceiling Tile w/Chicken Scratch	25,000	SF	1925 Building-Throughout 1st & 2nd Corridors, and All Classrooms	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
48	Hard Coat Plaster	37,500	SF	Throughout 1925 Building	ASSUMED	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
49	Hard Coat Plaster	37,500	SF	Throughout 1974 Building	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
50	12x12 Dark Brown Floor Tile	474	SF	1st Floor Restroom and Rooms 115B and 215B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	12"x12" Dark Brown Floor Tile Mastic	474	SF	1st Floor Restroom and Rooms 115B and 215B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	1'x1' Acoustical Ceiling Tile	38	SF	Room 213	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	1'x1' Acoustical Ceiling Tile Glue Dots	38	SF	Room 213	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12"x12" Light Beige w/Tan Specks Floor Tile	725	SF	Room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12"x12" Light Beige w/Tan Specks Floor Tile Mastic	725	SF	Room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	12"x12" Light Blue Floor Tile	1,200	SF	Rooms 112 & 113	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
56A	Mastic associated with 12"x12" Light Blue Floor Tile	1,200	SF	Rooms 112 & 113	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
57	12"x12" Dark Blue Floor Tile	1,200	SF	Rooms 112 & 113	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
57A	Mastic associated with 12"x12" Dark Blue Floor Tile	1,200	SF	Rooms 112 & 113	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
58	12"x12" Beige w/Specks Floor Tile	1,800	SF	Rooms 111, 112, 113 & 119	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
58A	Mastic associated with 12"x12" Beige w/Specks Floor Tile	1,800	SF	Room 111, 112, 113 & 119	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
59	12"x12" Brown w/Specks Floor Tile	600	SF	Room 110	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
59A	Mastic associated with 12"x12" Brown w/Specks Floor Tile	600	SF	Room 110	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
60	12"x12" Grey w/Specks Floor Tile	600	SF	Room 121	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
60A	Mastic associated with 12"x12" Grey w/Specks Floor Tile	600	SF	Room 121	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
61	12"x12" Ash Blue w/Specks Floor Tile	1,600	SF	Main Office & Principal's Office	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
61A	Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile	1,600	SF	Main Office & Principal's Office	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
A	Aircell Pipe Insulation		LF	1925 Building-Basement, Open Crawlspace	CHR	TSI	Y	NONE	150		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW
B	Paper Wrap Pipe Insulation	60	LF	1925 Building-Basement Crawlspace, Boys' & Girls Bathroom, Pipe Chases Throughout	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
D	Aircell Duct Insulation NOT OBSERVED			Wall, Crawlspace	CHR	TSI								
E	Tank Insulation	100	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
F	Fittings on Fiberglass	1	FITTING	1974 Building-Compactor Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
H	Fittings on Paper Wrap	20	LF	1925 Building-Basement Crawlspace, Boys' & Girls' Bathrooms, Pipe Chases Throughout Building	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
I	Fittings on Aircell		LF	1925 Building-Crawlspace	ASSUMED	TSI	Y	DIST	25		No	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
J	Incinerator Insulation (ABATED 1990)			1925 Building-Boiler Room	ABATED	TSI								
K	Whiteboard Mastic	750	SF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
L	Old Chalkboards	4,000	SF	Throughout School	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKNO WN			Yes	ACBM with the potential for damage		

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 10/17/2022
Inspector Name Mallory Jones
100-11070 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
03	5 Floor tiles with cracks - Intact - O&M Repair
04	2 Tiles have cracks but are intact
05	2 tiles with cracks but intact- Complete O&M Repairs
07	10 Floor Tile Intact - Conduct O&M Repairs
08	
09	
12	
14	Damage in Lunchroom
16	
17	
18	
19	
20	
21	
22	
23	
24	2 Tiles cracked/missing Complete O&M Repair
25	
26	
27	
28	
29	
30	
31	

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
32	
33	
34	
35	
36	
37	Not Observed. Concrete Floors
38	Not Observed. Concrete Floors
39	
40	
41	
42	NOT OBESERVED 2022
43	
44	Room 218 Has No Carpet
45	
46	Not Observed 2022
47	Selective Removal for Fire Alarms in Annex Building
48	
49	
50	
51	
52	
53	
54	
55	
56	
56A	
57	
57A	
58	

Chicago Public Schools

School Cook School Unit 22801 Building ID 2860

Address 8150 S. Bishop Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
58A	
59	
59A	
60	
60A	
61	
61A	
A	Damage in crawlspace
B	
D	Not Observed
E	
F	
H	
I	Damage in Crawlspace
J	Not Observed. ABATED 1990
K	
L	
NEW	

Table II

Management Planner's Review

Chicago Public Schools

School Cook School

Unit 22801

Building ID 2860

Address 8150 S. Bishop

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
03	12"x12" White Floor Tile	2,250	SF	1925 Building- Room 102 & 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	9"x9" Beige Floor Tile	750	SF	1925 Building- Room 104	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" Tan Floor Tile	1,150	SF	1925 Building- Room 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Brown Floor Tile	1,950	SF	Room 110 & 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Beige with Specks Floor Tile	750	SF	1925 Building- Room 111	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12"x12" Brown Floor Tile	3,520	SF	1974 Building- Store Rooms, Eng. Office, 1st & 2nd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12"x12" Beige Floor Tile	1,950	SF	1974 Building- Room 224 & 228	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" White Floor Tile	5,600	SF	1974 Building- Room 119, 121, Lunchroom, Teachers' Lunchroom & Corridor	Assumed	MISC	No	25	SF	6 ACBM with the potential for damage	Repair
16	Fire Doors	2	EA	1925 Building- Boiler Room, Boiler Room Tunnel	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
17	Boiler Room Gasket ABATED			1925 Building- Boiler Room	Abated	TSI					
18	Transite Lab Tables	30	SF	1925 Building- Room 207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Baseboard Mastic	70	LF	1925 Building- Rooms 115A, 216A, 1st Floor Boys' Toilet & Adjacent Corridor	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
20	Fire Doors	2	EA	1974 Building- Kitchen	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
21	Baseboard Mastic	2,940	LF	Throughout 1974 Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
22	Baseboard	70	LF	1925 Building- Rooms 115A & 216A	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
23	Baseboard	2,940	LF	Throughout 1974 Building	Anthophyllite	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
24	9"x9" Beige Floor Tile Mastic	750	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" Orange Floor Tile Mastic	8,650	SF	1st & 2nd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Brown Floor Tile Mastic	1,950	SF	1925 Building- Room 110 & 112	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" White Floor Tile Mastic	5,600	SF	1974 Building- Room 119, 121, Teachers' Lunchroom, Lunchroom & Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" Brown Floor Tile Mastic	3,520	SF	1974 Building- Storerooms, Electrical Room, Engineer's Office, 1st & 2nd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12"x12" White Floor Tile Mastic	2,250	SF	1925 Building- Rooms 102 & 112	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12"x12" Tan Floor Tile Mastic	1,150	SF	1925 Building- Room 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"x12" Medium Brown Floor Tile Mastic	750	SF	1925 Building- Rooms 111 & 115A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12"x12" Beige Floor Tile Mastic	1,950	SF	1974 Building- Rooms 224 & 228	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Cook School

Unit 22801

Building ID 2860

Address 8150 S. Bishop

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
33	12"x12" Purple Floor Tile	420	SF	1925 Building- Main Office, Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" Purple Floor Tile Mastic	420	SF	1925 Building- Main Office, Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12"x12" Tan Floor Tile	625	SF	1974 Annex Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12"x12" Tan Floor Tile Mastic	625	SF	1974 Annex Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Brown Linoleum			1925 Building- Storeroom	Assumed	MISC					
38	Brown Linoleum Mastic			1925 Building- Storeroom	Assumed	MISC					
39	Purple Carpet Mastic	80	SF	1925 Building- Main Office Storeroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	Orange Carpet Mastic	1,125	SF	1925 Building- Teachers' Restroom & Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Brown Carpet Mastic	1,500	SF	Principal's Office, Annex Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	Orange Carpet Mastic NOT OBSERVED	6,000		1974 Building- Rooms 120, 122, 124, 126, Storeroom & Library; Rooms 217, 219-223, 226, Teachers' Lounge, Library Office & AV Room		MISC		0			
43	12"x12" Beige with Specks Floor Tile Mastic	375	SF	1925 Building- Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	Multicolor Carpet Adhesive	1,125	SF	Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12"x12" Tan w/Specks Floor Tile	9,000	SF	Rooms 124, 126, 219 & 226	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Purple Carpet	2,000	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
47	2'x4' Ceiling Tile w/Chicken Scratch	25,000	SF	1925 Building- Throughout 1st & 2nd Corridors, and All Classrooms	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
48	Hard Coat Plaster	37,500	SF	Throughout 1925 Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	Hard Coat Plaster	37,500	SF	Throughout 1974 Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12x12 Dark Brown Floor Tile	474	SF	1st Floor Restroom and Rooms 115B and 215B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12"x12" Dark Brown Floor Tile Mastic	474	SF	1st Floor Restroom and Rooms 115B and 215B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	1'x1' Acoustical Ceiling Tile	38	SF	Room 213	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	1'x1' Acoustical Ceiling Tile Glue Dots	38	SF	Room 213	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12"x12" Light Beige w/Tan Specks Floor Tile	725	SF	Room 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12"x12" Light Beige w/Tan Specks Floor Tile Mastic	725	SF	Room 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	12"x12" Light Blue Floor Tile	1,200	SF	Rooms 112 & 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56A	Mastic associated with 12"x12" Light Blue Floor Tile	1,200	SF	Rooms 112 & 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	12"x12" Dark Blue Floor Tile	1,200	SF	Rooms 112 & 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Cook School
Address 8150 S. Bishop

Unit 22801
Chicago, IL, 60620

Building ID 2860
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
57A	Mastic associated with 12"x12" Dark Blue Floor Tile	1,200	SF	Rooms 112 & 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12"x12" Beige w/Specks Floor Tile	1,800	SF	Rooms 111, 112, 113 & 119	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58A	Mastic associated with 12"x12" Beige w/Specks Floor Tile	1,800	SF	Room 111, 112, 113 & 119	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	12"x12" Brown w/Specks Floor Tile	600	SF	Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59A	Mastic associated with 12"x12" Brown w/Specks Floor Tile	600	SF	Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12"x12" Grey w/Specks Floor Tile	600	SF	Room 121	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60A	Mastic associated with 12"x12" Grey w/Specks Floor Tile	600	SF	Room 121	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12"x12" Ash Blue w/Specks Floor Tile	1,600	SF	Main Office & Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61A	Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile	1,600	SF	Main Office & Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Aircell Pipe Insulation		LF	1925 Building- Basement, Open Crawlspace	Chrysotile	TSI	Yes	150	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
B	Paper Wrap Pipe Insulation	60	LF	1925 Building- Basement Crawlspace, Boys' & Girls Bathroom, Pipe Chases Throughout	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
D	Aircell Duct Insulation NOT OBSERVED			Wall, Crawlspace	Chrysotile	TSI					
E	Tank Insulation	100	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Fittings on Fiberglass	1	FITTING	1974 Building- Compactor Room	Chrysotile	TSI	Yes	0	FITTING	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
H	Fittings on Paper Wrap	20	LF	1925 Building- Basement Crawlspace, Boys' & Girls' Bathrooms, Pipe Chases Throughout Building	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
I	Fittings on Aircell		LF	1925 Building- Crawlspace	Assumed	TSI	Yes	25	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
J	Incinerator Insulation (ABATED 1990)			1925 Building- Boiler Room	Abated	TSI					
K	Whiteboard Mastic	750	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
L	Old Chalkboards	4,000	SF	Throughout School	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC				6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Cook School
Address 8150 S. Bishop

Unit 22801
Chicago, IL, 60620

Building ID 2860
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	11/14/2022
Manager Planner Name	Steven Geneser
100-01784	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
03	
04	
05	
07	
08	
09	
12	

Chicago Public Schools

School Cook School
Address 8150 S. Bishop

Unit 22801
Chicago, IL, 60620

Building ID 2860
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
14	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	

Chicago Public Schools

School Cook School
Address 8150 S. Bishop

Unit 22801
 Chicago, IL, 60620

Building ID 2860
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
56A	
57	
57A	
58	
58A	
59	
59A	
60	
60A	
61	
61A	
A	Repair damages and continue O&M

Chicago Public Schools

School Cook School
Address 8150 S. Bishop

Unit 22801
Chicago, IL, 60620

Building ID 2860
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
B	
D	
E	
F	
H	
I	Repair Damages and Continue O&M
J	
K	
L	
NEW	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 102 & 112**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **2250** DAMAGE UNITS: **SF**
COMMENTS: **5 Floor tiles with cracks - Intact - O&M Repair**

Inspector's Signature: _____

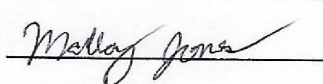

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**
MATERIAL LOCATION: **1925 Building- Room 102 & 112**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

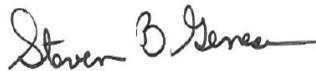

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 104**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **750** DAMAGE UNITS: **SF**
COMMENTS: **2 Tiles have cracks but are intact**

Inspector's Signature: _____

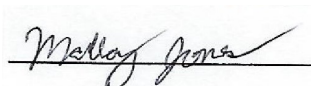

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile**
MATERIAL LOCATION: **1925 Building- Room 104**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 113**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **2 tiles with cracks but intact- Complete O&M Repairs**

Inspector's Signature:

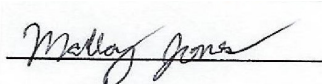

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile**
MATERIAL LOCATION: **1925 Building- Room 113**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 110 & 112**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **10 Floor Tile Intact - Conduct O&M Repairs**

Inspector's Signature: _____

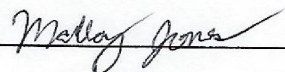

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
MATERIAL LOCATION: **Room 110 & 112**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **12"x12" Beige with Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 111**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

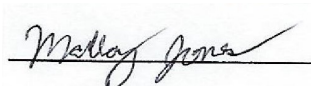

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **12"x12" Beige with Specks Floor Tile**
MATERIAL LOCATION: **1925 Building- Room 111**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Store Rooms, Eng. Office, 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **3520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

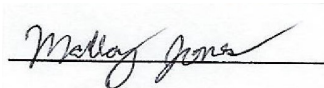

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
MATERIAL LOCATION: **1974 Building- Store Rooms, Eng. Office, 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **3520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Room 224 & 228**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

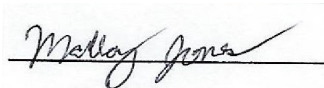

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile**
MATERIAL LOCATION: **1974 Building- Room 224 & 228**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

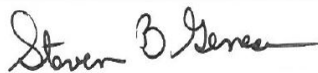

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Room 119, 121, Lunchroom, Teachers' Lunchroom & Corridor**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5600** DAMAGE UNITS: **SF**
COMMENTS: **Damage in Lunchroom**

Inspector's Signature: _____

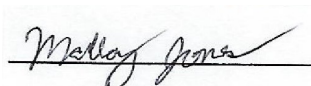

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**
MATERIAL LOCATION: **1974 Building- Room 119, 121, Lunchroom, Teachers' Lunchroom & Corridor**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **25** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

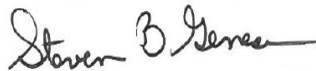

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Boiler Room, Boiler Room Tunnel**
MATERIAL QUANTITY: **2** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: DAMAGE UNITS: **EA**
COMMENTS:

Inspector's Signature:

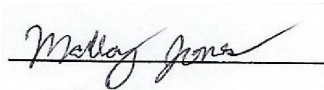

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Fire Doors**
MATERIAL LOCATION: **1925 Building- Boiler Room, Boiler Room Tunnel**
MATERIAL QUANTITY: **2** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

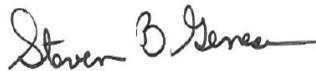

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Boiler Room Gasket ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1925 Building- Boiler Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

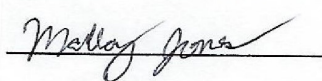

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Boiler Room Gasket ABATED**

MATERIAL LOCATION: **1925 Building- Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

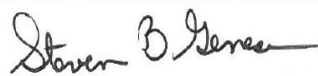

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Transite Lab Tables**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 207**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

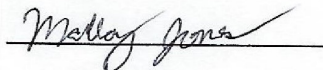

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Transite Lab Tables**
MATERIAL LOCATION: **1925 Building- Room 207**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Rooms 115A, 216A, 1st Floor Boys' Toilet & Adjacent Corridor**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

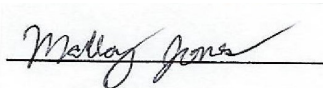

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Baseboard Mastic**
MATERIAL LOCATION: **1925 Building- Rooms 115A, 216A, 1st Floor Boys' Toilet & Adjacent Corridor**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Kitchen**
MATERIAL QUANTITY: **2** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: DAMAGE UNITS: **EA**
COMMENTS:

Inspector's Signature:

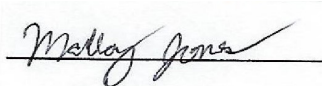

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Fire Doors**
MATERIAL LOCATION: **1974 Building- Kitchen**
MATERIAL QUANTITY: **2** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1974 Building**
MATERIAL QUANTITY: **2940** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

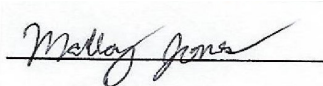

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Baseboard Mastic**
MATERIAL LOCATION: **Throughout 1974 Building**
MATERIAL QUANTITY: **2940** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Rooms 115A & 216A**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

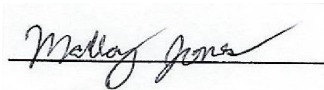

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Baseboard**
MATERIAL LOCATION: **1925 Building- Rooms 115A & 216A**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

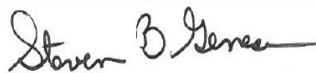

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Anthophyllite** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1974 Building**
MATERIAL QUANTITY: **2940** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

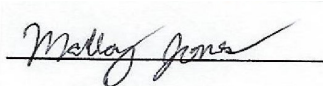

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Baseboard**
MATERIAL LOCATION: **Throughout 1974 Building**
MATERIAL QUANTITY: **2940** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 104**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **750** DAMAGE UNITS: **SF**
COMMENTS: **2 Tiles cracked/missing Complete O&M Repair**

Inspector's Signature: _____

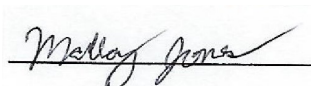

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile Mastic**
MATERIAL LOCATION: **Room 104**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Orange Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **8650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

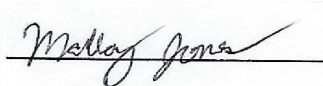

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Orange Floor Tile Mastic**
MATERIAL LOCATION: **1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **8650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

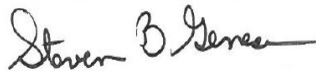

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 110 & 112**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

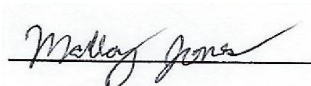

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **1925 Building- Room 110 & 112**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Room 119, 121, Teachers' Lunchroom, Lunchroom & Corridor**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

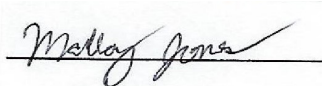

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**
MATERIAL LOCATION: **1974 Building- Room 119, 121, Teachers' Lunchroom, Lunchroom & Corridor**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

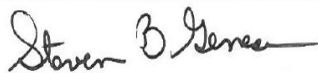

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1974 Building- Storerooms, Electrical Room, Engineer's Office, 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: **3520**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

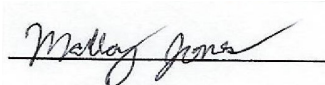

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **1974 Building- Storerooms, Electrical Room, Engineer's Office, 1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **3520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Rooms 102 & 112**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

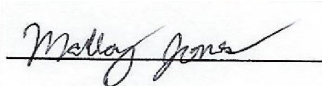

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**
MATERIAL LOCATION: **1925 Building- Rooms 102 & 112**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 113**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

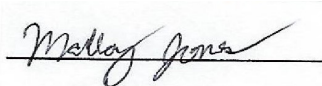

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic**
MATERIAL LOCATION: **1925 Building- Room 113**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12"x12" Medium Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Rooms 111 & 115A**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

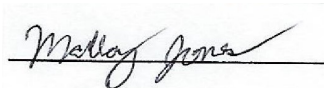

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12"x12" Medium Brown Floor Tile Mastic**
MATERIAL LOCATION: **1925 Building- Rooms 111 & 115A**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Rooms 224 & 228**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

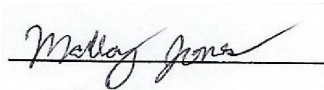

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile Mastic**
MATERIAL LOCATION: **1974 Building- Rooms 224 & 228**
MATERIAL QUANTITY: **1950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12"x12" Purple Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Main Office, Principal's Office**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

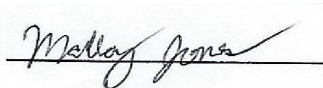

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12"x12" Purple Floor Tile**
MATERIAL LOCATION: **1925 Building- Main Office, Principal's Office**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

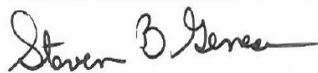

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" Purple Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Main Office, Principal's Office**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

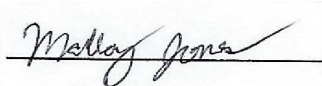

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" Purple Floor Tile Mastic**
MATERIAL LOCATION: **1925 Building- Main Office, Principal's Office**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

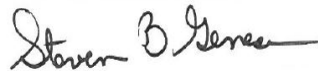

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Annex Office**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

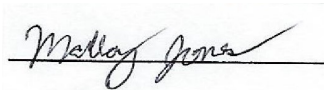

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile**
MATERIAL LOCATION: **1974 Annex Office**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12"x12"Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Annex Office**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

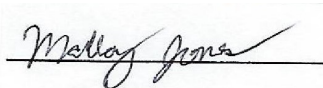

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12"x12"Tan Floor Tile Mastic**
MATERIAL LOCATION: **1974 Annex Office**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Brown Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1925 Building- Storeroom**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed. Concrete Floors**

Inspector's Signature:

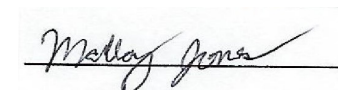

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Brown Linoleum**

MATERIAL LOCATION: **1925 Building- Storeroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

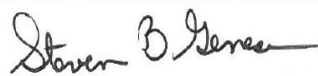

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1925 Building- Storeroom**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed. Concrete Floors**

Inspector's Signature:

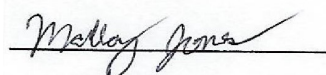

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Brown Linoleum Mastic**

MATERIAL LOCATION: **1925 Building- Storeroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

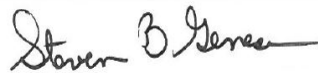

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Main Office Storeroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

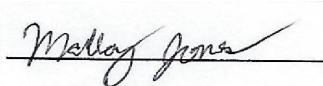

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
MATERIAL LOCATION: **1925 Building- Main Office Storeroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Orange Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Teachers' Restroom & Room 218**
MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

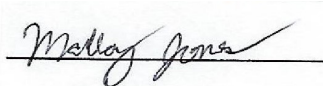

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Orange Carpet Mastic**
MATERIAL LOCATION: **1925 Building- Teachers' Restroom & Room 218**
MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office, Annex Office**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

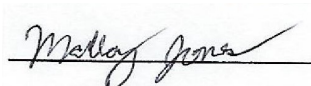

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
MATERIAL LOCATION: **Principal's Office, Annex Office**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Orange Carpet Mastic NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1974 Building- Rooms 120, 122, 124, 126, Storeroom & Library; Rooms 217, 219-223, 226, Teachers' Lounge, Library Office & AV Room**

MATERIAL QUANTITY: **6000** MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **NOT OBESERVED 2022**

Inspector's Signature: 

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Orange Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **1974 Building- Rooms 120, 122, 124, 126, Storeroom & Library; Rooms 217, 219-223, 226, Teachers' Lounge, Library Office & AV Room**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

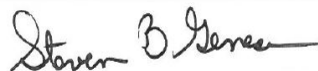

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" Beige with Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Room 111**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

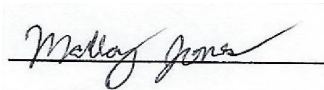

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" Beige with Specks Floor Tile Mastic**
MATERIAL LOCATION: **1925 Building- Room 111**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

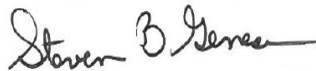

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Multicolor Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Room 218 Has No Carpet**

Inspector's Signature:

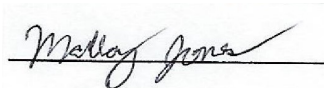

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Multicolor Carpet Adhesive**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Tan w/Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 124, 126, 219 & 226**
MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

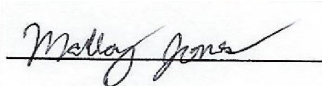

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Tan w/Specks Floor Tile**
MATERIAL LOCATION: **Rooms 124, 126, 219 & 226**
MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Purple Carpet**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Not Observed 2022**

Inspector's Signature:

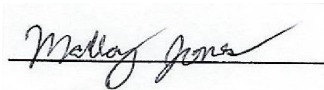

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Purple Carpet**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

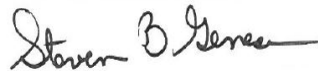

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile w/Chicken Scratch**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Throughout 1st & 2nd Corridors, and All Classrooms**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Selective Removal for Fire Alarms in Annex Building**

Inspector's Signature:

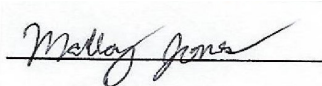

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile w/Chicken Scratch**
MATERIAL LOCATION: **1925 Building- Throughout 1st & 2nd Corridors, and All Classrooms**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

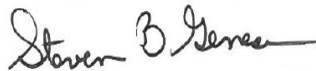

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1925 Building**
MATERIAL QUANTITY: **37500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

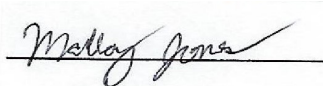

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout 1925 Building**
MATERIAL QUANTITY: **37500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1974 Building**
MATERIAL QUANTITY: **37500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

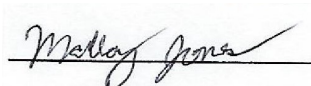

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout 1974 Building**
MATERIAL QUANTITY: **37500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

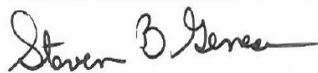

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12x12 Dark Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Restroom and Rooms 115B and 215B**
MATERIAL QUANTITY: **474** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

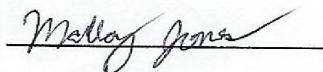

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12x12 Dark Brown Floor Tile**
MATERIAL LOCATION: **1st Floor Restroom and Rooms 115B and 215B**
MATERIAL QUANTITY: **474** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12"x12" Dark Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Restroom and Rooms 115B and 215B**
MATERIAL QUANTITY: **474** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

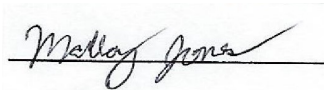

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12"x12" Dark Brown Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Restroom and Rooms 115B and 215B**
MATERIAL QUANTITY: **474** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

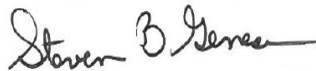

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **1'x1' Acoustical Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 213**
MATERIAL QUANTITY: **38** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

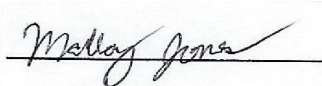

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **1'x1' Acoustical Ceiling Tile**
MATERIAL LOCATION: **Room 213**
MATERIAL QUANTITY: **38** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **1'x1' Acoustical Ceiling Tile Glue Dots**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 213**
MATERIAL QUANTITY: **38** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

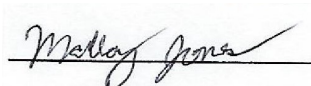

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **1'x1' Acoustical Ceiling Tile Glue Dots**
MATERIAL LOCATION: **Room 213**
MATERIAL QUANTITY: **38** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12"x12" Light Beige w/Tan Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

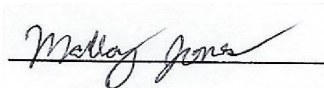

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12"x12" Light Beige w/Tan Specks Floor Tile**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

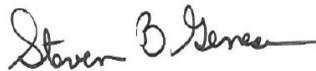

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12"x12" Light Beige w/Tan Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

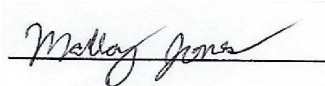

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12"x12" Light Beige w/Tan Specks Floor Tile Mastic**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration
Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration
Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Basement, Open Crawlspace**
MATERIAL QUANTITY: MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS: **Damage in crawlspace**

Inspector's Signature: _____

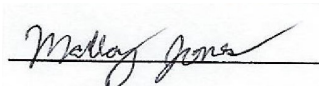

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **1925 Building- Basement, Open Crawlspace**
MATERIAL QUANTITY: MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **150** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair damages and continue O&M

Management Planner's Signature: _____

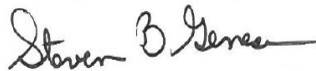

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Paper Wrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACM or friable suspect ACM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACM or friable suspect ACM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Basement Crawlspace, Boys' & Girls Bathroom, Pipe Chases Throughout**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

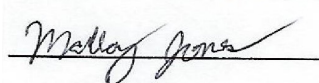

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Paper Wrap Pipe Insulation**
MATERIAL LOCATION: **1925 Building- Basement Crawlspace, Boys' & Girls Bathroom, Pipe Chases Throughout**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 22801 BUILDING ID: 2860
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Mallory Jones
SCHOOL NAME: Cook School INSPECTION DATE: 10/17/2022
ADDRESS: 8150 S. Bishop IDPH LICENSE NO: 100-11070

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: D
MATERIAL DESCRIPTION: Aircell Duct Insulation NOT OBSERVED
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Chrysotile FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Wall, Crawlspace

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not Observed

Inspector's Signature:

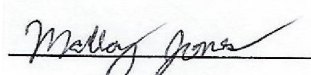

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Aircell Duct Insulation NOT OBSERVED**

MATERIAL LOCATION: **Wall, Crawlspace**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

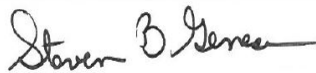

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

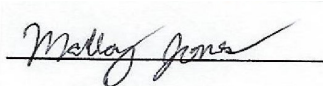

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

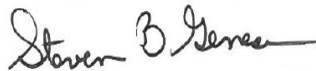

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Fittings on Fiberglass**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1974 Building- Compactor Room**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature:

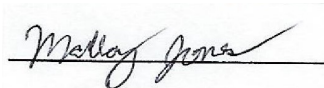

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Fittings on Fiberglass**
MATERIAL LOCATION: **1974 Building- Compactor Room**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Fittings on Paper Wrap**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Basement Crawlspace, Boys' & Girls' Bathrooms, Pipe Chases Throughout Building**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

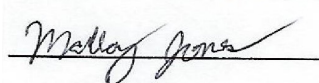

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Fittings on Paper Wrap**
MATERIAL LOCATION: **1925 Building- Basement Crawlspace, Boys' & Girls' Bathrooms, Pipe Chases Throughout Building**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

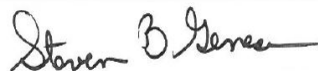

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Fittings on Aircell**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1925 Building- Crawlspace**
MATERIAL QUANTITY: MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS: **Damage in Crawlspace**

Inspector's Signature: _____

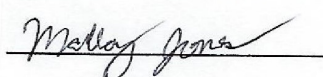

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Fittings on Aircell**
MATERIAL LOCATION: **1925 Building- Crawlspace**
MATERIAL QUANTITY: MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **25** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damages and Continue O&M

Management Planner's Signature:

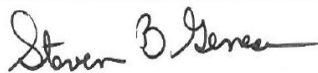

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Incinerator Insulation (ABATED 1990)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1925 Building- Boiler Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed. ABATED 1990**

Inspector's Signature:

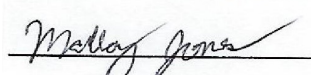

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Incinerator Insulation (ABATED 1990)**

MATERIAL LOCATION: **1925 Building- Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

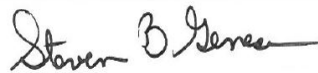

Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Whiteboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

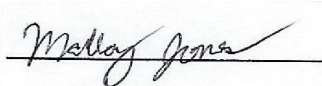

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Whiteboard Mastic**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Old Chalkboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout School**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

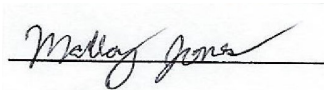

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Old Chalkboards**
MATERIAL LOCATION: **Throughout School**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**


HOMOGENEOUS AREA: **NEW**
MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**
MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

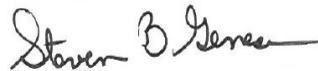

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12"x12" Dark Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**


HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **12"x12" Brown w/Specks Floor Tile**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

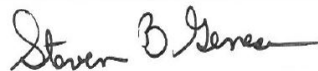

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **56A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Light Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

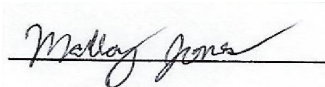

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**


HOMOGENEOUS AREA: **56A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Light Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

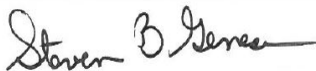

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **57A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Dark Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

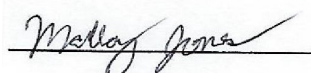

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **57A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Dark Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12"x12" Light Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

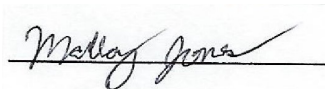

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**


HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12"x12" Light Blue Floor Tile**
MATERIAL LOCATION: **Rooms 112 & 113**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

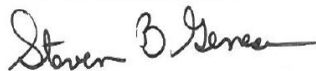

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12"x12" Grey w/Specks Floor Tile**
MATERIAL LOCATION: **Room 121**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **58A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Beige w/Specks Floor Tile**
MATERIAL LOCATION: **Room 111, 112, 113 & 119**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

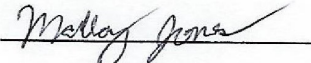

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **58A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Beige w/Specks Floor Tile**
MATERIAL LOCATION: **Room 111, 112, 113 & 119**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **60A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Grey w/Specks Floor Tile**
MATERIAL LOCATION: **Room 121**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

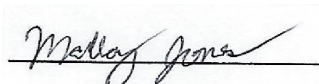

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **60A**

MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Grey w/Specks Floor Tile**

MATERIAL LOCATION: **Room 121**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

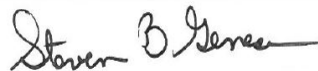

Date: 11/14/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12"x12" Ash Blue w/Specks Floor Tile**
MATERIAL LOCATION: **Main Office & Principal's Office**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

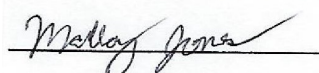

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12"x12" Ash Blue w/Specks Floor Tile**
MATERIAL LOCATION: **Main Office & Principal's Office**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **59A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Brown w/Specks Floor Tile**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

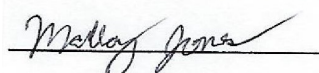

Date: 10/17/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **59A**

MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Brown w/Specks Floor Tile**

MATERIAL LOCATION: **Room 110**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUIDLING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **61A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile**
MATERIAL LOCATION: **Main Office & Principal's Office**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

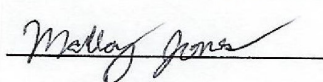

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **61A**
MATERIAL DESCRIPTION: **Mastic associated with 12"x12" Ash Blue w/Specks Floor Tile**
MATERIAL LOCATION: **Main Office & Principal's Office**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mallory Jones**
SCHOOL NAME: **Cook School** INSPECTION DATE: **10/17/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **12"x12" Beige w/Specks Floor Tile**
MATERIAL LOCATION: **Rooms 111, 112, 113 & 119**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

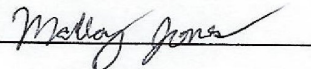

Date: **10/17/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22801** BUILDING ID: **2860**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**
SCHOOL NAME: **Cook School** REVIEW DATE: **11/14/2022**
ADDRESS: **8150 S. Bishop** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **12"x12" Beige w/Specks Floor Tile**
MATERIAL LOCATION: **Rooms 111, 112, 113 & 119**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/14/2022**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

MALLORY JONES
524 HOMELAND ROAD
MATTESON, IL 60443

3/16/2022



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11070

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE	
ID NUMBER 100 - 11070	ISSUED 3/16/2022	EXPIRES 05/15/2023	
MALLORY JONES 524 HOMELAND ROAD MATTESON, IL 60443 Environmental Health		ENDORSEMENTS SUPERVISOR/WORKER INSPECTOR	
		TC EXPIRES 6/5/2022 3/9/2023	
		PROJECT MANAGER AIR SAMPLING PROFESSIONAL 6/5/2022	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MALLORY JONES
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/09/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/09/2022

Course Dates:

03/09/2023

Expires:

2203BIR06

Certificate Number:

PHS Environmental &
Occupational Services

37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com



Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that

Steve Geneser

*has on 4/6/22, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher.*

Course Date: April 6, 2022

COURSE LENGTH: 4 HOURS

Examination Date: April 6, 2022

Expiration Date: April 6, 2023

Certificate Number: BIR/1044

William S. Williams

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois ☐ 217.787.9800 ☐ www.ReliableEnv.com

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that

Steve Geneser

*has on 4/06/22, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: April 6, 2022

COURSE LENGTH: 4 HOURS

Examination Date: April 6, 2022

Expiration Date: April 6, 2023

William S. Williams

Certificate Number: MPR/0470

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois ☐ 217.787.9800 ☐ www.ReliableEnv.com



**ASBESTOS
 PROFESSIONAL
 LICENSE**

ID NUMBER
 100 - 01784

ISSUED
 3/1/2022

EXPIRES
 05/15/2023

STEVEN B GENESER
 210 BARNSIDE CIRCLE
 GENEVA, IL 60134

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

5/5/2022

MANAGEMENT PLANNER

5/5/2022

PROJECT MANAGER

8/4/2022

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
 This license issued under authority of the State of Illinois
 Department of Public Health
 This license is valid only when accompanied by a valid
 training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed