

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2472  
SCHOOL NAME: Stowe School  
ADDRESS OF SCHOOL: 3444 W. Wabansia Avenue  
CITY: Chicago, IL, 60647

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **11/22/2019**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** (Please type or print)

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 6/21/2022 ENROLLMENT 566  
IDPH INSPECTOR LICENSE NUMBER: 100-19036  
IDPH LICENSED INSPECTOR NAME (Please Print): Ismael Hernandez  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah  
  
DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 7/14/2022  
Signature of Designated Person Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**  
\_\_\_\_\_  
\_\_\_\_\_

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Stowe School**

3444 W. Wabansia Avenue  
Chicago, IL, 60647

Unit: 25521  
Building ID: 6080

IDPH ID Number: 14-016-2990-2472

**REPORT DATE:**

Thursday, July 14, 2022

**Prepared for:**

**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

**Specialty Consulting, Inc.**

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

07/14/2022

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 25521                      Region: 02                      IDPH ID: 14-016-2990-2472

School: Stowe School                      Building ID: 6080

Address: 3444 W. Wabansia Avenue  
Chicago, IL, 60647

Building Contact:                      Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 6/21/2022

Review Date: 07/14/2022

Inspector: Ismael Hernandez

Inspector IDPH License: 100-19036

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,  
Specialty Consulting, Inc.



Jigar Shah  
100-07342

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: July 14, 2022

RE: Stowe School, Unit 25521  
3444 W. Wabansia Avenue  
Chicago, IL, 60647

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Stowe School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Stowe School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Stowe School Unit: 25521 Region: 02  
Address: 3444 W. Wabansia Avenue Chicago, IL, 60647  
IDPH ID: 14-016-2990-2472 Building ID: 6080  
Contact: Phone:

### 2. Description of Facility

Original Construction: Additional Construction:  
Total Square Footage: No of Floors:  
Current Occupancy: 566

### 3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602


### 4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.  
Contact: Jigar Shah  
Address 2942 W. Van Buren Street  
Phone: (312) 319-7575 Fax: (312) 319-7580

### 5. Inspector

Inspector Name: Ismael Hernandez


Inspector IDPH license # 100-19036  
Reinspection Date: 6/21/2022

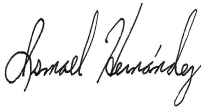  
Signature:  
Date: 6/21/2022

### 6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342


  
Signature:  
Date: 07/14/2022

### 7. Review Date: 07/14/2022

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

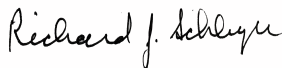

Date: 7/14/2022

Name: Richard J.Schleyer

## II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Stowe School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 6080:

L	Aircell Pipe Insulation
M	MJP E/F/V on Aircell Pipe Insulation
N	Mag Block Pipe Insulation
O	MJP E/F/V on Mag Block Pipe Insulation
P	MJP E/F/V on Fiberglass Pipe Insulation

B. The following new homogenous areas have been identified for Building 6080:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02	1'x1' Off White Floor Tile
07	Battleship Brown Linoleum
10	12"x12" Tan Floor Tile Mastic - NOT OBSERVED
14	Battleship Brown Linoleum Mastic
15	12"x12" Brown Floor Tile
17	12"x12" Bronze Floor Tile - NOT OBSERVED
20	12"x12" Sand Floor Tile Mastic
21	12"x12" Beige Floor Tile- NOT OBSERVED
22	12"x12" Beige Floor Tile Mastic- NOT OBSERVED
23	12"x12" Beige w/Brown Streaks Floor Tile- NOT OBSERVED
24	12"x12" Beige w/Brown Streaks Floor Tile Mastic- NOT OBSERVED
26	9"x9" Dark Brown Floor Tile Mastic- NOT OBSERVED
30	12"x12" Gray Floor Tile Mastic- NOT OBSERVED
31	12"x12" Off White Floor Tile
32	12"x12" Off White Floor Tile Mastic
43	12"x12" White Floor Tile
44	12"x12" White Floor Tile Mastic
48	12" x 12" White w/ Black & Gray Specks Floor Tile
49	12" x 12" White w/ Black & Gray Specks Floor Tile Mastic
50	12" x 12" White w/ Black & Gray Specks Floor Tile- NOT OBSERVED
51	12" x 12" White w/ Black & Gray Specks Floor Tile Mastic- NOT OBSERVED
52	9" x 9" Light Green w/ Green Specks Floor Tile
54	12" x 12" Beige Floor Tile
54 A	12" x 12" Beige Floor Tile Mastic
55	9" x 9" Off White and Green Floor Tile
55A	9" x 9" Off White and Green Floor Tile Mastic
56	Brick in Kiln
57	Lab Table Tops
58	12" x 12" Tan and Brown Floor Tile
58A	12" x 12" Tan and Brown Floor Tile Mastic
59	12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED
59A	12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED

60	Carpet MASTIC
61	12"x12" White w/ black specks VFT
62	12"x12" White w/ black specks VFT MASTIC
63	12"x12" White w/ black specks VFT
64	12"x12" white w/ black specks VFT
65	12" x 12" Beige w/ Tan Specks VFT
65A	12" x 12" Beige w/ Tan Specks VFT Mastic
F	Tank Insulation
Q	Fire Door Insulation
R	Terrazzo

The following areas were deemed to be inaccessible:

Q	Fire Door Insulation
---	----------------------

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ismael Hernandez, IDPH License # 100-19036. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 7/3/2021

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Stowe School Building 6080 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	2' x 4' White w/Dots Ceiling Tile			Rooms 101-103, 105, 107, 201-203, 204, 205, 207, 300 (Library), 301-303, 305, 307, 1st, 2nd and 3rd Floor Corridors - 1902 Bldg.	NO_ACBM						No			
02	1'x1' Off White Floor Tile	2,500	SF	Room 001, 104 & Wardrobe, 300 (Under Carpet), 303, Lunchroom, Kitchen - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03	9"x 9" Beige Floor Tile	900	SF	Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04	2'x2' White w/Dots Ceiling Tile			Lunchroom - 1902 Bldg.	NO_ACBM						No			
05	1'x1' White Wormy Ceiling Tile			Room 100A - 100C, 104, Room 010 and Basement Corridor - 1902 Bldg.	NO_ACBM						No			
06	Hard Coat Plaster			Throughout - 1902 Bldg.	NO_ACBM						No			
07	Battleship Brown Linoleum	1,000	SF	Gymnasium, Office - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	12"x12" Tan Floor Tile - NOT OBSERVED	1,800	SF	Lunchroom - 1921 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	12"x12" Off White Floor Tile Mastic	2,500	SF	Room 001, 104 & Wardrobe, 300 (Under Carpet), 008, 303, Lunchroom - 1902 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	12"x12" Tan Floor Tile Mastic - NOT OBSERVED	1,800	SF	Lunchroom - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	9"x 9" Beige Floor Tile Mastic	900	SF	Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Hard Coat Plaster			Throughout - 1921 Bldg.	NO_ACBM						No			
14	Battleship Brown Linoleum Mastic	1,000	SF	Gymnasium Office - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
15	12"x12" Brown Floor Tile	1,500	SF	Room 001, 300 (Under Carpet), 008, 303, Lunchroom, Kitchen - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12"x12" Brown Floor Tile Mastic	1,500	SF	Room 001, 300 (Under Carpet), 303, Lunchroom - 1902 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12"x12" Bronze Floor Tile - NOT OBSERVED	300	SF	Room 300 (Under Carpet) - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12"x12" Bronze Floor Tile Mastic- NOT OBSERVED	300	SF	Room 300 (Under Carpet) - 1902 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Sand Floor Tile	825	SF	Stairwell Landings - 1902 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12"x12" Sand Floor Tile Mastic	825	SF	Stairwell Landings - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Beige Floor Tile- NOT OBSERVED	600	SF	Room 002 - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12"x12" Beige Floor Tile Mastic- NOT OBSERVED	600	SF	Room 002 - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" Beige w/Brown Streaks Floor Tile- NOT OBSERVED	600	SF	Room 006 - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12"x12" Beige w/Brown Streaks Floor Tile Mastic- NOT OBSERVED	600	SF	Room 006 - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	9"x9" Dark Brown Floor Tile- NOT OBSERVED	400	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	CHR	MISC	N	None	0		No	ACBM with the potential for damage		LOW
26	9"x9" Dark Brown Floor Tile Mastic- NOT OBSERVED	600	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	9"x9" Brown Floor Tile- NOT OBSERVED	200	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	9"x9" Brown Floor Tile Mastic- NOT OBSERVED	200	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	12"x12" Gray Floor Tile- NOT OBSERVED	450	SF	Room 113 - 1921 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12"x12" Gray Floor Tile Mastic- NOT OBSERVED	450	SF	Room 113 - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
31	12"x12" Off White Floor Tile	900	SF	Room 113 - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12"x12" Off White Floor Tile Mastic	900	SF	Room 113 - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	12"x12" Beige Floor Tile- NOT OBSERVED	1,500	SF	Room 108 & Closet, Library (Under New VFT and Plywood - 1921 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12"x12" Beige Floor Tile Mastic- NOT OBSERVED	1,500	SF	Room 108 & Closet, Library (Under New VFT and Plywood - 1921 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	2'x4' White w/Dots Ceiling Tile			Rooms 111, 109, 106, 206, 208, 308, 1st, 2nd and 3rd Floor Corridors - 1921 Bldg.	NO_ACBM						No			
36	1'x1' White Wormy Ceiling Tile			Lunchroom - 1921 Bldg.	NO_ACBM						No			
41	1'x1' White w/Grooves Ceiling Tile			Rooms 411, 416, 501-504, 509-511, 513, 1st & 2nd Floor Corridors - 1986 Bldg.	NO_ACBM						No			
42	Drywall Joint Compound			Rooms 401-404, 411, 415-417, 501-504, 509, 510, 513, 1st & 2nd Floor Corridors - 1986 Bldg.	NO_ACBM						No			
43	12"x12" White Floor Tile	6,300	SF	Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12"x12" White Floor Tile Mastic	6,300	SF	Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	Vinyl Baseboard Glue			Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.	NO_ACBM						No			
46	Exterior Window Caulk			Throughout - 1986 Bldg.	NO_ACBM						No			
47	Interior Window Caulk			Throughout - 1986	NO_ACBM						No			

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Bldg.										
48	12" x 12" White w/ Black & Gray Specks Floor Tile	2,000	SF	Room 108 Library and Closet, 213 - 1921 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
49	12" x 12" White w/ Black & Gray Specks Floor Tile Mastic	2,000	SF	Room 108 Library and Closet, 213 - 1921 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	12" x 12" White w/ Black & Gray Specks Floor Tile- NOT OBSERVED	700	SF	Room 104 Office, Room 104 B - 1902 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	12" x 12" White w/ Black & Gray Specks Floor Tile Mastic- NOT OBSERVED	700	SF	Room 104 Office, Room 104 B - 1902 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
52	9" x 9" Light Green w/ Green Specks Floor Tile	36	SF	Clinic Storage Room - 1902 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
53	9" x 9" Light Green w/ Green Specks Floor Tile Mastic	36	SF	Clinic Storage Room - 1902 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12" x 12" Beige Floor Tile	250	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
54 A	12" x 12" Beige Floor Tile Mastic	250	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	9" x 9" Off White and Green Floor Tile	130	SF	Non Gender washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
55A	9" x 9" Off White and Green Floor Tile Mastic	99	SF	Vault (Principal's Hall Area)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Brick in Kiln	24	SF	Room 003	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	Lab Table Tops	28	SF	Rooms 304 and 306	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	12" x 12" Tan and Brown Floor Tile	2,244	SF	Rooms 101 and 102	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58A	12" x 12" Tan and Brown Floor Tile Mastic	2,244	SF	Rooms 101 and 102	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED	175	SF	Room 100C	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59A	12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED	175	SF	Room 100C	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	Carpet MASTIC	3,000	SF	Rooms 300, 200, main office & associated offices - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	12"x12" White w/ black specks VFT	1,200	SF	Lunchroom (010) - 1921 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
62	12"x12" White w/ black specks VFT	1,200	SF	Lunchroom (010) -	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW



# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	MASTIC			1921 Bldg.								potential for damage		
63	12"x12" White w/ black specks VFT	1,000	SF	Lunchroom (006) - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
64	12"x12" white w/ black specks VFT	1,000	SF	Lunchroom (006) - 1902 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	12" x 12" Beige w/ Tan Specks VFT	850	SF	Room 113	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65A	12" x 12" Beige w/ Tan Specks VFT Mastic	850	SF	Room 113	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	MJP E/F/V on Fiberglass Pipe Insulation	178	FITTING	Throughout - 1902 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
B	Cardboard Pipe Insulation	1,377	LF	Throughout - 1902 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
C	MJP E/F/V on Cardboard Pipe Insulation	184	FITTING	Throughout - 1902 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
D	Aircell Pipe Insulation	1,365	LF	Throughout - 1902 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	MJP E/F/V on Aircell Pipe Insulation	126	FITTING	Throughout - 1902 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	Tank Insulation	120	SF	Boiler Room - 1902 Bldg.	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
G	Boiler Packing	60	SF	Boiler Room - 1902 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
J	Cardboard Pipe Insulation	192	LF	Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
K	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
L	Aircell Pipe Insulation	500	LF	Engine Room & Fan Unit - 1921 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
M	MJP E/F/V on Aircell Pipe Insulation	43	FITTING	Engine Room & Fan Unit - 1921 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
N	Mag Block Pipe Insulation	40	LF	Basement Corridor - 1902 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
O	MJP E/F/V on Mag Block Pipe Insulation	1	FITTING	Basement Corridor - 1902 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
P	MJP E/F/V on Fiberglass Pipe Insulation	40	FITTING	Throughout - 1921 Bldg.	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
Q	Fire Door Insulation	84	SF	Boiler Room &	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Tank Room - 1902 Bldg.								potential for damage		
R	Terrazzo	2,080	SF	1921 Building: In all corridors and stairwells and principal's washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>6/21/2022</b>
Inspector Name <b>Ismael Hernandez</b>
<b>100-19036</b> <b>5/15/2023</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
54 A	
55	
55A	
56	

# Chicago Public Schools

School Stowe School Unit 25521 Building ID 6080

Address 3444 W. Wabansia Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
57	
58	
58A	
59	
59A	
60	
61	
62	
63	
64	
65	
65A	
A	
B	
C	
D	
E	
F	
G	
J	
K	
L	
M	
N	
O	
P	
Q	
R	

# Chicago Public Schools

**School** Stowe School **Unit** 25521 **Building ID** 6080

**Address** 3444 W. Wabansia Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

---

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	2' x 4' White w/Dots Ceiling Tile			Rooms 101-103, 105, 107, 201-203, 204, 205, 207, 300 (Library), 301-303, 305, 307, 1st, 2nd and 3rd Floor Corridors - 1902 Bldg.	No ACBM						
02	1'x1' Off White Floor Tile	2,500	SF	Room 001, 104 & Wardrobe, 300 (Under Carpet), 303, Lunchroom, Kitchen - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	9"x 9" Beige Floor Tile	900	SF	Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	2'x2' White w/Dots Ceiling Tile			Lunchroom - 1902 Bldg.	No ACBM						
05	1'x1' White Wormy Ceiling Tile			Room 100A - 100C, 104, Room 010 and Basement Corridor - 1902 Bldg.	No ACBM						
06	Hard Coat Plaster			Throughout - 1902 Bldg.	No ACBM						
07	Battleship Brown Linoleum	1,000	SF	Gymnasium, Office - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Tan Floor Tile - NOT OBSERVED	1,800	SF	Lunchroom - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12"x12" Off White Floor Tile Mastic	2,500	SF	Room 001, 104 & Wardrobe, 300 (Under Carpet), 008, 303, Lunchroom - 1902 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12"x12" Tan Floor Tile Mastic - NOT OBSERVED	1,800	SF	Lunchroom - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	9"x 9" Beige Floor Tile Mastic	900	SF	Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Hard Coat Plaster			Throughout - 1921 Bldg.	No ACBM						
14	Battleship Brown Linoleum Mastic	1,000	SF	Gymnasium Office - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" Brown Floor Tile	1,500	SF	Room 001, 300 (Under Carpet), 008, 303, Lunchroom, Kitchen - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12"x12" Brown Floor Tile Mastic	1,500	SF	Room 001, 300 (Under Carpet), 303, Lunchroom - 1902 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Bronze Floor Tile - NOT OBSERVED	300	SF	Room 300 (Under Carpet) - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Bronze Floor Tile Mastic- NOT OBSERVED	300	SF	Room 300 (Under Carpet) - 1902 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Sand Floor Tile	825	SF	Stairwell Landings - 1902 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Sand Floor Tile Mastic	825	SF	Stairwell Landings - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Beige Floor Tile- NOT OBSERVED	600	SF	Room 002 - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Beige Floor Tile Mastic- NOT OBSERVED	600	SF	Room 002 - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" Beige w/Brown Streaks Floor Tile- NOT OBSERVED	600	SF	Room 006 - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
24	12"x12" Beige w/Brown Streaks Floor Tile Mastic- NOT OBSERVED	600	SF	Room 006 - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	9"x9" Dark Brown Floor Tile- NOT OBSERVED	400	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	9"x9" Dark Brown Floor Tile Mastic- NOT OBSERVED	600	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	9"x9" Brown Floor Tile- NOT OBSERVED	200	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	9"x9" Brown Floor Tile Mastic- NOT OBSERVED	200	SF	Room 213 (Under New VFT and Plywood) - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12"x12" Gray Floor Tile- NOT OBSERVED	450	SF	Room 113 - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12"x12" Gray Floor Tile Mastic- NOT OBSERVED	450	SF	Room 113 - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"x12" Off White Floor Tile	900	SF	Room 113 - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12"x12" Off White Floor Tile Mastic	900	SF	Room 113 - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12"x12" Beige Floor Tile- NOT OBSERVED	1,500	SF	Room 108 & Closet, Library (Under New VFT and Plywood) - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" Beige Floor Tile Mastic- NOT OBSERVED	1,500	SF	Room 108 & Closet, Library (Under New VFT and Plywood) - 1921 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	2'x4' White w/Dots Ceiling Tile			Rooms 111, 109, 106, 206, 208, 308, 1st, 2nd and 3rd Floor Corridors - 1921 Bldg.	No ACBM						
36	1'x1' White Wormy Ceiling Tile			Lunchroom - 1921 Bldg.	No ACBM						
41	1'x1' White w/Grooves Ceiling Tile			Rooms 411, 416, 501-504, 509-511, 513, 1st & 2nd Floor Corridors - 1986 Bldg.	No ACBM						
42	Drywall Joint Compound			Rooms 401-404, 411, 415-417, 501-504, 509, 510, 513, 1st & 2nd Floor Corridors - 1986 Bldg.	No ACBM						
43	12"x12" White Floor Tile	6,300	SF	Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12"x12" White Floor Tile Mastic	6,300	SF	Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	Vinyl Baseboard Glue			Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.	No ACBM						
46	Exterior Window Caulk			Throughout - 1986 Bldg.	No ACBM						
47	Interior Window Caulk			Throughout - 1986 Bldg.	No ACBM						

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
48	12" x 12" White w/ Black & Gray Specks Floor Tile	2,000	SF	Room 108 Library and Closet, 213 - 1921 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12" x 12" White w/ Black & Gray Specks Floor Tile Mastic	2,000	SF	Room 108 Library and Closet, 213 - 1921 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12" x 12" White w/ Black & Gray Specks Floor Tile- NOT OBSERVED	700	SF	Room 104 Office, Room 104 B - 1902 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12" x 12" White w/ Black & Gray Specks Floor Tile Mastic- NOT OBSERVED	700	SF	Room 104 Office, Room 104 B - 1902 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	9" x 9" Light Green w/ Green Specks Floor Tile	36	SF	Clinic Storage Room - 1902 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	9" x 9" Light Green w/ Green Specks Floor Tile Mastic	36	SF	Clinic Storage Room - 1902 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12" x 12" Beige Floor Tile	250	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54 A	12" x 12" Beige Floor Tile Mastic	250	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	9" x 9" Off White and Green Floor Tile	130	SF	Non Gender washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55A	9" x 9" Off White and Green Floor Tile Mastic	99	SF	Vault (Principal's Hall Area)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	Brick in Kiln	24	SF	Room 003	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Lab Table Tops	28	SF	Rooms 304 and 306	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12" x 12" Tan and Brown Floor Tile	2,244	SF	Rooms 101 and 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58A	12" x 12" Tan and Brown Floor Tile Mastic	2,244	SF	Rooms 101 and 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED	175	SF	Room 100C	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59A	12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED	175	SF	Room 100C	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	Carpet MASTIC	3,000	SF	Rooms 300, 200, main office & associated offices - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12"x12" White w/ black specks VFT	1,200	SF	Lunchroom (010) - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12"x12" White w/ black specks VFT MASTIC	1,200	SF	Lunchroom (010) - 1921 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	12"x12" White w/ black specks VFT	1,000	SF	Lunchroom (006) - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	12"x12" white w/ black specks VFT	1,000	SF	Lunchroom (006) - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	12" x 12" Beige w/ Tan Specks VFT	850	SF	Room 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65A	12" x 12" Beige w/ Tan Specks VFT Mastic	850	SF	Room 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	MJP E/F/V on Fiberglass Pipe Insulation	178	FITTING	Throughout - 1902 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
B	Cardboard Pipe Insulation	1,377	LF	Throughout - 1902 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
C	MJP E/F/V on Cardboard Pipe Insulation	184	FITTING	Throughout - 1902 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
D	Aircell Pipe Insulation	1,365	LF	Throughout - 1902 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
 Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
E	MJP E/F/V on Aircell Pipe Insulation	126	FITTING	Throughout - 1902 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
F	Tank Insulation	120	SF	Boiler Room - 1902 Bldg.	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Boiler Packing	60	SF	Boiler Room - 1902 Bldg.	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
J	Cardboard Pipe Insulation	192	LF	Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
K	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
L	Aircell Pipe Insulation	500	LF	Engine Room & Fan Unit - 1921 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M	MJP E/F/V on Aircell Pipe Insulation	43	FITTING	Engine Room & Fan Unit - 1921 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
N	Mag Block Pipe Insulation	40	LF	Basement Corridor - 1902 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
O	MJP E/F/V on Mag Block Pipe Insulation	1	FITTING	Basement Corridor - 1902 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
P	MJP E/F/V on Fiberglass Pipe Insulation	40	FITTING	Throughout - 1921 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
Q	Fire Door Insulation	84	SF	Boiler Room & Tank Room - 1902 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
R	Terrazzo	2,080	SF	1921 Building: In all corridors and stairwells and principal's washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
 Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

*Management Planner's Comments Summarized at the End of the Report*

Review Date	7/14/2022
Manager Planner Name	Jigar Shah
100-07342	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
 Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
54 A	
55	
55A	
56	
57	
58	
58A	
59	
59A	
60	
61	
62	
63	
64	
65	
65A	
A	
B	
C	
D	
E	
F	
G	
J	
K	
L	
M	

# Chicago Public Schools

**School** Stowe School  
**Address** 3444 W. Wabansia Avenue

**Unit** 25521  
Chicago, IL, 60647

**Building ID** 6080  
**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
N	
O	
P	
Q	
R	

# APPENDIX A

## Assessment Sheets, Drawings and Photos

---



# Chicago Public Schools

Specialty Consulting, Inc.  
*2022 AHERA REINSPECTION*

# Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **2' x 4' White w/Dots Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Rooms 101-103, 105, 107, 201-203, 204, 205, 207, 300 (Library), 301-303, 305, 307, 1st, 2nd and 3rd Floor Corridors - 1902 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

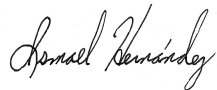

Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **2' x 4' White w/Dots Ceiling Tile**  
MATERIAL LOCATION: **Rooms 101-103, 105, 107, 201-203, 204, 205, 207, 300 (Library), 301-303, 305, 307, 1st, 2nd and 3rd Floor Corridors - 1902 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **1'x1' Off White Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 001, 104 & Wardrobe, 300 (Under Carpet), 303, Lunchroom, Kitchen - 1902 Bldg.**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

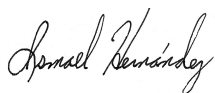

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **1'x1' Off White Floor Tile**  
MATERIAL LOCATION: **Room 001, 104 & Wardrobe, 300 (Under Carpet), 303, Lunchroom, Kitchen - 1902 Bldg.**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**  
MATERIAL DESCRIPTION: **9"x 9" Beige Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

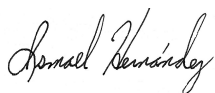

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **03**  
MATERIAL DESCRIPTION: **9"x 9" Beige Floor Tile**  
MATERIAL LOCATION: **Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **2'x2' White w/Dots Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Lunchroom - 1902 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **2'x2' White w/Dots Ceiling Tile**  
MATERIAL LOCATION: **Lunchroom - 1902 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **1'x1' White Wormy Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 100A - 100C, 104, Room 010 and Basement Corridor - 1902 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **1'x1' White Wormy Ceiling Tile**  
MATERIAL LOCATION: **Room 100A - 100C, 104, Room 010 and Basement Corridor - 1902 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1902 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **Battleship Brown Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gymnasium, Office - 1921 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **Battleship Brown Linoleum**  
MATERIAL LOCATION: **Gymnasium, Office - 1921 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile - NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Lunchroom - 1921 Bldg.**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

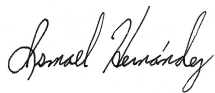

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile - NOT OBSERVED**  
MATERIAL LOCATION: **Lunchroom - 1921 Bldg.**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 001, 104 & Wardrobe, 300 (Under Carpet), 008, 303, Lunchroom - 1902 Bldg.**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

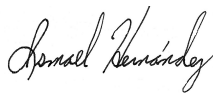

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile Mastic**  
MATERIAL LOCATION: **Room 001, 104 & Wardrobe, 300 (Under Carpet), 008, 303, Lunchroom - 1902 Bldg.**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic - NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Lunchroom - 1921 Bldg.**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

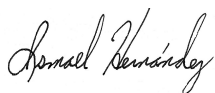

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic - NOT OBSERVED**  
MATERIAL LOCATION: **Lunchroom - 1921 Bldg.**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9"x 9" Beige Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9"x 9" Beige Floor Tile Mastic**  
MATERIAL LOCATION: **Room 002, 002 Closet, Pump Room in Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1921 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
MATERIAL LOCATION: **Throughout - 1921 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Battleship Brown Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gymnasium Office - 1921 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Battleship Brown Linoleum Mastic**  
MATERIAL LOCATION: **Gymnasium Office - 1921 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 001, 300 (Under Carpet), 008, 303, Lunchroom, Kitchen - 1902 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

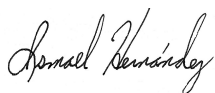

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**  
MATERIAL LOCATION: **Room 001, 300 (Under Carpet), 008, 303, Lunchroom, Kitchen - 1902 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 001, 300 (Under Carpet), 303, Lunchroom - 1902 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

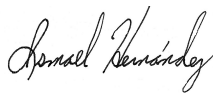

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Room 001, 300 (Under Carpet), 303, Lunchroom - 1902 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **12"x12" Bronze Floor Tile - NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 300 (Under Carpet) - 1902 Bldg.**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

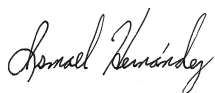

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **12"x12" Bronze Floor Tile - NOT OBSERVED**  
MATERIAL LOCATION: **Room 300 (Under Carpet) - 1902 Bldg.**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **12"x12" Bronze Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 300 (Under Carpet) - 1902 Bldg.**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

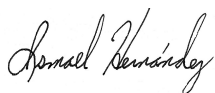

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **12"x12" Bronze Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 300 (Under Carpet) - 1902 Bldg.**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12"x12" Sand Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Stairwell Landings - 1902 Bldg.**  
MATERIAL QUANTITY: **825** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12"x12" Sand Floor Tile**  
MATERIAL LOCATION: **Stairwell Landings - 1902 Bldg.**  
MATERIAL QUANTITY: **825** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **12"x12" Sand Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stairwell Landings - 1902 Bldg.**

MATERIAL QUANTITY: **825**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

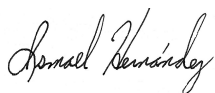

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **12"x12" Sand Floor Tile Mastic**  
MATERIAL LOCATION: **Stairwell Landings - 1902 Bldg.**  
MATERIAL QUANTITY: **825** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

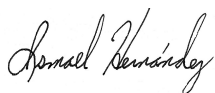

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 002 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown Streaks Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 006 - 1902 Bldg.**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown Streaks Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 006 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown Streaks Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 006 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown Streaks Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 006 - 1902 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **9"x9" Dark Brown Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

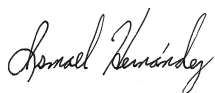

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **9"x9" Dark Brown Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **9"x9" Dark Brown Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

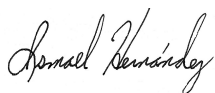

Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **9"x9" Dark Brown Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **9"x9" Brown Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **9"x9" Brown Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **9"x9" Brown Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

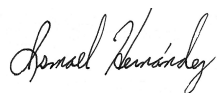

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **9"x9" Brown Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 213 (Under New VFT and Plywood) - 1921 Bldg.**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

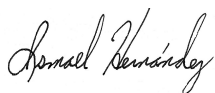

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

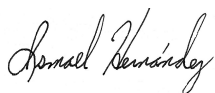

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile Mastic**  
MATERIAL LOCATION: **Room 113 - 1921 Bldg.**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 108 & Closet, Library (Under New VFT and Plywood - 1921 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

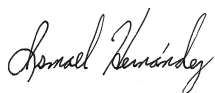

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 108 & Closet, Library (Under New VFT and Plywood - 1921 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 108 & Closet, Library (Under New VFT and Plywood - 1921 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

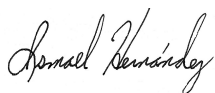

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 108 & Closet, Library (Under New VFT and Plywood - 1921 Bldg.**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **2'x4' White w/Dots Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 111, 109, 106, 206, 208, 308, 1st, 2nd and 3rd Floor Corridors - 1921 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **2'x4' White w/Dots Ceiling Tile**  
MATERIAL LOCATION: **Rooms 111, 109, 106, 206, 208, 308, 1st, 2nd and 3rd Floor Corridors - 1921 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **1'x1' White Wormy Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Lunchroom - 1921 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **1'x1' White Wormy Ceiling Tile**  
MATERIAL LOCATION: **Lunchroom - 1921 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **1'x1' White w/Grooves Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 411, 416, 501-504, 509-511, 513, 1st & 2nd Floor Corridors - 1986 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **1'x1' White w/Grooves Ceiling Tile**  
MATERIAL LOCATION: **Rooms 411, 416, 501-504, 509-511, 513, 1st & 2nd Floor Corridors - 1986 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Drywall Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 401-404, 411, 415-417, 501-504, 509, 510, 513, 1st & 2nd Floor Corridors - 1986 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Drywall Joint Compound**  
MATERIAL LOCATION: **Rooms 401-404, 411, 415-417, 501-504, 509, 510, 513, 1st & 2nd Floor Corridors - 1986 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.**  
MATERIAL QUANTITY: **6300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

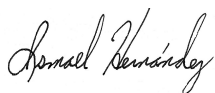

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**  
MATERIAL LOCATION: **Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.**  
MATERIAL QUANTITY: **6300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.**  
MATERIAL QUANTITY: **6300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**  
MATERIAL LOCATION: **Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.**  
MATERIAL QUANTITY: **6300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Vinyl Baseboard Glue**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

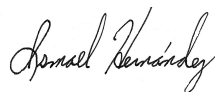

Date: **06/21/2022**



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Vinyl Baseboard Glue**  
MATERIAL LOCATION: **Corridor, Rooms 401, 403, 404, 412, 413, 418 & 514 - 1986 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Exterior Window Caulk**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1986 Bldg.**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

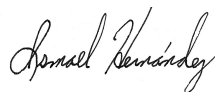

Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Exterior Window Caulk**  
MATERIAL LOCATION: **Throughout - 1986 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Interior Window Caulk**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1986 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Interior Window Caulk**  
MATERIAL LOCATION: **Throughout - 1986 Bldg.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 108 Library and Closet, 213 - 1921 Building**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile**  
MATERIAL LOCATION: **Room 108 Library and Closet, 213 - 1921 Building**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 108 Library and Closet, 213 - 1921 Building**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

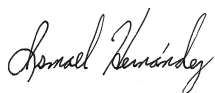

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Room 108 Library and Closet, 213 - 1921 Building**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 104 Office, Room 104 B - 1902 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 104 Office, Room 104 B - 1902 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile Mastic- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 104 Office, Room 104 B - 1902 Building**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Black & Gray Specks Floor Tile Mastic- NOT OBSERVED**  
MATERIAL LOCATION: **Room 104 Office, Room 104 B - 1902 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **9" x 9" Light Green w/ Green Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Clinic Storage Room - 1902 Building**  
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

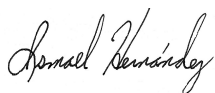

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **9" x 9" Light Green w/ Green Specks Floor Tile**  
MATERIAL LOCATION: **Clinic Storage Room - 1902 Building**  
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **9" x 9" Light Green w/ Green Specks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Clinic Storage Room - 1902 Building**  
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **9" x 9" Light Green w/ Green Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Clinic Storage Room - 1902 Building**  
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: **250**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

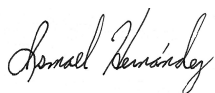

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54 A**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

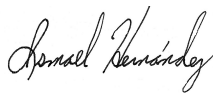

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **54 A**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **9" x 9" Off White and Green Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Non Gender washroom**

MATERIAL QUANTITY: **130**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **9" x 9" Off White and Green Floor Tile**  
MATERIAL LOCATION: **Non Gender washroom**  
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55A**  
MATERIAL DESCRIPTION: **9" x 9" Off White and Green Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Vault (Principal's Hall Area)**

MATERIAL QUANTITY: **99**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

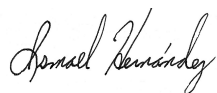

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **55A**  
MATERIAL DESCRIPTION: **9" x 9" Off White and Green Floor Tile Mastic**  
MATERIAL LOCATION: **Vault (Principal's Hall Area)**  
MATERIAL QUANTITY: **99** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **Brick in Kiln**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 003**  
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

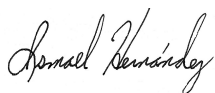

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **Brick in Kiln**  
MATERIAL LOCATION: **Room 003**  
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **Lab Table Tops**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 304 and 306**  
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

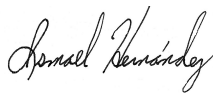

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **Lab Table Tops**  
MATERIAL LOCATION: **Rooms 304 and 306**  
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12" x 12" Tan and Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 101 and 102**  
MATERIAL QUANTITY: **2244** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

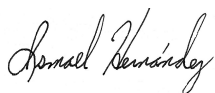

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12" x 12" Tan and Brown Floor Tile**  
MATERIAL LOCATION: **Rooms 101 and 102**  
MATERIAL QUANTITY: **2244** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58A**  
MATERIAL DESCRIPTION: **12" x 12" Tan and Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 101 and 102**  
MATERIAL QUANTITY: **2244** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **58A**  
MATERIAL DESCRIPTION: **12" x 12" Tan and Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 101 and 102**  
MATERIAL QUANTITY: **2244** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 100C**  
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

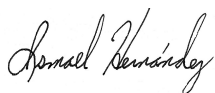

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 100C**  
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59A**  
MATERIAL DESCRIPTION: **12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 100C**

MATERIAL QUANTITY: **175**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **59A**  
MATERIAL DESCRIPTION: **12" x 12" Beige, Brown and Grey Floor Tile- NOT OBSERVED**  
MATERIAL LOCATION: **Room 100C**  
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **Carpet MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 300, 200, main office & associated offices - 1902 Bldg.**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

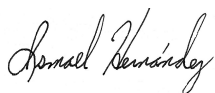

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **Carpet MASTIC**  
MATERIAL LOCATION: **Rooms 300, 200, main office & associated offices - 1902 Bldg.**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12"x12" White w/ black specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Lunchroom (010) - 1921 Bldg.**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

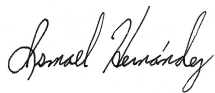

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12"x12" White w/ black specks VFT**  
MATERIAL LOCATION: **Lunchroom (010) - 1921 Bldg.**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **12"x12" White w/ black specks VFT MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Lunchroom (010) - 1921 Bldg.**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

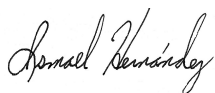

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **12"x12" White w/ black specks VFT MASTIC**  
MATERIAL LOCATION: **Lunchroom (010) - 1921 Bldg.**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **12"x12" White w/ black specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Lunchroom (006) - 1902 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **12"x12" White w/ black specks VFT**  
MATERIAL LOCATION: **Lunchroom (006) - 1902 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **12"x12" white w/ black specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Lunchroom (006) - 1902 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **12"x12" white w/ black specks VFT**  
MATERIAL LOCATION: **Lunchroom (006) - 1902 Bldg.**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Tan Specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Tan Specks VFT**  
MATERIAL LOCATION: **Room 113**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65A**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Tan Specks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **65A**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Tan Specks VFT Mastic**  
MATERIAL LOCATION: **Room 113**  
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **178** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

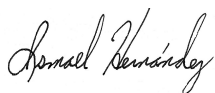

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **178** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **1377** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **1377** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **184** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

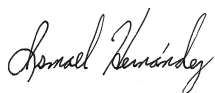

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **184** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1902 Bldg.**

MATERIAL QUANTITY: **1365**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

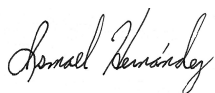

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **1365** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **126** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
MATERIAL LOCATION: **Throughout - 1902 Bldg.**  
MATERIAL QUANTITY: **126** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Tank Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room - 1902 Bldg.**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Tank Insulation**  
MATERIAL LOCATION: **Boiler Room - 1902 Bldg.**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Boiler Packing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room - 1902 Bldg.**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

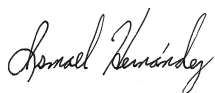

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Boiler Packing**  
MATERIAL LOCATION: **Boiler Room - 1902 Bldg.**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.**  
MATERIAL QUANTITY: **192** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

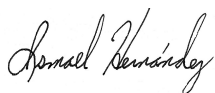

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.**  
MATERIAL QUANTITY: **192** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **07/14/2022**

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

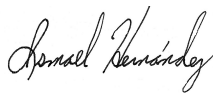

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Fan Unit, Basement Corridor, Room 113 & Toilet - 1921 Bldg.**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engine Room & Fan Unit - 1921 Bldg.**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Engine Room & Fan Unit - 1921 Bldg.**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engine Room & Fan Unit - 1921 Bldg.**  
MATERIAL QUANTITY: **43** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**  
MATERIAL LOCATION: **Engine Room & Fan Unit - 1921 Bldg.**  
MATERIAL QUANTITY: **43** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Corridor - 1902 Bldg.**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

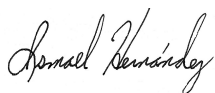

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
MATERIAL LOCATION: **Basement Corridor - 1902 Bldg.**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **O**  
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Corridor - 1902 Bldg.**  
MATERIAL QUANTITY: **1** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

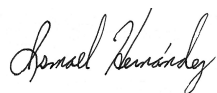

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**  
MATERIAL LOCATION: **Basement Corridor - 1902 Bldg.**  
MATERIAL QUANTITY: **1** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout - 1921 Bldg.**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

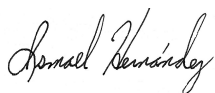

Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
MATERIAL LOCATION: **Throughout - 1921 Bldg.**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Fire Door Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room & Tank Room - 1902 Bldg.**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

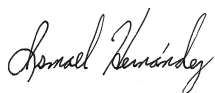

Date: 06/21/2022



# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Fire Door Insulation**  
MATERIAL LOCATION: **Boiler Room & Tank Room - 1902 Bldg.**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUIDLING ID: **6080**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ismael Hernandez**  
SCHOOL NAME: **Stowe School** INSPECTION DATE: **6/21/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **Terrazzo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1921 Building: In all corridors and stairwells and principal's washroom**  
MATERIAL QUANTITY: **2080** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 06/21/2022

# Chicago Public Schools

## Specialty Consulting, Inc. 2022 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25521** BUILDING ID: **6080**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Stowe School** REVIEW DATE: **7/14/2022**  
ADDRESS: **3444 W. Wabansia Avenue** IDPH LICENSE NO: **100-19036**

---

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **Terrazzo**  
MATERIAL LOCATION: **1921 Building: In all corridors and stairwells and principal's washroom**  
MATERIAL QUANTITY: **2080** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 07/14/2022

# Chicago Public Schools

Specialty Consulting, Inc.  
*2022 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses

---

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that ISMAEL HERNANDEZ  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/15/2022

Course Dates:

01/15/2023

Expires:

2201BIR12

Certificate Number:



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

A handwritten signature in blue ink that reads "N Peneff". The signature is written over a light-colored rectangular background.

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois

**ISMAEL HERNANDEZ**  
 2942 W VAN BUREN ST, STE 200  
 CHICAGO, IL 60612

2/28/2022



**ASBESTOS  
 PROFESSIONAL  
 LICENSE**

ID NUMBER  
**100 - 19036**

ISSUED  
**2/28/2022**

EXPIRES  
**05/15/2023**

**ISMAEL HERNANDEZ**  
 2942 W VAN BUREN ST, STE 2  
 CHICAGO, IL 60612  
 Environmental Health





ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 19036

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

 <p><b>ASBESTOS          PROFESSIONAL          LICENSE</b></p>			<p><b>ENDORSEMENTS</b></p>		<p><b>TC EXPIRES</b></p>
<p>ID NUMBER  <b>100 - 19036</b></p>	<p>ISSUED  <b>2/28/2022</b></p>	<p>EXPIRES  <b>05/15/2023</b></p>	<p>INSPECTOR</p>	<p>1/15/2023</p>	
<p><b>ISMAEL HERNANDEZ</b>            2942 W VAN BUREN ST, STE 2            CHICAGO, IL 60612            Environmental Health</p> 			<p>PROJECT MANAGER</p>	<p>2/6/2022</p>	
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p><b>Alteration of this license shall result in legal action</b>            This license issued under authority of the State of Illinois            Department of Public Health            This license is valid only when accompanied by a valid            training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
 EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*

7233 S. Adams Street | Willowbrook, IL 60527  
(630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2023



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo, Director





OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

---

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

## Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

---

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois



**ASBESTOS PROFESSIONAL LICENSE**

ID NUMBER  
**100 - 07342**

ISSUED  
**4/1/2022**

EXPIRES  
**05/15/2023**

**JIGAR M SHAH**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612



Environmental Health

**JIGAR M SHAH**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

 <p><b>ASBESTOS PROFESSIONAL LICENSE</b></p>			<p><b>ENDORSEMENTS</b></p>		<p><b>TC EXPIRES</b></p>
<p>ID NUMBER <b>100 - 07342</b></p>	<p>ISSUED <b>4/1/2022</b></p>	<p>EXPIRES <b>05/15/2023</b></p>	<p>INSPECTOR</p>	<p>3/9/2023</p>	
<p><b>JIGAR M SHAH</b> 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p>			<p>PROJECT DESIGNER</p>	<p>3/24/2023</p>	
			<p>MANAGEMENT PLANNER</p>	<p>3/9/2023</p>	
			<p>PROJECT MANAGER</p>	<p>3/2/2023</p>	
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p><b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**

Nationally Accredited by PHAB

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed