

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2093
SCHOOL NAME: Brennemann School
ADDRESS OF SCHOOL: 4251 N Clarendon Avenue
CITY: Chicago, IL, 60613

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **10/2/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 11/10/2022 ENROLLMENT 472
IDPH INSPECTOR LICENSE NUMBER: 100-18350
IDPH LICENSED INSPECTOR NAME (Please Print): Joseph Hennigan
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



12/5/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Brennemann School

4251 N Clarendon Avenue
Chicago, IL, 60613

Unit: 25991
Building ID: 6600

IDPH ID Number: 14-016-2990-2093

REPORT DATE:

Monday, December 05, 2022

Prepared for:

**Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602**

Prepared by:

Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

12/05/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 25991 Region: 01 IDPH ID: 14-016-2990-2093

School: Brennemann School Building ID: 6600

Address: 4251 N Clarendon Avenue

Chicago, IL, 60613

Building Contact: Budimir, Aleksandar

Contact Phone: 7737096707

Current Building Owners: Chicago Public Schools

Reinspection Date: 11/10/2022

Review Date: 12/05/2022

Inspector: Joseph Hennigan

Inspector IDPH License: 100-18350

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: December 05, 2022

RE: Brennemann School, Unit 25991
4251 N Clarendon Avenue
Chicago, IL, 60613

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Brennemann School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Brennemann School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Brennemann School Unit: 25991 Region: 01
Address: 4251 N Clarendon Avenue Chicago, IL, 60613
IDPH ID: 14-016-2990-2093 Building ID: 6600
Contact: Budimir, Aleksandar Phone: 7737096707

2. Description of Facility

Original Construction: 1970 Additional Construction:
Total Square Footage: 4428 No of Floors: 1
Current Occupancy: 472

3. LEA Designated Person

Contact: Richard J. Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Joseph Hennigan




Inspector IDPH license # 100-18350
Reinspection Date: 11/10/2022

Signature:
Date: 11/10/2022

6. Management Planner

Management Planner Name: Jigar Shah



Management Planner IDPH license # 100-07342

Signature:
Date: 12/05/2022

7. Review Date: 12/05/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 12/5/2022

Name: Richard J. Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Brennemann School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 6600:

B. The following new homogenous areas have been identified for Building 6600:

08AR-2022 2' x 2' White Ceiling Tiles

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Hard Coat Plaster
02	Acoustical Plaster
05	12"x12" Beige w/Brown & White Streaks VFT
08AR-2022	2' x 2' White Ceiling Tiles
09	2'x4' Pressboard Ceiling Tile
11	Cove Base Mastic
11A	Brown Cove Base Mastic
15	12"x12" White w/Brownish Streaks VFT- NOT OBSERVED
16	12"x12" Brown w/White & Dark Brown Streaks VFT
17	12"x12" Beige w/White & Brown Streaks VFT- NOT OBSERVED
18	12"x12" Light Brown w/Light Streaks VFT
19	12"x12" Brown w/Light Streaks VFT
21	12"x12" Black w/Light Streaks VFT
21A	12"x12" Black w/Light Streaks VFT Mastic
22	12"x12" Black w/White Streaks VFT
22A	12"x12" Black w/White Streaks VFT Mastic
23	12"x12" Brown w/Lt Brown & White Streaks VFT
23A	12"x12" Brown w/Lt Brown & White Streaks VFT Mastic
26	12"x12" Blue VFT (under existing VFT) - NOT OBSERVED
26A	12"x12" Blue VFT Mastic (under existing VFT) - NOT OBSERVED
27	12"x12" White w/Blue & Red Streaks VFT
29	Fire Doors
30	Black and Red Vinyl Baseboard Mastic
31	Carpet Mastic
32	2'x4' Ceiling Tiles
35	Black, Red, Beige Vinyl Baseboard Mastic
36	Wall Panelling
37	Spray-on Fireproofing
38	12"x12" Tan w/ white streaks VFT
38A	12"x12" Tan w/ white streaks VFT MASTIC
39	12"x12" Red VFT
39A	12"x12" Red VFT Mastic
40	12"x12" White w/ Gray Shadows VFT
40A	12"x12" White w/ Gray Shadows VFT Mastic
41	Drywall System
42	12"x12" White w/ Light Blue & Black Design VFT

42A	12"x12" White w/ Light Blue & Black Design VFT Mastic
43	Carpet Mastic
45	12"x12" Red VFT
45A	12"x12" Red Mastic
46	Blue Vinyl Flooring Mastic
47	Tectum Ceiling Panels
48	Drywall System (Drywall, Tape, Compound)
L	Vibration Damper
M	Acoustic Plaster Ceiling

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Joseph Hennigan, IDPH License # 100-18350. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Brennemann School Building 6600 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Hard Coat Plaster	10,000	SF	West Hallway, Kitchen, Gym Foyer, 1st Floor Corridor - 1963 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
02	Acoustical Plaster	2,500	SF	Rooms 125 & 126, Kitchen Hallway, Lunchroom - 1963 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
05	12"x12" Beige w/Brown & White Streaks VFT	7,600	SF	Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym) [103, 104, (under carpet) Not Observed] - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	2'x4' White Ceiling Tile	2,500	SF	1st Floor Room 001,002, 003 & 004; Teacher's Toilet; Electric Closet - 1970 Bldg.	CHR	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
08	2'x2' White Ceiling Tile	550	SF	All purpose Room (Gym) - 1963 Bldg.	CHR	MISC	Y	NONE	0		No	ACBM with the potential for damage	10	LOW
08AR-2022	2' x 2' White Ceiling Tiles	3,500	SF	All Purpose Room (Gym) - 1968 Building	ASSUMED	MISC	Y	NONE	0		No			LOW
09	2'x4' Pressboard Ceiling Tile	1,800	SF	Rooms 101, 114 & 124 - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	12"x12" White w/Brownish Streaks VFT Mastic - NOT OBSERVED	420	SF	1st Floor Annex Connection Hallway - 1970 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	Cove Base Mastic	1,800	SF	Rooms 107, 110 & 118 - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11A	Brown Cove Base Mastic	1,100	LF	Rooms 001, 002 & 004 - 1970 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12"x12" Beige w/Brown & White Streaks VFT Mastic	7,600	SF	Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym), [103, 104, (under	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				carpet) -Not Observed] - 1963 Bldg.										
15	12"x12" White w/Brownish Streaks VFT- NOT OBSERVED	420	SF	1st Floor Annex Connection Hallway - 1970 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12"x12" Brown w/White & Dark Brown Streaks VFT	7,800	SF	Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16A	12"x12" Brown w/White & Dark Brown Streaks VFT Mastic	7,800	SF	Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12"x12" Beige w/White & Brown Streaks VFT- NOT OBSERVED	6,410	SF	South, North & West Hallways - 1963 Bldg. - Assumed under existing VFT	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17A	12"x12" Beige w/White & Brown Streaks VFT Mastic- NOT OBSERVED	6,410	SF	South, North & West Hallways - 1963 Bldg. Not observed - Assumed under existing VFT	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12"x12" Light Brown w/Light Streaks VFT	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18A	12"x12" Light Brown w/Light Streaks VFT Mastic	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Brown w/Light Streaks VFT	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19A	12"x12" Brown w/Light Streaks VFT Mastic	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	9"x9" Black w/Beige Streaks VFT	1,418	SF	Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet,	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.										
20A	9"x9" Black w/Beige Streaks VFT Mastic	120	SF	Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Black w/Light Streaks VFT	30	SF	West Stage Stairs - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21A	12"x12" Black w/Light Streaks VFT Mastic	30	SF	West Stage Stairs - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12"x12" Black w/White Streaks VFT	24	SF	Basement Storage/Locker Room - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22A	12"x12" Black w/White Streaks VFT Mastic	24	SF	Basement Storage/Locker Room - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" Brown w/Lt Brown & White Streaks VFT	2,200	SF	Rooms 001, 002, 003 & 004 - 1970 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23A	12"x12" Brown w/Lt Brown & White Streaks VFT Mastic	2,200	SF	Rooms 001, 002, 003 & 004 - 1970 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12"x12" Green VFT	40	SF	Electric Closet - 1970 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25A	12"x12" Green VFT Mastic	1,910	SF	Electric Closet - 1970 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12"x12" Blue VFT (under existing VFT) - NOT OBSERVED	850	SF	West Hallway (under existing VFT) -1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26A	12"x12" Blue VFT Mastic (under existing VFT) - NOT OBSERVED	850	SF	West Hallway (under existing VFT) -1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
27	12"x12" White w/Blue & Red Streaks VFT	175	SF	Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27A	12"x12" White w/Blue-Red VFT Mastic	175	SF	Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	9"x9" Beige w/Black Streaks VFT	300	SF	Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28A	9"x9" Beige w/Blk Streaks VFT Mastic	300	SF	Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Fire Doors	13	EA	All-purpose Room (6 units); Gym (4 units); Boiler Room (2 units); To Eng. Hall (1unit); Doors to Modular Room; All units in 1960 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Black and Red Vinyl Baseboard Mastic	2,500	LF	Throughout - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Carpet Mastic	800	SF	Main Office, Principal's Office, Counselor's Office, Counselor's Office - 1963 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	2'x4' Ceiling Tiles	5,000	SF	All Classrooms - 1963 Bldg	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
35	Black, Red, Beige Vinyl Baseboard Mastic	800	SF	Throughout - 1970 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	Wall Panelling	6,000	SF	Throughout - 1970 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Spray-on Fireproofing	8,600	SF	Boiler Room Ceiling and Throughout 1963 Bldg. (above ceiling tiles/panels)	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
38	12"x12" Tan w/ white streaks VFT	1,400	SF	Rooms 125 & 126 - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38A	12"x12" Tan w/ white streaks VFT MASTIC	1,400	SF	Rooms 125 & 126 - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
39	12"x12" Red VFT	2,500	SF	Teachers' Lounge, Hall by Gym, all corridors - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39A	12"x12" Red VFT Mastic	2,500	SF	Teachers' Lounge, Hall by Gym, all corridors - 1963 bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12"x12" White w/ Gray Shadows VFT	8,000	SF	Throughout Corridors and Hall by Gym - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40A	12"x12" White w/ Gray Shadows VFT Mastic	8,000	SF	Throughout Corridors and Hall by Gym - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	Drywall System	260	SF	Girls and Boys Washrooms, Lunch Room, Closets all Rooms, Basement Toilets - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12"x12" White w/ Light Blue & Black Design VFT	60	SF	Unisex Toilet - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42A	12"x12" White w/ Light Blue & Black Design VFT Mastic	60	SF	Unisex Toilet - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Carpet Mastic	2,022	SF	Library made up of rooms 103 and 104, 106 - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	Linoleum White, Green & Red Design - REMOVED SUMMER 2013			Girls' and Boys' Washrooms	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
44A	Linoleum White, Green & Red Design Mastic - REMOVED SUMMER 2013			Boys' and Girls' Washrooms	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
45	12"x12" Red VFT	200	SF	Corridor - 1970 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45A	12"x12" Red Mastic	200	SF	Corridor - 1970 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	Blue Vinyl Flooring Mastic	800	SF	Room 105- 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	Tectum Ceiling Panels	2,500	SF	North, Center and South Corridors - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	Drywall System (Drywall, Tape,	700	SF	Boy's, Girl's,	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Compound)			Teacher's Toilets - 1970 Bldg.								potential for damage		
A	Heat Reflector Shields	360	LF	West Hall - 1963 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	MJP E/F/V on Fiberglass Pipe Insulation	130	EA	Throughout Basement (See Hatching Maps) - 1963 Bldg	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	Water Main Packing - Abated			Basement Boiler Room - 1963 Bldg.	ABATED	TSI		None				Any remaining friable ACBM or friable suspect ACBM		
G	Aircell Pipe Insulation (Abated)			Basement Boiler Room - 1963 Bldg.	ABATED	TSI						Any remaining friable ACBM or friable suspect ACBM		
H	MJP E/F/V on Aircell Pipe Insulation (Abated)			Basement Boiler Room - 1963 Bldg.	ABATED	TSI						Any remaining friable ACBM or friable suspect ACBM		
I	Tank Insulation	90	SF	Boiler Room - 1963 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
K	MJP E/F/V on Fiberglass Pipe Insulation	60	EA	Girl's Toilet Utility & Boy's Toilet Utility - 1970 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
L	Vibration Damper	100	SF	Air Handling Duct Boiler Room, Fan Storage Room & Engineer's Hallway - 1963 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M	Acoustic Plaster Ceiling	3,000	SF	Corridors - 1963 Bldg.	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 11/10/2022
Inspector Name Joseph Hennigan
100-18350 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
05	
07	
08	3500 SF abated in Gym - 2022
08AR-2022	Summer 2022 New Installation to replace abated HA #08 in Gym
09	
10	
11	
11A	
14	
15	
16	
16A	
17	
17A	
18	
18A	
19	
19A	
20	
20A	
21	
21A	

Chicago Public Schools

School Brennemann School Unit 25991 Building ID 6600

Address 4251 N Clarendon Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
22	
22A	
23	
23A	
25	
25A	
26	
26A	
27	
27A	
28	
28A	
29	
30	
31	
32	
35	
36	
37	
38	
38A	
39	
39A	
40	
40A	
41	
42	
42A	
43	

Chicago Public Schools

School Brennemann School **Unit** 25991 **Building ID** 6600

Address 4251 N Clarendon Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
44	
44A	
45	
45A	
46	
47	
48	
A	Removed - Summer 2022
E	
F	
G	
H	
I	Abated 90 SF - Summer 2022
K	
L	
M	

Table II

Management Planner's Review

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Hard Coat Plaster	10,000	SF	West Hallway, Kitchen, Gym Foyer, 1st Floor Corridor - 1963 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	Acoustical Plaster	2,500	SF	Rooms 125 & 126, Kitchen Hallway, Lunchroom - 1963 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" Beige w/Brown & White Streaks VFT	7,600	SF	Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym) [103, 104, (under carpet) Not Observed] - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	2'x4' White Ceiling Tile	2,500	SF	1st Floor Room 001 ,002, 003 & 004; Teacher's Toilet; Electric Closet - 1970 Bldg.	Chrysotile	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	2'x2' White Ceiling Tile	550	SF	All purpose Room (Gym) - 1963 Bldg.	Chrysotile	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08AR-2022	2' x 2' White Ceiling Tiles	3,500	SF	All Purpose Room (Gym) - 1968 Building	Assumed	MISC	Yes	0	SF		Follow O&M Plan
09	2'x4' Pressboard Ceiling Tile	1,800	SF	Rooms 101, 114 & 124 - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12"x12" White w/Brownish Streaks VFT Mastic - NOT OBSERVED	420	SF	1st Floor Annex Connection Hallway - 1970 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Cove Base Mastic	1,800	SF	Rooms 107, 110 & 118 - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A	Brown Cove Base Mastic	1,100	LF	Rooms 001, 002 & 004 - 1970 Bldg.	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" Beige w/Brown & White Streaks VFT Mastic	7,600	SF	Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym), [103, 104, (under carpet) -Not Observed] - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" White w/Brownish Streaks VFT- NOT OBSERVED	420	SF	1st Floor Annex Connection Hallway - 1970 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12"x12" Brown w/White & Dark Brown Streaks VFT	7,800	SF	Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A	12"x12" Brown w/White & Dark Brown Streaks VFT Mastic	7,800	SF	Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Beige w/White & Brown Streaks VFT- NOT OBSERVED	6,410	SF	South, North & West Hallways - 1963 Bldg. - Assumed under existing VFT	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17A	12"x12" Beige w/White & Brown Streaks VFT	6,410	SF	South, North & West Hallways - 1963	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Mastic- NOT OBSERVED			Bldg. Not observed - Assumed under existing VFT							
18	12"x12" Light Brown w/Light Streaks VFT	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18A	12"x12" Light Brown w/Light Streaks VFT Mastic	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Brown w/Light Streaks VFT	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A	12"x12" Brown w/Light Streaks VFT Mastic	2,000	SF	Rooms 125 & 126, Lunchroom - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	9"x9" Black w/Beige Streaks VFT	1,418	SF	Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	9"x9" Black w/Beige Streaks VFT Mastic	120	SF	Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Black w/Light Streaks VFT	30	SF	West Stage Stairs - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21A	12"x12" Black w/Light Streaks VFT Mastic	30	SF	West Stage Stairs - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Black w/White Streaks VFT	24	SF	Basement Storage/Locker Room - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22A	12"x12" Black w/White Streaks VFT Mastic	24	SF	Basement Storage/Locker Room - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" Brown w/Lt Brown & White Streaks VFT	2,200	SF	Rooms 001, 002, 003 & 004 - 1970 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	12"x12" Brown w/Lt Brown & White Streaks VFT Mastic	2,200	SF	Rooms 001, 002, 003 & 004 - 1970 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" Green VFT	40	SF	Electric Closet - 1970 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	12"x12" Green VFT Mastic	1,910	SF	Electric Closet - 1970 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
 Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
26	12"x12" Blue VFT (under existing VFT) - NOT OBSERVED	850	SF	West Hallway (under existing VFT) -1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26A	12"x12" Blue VFT Mastic (under existing VFT) - NOT OBSERVED	850	SF	West Hallway (under existing VFT) -1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" White w/Blue & Red Streaks VFT	175	SF	Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27A	12"x12" White w/Blue-Red VFT Mastic	175	SF	Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	9"x9" Beige w/Black Streaks VFT	300	SF	Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28A	9"x9" Beige w/Blk Streaks VFT Mastic	300	SF	Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Fire Doors	13	EA	All-purpose Room (6 units); Gym (4 units); Boiler Room (2 units); To Eng. Hall (1unit); Doors to Modular Room; All units in 1960 Bldg.	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
30	Black and Red Vinyl Baseboard Mastic	2,500	LF	Throughout - 1963 Bldg.	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
31	Carpet Mastic	800	SF	Main Office, Principal's Office, Counselor's Office, Counselor's Office - 1963 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	2'x4' Ceiling Tiles	5,000	SF	All Classrooms - 1963 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Black, Red, Beige Vinyl Baseboard Mastic	800	SF	Throughout - 1970 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Wall Panelling	6,000	SF	Throughout - 1970 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Spray-on Fireproofing	8,600	SF	Boiler Room Ceiling and Throughout 1963 Bldg. (above ceiling tiles/panels)	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" Tan w/ white streaks VFT	1,400	SF	Rooms 125 & 126 - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38A	12"x12" Tan w/ white streaks VFT MASTIC	1,400	SF	Rooms 125 & 126 - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12"x12" Red VFT	2,500	SF	Teachers' Lounge, Hall by Gym, all corridors - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	12"x12" Red VFT Mastic	2,500	SF	Teachers' Lounge, Hall by Gym, all corridors - 1963 bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12"x12" White w/ Gray Shadows VFT	8,000	SF	Throughout Corridors and Hall by Gym - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	12"x12" White w/ Gray Shadows VFT Mastic	8,000	SF	Throughout Corridors and Hall by Gym - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Drywall System	260	SF	Girls and Boys Washrooms, Lunch	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Room, Closets all Rooms, Basement Toilets - 1963 Bldg.							
42	12"x12" White w/ Light Blue & Black Design VFT	60	SF	Unisex Toilet - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12"x12" White w/ Light Blue & Black Design VFT Mastic	60	SF	Unisex Toilet - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Carpet Mastic	2,022	SF	Library made up of rooms 103 and 104, 106 - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	Linoleum White, Green & Red Design - REMOVED SUMMER 2013			Girls' and Boys' Washrooms	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	
44A	Linoleum White, Green & Red Design Mastic - REMOVED SUMMER 2013			Boys' and Girls' Washrooms	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	
45	12"x12" Red VFT	200	SF	Corridor - 1970 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45A	12"x12" Red Mastic	200	SF	Corridor - 1970 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Blue Vinyl Flooring Mastic	800	SF	Room 105- 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	Tectum Ceiling Panels	2,500	SF	North, Center and South Corridors - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	Drywall System (Drywall, Tape, Compound)	700	SF	Boy's, Girl's, Teacher's Toilets - 1970 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Heat Reflector Shields	360	LF	West Hall - 1963 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
E	MJP E/F/V on Fiberglass Pipe Insulation	130	EA	Throughout Basement (See Hatching Maps) - 1963 Bldg	Chrysotile	TSI	Yes	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
F	Water Main Packing - Abated			Basement Boiler Room - 1963 Bldg.	Abated	TSI				7 Any remaining friable ACBM or friable suspect ACBM	
G	Aircell Pipe Insulation (Abated)			Basement Boiler Room - 1963 Bldg.	Abated	TSI				7 Any remaining friable ACBM or friable suspect ACBM	
H	MJP E/F/V on Aircell Pipe Insulation (Abated)			Basement Boiler Room - 1963 Bldg.	Abated	TSI				7 Any remaining friable ACBM or friable suspect ACBM	
I	Tank Insulation	90	SF	Boiler Room - 1963 Bldg.	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K	MJP E/F/V on Fiberglass Pipe Insulation	60	EA	Girl's Toilet Utility & Boy's Toilet Utility - 1970 Bldg.	Chrysotile	TSI	Yes	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
L	Vibration Damper	100	SF	Air Handling Duct Boiler Room, Fan Storage Room & Engineer's Hallway - 1963 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M	Acoustic Plaster Ceiling	3,000	SF	Corridors - 1963 Bldg.	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.
2942 W. Van Buren Street
Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	12/5/2022
Manager Planner Name	Jigar Shah
100-07342	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
05	
07	
08	
08AR-2022	
09	

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
 Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
10	
11	
11A	
14	
15	
16	
16A	
17	
17A	
18	
18A	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
25	
25A	
26	
26A	
27	
27A	

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
 Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
28	
28A	
29	
30	
31	
32	
35	
36	
37	
38	
38A	
39	
39A	
40	
40A	
41	
42	
42A	
43	
44	
44A	
45	
45A	
46	
47	
48	
A	

Chicago Public Schools

School Brennemann School
Address 4251 N Clarendon Avenue

Unit 25991
Chicago, IL, 60613

Building ID 6600
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
E	
F	
G	
H	
I	
K	
L	
M	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West Hallway, Kitchen, Gym Foyer, 1st Floor Corridor - 1963 Bldg.**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **West Hallway, Kitchen, Gym Foyer, 1st Floor Corridor - 1963 Bldg.**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **Acoustical Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125 & 126, Kitchen Hallway, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **Acoustical Plaster**
MATERIAL LOCATION: **Rooms 125 & 126, Kitchen Hallway, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown & White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym)
[103, 104, (under carpet) Not Observed] - 1963 Bldg.**

MATERIAL QUANTITY: **7600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown & White Streaks VFT**
MATERIAL LOCATION: **Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym) [103, 104, (under carpet) Not Observed] - 1963 Bldg.**
MATERIAL QUANTITY: **7600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25991 BUIDLING ID: 6600
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Brennemann School INSPECTION DATE: 11/10/2022
ADDRESS: 4251 N Clarendon Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07
MATERIAL DESCRIPTION: 2'x4' White Ceiling Tile
HISTORICAL AHERA DAMAGE CATEGORY 6 Damaged or significantly damaged friable misc. ACBM
HISTORICAL DAMAGE REASON: Water
HISTORICAL RESPONSE ACTION: Remove
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Room 001 ,002, 003 & 004; Teacher's Toilet; Electric Closet - 1970 Bldg.**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**
MATERIAL LOCATION: **1st Floor Room 001 ,002, 003 & 004; Teacher's Toilet; Electric Closet - 1970 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **2'x2' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION: **Remove**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Water**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All purpose Room (Gym) - 1963 Bldg.**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **550** DAMAGE UNITS: **SF**
COMMENTS: **3500 SF abated in Gym - 2022**

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **2'x2' White Ceiling Tile**
MATERIAL LOCATION: **All purpose Room (Gym) - 1963 Bldg.**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **2'x4' Pressboard Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 101, 114 & 124 - 1963 Bldg.**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **2'x4' Pressboard Ceiling Tile**
MATERIAL LOCATION: **Rooms 101, 114 & 124 - 1963 Bldg.**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12"x12" White w/Brownish Streaks VFT Mastic - NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Annex Connection Hallway - 1970 Bldg.**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12"x12" White w/Brownish Streaks VFT Mastic - NOT OBSERVED**
MATERIAL LOCATION: **1st Floor Annex Connection Hallway - 1970 Bldg.**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Cove Base Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 107, 110 & 118 - 1963 Bldg.**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Cove Base Mastic**
MATERIAL LOCATION: **Rooms 107, 110 & 118 - 1963 Bldg.**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **Brown Cove Base Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001, 002 & 004 - 1970 Bldg.**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **Brown Cove Base Mastic**
MATERIAL LOCATION: **Rooms 001, 002 & 004 - 1970 Bldg.**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown & White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym), [103, 104, (under carpet) -Not Observed] - 1963 Bldg.**

MATERIAL QUANTITY: **7600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Beige w/Brown & White Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 101,102, 112, 113, 120, 121, 122, 123 & 124, Foyer outside All Purpose Room (Gym), [103, 104, (under carpet) -Not Observed] - 1963 Bldg.**
MATERIAL QUANTITY: **7600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

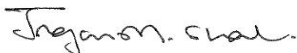

Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White w/Brownish Streaks VFT- NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Annex Connection Hallway - 1970 Bldg.**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White w/Brownish Streaks VFT- NOT OBSERVED**
MATERIAL LOCATION: **1st Floor Annex Connection Hallway - 1970 Bldg.**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Brown w/White & Dark Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Brown w/White & Dark Brown Streaks VFT**
MATERIAL LOCATION: **Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12"x12" Brown w/White & Dark Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12"x12" Brown w/White & Dark Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 106, 107, 108, 109, 110, 111, 114, 115, 116, 117, 118, 119 - 1963 Bldg.**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Beige w/White & Brown Streaks VFT- NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **South, North & West Hallways - 1963 Bldg. - Assumed under existing VFT**
MATERIAL QUANTITY: **6410** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Beige w/White & Brown Streaks VFT- NOT OBSERVED**
MATERIAL LOCATION: **South, North & West Hallways - 1963 Bldg. - Assumed under existing VFT**
MATERIAL QUANTITY: **6410** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **12"x12" Beige w/White & Brown Streaks VFT Mastic- NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **South, North & West Hallways - 1963 Bldg. Not observed - Assumed under existing VFT**

MATERIAL QUANTITY: **6410**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **12"x12" Beige w/White & Brown Streaks VFT Mastic- NOT OBSERVED**
MATERIAL LOCATION: **South, North & West Hallways - 1963 Bldg. Not observed - Assumed under existing VFT**
MATERIAL QUANTITY: **6410** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Light Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Light Streaks VFT**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Light Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/Light Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Brown w/Light Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Brown w/Light Streaks VFT**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **12"x12" Brown w/Light Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **12"x12" Brown w/Light Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 125 & 126, Lunchroom - 1963 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9"x9" Black w/Beige Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.**

MATERIAL QUANTITY: **1418** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9"x9" Black w/Beige Streaks VFT**
MATERIAL LOCATION: **Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.**
MATERIAL QUANTITY: **1418** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **9"x9" Black w/Beige Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **9"x9" Black w/Beige Streaks VFT Mastic**
MATERIAL LOCATION: **Engineer's Office, Main Office Storage Room, Main Office (under carpet), Principals Office (under carpet), Principals Toilet, Hallway (under carpet), AP Office (under carpet) Room next to Learning Center (under carpet) - 1963 Bldg.**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Black w/Light Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West Stage Stairs - 1963 Bldg.**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Black w/Light Streaks VFT**
MATERIAL LOCATION: **West Stage Stairs - 1963 Bldg.**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **12"x12" Black w/Light Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West Stage Stairs - 1963 Bldg.**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **12"x12" Black w/Light Streaks VFT Mastic**
MATERIAL LOCATION: **West Stage Stairs - 1963 Bldg.**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Black w/White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Storage/Locker Room - 1963 Bldg.**

MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Black w/White Streaks VFT**
MATERIAL LOCATION: **Basement Storage/Locker Room - 1963 Bldg.**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **12"x12" Black w/White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Storage/Locker Room - 1963 Bldg.**

MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **12"x12" Black w/White Streaks VFT Mastic**
MATERIAL LOCATION: **Basement Storage/Locker Room - 1963 Bldg.**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" Brown w/Lt Brown & White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001, 002, 003 & 004 - 1970 Bldg.**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" Brown w/Lt Brown & White Streaks VFT**
MATERIAL LOCATION: **Rooms 001, 002, 003 & 004 - 1970 Bldg.**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **12"x12" Brown w/Lt Brown & White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001, 002, 003 & 004 - 1970 Bldg.**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **12"x12" Brown w/Lt Brown & White Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 001, 002, 003 & 004 - 1970 Bldg.**
MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Green VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Electric Closet - 1970 Bldg.**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Green VFT**
MATERIAL LOCATION: **Electric Closet - 1970 Bldg.**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12"x12" Green VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Electric Closet - 1970 Bldg.**
MATERIAL QUANTITY: **1910** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12"x12" Green VFT Mastic**
MATERIAL LOCATION: **Electric Closet - 1970 Bldg.**
MATERIAL QUANTITY: **1910** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Blue VFT (under existing VFT) - NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **West Hallway (under existing VFT) -1963 Bldg.**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Blue VFT (under existing VFT) - NOT OBSERVED**
MATERIAL LOCATION: **West Hallway (under existing VFT) -1963 Bldg.**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **12"x12" Blue VFT Mastic (under existing VFT) - NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West Hallway (under existing VFT) -1963 Bldg.**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **12"x12" Blue VFT Mastic (under existing VFT) - NOT OBSERVED**
MATERIAL LOCATION: **West Hallway (under existing VFT) -1963 Bldg.**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" White w/Blue & Red Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" White w/Blue & Red Streaks VFT**
MATERIAL LOCATION: **Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **12"x12" White w/Blue-Red VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **12"x12" White w/Blue-Red VFT Mastic**
MATERIAL LOCATION: **Mens Toilet, Womens Toilet, Room 125 Toilet, Room 126 Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **9"x9" Beige w/Black Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **9"x9" Beige w/Black Streaks VFT**
MATERIAL LOCATION: **Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **9"x9" Beige w/Blk Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **9"x9" Beige w/Blk Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 125, 126 Coat Room/Book Shelves - 1963 Bldg.**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **All-purpose Room (6 units); Gym (4 units); Boiler Room (2 units); To Eng. Hall (1unit); Doors to Modular Room; All units in 1960 Bldg.**

MATERIAL QUANTITY: **13** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Fire Doors**
MATERIAL LOCATION: **All-purpose Room (6 units); Gym (4 units); Boiler Room (2 units); To Eng. Hall (1unit); Doors to Modular Room; All units in 1960 Bldg.**
MATERIAL QUANTITY: **13** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Black and Red Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Black and Red Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **12/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office, Principal's Office, Counselor's Office, Counselor's Office - 1963 Bldg**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Main Office, Principal's Office, Counselor's Office, Counselor's Office - 1963 Bldg**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Classrooms - 1963 Bldg**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tiles**
MATERIAL LOCATION: **All Classrooms - 1963 Bldg**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Black, Red, Beige Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1970 Bldg**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Black, Red, Beige Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout - 1970 Bldg**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Wall Panelling**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1970 Bldg**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Wall Panelling**
MATERIAL LOCATION: **Throughout - 1970 Bldg**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Spray-on Fireproofing**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room Ceiling and Throughout 1963 Bldg. (above ceiling tiles/panels)**
MATERIAL QUANTITY: **8600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Spray-on Fireproofing**
MATERIAL LOCATION: **Boiler Room Ceiling and Throughout 1963 Bldg. (above ceiling tiles/panels)**
MATERIAL QUANTITY: **8600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12"x12" Tan w/ white streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125 & 126 - 1963 Bldg.**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12"x12" Tan w/ white streaks VFT**
MATERIAL LOCATION: **Rooms 125 & 126 - 1963 Bldg.**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38A**
MATERIAL DESCRIPTION: **12"x12" Tan w/ white streaks VFT MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 125 & 126 - 1963 Bldg.**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **38A**
MATERIAL DESCRIPTION: **12"x12" Tan w/ white streaks VFT MASTIC**
MATERIAL LOCATION: **Rooms 125 & 126 - 1963 Bldg.**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12"x12" Red VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Teachers' Lounge, Hall by Gym, all corridors - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12"x12" Red VFT**
MATERIAL LOCATION: **Teachers' Lounge, Hall by Gym, all corridors - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **12"x12" Red VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Teachers' Lounge, Hall by Gym, all corridors - 1963 bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **12"x12" Red VFT Mastic**
MATERIAL LOCATION: **Teachers' Lounge, Hall by Gym, all corridors - 1963 bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Shadows VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Corridors and Hall by Gym - 1963 Bldg.**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Shadows VFT**
MATERIAL LOCATION: **Throughout Corridors and Hall by Gym - 1963 Bldg.**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Shadows VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Corridors and Hall by Gym - 1963 Bldg.**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Shadows VFT Mastic**
MATERIAL LOCATION: **Throughout Corridors and Hall by Gym - 1963 Bldg.**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Drywall System**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Girls and Boys Washrooms, Lunch Room, Closets all Rooms, Basement Toilets - 1963 Bldg.**
MATERIAL QUANTITY: **260** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: 

Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Drywall System**
MATERIAL LOCATION: **Girls and Boys Washrooms, Lunch Room, Closets all Rooms, Basement Toilets - 1963 Bldg.**
MATERIAL QUANTITY: **260** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Blue & Black Design VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Unisex Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Blue & Black Design VFT**
MATERIAL LOCATION: **Unisex Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Blue & Black Design VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Unisex Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12"x12" White w/ Light Blue & Black Design VFT Mastic**
MATERIAL LOCATION: **Unisex Toilet - 1963 Bldg.**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library made up of rooms 103 and 104, 106 - 1963 Bldg.**

MATERIAL QUANTITY: **2022** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Library made up of rooms 103 and 104, 106 - 1963 Bldg.**
MATERIAL QUANTITY: **2022** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Linoleum White, Green & Red Design - REMOVED SUMMER 2013**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Girls' and Boys' Washrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Linoleum White, Green & Red Design - REMOVED SUMMER 2013**
MATERIAL LOCATION: **Girls' and Boys' Washrooms**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A**
MATERIAL DESCRIPTION: **Linoleum White, Green & Red Design Mastic - REMOVED SUMMER 2013**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boys' and Girls' Washrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: 

Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **44A**
MATERIAL DESCRIPTION: **Linoleum White, Green & Red Design Mastic - REMOVED SUMMER 2013**
MATERIAL LOCATION: **Boys' and Girls' Washrooms**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Red VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Corridor - 1970 Bldg.**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Red VFT**
MATERIAL LOCATION: **Corridor - 1970 Bldg.**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

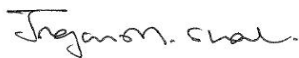

Date: **12/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45A**
MATERIAL DESCRIPTION: **12"x12" Red Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Corridor - 1970 Bldg.**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **45A**
MATERIAL DESCRIPTION: **12"x12" Red Mastic**
MATERIAL LOCATION: **Corridor - 1970 Bldg.**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Blue Vinyl Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 105- 1963 Bldg.**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Blue Vinyl Flooring Mastic**
MATERIAL LOCATION: **Room 105- 1963 Bldg.**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Tectum Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North, Center and South Corridors - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Tectum Ceiling Panels**
MATERIAL LOCATION: **North, Center and South Corridors - 1963 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Drywall System (Drywall, Tape, Compound)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boy's, Girl's, Teacher's Toilets - 1970 Bldg.**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Drywall System (Drywall, Tape, Compound)**
MATERIAL LOCATION: **Boy's, Girl's, Teacher's Toilets - 1970 Bldg.**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Heat Reflector Shields**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West Hall - 1963 Bldg.**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS: **Removed - Summer 2022**

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Heat Reflector Shields**
MATERIAL LOCATION: **West Hall - 1963 Bldg.**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **12/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Basement (See Hatching Maps) - 1963 Bldg**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Throughout Basement (See Hatching Maps) - 1963 Bldg**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **12/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Water Main Packing - Abated**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Boiler Room - 1963 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Water Main Packing - Abated**
MATERIAL LOCATION: **Basement Boiler Room - 1963 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Boiler Room - 1963 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation (Abated)**
MATERIAL LOCATION: **Basement Boiler Room - 1963 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Boiler Room - 1963 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation (Abated)**
MATERIAL LOCATION: **Basement Boiler Room - 1963 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1963 Bldg.**
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Abated 90 SF - Summer 2022**

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room - 1963 Bldg.**
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25991 BUIDLING ID: 6600
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Brennemann School INSPECTION DATE: 11/10/2022
ADDRESS: 4251 N Clarendon Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: K
MATERIAL DESCRIPTION: MJP E/F/V on Fiberglass Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Girl's Toilet Utility & Boy's Toilet Utility - 1970 Bldg.
MATERIAL QUANTITY: 60 MATERIAL UNITS: EA
DAMAGE QUANTITY: DAMAGE UNITS: EA

COMMENTS:

Inspector's Signature:



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Girl's Toilet Utility & Boy's Toilet Utility - 1970 Bldg.**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Vibration Damper**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Air Handling Duct Boiler Room, Fan Storage Room & Engineer's Hallway - 1963 Bldg.**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Vibration Damper**
MATERIAL LOCATION: **Air Handling Duct Boiler Room, Fan Storage Room & Engineer's Hallway - 1963 Bldg.**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Acoustic Plaster Ceiling**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Corridors - 1963 Bldg.**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/10/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUIDLING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Acoustic Plaster Ceiling**
MATERIAL LOCATION: **Corridors - 1963 Bldg.**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 12/05/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)


LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Brennemann School** INSPECTION DATE: **11/10/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **08AR-2022**
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tiles**
MATERIAL LOCATION: **All Purpose Room (Gym) - 1968 Building**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
Summer 2022 New Installation to replace abated HA #08 in Gym

Inspector's Signature:  Date: 11/10/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25991** BUILDING ID: **6600**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Brennemann School** REVIEW DATE: **12/5/2022**
ADDRESS: **4251 N Clarendon Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **08AR-2022**
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tiles**
MATERIAL LOCATION: **All Purpose Room (Gym) - 1968 Building**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 12/05/2022

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/28/2023 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA-II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/28/2023

Course Dates:

01/28/2024

Expires:

2301BIR23

Certificate Number:

A handwritten signature in black ink, appearing to read "N Peneff".

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/15/2022

Course Dates:

01/15/2023

Expires:

2201BIR11

Certificate Number:



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

A handwritten signature in black ink, appearing to read "N Peneff". The signature is written in a cursive style and is positioned above the printed name of the Director of Training.

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 18350

ISSUED
2/28/2022

EXPIRES
05/15/2023

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER	ISSUED	EXPIRES		INSPECTOR	1/15/2023
100 - 18350	2/28/2022	05/15/2023		PROJECT MANAGER	1/22/2023
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health				AIR SAMPLING PROFESSIONAL	
				Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612



Environmental Health

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 07342</p>	<p>ISSUED 4/1/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>INSPECTOR</p>	<p>3/9/2023</p>	
<p>JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p>			<p>PROJECT DESIGNER</p>	<p>3/24/2023</p>	
			<p>MANAGEMENT PLANNER</p>	<p>3/9/2023</p>	
			<p>PROJECT MANAGER</p>	<p>3/2/2023</p>	
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed