

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2724
SCHOOL NAME: Robinson School
ADDRESS OF SCHOOL: 4225 S. Lake Park Ave
CITY: Chicago, IL, 60653

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/15/2019**


If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/28/2022 ENROLLMENT 121
IDPH INSPECTOR LICENSE NUMBER: 100-07134
IDPH LICENSED INSPECTOR NAME (Please Print): Ron Brock
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



11/18/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Robinson School

4225 S. Lake Park Ave
Chicago, IL, 60653

Unit: 26061
Building ID: 6780

IDPH ID Number: 14-016-2990-2724

REPORT DATE:

Friday, November 18, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Chicago, IL, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

11/18/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 26061 Region: 04 IDPH ID: 14-016-2990-2724

School: Robinson School Building ID: 6780

Address: 4225 S. Lake Park Ave

Chicago, IL, 60653

Building Contact: Davis, Natasha

Contact Phone: 7737102376

Current Building Owners: Chicago Public Schools

Reinspection Date: 10/28/2022

Review Date: 11/18/2022

Inspector: Ron Brock

Inspector IDPH License: 100-07134

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: November 18, 2022

RE: Robinson School, Unit 26061
4225 S. Lake Park Ave
Chicago, IL, 60653

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Robinson School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Robinson School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Robinson School Unit: 26061 Region: 04
Address: 4225 S. Lake Park Ave Chicago, IL, 60653
IDPH ID: 14-016-2990-2724 Building ID: 6780
Contact: Davis, Natasha Phone: 7737102376

2. Description of Facility

Original Construction: 1972 Additional Construction:
Total Square Footage: 41784 No of Floors: 3
Current Occupancy: 121

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Doug McCormick
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Ron Brock


Inspector IDPH license # 100-07134
Reinspection Date: 10/28/2022

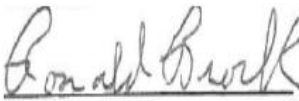
Signature:
Date: 10/28/2022

6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466


Signature:
Date: 11/18/2022

7. Review Date: 11/18/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.


Signature:

Date: 11/18/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Robinson School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 6780:

2	Ceiling plaster
22	Steel door insulation
34	12" x 12" Beige w/Brown Streaks Floor Tile
35	Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile
36	12" x 12" White w/Gray Streaks Floor Tile
37	Mastic for 12" x 12" White w/Gray Streaks Floor Tile
38	Chalkboard/whiteboard adhesive
39	12" x 12" Light Blue wBlue Streaks Floor Tile

- 40 Mastic for 12" x 12" Light Blue wBlue Streaks Floor Tile
- 41 2' x 4' Smooth Lay in Ceiling Panel
- 42 Mastic for Dark Blue/Orange Multicolored Carpet
- 43 12" x 12" Off-White w/White/Tan Streaks Floor Tile
- 44 Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile
- 45 12" x 12" Dark Blue w/Blue Streaks Floor Tile
- 46 Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile
- 47 12" x 12" Light Grayish Blue w/White Streak Floor Tile
- 48 Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile
- 49 Mudded joints
- B Mag block pipe insulation
- C Cementitious joint insulation -fiberglass lagging

B. The following new homogenous areas have been identified for Building 6780:

- 34 12" x 12" Beige w/Brown Streaks Floor Tile
- 35 Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile
- 36 12" x 12" White w/Gray Streaks Floor Tile
- 37 Mastic for 12" x 12" White w/Gray Streaks Floor Tile
- 38 Chalkboard/whiteboard adhesive
- 39 12" x 12" Light Blue wBlue Streaks Floor Tile
- 40 Mastic for 12" x 12" Light Blue wBlue Streaks Floor Tile
- 41 2' x 4' Smooth Lay in Ceiling Panel
- 42 Mastic for Dark Blue/Orange Multicolored Carpet
- 43 12" x 12" Off-White w/White/Tan Streaks Floor Tile
- 44 Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile
- 45 12" x 12" Dark Blue w/Blue Streaks Floor Tile
- 46 Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile
- 47 12" x 12" Light Grayish Blue w/White Streak Floor Tile
- 48 Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile
- 49 Mudded joints

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	2' x 4' Lay In Ceiling Panels
10	Drywall
11	Vinyl baseboard mastic
12	Vinyl baseboard
13	Transite table tops
15	Duct vibration absorbers
16	Window caulk
17	Insulation Inside of Vault Door
18	Chalk Board and Bulletin Board Adhesive
19	Cloth Wiring Insulation on Unit Ventilators
2	Ceiling plaster
20	Cinderblock
21	Cinderblock mortar
22	Steel door insulation
23	12" x 12" White Floor Tile
24	12" x 12" White Floor Tile Mastic
25	Laminate table tops
26	Laminate table top adhesive
27	Drywall joint compound
28	Drywall joint tape
29	Linoleum
3	12" x 12" White Floor Tile
30	Linoleum mastic
31	Carpet mastic
32	12" x 12" Blue Vinyl Floor Tile
33	12" x 12" Blue Vinyl Floor Tile Mastic
34	12" x 12" Beige w/Brown Streaks Floor Tile
35	Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile
36	12" x 12" White w/Gray Streaks Floor Tile
37	Mastic for 12" x 12" White w/Gray Streaks Floor Tile
38	Chalkboard/whiteboard adhesive
39	12" x 12" Light Blue wBlue Streaks Floor Tile
40	Mastic for 12" x 12" Light Blue wBlue Streaks Floor Tile
41	2' x 4' Smooth Lay in Ceiling Panel
42	Mastic for Dark Blue/Orange Multicolored Carpet
43	12" x 12" Off-White w/White/Tan Streaks Floor Tile
44	Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile

45	12" x 12" Dark Blue w/Blue Streaks Floor Tile
46	Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile
47	12" x 12" Light Grayish Blue w/White Streak Floor Tile
48	Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile
49	Mudded joints
5	Incinerator fire brick
6	Insulation Inside of Firedoors
7	Blue/brown mix carpet mastic
8	Window glazing
9	Gasket material
B	Mag block pipe insulation
C	Cementitious joint insulation -fiberglass lagging

The following areas were deemed to be inaccessible:

11	Vinyl baseboard mastic
18	Chalk Board and Bulletin Board Adhesive
22	Steel door insulation
24	12" x 12" White Floor Tile Mastic
30	Linoleum mastic
31	Carpet mastic
33	12" x 12" Blue Vinyl Floor Tile Mastic
35	Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile
37	Mastic for 12" x 12" White w/Gray Streaks Floor Tile
38	Chalkboard/whiteboard adhesive
4	12" x 12" White Floor Tile Mastic
4 A	12" x 12" Brown Floor Tile Mastic
40	Mastic for 12" x 12" Light Blue wBlue Streaks Floor Tile
41	2' x 4' Smooth Lay in Ceiling Panel
42	Mastic for Dark Blue/Orange Multicolored Carpet
44	Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile
46	Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile
48	Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile
7	Blue/brown mix carpet mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ron Brock, IDPH License # 100-07134. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Robinson School Building 6780 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Robinson School Unit 26061 Building ID 6780

Address 4225 S. Lake Park Ave Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	2' x 4' Lay In Ceiling Panels	40,200	SF	3rd Fl Hallway, 2nd Fl Hallway, 201, 203, 202, 204, 206, 208, 205, 207A, 207, 210, 212, 1st Fl Hallway, Gymnasium, 110C, 111, 111A, Vestibules, 117, 109A, 107, 107A, Teacher's Lounge (106), 105, 103A, 103, 103B	ASSUMED	MISC	Y	LOC	112	SF	No	Damaged or significantly damaged friable misc. ACBM	5	LOW
10	Drywall	800	SF	Stage	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
11	Vinyl baseboard mastic	130	LF	Library	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
12	Vinyl baseboard	130	LF	Library	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
13	Transite table tops			Material Not Present	ASSUMED	MISC								
14	Coating on Bottoms of Sinks	6	SF	Rooms 102 & 104	CHR	MISC	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
15	Duct vibration absorbers	40	LF	2nd Floor Fan Room	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
16	Window caulk	2,000	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
17	Insulation Inside of Vault Door	32	SF	Office	ASSUMED	TSI	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
18	Chalk Board and Bulletin Board Adhesive	2,000	SF	Throughout Classrooms	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
19	Cloth Wiring Insulation on Unit Ventilators			Material Not Present	ASSUMED	MISC								
2	Ceiling plaster	40,000	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
20	Cinderblock	40,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
21	Cinderblock mortar	20,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
22	Steel door insulation	28	SF	Incinerator Room	ASSUMED	MISC	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Robinson School Unit 26061 Building ID 6780

Address 4225 S. Lake Park Ave Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
23	12" x 12" White Floor Tile	1,800	SF	Offices	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
24	12" x 12" White Floor Tile Mastic	1,800	SF	Offices	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
25	Laminate table tops			Material Not Present	ASSUMED	MISC								
26	Laminate table top adhesive			Material Not Present	ASSUMED	MISC								
27	Drywall joint compound	200	SF	Stage	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
28	Drywall joint tape	200	LF	Stage	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
29	Linoleum	600	SF	Principal's Office	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
3	12" x 12" White Floor Tile	18,200	SF	Corridors, Lunchroom, Storages, 101, 102,	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
3 A	12" x 12" Brown Gray Floor Tile	1,400	SF	Gym, 110A, 110C, 110D	CHR	MISC	N	DIST	14	SF	No	ACBM with the potential for damage	5	LOW
30	Linoleum mastic	600	SF	Principal's Office	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
31	Carpet mastic	825	SF	Room 309	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
32	12" x 12" Blue Vinyl Floor Tile	3,600	SF	Rooms 201/203, 307	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
33	12" x 12" Blue Vinyl Floor Tile Mastic	3,600	SF	Rooms 201/203, 307	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
34	12" x 12" Beige w/Brown Streaks Floor Tile	25,000	SF	Rooms 3rd Fl Hallway, 312, 2nd Fl Hallway, 202, 204, 207A, 210, 210A, 211, 1st Fl Hallway, 111, 111A, Lunchroom (107), 137	ASSUMED	MISC	N	LOC	1	SF	Yes	ACBM with the potential for damage	5	LOW
35	Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile	25,000	SF	Rooms 3rd Fl Hallway, 312, 2nd Fl Hallway, 202, 204, 207A, 210, 210A, 211 1st Fl Hallway, 111, 111A, Lunchroom (107), 137	ASSUMED	MISC	N	LOC	1	SF	Yes	ACBM with the potential for damage	5	LOW
36	12" x 12" White w/Gray Streaks Floor Tile	7,000	SF	Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303,	ASSUMED	MISC	N	LOC	1	SF	Yes	ACBM with the potential for damage	5	LOW

Chicago Public Schools

School Robinson School Unit 26061 Building ID 6780

Address 4225 S. Lake Park Ave Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
37	Mastic for 12" x 12" White w/Gray Streaks Floor Tile	7,000	SF	301, 203, 206, 208 Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208	ASSUMED	MISC	N	LOC	1	SF	Yes	ACBM with the potential for damage	5	LOW
38	Chalkboard/whiteboard adhesive	1,100	SF	Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 201, 203, 202, 204, 208, 210	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
39	12" x 12" Light Blue w/Blue Streaks Floor Tile	1,000	SF	Rooms 307, 201	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
4	12" x 12" White Floor Tile Mastic	20,000	SF	Corridors, Offices, Lunchroom, Storages, 101, 102	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
4 A	12" x 12" Brown Floor Tile Mastic	1,400	SF	Gym, 110A, 110C, 110D	CHR	MISC	N	DIST	14	SF	No	ACBM with the potential for damage	5	LOW
40	Mastic for 12" x 12" Light Blue w/Blue Streaks Floor Tile	1,000	SF	Rooms 307, 201	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
41	2' x 4' Smooth Lay in Ceiling Panel	6,000	SF	Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 104, 102	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
42	Mastic for Dark Blue/Orange Multicolored Carpet	1,300	SF	Rooms 205, 207, 107A, 105	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
43	12" x 12" Off-White w/White/Tan Streaks Floor Tile	1,000	SF	Rooms 104, 104B, 102, 102B, 101, 103A, 103	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
44	Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile	1,000	SF	Rooms 104, 104B, 102, 102B, 101, 103A, 103	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
45	12" x 12" Dark Blue w/Blue Streaks Floor Tile	300	SF	Rooms 104, 102	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
46	Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile	300	SF	Rooms 104, 102	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
47	12" x 12" Light Grayish Blue w/White Streak Floor Tile	200	SF	Rooms 104, 102	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
48	Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile	200	SF	Rooms 104, 102	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
49	Mudded joints	500	LF	Room 136	ASSUMED	MISC	N	LOC	1	LF	Yes	ACBM with the potential for damage	5	LOW
5	Incinerator fire brick			Material Not Present	ASSUMED	MISC								
6	Insulation Inside of Firedoors			Material Not Present	ASSUMED	TSI								
7	Blue/brown mix carpet mastic	21,350	SF	Classrooms and	ASSUMED	MISC	N	LOC	30	SF	No	ACBM with the	5	LOW

Chicago Public Schools

School Robinson School Unit 26061 Building ID 6780

Address 4225 S. Lake Park Ave Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Offices, Library								potential for damage		
8	Window glazing	10,000	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
9	Gasket material			Material Not Present	ASSUMED	MISC								
B	Mag block pipe insulation	10	LF	Closet by Principal's Office	ASSUMED	TSI	Y	LOC	2	LF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
C	Cementitious joint insulation -fiberglass lagging	6	JOINTS	2nd Floor Fan Room	ASSUMED	TSI	Y	NONE	0	JOINTS	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Robinson School Unit 26061 Building ID 6780

Address 4225 S. Lake Park Ave Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **10/28/2022**
Inspector Name **Ron Brock**
100-07134 **5/15/2023**
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	Damage in 207, 207A, 212
10	
11	
12	
13	Not observed 2022
14	
15	
16	
17	
18	
19	Not observed 2022
2	
20	
21	
22	
23	
24	
25	Not observed 2022
26	Not observed 2022
27	
28	
29	
3	
3 A	Damage in Gym, 110A

Chicago Public Schools

School Robinson School Unit 26061 Building ID 6780

Address 4225 S. Lake Park Ave Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
30	
31	
32	
33	
34	Damage in Outside Room 205
35	Damage in Outside Room 205
36	Damage in 302A
37	Damage in 302A
38	
39	
4	
4 A	Damage in Gym, 110A
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	Damage in 136
5	Not observed 2022
6	Not observed 2022
7	Damage in Room 106
8	
9	Not observed 2022
B	Damage in closet by Principal's Office
C	

Chicago Public Schools

School Robinson School **Unit** 26061 **Building ID** 6780

Address 4225 S. Lake Park Ave **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Robinson School
Address 4225 S. Lake Park Ave

Unit 26061
Chicago, IL, 60653

Building ID 6780
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	2' x 4' Lay In Ceiling Panels	40,200	SF	3rd Fl Hallway, 2nd Fl Hallway, 201, 203, 202, 204, 206, 208, 205, 207A, 207, 210, 212, 1st Fl Hallway, Gymnasium, 110C, 111, 111A, Vestibules, 117, 109A, 107, 107A, Teacher's Lounge (106), 105, 103A, 103, 103B	Assumed	MISC	Yes	112	SF	4 Damaged or significantly damaged friable misc. ACBM	Encapsulate
10	Drywall	800	SF	Stage	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	
11	Vinyl baseboard mastic	130	LF	Library	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12	Vinyl baseboard	130	LF	Library	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
13	Transite table tops			Material Not Present	Assumed	MISC					Follow O&M Plan
14	Coating on Bottoms of Sinks	6	SF	Rooms 102 & 104	Chrysotile	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
15	Duct vibration absorbers	40	LF	2nd Floor Fan Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
16	Window caulk	2,000	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
17	Insulation Inside of Vault Door	32	SF	Office	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
18	Chalk Board and Bulletin Board Adhesive	2,000	SF	Throughout Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Cloth Wiring Insulation on Unit Ventilators			Material Not Present	Assumed	MISC					Follow O&M Plan
2	Ceiling plaster	40,000	SF	Throughout Facility	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
20	Cinderblock	40,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Cinderblock mortar	20,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Steel door insulation	28	SF	Incinerator Room	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
23	12" x 12" White Floor Tile	1,800	SF	Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12" x 12" White Floor Tile Mastic	1,800	SF	Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Laminate table tops			Material Not Present	Assumed	MISC					Follow O&M Plan
26	Laminate table top adhesive			Material Not Present	Assumed	MISC					Follow O&M Plan
27	Drywall joint compound	200	SF	Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Drywall joint tape	200	LF	Stage	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
29	Linoleum	600	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3	12" x 12" White Floor Tile	18,200	SF	Corridors, Lunchroom, Storages, 101, 102,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3 A	12" x 12" Brown Gray Floor Tile	1,400	SF	Gym, 110A, 110C, 110D	Chrysotile	MISC	No	14	SF	6 ACBM with the potential for damage	Repair

Chicago Public Schools

School Robinson School
Address 4225 S. Lake Park Ave

Unit 26061
Chicago, IL, 60653

Building ID 6780
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
30	Linoleum mastic	600	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Carpet mastic	825	SF	Room 309	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12" x 12" Blue Vinyl Floor Tile	3,600	SF	Rooms 201/203, 307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12" x 12" Blue Vinyl Floor Tile Mastic	3,600	SF	Rooms 201/203, 307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Beige w/Brown Streaks Floor Tile	25,000	SF	Rooms 3rd Fl Hallway, 312, 2nd Fl Hallway, 202, 204, 207A, 210, 210A, 211, 1st Fl Hallway, 111, 111A, Lunchroom (107), 137	Assumed	MISC	No	1	SF	6 ACBM with the potential for damage	Repair
35	Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile	25,000	SF	Rooms 3rd Fl Hallway, 312, 2nd Fl Hallway, 202, 204, 207A, 210, 210A, 211 1st Fl Hallway, 111, 111A, Lunchroom (107), 137	Assumed	MISC	No	1	SF	6 ACBM with the potential for damage	Repair
36	12" x 12" White w/Gray Streaks Floor Tile	7,000	SF	Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208	Assumed	MISC	No	1	SF	6 ACBM with the potential for damage	Repair
37	Mastic for 12" x 12" White w/Gray Streaks Floor Tile	7,000	SF	Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208	Assumed	MISC	No	1	SF	6 ACBM with the potential for damage	Repair
38	Chalkboard/whiteboard adhesive	1,100	SF	Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 201, 203, 202, 204, 208, 210	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12" x 12" Light Blue w/Blue Streaks Floor Tile	1,000	SF	Rooms 307, 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
4	12" x 12" White Floor Tile Mastic	20,000	SF	Corridors, Offices, Lunchroom, Storages, 101, 102	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
4 A	12" x 12" Brown Floor Tile Mastic	1,400	SF	Gym, 110A, 110C, 110D	Chrysotile	MISC	No	14	SF	6 ACBM with the potential for damage	Repair
40	Mastic for 12" x 12" Light Blue w/Blue Streaks Floor Tile	1,000	SF	Rooms 307, 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	2' x 4' Smooth Lay in Ceiling Panel	6,000	SF	Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 104, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	Mastic for Dark Blue/Orange Multicolored Carpet	1,300	SF	Rooms 205, 207, 107A, 105	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12" x 12" Off-White w/White/Tan Streaks Floor Tile	1,000	SF	Rooms 104, 104B, 102, 102B, 101, 103A, 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile	1,000	SF	Rooms 104, 104B, 102, 102B, 101, 103A, 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12" x 12" Dark Blue w/Blue Streaks Floor Tile	300	SF	Rooms 104, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile	300	SF	Rooms 104, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12" x 12" Light Grayish Blue w/White Streak Floor	200	SF	Rooms 104, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Robinson School
Address 4225 S. Lake Park Ave

Unit 26061
 Chicago, IL, 60653

Building ID 6780
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Tile										
48	Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile	200	SF	Rooms 104, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	Mudded joints	500	LF	Room 136	Assumed	MISC	No	1	LF	6 ACBM with the potential for damage	Repair
5	Incinerator fire brick			Material Not Present	Assumed	MISC					Follow O&M Plan
6	Insulation Inside of Firedoors			Material Not Present	Assumed	TSI					Follow O&M Plan
7	Blue/brown mix carpet mastic	21,350	SF	Classrooms and Offices, Library	Assumed	MISC	No	30	SF	6 ACBM with the potential for damage	Follow O&M Plan
8	Window glazing	10,000	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
9	Gasket material			Material Not Present	Assumed	MISC					Follow O&M Plan
B	Mag block pipe insulation	10	LF	Closet by Principal's Office	Assumed	TSI	Yes	2	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Remove
C	Cementitious joint insulation -fiberglass lagging	6	JOINTS	2nd Floor Fan Room	Assumed	TSI	Yes	0	JOINTS	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Robinson School
Address 4225 S. Lake Park Ave

Unit 26061
 Chicago, IL, 60653

Building ID 6780
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	11/18/2022
Manager Planner Name	Evan Christian
100-19466	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
3	
3 A	

Chicago Public Schools

School Robinson School
Address 4225 S. Lake Park Ave

Unit 26061
Chicago, IL, 60653

Building ID 6780
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
4	
4 A	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
5	
6	
7	
8	
9	

Chicago Public Schools

School Robinson School
Address 4225 S. Lake Park Ave

Unit 26061
Chicago, IL, 60653

Building ID 6780
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
B	Sample to determine ACM content
C	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY: **4 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration
Water**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd FI Hallway, 2nd FI Hallway, 201, 203, 202, 204, 206, 208, 205, 207A, 207, 210, 212,
1st FI Hallway, Gymnasium, 110C, 111, 111A, Vestibules, 117, 109A, 107, 107A,
Teacher's Lounge (106), 105, 103A, 103, 103B**
MATERIAL QUANTITY: **40200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in 207, 207A, 212**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
MATERIAL LOCATION: **3rd FI Hallway, 2nd FI Hallway, 201, 203, 202, 204, 206, 208, 205, 207A, 207, 210, 212, 1st FI Hallway, Gymnasium, 110C, 111, 111A, Vestibules, 117, 109A, 107, 107A, Teacher's Lounge (106), 105, 103A, 103, 103B**
MATERIAL QUANTITY: **40200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **112** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stage**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Stage**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Vinyl baseboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Vinyl baseboard mastic**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Vinyl baseboard**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Transite table tops**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Transite table tops**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Coating on Bottoms of Sinks**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 102 & 104**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Coating on Bottoms of Sinks**

MATERIAL LOCATION: **Rooms 102 & 104**

MATERIAL QUANTITY: **6**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Duct vibration absorbers**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Fan Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Duct vibration absorbers**
MATERIAL LOCATION: **2nd Floor Fan Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Window caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Window caulk**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Insulation Inside of Vault Door**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Insulation Inside of Vault Door**

MATERIAL LOCATION: **Office**

MATERIAL QUANTITY: **32**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Chalk Board and Bulletin Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Classrooms**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Chalk Board and Bulletin Board Adhesive**
MATERIAL LOCATION: **Throughout Classrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Cloth Wiring Insulation on Unit Ventilators**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Cloth Wiring Insulation on Unit Ventilators**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Ceiling plaster**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Ceiling plaster**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Cinderblock**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Cinderblock**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Cinderblock mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Cinderblock mortar**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Steel door insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Incinerator Room**
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Steel door insulation**
MATERIAL LOCATION: **Incinerator Room**
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Offices**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
MATERIAL LOCATION: **Offices**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Offices**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**

MATERIAL LOCATION: **Offices**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Laminate table tops**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Laminate table tops**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Laminate table top adhesive**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Laminate table top adhesive**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Drywall joint compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stage**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Drywall joint compound**

MATERIAL LOCATION: **Stage**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Drywall joint tape**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stage**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Drywall joint tape**

MATERIAL LOCATION: **Stage**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Linoleum**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Corridors, Lunchroom, Storages, 101, 102,**

MATERIAL QUANTITY: **18200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
MATERIAL LOCATION: **Corridors, Lunchroom, Storages, 101, 102,**
MATERIAL QUANTITY: **18200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3 A**
MATERIAL DESCRIPTION: **12" x 12" Brown Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym, 110A, 110C, 110D**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in Gym, 110A**

Inspector's Signature: _____



Date: 10/28/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **3 A**
MATERIAL DESCRIPTION: **12" x 12" Brown Gray Floor Tile**
MATERIAL LOCATION: **Gym, 110A, 110C, 110D**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **14** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Linoleum mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Linoleum mastic**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 309**
MATERIAL QUANTITY: **825** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Carpet mastic**
MATERIAL LOCATION: **Room 309**
MATERIAL QUANTITY: **825** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Blue Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201/203, 307**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Blue Vinyl Floor Tile**
MATERIAL LOCATION: **Rooms 201/203, 307**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" x 12" Blue Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201/203, 307**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **12" x 12" Blue Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 201/203, 307**

MATERIAL QUANTITY: **3600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Corridors, Offices, Lunchroom, Storages, 101, 102**

MATERIAL QUANTITY: **20000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**
MATERIAL LOCATION: **Corridors, Offices, Lunchroom, Storages, 101, 102**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4 A**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym, 110A, 110C, 110D**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in Gym, 110A**

Inspector's Signature: _____



Date: 10/28/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **4 A**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **Gym, 110A, 110C, 110D**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **14** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **Incinerator fire brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **5**

MATERIAL DESCRIPTION: **Incinerator fire brick**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **Insulation Inside of Firedoors**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **6**

MATERIAL DESCRIPTION: **Insulation Inside of Firedoors**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **Blue/brown mix carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms and Offices, Library**
MATERIAL QUANTITY: **21350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in Room 106**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **Blue/brown mix carpet mastic**
MATERIAL LOCATION: **Classrooms and Offices, Library**
MATERIAL QUANTITY: **21350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **Window glazing**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **Window glazing**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **Gasket material**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **Gasket material**

MATERIAL LOCATION: **Material Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Mag block pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **1 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage
Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage
Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Closet by Principal's Office**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **10** DAMAGE UNITS: **LF**
COMMENTS: **Damage in closet by Principal's Office**

Inspector's Signature: _____



Date: 10/28/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Mag block pipe insulation**
MATERIAL LOCATION: **Closet by Principal's Office**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **2** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Sample to determine ACM content

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Cementitious joint insulation -fiberglass lagging**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Fan Room**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **JOINTS**
DAMAGE QUANTITY: DAMAGE UNITS: **JOINTS**

COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Cementitious joint insulation -fiberglass lagging**

MATERIAL LOCATION: **2nd Floor Fan Room**

MATERIAL QUANTITY: **6**

MATERIAL UNITS: **JOINTS**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **JOINTS**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Chalkboard/whiteboard adhesive**

MATERIAL LOCATION: **Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 201, 203, 202, 204, 208, 210**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Dark Blue w/Blue Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 104, 102**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Mastic for Dark Blue/Orange Multicolored Carpet**
MATERIAL LOCATION: **Rooms 205, 207, 107A, 105**
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 3rd Fl Hallway, 312, 2nd Fl Hallway, 202, 204, 207A, 210, 210A, 211, 1st Fl Hallway, 111, 111A, Lunchroom (107), 137**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/White/Tan Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 104, 104B, 102, 102B, 101, 103A, 103**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/White/Tan Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 104, 104B, 102, 102B, 101, 103A, 103**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Mastic for 12" x 12" White w/Gray Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **1** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
Damage in 302A

Inspector's Signature:



Date: **10/28/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**

ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" White w/Gray Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208**

MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" Dark Blue w/Blue Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 104, 102**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12" x 12" Light Blue wBlue Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 307, 201**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Mastic for 12" x 12" Off-White w/White/Tan Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 104, 104B, 102, 102B, 101, 103A, 103**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Light Grayish Blue w/White Streak Floor Tile**

MATERIAL LOCATION: **Rooms 104, 102**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **2' x 4' Smooth Lay in Ceiling Panel**
MATERIAL LOCATION: **Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 104, 102**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 10/28/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **2' x 4' Smooth Lay in Ceiling Panel**
MATERIAL LOCATION: **Rooms 309, 310, 307, 305, 308, 306, 304, 302, 303, 301, 104, 102**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Mudded joints**
MATERIAL LOCATION: **Room 136**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **1** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUIDLING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 3rd FI Hallway, 312, 2nd FI Hallway, 202, 204, 207A, 210, 210A, 211 1st FI Hallway, 111, 111A, Lunchroom (107), 137**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

COMMENTS:
Damage in Outside Room 205

Inspector's Signature: _____



Date: 10/28/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Beige w/Brown Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 3rd Fl Hallway, 312, 2nd Fl Hallway, 202, 204, 207A, 210, 210A, 211 1st Fl Hallway, 111, 111A, Lunchroom (107), 137**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Robinson School** INSPECTION DATE: **10/28/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **1** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
Damage in 302A

Inspector's Signature: _____



Date: 10/28/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26061** BUILDING ID: **6780**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Robinson School** REVIEW DATE: **11/18/2022**
ADDRESS: **4225 S. Lake Park Ave** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Streaks Floor Tile**
MATERIAL LOCATION: **Rooms 309, 310, 305, 308, 306, 304, 302, 302A, 303, 301, 203, 206, 208**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

APPENDIX B

Inspector and Management Planner Licenses



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Ron Brock

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/19/2022

Exam Date: 1/19/2022



Expiration Date: 1/19/2023

Certificate Number: BIR2201190225

Kathy DeSalvo, Director

Ronald Brock

Illinois Licensed Building Inspector, Air Sampling Professional, Asbestos Project Manager

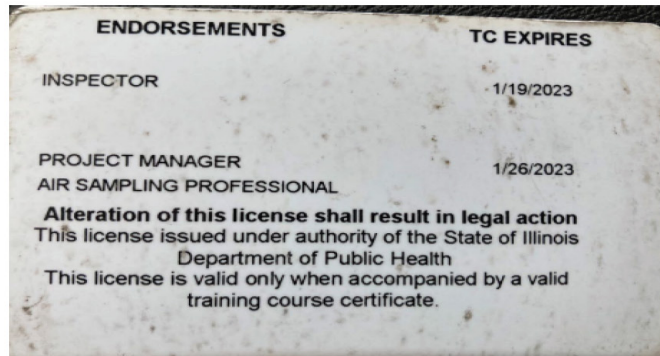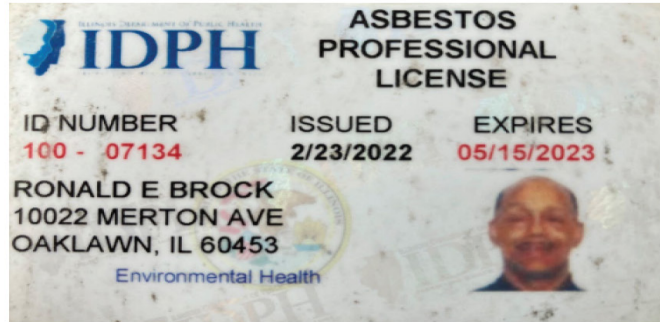



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012581

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: MPR2211033519


Kathy DeSalvo, Director



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

100 - 19466

ISSUED

4/22/2022

EXPIRES

05/15/2023

EVAN I CHRISTIAN
1119 N HOYNE AVE, APT 1
CHICAGO, IL 60622

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

10/8/2022

MANAGEMENT PLANNER

11/1/2022

PROJECT MANAGER


3/28/2023

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

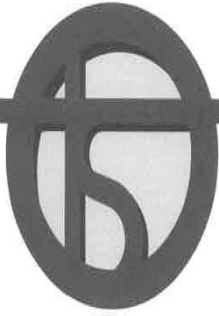

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082264

Kathy DeSalvo, Director



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113639

Kathy DeSalvo, Director -

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed