

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2306
SCHOOL NAME: LaSalle Academy
ADDRESS OF SCHOOL: 1734 N. Orleans Street
CITY: Chicago, IL, 60614

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **8/29/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 9/17/2022 ENROLLMENT 482
IDPH INSPECTOR LICENSE NUMBER: 100-07210
IDPH LICENSED INSPECTOR NAME (Please Print): Michael Holvay
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

LaSalle Academy

1734 N. Orleans Street
Chicago, IL, 60614

Unit: 29161
Building ID: 4420

IDPH ID Number: 14-016-2990-2306

REPORT DATE:

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

10/14/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 29161 Region: 02 IDPH ID: 14-016-2990-2306

School: LaSalle Academy Building ID: 4420

Address: 1734 N. Orleans Street

Chicago, IL, 60614

Building Contact: Jay Pierce (apprentice), John

Contact Phone: 7737096913

Current Building Owners: Chicago Public Schools

Reinspection Date: 9/17/2022

Review Date: 10/14/2022

Inspector: Michael Holvay

Inspector IDPH License: 100-07210

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date:

RE: LaSalle Academy, Unit 29161
1734 N. Orleans Street
Chicago, IL, 60614

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at LaSalle Academy , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at LaSalle Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: LaSalle Academy Unit: 29161 Region: 02
Address: 1734 N. Orleans Street Chicago, IL, 60614
IDPH ID: 14-016-2990-2306 Building ID: 4420
Contact: Jay Pierce (apprentice), John Phone: 7737096913

2. Description of Facility

Original Construction: 1961 Additional Construction:
Total Square Footage: 47156 No of Floors: 2
Current Occupancy: 482

3. LEA Designated Person


Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Michael Holvay



Michael Holvay
Project Manager

Signature:
Date: 9/17/2022

Inspector IDPH license # 100-07210
Reinspection Date: 9/17/2022

6. Management Planner

Management Planner Name: Jigar Shah



Signature:
Date: 10/14/2022

Management Planner IDPH license # 100-07342

7. Review Date: 10/14/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date:

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the LaSalle Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4420:

B. The following new homogenous areas have been identified for Building 4420:

- 40 2' x 4' White w/pinholes & grooves ceiling tile
- 41 2' x 2' White w/pinholes & grooves ceiling tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

04	12" x 12" Brown w/ White and Gray Streaks VFT
06	Brown Hard Coat Plaster
12	12" x 12" White w/ Beige Floor Tile
14	12" x 12" Ceiling Tiles w/Grooves
15	12" x 12" Light Brown Streaked Floor Tile
15A	12" x 12" Light Brown Streaked Floor Tile Mastic
16	12" x 12" Gray Streaked Floor Tile
16A	12" x 12" Gray Streaked Floor Tile Mastic
17	9" x 9" Green Streaked Floor Tile
17A	9" x 9" Green Streaked Floor Tile Mastic
18	12" x 12" Lt. Blue Mixed Speckled VFT
19	12" x 12" Lt. Blue Mixed Speckled VFT Mastic
20	12" x 12" Yellow Mixed Speckled VFT
21	12" x 12" Yellow Mixed Speckled VFT Mastic
22	12" X 12" Dark Blue with Lt. Blue Specs VFT
23	12" x 12" Dark Blue with Lt. Blue Specs VFT Mastic
24	12" x 12" Pink with Specs VFT
25	12" x 12" Pink with Specs VFT Mastic
26	12" x 12" Dark Green Mixed Speckled VFT
27	12" x 12" Dark Green Mixed Speckled VFT Mastic
28	12" x 12" Lt. Green Mixed Speckled VFT
29	12" x 12" Lt. Green Mixed Speckled VFT Mastic
30	12" x 12" Dark Brown Mixed Speckled VFT
31	12" x 12" Dark Brown Mixed Speckled VFT Mastic
32	Drywall
33	Carpet Mastic
34	12" x 12" Gray Mixed Speckled VFT
35	12" x 12" Gray Mixed Speckled VFT Mastic
36	12" x 12" Cream with Brown Specs VFT
37	12" x 12" Cream with Brown Specs VFT Mastic
38	1' x 1' Ceiling Tile
39	Vinyl Baseboard Brown
40	2' x 4' White w/pinholes & grooves ceiling tile
41	2' x 2' White w/pinholes & grooves ceiling tile
G	Boiler Caulk
H	Boiler Gasket
I	Duct Dampening Cloth
J	12" x 12" Beige with Brown Specs Floor Tile
K	12" x 12" Beige with Brown Specs Floor Tile Mastic

The following areas were deemed to be inaccessible:

33

Carpet Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Holvay, IDPH License # 100-07210. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The LaSalle Academy Building 4420 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School LaSalle Academy Unit 29161 Building ID 4420

Address 1734 N. Orleans Street Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
02	9" x 9" Brown Floor Tile	2,400	SF	Lunchroom storage, Rooms 101,207 & 1st Fl Boy's Toilet. Landing by Boiler Room toilet, Maintenance Room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03	9" x 9" Gray Floor Tile	1,500	SF	Office and Equipment Room, Boiler Room Stairway	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04	12" x 12" Brown w/ White and Gray Streaks VFT	2,000	SF	Room 109, 110, & 1st Floor Northeast Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06	Brown Hard Coat Plaster	28,000	SF	Throughout	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
09	9" x 9" Brown Floor Tile Mastic	2,400	SF	Lunchroom storage, Rooms 101, 207, 1st Floor Boy's Toilet, Landing by Boiler Room Toilet	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	9" x 9" Gray Floor Tile Mastic	1,500	SF	Office and Equipment Room, Boiler Room Stairway	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12" x 12" White w/ Gray Specks VFT Mastic	1,500	SF	Room 109, 110, & 1st Floor Northeast Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12" x 12" White w/ Beige Floor Tile	2,000	SF	Principal's Office, Main Office, Health Suite, Faculty Room, and Stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	12" x 12" White w/ Beige Floor Tile Mastic	2,000	SF	Principal's Office, Main Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12" x 12" Ceiling Tiles w/Grooves	21,000	SF	Throughout	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
15	12" x 12" Light Brown Streaked Floor Tile	900	SF	Entrance to Gym Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15A	12" x 12" Light Brown Streaked Floor Tile Mastic	900	SF	Entrance to Gym Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12" x 12" Gray Streaked Floor Tile	2,700	SF	Room 111, 111A, Room doorway 206A, Elevator, Rooms 215, 112, 200, 201, and 2nd floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LaSalle Academy Unit 29161 Building ID 4420

Address 1734 N. Orleans Street Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
16A	12" x 12" Gray Streaked Floor Tile Mastic	2,700	SF	Room 111, 111A, Doorway 206A, Elevator, 2nd Floor Corridor and Rooms 215, 112, 200, 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	9" x 9" Green Streaked Floor Tile	4,000	SF	Rooms 206, 206A, 205, 204, 203, 209, 209A replacements	ASSUMED	MISC	N	NONE			No	ACBM with the potential for damage		LOW
17A	9" x 9" Green Streaked Floor Tile Mastic	3,200	SF	Rooms 206, 206A, 205, 204, 203, 209, 209A replacements	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12" x 12" Lt. Blue Mixed Speckled VFT	2,000	SF	2nd Floor Corridor Lunch Room and room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12" x 12" Lt. Blue Mixed Speckled VFT Mastic	2,000	SF	2nd Floor Corridor Lunch Room and room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12" x 12" Yellow Mixed Speckled VFT	450	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12" x 12" Yellow Mixed Speckled VFT Mastic	450	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12" X 12" Dark Blue with Lt. Blue Specs VFT	600	SF	Room 200 & Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12" x 12" Dark Blue with Lt. Blue Specs VFT Mastic	600	SF	Room 200 & Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12" x 12" Pink with Specs VFT	200	SF	Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12" x 12" Pink with Specs VFT Mastic	200	SF	Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12" x 12" Dark Green Mixed Speckled VFT	200	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12" x 12" Dark Green Mixed Speckled VFT Mastic	200	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	12" x 12" Lt. Green Mixed Speckled VFT	200	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	12" x 12" Lt. Green Mixed Speckled VFT Mastic	200	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12" x 12" Dark Brown Mixed Speckled VFT	1,000	SF	Room 202 and 1st Floor Men & Womens Teacher's toilet and engineer's office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12" x 12" Dark Brown Mixed Speckled VFT Mastic	1,000	SF	Room 202 and 1st Floor Men &	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LaSalle Academy Unit 29161 Building ID 4420

Address 1734 N. Orleans Street Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Womens Teachers Toilet, and engineer's office										
32	Drywall	2,000	SF	1st and 2nd Floor Boys and Girls Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Carpet Mastic		SF	not observed	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12" x 12" Gray Mixed Speckled VFT	2,400	SF	Rooms 107, 105, 103, 101, 210, 212, 213	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12" x 12" Gray Mixed Speckled VFT Mastic	2,400	SF	Rooms 107, 105, 103, 101, 210, 212, 213	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12" x 12" Cream with Brown Specs VFT	1,200	SF	Rooms 102 and 100	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12" x 12" Cream with Brown Specs VFT Mastic	1,200	SF	Rooms 102 and 100	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	1' x 1' Ceiling Tile	1,000	SF	Gymnasium Stage	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		
39	Vinyl Baseboard Brown	3,500	SF	1st and 2nd Corridors, Rooms 206, 209, 210, 213	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	2' x 4' White w/pinholes & grooves ceiling tile	1,400	SF	Rooms 111, 111A, 112 & adjacent corridor, and room 208	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		MODERATE
41	2' x 2' White w/pinholes & grooves ceiling tile	240	SF	Door #7 Vestibule, room 99, and room 199	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		MODERATE
A	Breeching Insulation	3,250	SF	Boiler Room	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
B	Tank Insulation	250	SF	Boiler Room	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
C	Aircell Pipe Insulation	2,494	LF	Above Corridor Ceilings	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
D	MJP E/F/V on Aircell Pipe Insulation	856	LF	Above Corridor Ceilings	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		Low
E	Cardboard Pipe Insulation	1,800	LF	Throughout Building (See Hatching Maps)	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	MJP E/F/V on Cardboard Pipe Insulation	725	LF	Throughout Building (See Hatching Maps)	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LaSalle Academy Unit 29161 Building ID 4420

Address 1734 N. Orleans Street Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
G	Boiler Caulk	40	LF	Boiler Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
H	Boiler Gasket	30	LF	Boiler Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
I	Duct Dampening Cloth	20	SF	Room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
J	12" x 12" Beige with Brown Specs Floor Tile	6,000	SF	1st Floor Hallway; 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
K	12" x 12" Beige with Brown Specs Floor Tile Mastic	6,000	SF	1st Floor Hallway, 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School LaSalle Academy Unit 29161 Building ID 4420

Address 1734 N. Orleans Street Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 9/17/2022
Inspector Name Michael Holvay
100-07210 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
02	
03	
04	
06	
09	
10	
11	
12	
13	
14	
15	
15A	
16	
16A	
17	
17A	
18	
19	
20	
21	
22	
23	
24	
25	

Chicago Public Schools

School LaSalle Academy Unit 29161 Building ID 4420

Address 1734 N. Orleans Street Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	Material in good condition
41	Material in good condition
A	
B	
C	
D	
E	
F	
G	
H	
I	
J	
K	

Chicago Public Schools

School LaSalle Academy **Unit** 29161 **Building ID** 4420

Address 1734 N. Orleans Street **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School LaSalle Academy
Address 1734 N. Orleans Street

Unit 29161
Chicago, IL, 60614

Building ID 4420
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02	9" x 9" Brown Floor Tile	2,400	SF	Lunchroom storage, Rooms 101,207 & 1st Fl Boy's Toilet. Landing by Boiler Room toilet, Maintenance Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	9" x 9" Gray Floor Tile	1,500	SF	Office and Equipment Room, Boiler Room Stairway	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12" x 12" Brown w/ White and Gray Streaks VFT	2,000	SF	Room 109, 110, & 1st Floor Northeast Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	Brown Hard Coat Plaster	28,000	SF	Throughout	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	9" x 9" Brown Floor Tile Mastic	2,400	SF	Lunchroom storage, Rooms 101, 207, 1st Floor Boy's Toilet, Landing by Boiler Room Toilet	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	9" x 9" Gray Floor Tile Mastic	1,500	SF	Office and Equipment Room, Boiler Room Stairway	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12" x 12" White w/ Gray Specks VFT Mastic	1,500	SF	Room 109, 110, & 1st Floor Northeast Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12" x 12" White w/ Beige Floor Tile	2,000	SF	Principal's Office, Main Office, Health Suite, Faculty Room, and Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12" x 12" White w/ Beige Floor Tile Mastic	2,000	SF	Principal's Office, Main Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12" x 12" Ceiling Tiles w/Grooves	21,000	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12" x 12" Light Brown Streaked Floor Tile	900	SF	Entrance to Gym Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	12" x 12" Light Brown Streaked Floor Tile Mastic	900	SF	Entrance to Gym Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12" x 12" Gray Streaked Floor Tile	2,700	SF	Room 111, 111A, Room doorway 206A, Elevator, Rooms 215, 112, 200, 201, and 2nd floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A	12" x 12" Gray Streaked Floor Tile Mastic	2,700	SF	Room 111, 111A, Doorway 206A, Elevator, 2nd Floor Corridor and Rooms 215, 112, 200, 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	9" x 9" Green Streaked Floor Tile	4,000	SF	Rooms 206, 206A, 205, 204, 203, 209, 209A replacements	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
17A	9" x 9" Green Streaked Floor Tile Mastic	3,200	SF	Rooms 206, 206A, 205, 204, 203, 209, 209A replacements	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12" x 12" Lt. Blue Mixed Speckled VFT	2,000	SF	2nd Floor Corridor Lunch Room and room 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12" x 12" Lt. Blue Mixed Speckled VFT Mastic	2,000	SF	2nd Floor Corridor Lunch Room and room 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12" x 12" Yellow Mixed Speckled VFT	450	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School LaSalle Academy
Address 1734 N. Orleans Street

Unit 29161
Chicago, IL, 60614

Building ID 4420
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
21	12" x 12" Yellow Mixed Speckled VFT Mastic	450	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12" X 12" Dark Blue with Lt. Blue Specs VFT	600	SF	Room 200 & Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12" x 12" Dark Blue with Lt. Blue Specs VFT Mastic	600	SF	Room 200 & Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12" x 12" Pink with Specs VFT	200	SF	Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12" x 12" Pink with Specs VFT Mastic	200	SF	Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12" x 12" Dark Green Mixed Speckled VFT	200	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12" x 12" Dark Green Mixed Speckled VFT Mastic	200	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12" x 12" Lt. Green Mixed Speckled VFT	200	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12" x 12" Lt. Green Mixed Speckled VFT Mastic	200	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12" x 12" Dark Brown Mixed Speckled VFT	1,000	SF	Room 202 and 1st Floor Men & Womens Teacher's toilet and engineer's office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12" x 12" Dark Brown Mixed Speckled VFT Mastic	1,000	SF	Room 202 and 1st Floor Men & Womens Teachers Toilet, and engineer's office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Drywall	2,000	SF	1st and 2nd Floor Boys and Girls Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	Carpet Mastic		SF	not observed	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Gray Mixed Speckled VFT	2,400	SF	Rooms 107, 105, 103, 101, 210, 212, 213	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" Gray Mixed Speckled VFT Mastic	2,400	SF	Rooms 107, 105, 103, 101, 210, 212, 213	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" x 12" Cream with Brown Specs VFT	1,200	SF	Rooms 102 and 100	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12" x 12" Cream with Brown Specs VFT Mastic	1,200	SF	Rooms 102 and 100	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	1' x 1' Ceiling Tile	1,000	SF	Gymnasium Stage	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Vinyl Baseboard Brown	3,500	SF	1st and 2nd Corridors, Rooms 206, 209, 210, 213	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	2' x 4' White w/pinholes & grooves ceiling tile	1,400	SF	Rooms 111, 111A, 112 & adjacent corridor, and room 208	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
41	2' x 2' White w/pinholes & grooves ceiling tile	240	SF	Door #7 Vestibule, room 99, and room 199	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Breeching Insulation	3,250	SF	Boiler Room	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	Tank Insulation	250	SF	Boiler Room	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Aircell Pipe Insulation	2,494	LF	Above Corridor Ceilings	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
D	MJP E/F/V on Aircell Pipe Insulation	856	LF	Above Corridor Ceilings	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School LaSalle Academy
Address 1734 N. Orleans Street

Unit 29161
 Chicago, IL, 60614

Building ID 4420
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
E	Cardboard Pipe Insulation	1,800	LF	Throughout Building (See Hatching Maps)	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
F	MJP E/F/V on Cardboard Pipe Insulation	725	LF	Throughout Building (See Hatching Maps)	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
G	Boiler Caulk	40	LF	Boiler Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	Boiler Gasket	30	LF	Boiler Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
I	Duct Dampening Cloth	20	SF	Room 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
J	12" x 12" Beige with Brown Specs Floor Tile	6,000	SF	1st Floor Hallway; 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K	12" x 12" Beige with Brown Specs Floor Tile Mastic	6,000	SF	1st Floor Hallway, 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School LaSalle Academy
Address 1734 N. Orleans Street

Unit 29161
 Chicago, IL, 60614

Building ID 4420
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	10/14/2022
Manager Planner Name	Jigar Shah
100-07342	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
02	
03	
04	
06	
09	
10	
11	
12	
13	
14	
15	
15A	
16	
16A	
17	
17A	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	

Chicago Public Schools

School LaSalle Academy
Address 1734 N. Orleans Street

Unit 29161
Chicago, IL, 60614

Building ID 4420
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
A	
B	
C	
D	
E	
F	
G	
H	
I	
J	
K	

Chicago Public Schools

School LaSalle Academy
Address 1734 N. Orleans Street

Unit 29161
Chicago, IL, 60614

Building ID 4420
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom storage, Rooms 101,207 & 1st FI Boy's Toilet. Landing by Boiler Room toilet, Maintenance Room**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile**
MATERIAL LOCATION: **Lunchroom storage, Rooms 101,207 & 1st Fl Boy's Toilet. Landing by Boiler Room toilet, Maintenance Room**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office and Equipment Room, Boiler Room Stairway**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile**
MATERIAL LOCATION: **Office and Equipment Room, Boiler Room Stairway**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ White and Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 109, 110, & 1st Floor Northeast Corridor**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ White and Gray Streaks VFT**
MATERIAL LOCATION: **Room 109, 110, & 1st Floor Northeast Corridor**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **Brown Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **Brown Hard Coat Plaster**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom storage, Rooms 101, 207, 1st Floor Boy's Toilet, Landing by Boiler Room Toilet**

MATERIAL QUANTITY: **2400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Mastic**
MATERIAL LOCATION: **Lunchroom storage, Rooms 101, 207, 1st Floor Boy's Toilet, Landing by Boiler Room Toilet**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office and Equipment Room, Boiler Room Stairway**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile Mastic**
MATERIAL LOCATION: **Office and Equipment Room, Boiler Room Stairway**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" White w/ Gray Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 109, 110, & 1st Floor Northeast Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" White w/ Gray Specks VFT Mastic**
MATERIAL LOCATION: **Room 109, 110, & 1st Floor Northeast Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" White w/ Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office, Main Office, Health Suite, Faculty Room, and Stage**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" White w/ Beige Floor Tile**
MATERIAL LOCATION: **Principal's Office, Main Office, Health Suite, Faculty Room, and Stage**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12" x 12" White w/ Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office, Main Office**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12" x 12" White w/ Beige Floor Tile Mastic**
MATERIAL LOCATION: **Principal's Office, Main Office**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tiles w/Grooves**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **21000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tiles w/Grooves**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **21000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

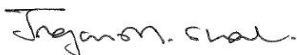

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Streaked Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrance to Gym Hall**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____


Michael Holvay
Project Manager

Date: 09/17/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Streaked Floor Tile**
MATERIAL LOCATION: **Entrance to Gym Hall**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Streaked Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrance to Gym Hall**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUILDING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Streaked Floor Tile Mastic**
MATERIAL LOCATION: **Entrance to Gym Hall**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12" x 12" Gray Streaked Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 111, 111A, Room doorway 206A, Elevator, Rooms 215, 112, 200, 201, and 2nd floor Corridor**

MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12" x 12" Gray Streaked Floor Tile**
MATERIAL LOCATION: **Room 111, 111A, Room doorway 206A, Elevator, Rooms 215, 112, 200, 201, and 2nd floor Corridor**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12" x 12" Gray Streaked Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 111, 111A, Doorway 206A, Elevator, 2nd Floor Corridor and Rooms 215, 112, 200, 201**

MATERIAL QUANTITY: **2700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12" x 12" Gray Streaked Floor Tile Mastic**
MATERIAL LOCATION: **Room 111, 111A, Doorway 206A, Elevator, 2nd Floor Corridor and Rooms 215, 112, 200, 201**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Green Streaked Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 206, 206A, 205, 204, 203, 209, 209A replacements**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Green Streaked Floor Tile**
MATERIAL LOCATION: **Rooms 206, 206A, 205, 204, 203, 209, 209A replacements**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **9" x 9" Green Streaked Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 206, 206A, 205, 204, 203, 209, 209A replacements**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **9" x 9" Green Streaked Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 206, 206A, 205, 204, 203, 209, 209A replacements**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12" x 12" Lt. Blue Mixed Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridor Lunch Room and room 208**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12" x 12" Lt. Blue Mixed Speckled VFT**
MATERIAL LOCATION: **2nd Floor Corridor Lunch Room and room 208**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Lt. Blue Mixed Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridor Lunch Room and room 208**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Lt. Blue Mixed Speckled VFT Mastic**
MATERIAL LOCATION: **2nd Floor Corridor Lunch Room and room 208**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mixed Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mixed Speckled VFT**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mixed Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mixed Speckled VFT Mastic**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12" X 12" Dark Blue with Lt. Blue Specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 200 & Lunchroom**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12" X 12" Dark Blue with Lt. Blue Specs VFT**
MATERIAL LOCATION: **Room 200 & Lunchroom**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Dark Blue with Lt. Blue Specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 200 & Lunchroom**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Dark Blue with Lt. Blue Specs VFT Mastic**
MATERIAL LOCATION: **Room 200 & Lunchroom**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Pink with Specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Pink with Specs VFT**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" Pink with Specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" Pink with Specs VFT Mastic**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Mixed Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Mixed Speckled VFT**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Mixed Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Mixed Speckled VFT Mastic**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12" x 12" Lt. Green Mixed Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12" x 12" Lt. Green Mixed Speckled VFT**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12" x 12" Lt. Green Mixed Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12" x 12" Lt. Green Mixed Speckled VFT Mastic**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Mixed Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202 and 1st Floor Men & Womens Teacher's toilet and engineer's office**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Mixed Speckled VFT**
MATERIAL LOCATION: **Room 202 and 1st Floor Men & Womens Teacher's toilet and engineer's office**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Mixed Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202 and 1st Floor Men & Womens Teachers Toilet, and engineer's office**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Mixed Speckled VFT Mastic**
MATERIAL LOCATION: **Room 202 and 1st Floor Men & Womens Teachers Toilet, and engineer's office**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Boys and Girls Bathrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **1st and 2nd Floor Boys and Girls Bathrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **not observed**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **not observed**
MATERIAL QUANTITY: MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Gray Mixed Speckled VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 107, 105, 103, 101, 210, 212, 213**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Gray Mixed Speckled VFT**
MATERIAL LOCATION: **Rooms 107, 105, 103, 101, 210, 212, 213**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" Gray Mixed Speckled VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 107, 105, 103, 101, 210, 212, 213**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" Gray Mixed Speckled VFT Mastic**
MATERIAL LOCATION: **Rooms 107, 105, 103, 101, 210, 212, 213**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 102 and 100**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Specs VFT**
MATERIAL LOCATION: **Rooms 102 and 100**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 102 and 100**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Specs VFT Mastic**
MATERIAL LOCATION: **Rooms 102 and 100**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gymnasium Stage**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
MATERIAL LOCATION: **Gymnasium Stage**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Vinyl Baseboard Brown**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Corridors, Rooms 206, 209, 210, 213**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Vinyl Baseboard Brown**
MATERIAL LOCATION: **1st and 2nd Corridors, Rooms 206, 209, 210, 213**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Breeching Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Breeching Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

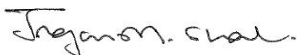

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Above Corridor Ceilings**
MATERIAL QUANTITY: **2494** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Above Corridor Ceilings**
MATERIAL QUANTITY: **2494** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**
MATERIAL LOCATION: **Above Corridor Ceilings**
MATERIAL QUANTITY: **856** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Above Corridor Ceilings**
MATERIAL QUANTITY: **856** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Building (See Hatching Maps)**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Throughout Building (See Hatching Maps)**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Building (See Hatching Maps)**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Throughout Building (See Hatching Maps)**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Boiler Caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Boiler Caulk**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Boiler Gasket**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Boiler Gasket**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Duct Dampening Cloth**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Duct Dampening Cloth**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **12" x 12" Beige with Brown Specs Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Hallway; 2nd Floor Corridor**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **12" x 12" Beige with Brown Specs Floor Tile**
MATERIAL LOCATION: **1st Floor Hallway; 2nd Floor Corridor**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **12" x 12" Beige with Brown Specs Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Hallway, 2nd Floor Corridor**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUIDLING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **12" x 12" Beige with Brown Specs Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Hallway, 2nd Floor Corridor**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

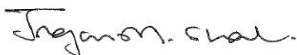

Date: **10/14/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUILDING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **2' x 4' White w/pinholes & grooves ceiling tile**
MATERIAL LOCATION: **Rooms 111, 111A, 112 & adjacent corridor, and room 208**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
Material in good condition

Inspector's Signature: _____


Michael Holvay
Project Manager

Date: 09/17/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUILDING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**


HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **2' x 4' White w/pinholes & grooves ceiling tile**
MATERIAL LOCATION: **Rooms 111, 111A, 112 & adjacent corridor, and room 208**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 10/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUILDING ID: **4420**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **LaSalle Academy** INSPECTION DATE: **9/17/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **2' x 2' White w/pinholes & grooves ceiling tile**
MATERIAL LOCATION: **Door #7 Vestibule, room 99, and room 199**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
Material in good condition

Inspector's Signature:


Michael Holvay
Project Manager

Date: **09/17/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29161** BUILDING ID: **4420**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **LaSalle Academy** REVIEW DATE: **10/14/2022**
ADDRESS: **1734 N. Orleans Street** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **2' x 2' White w/pinholes & grooves ceiling tile**
MATERIAL LOCATION: **Door #7 Vestibule, room 99, and room 199**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature:  Date: **10/14/2022**

APPENDIX B

Inspector and Management Planner Licenses

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2022

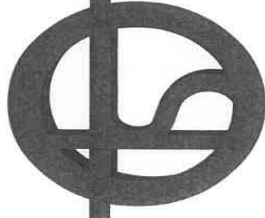

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Michael Holvay

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092152

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Michael Holvay

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/10/2021

Exam Date: 9/10/2021

Expiration Date: 9/10/2022

Certificate Number: BIR2109101950

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 07210

ISSUED
2/28/2022

EXPIRES
05/15/2023

MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07210

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE
Front of License Back of License

 ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS INSPECTOR PROJECT MANAGER AIR SAMPLING PROFESSIONAL	TC EXPIRES 9/10/2022 1/13/2023
ID NUMBER 100 - 07210 MICHAEL HOLVAY 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health	ISSUED 2/28/2022 EXPIRES 05/15/2023	 Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	


If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023

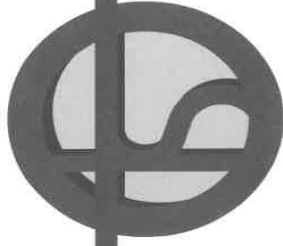

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612



Environmental Health

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 07342</p>	<p>ISSUED 4/1/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>INSPECTOR</p>	<p>3/9/2023</p>	
<p>JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p> 			<p>PROJECT DESIGNER</p>	<p>3/24/2023</p>	
			<p>MANAGEMENT PLANNER</p>	<p>3/9/2023</p>	
			<p>PROJECT MANAGER</p>	<p>3/2/2023</p>	
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed