

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0019
SCHOOL NAME: Hirsch High School
ADDRESS OF SCHOOL: 7740 S. Ingleside
CITY: Chicago, IL, 60619

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **8/27/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 7/22/2022 ENROLLMENT 112
IDPH INSPECTOR LICENSE NUMBER: 100-04208
IDPH LICENSED INSPECTOR NAME (Please Print): James Lehnhardt
IDPH MP LICENSE NUMBER: 100-09870
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Todd Huffer

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer

8/16/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Hirsch High School

7740 S. Ingleside
Chicago, IL, 60619

Unit: 47031
Building ID: 1380

IDPH ID Number: 14-016-2990-0019

REPORT DATE:

Tuesday, August 16, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

08/16/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 47031 Region: 05 IDPH ID: 14-016-2990-0019

School: Hirsch High School Building ID: 1380

Address: 7740 S. Ingleside

Chicago, IL, 60619

Building Contact: Frieri, Anthony

Contact Phone: 3123300153

Current Building Owners: Chicago Public Schools

Reinspection Date: 7/22/2022

Review Date: 08/16/2022

Inspector: James Lehnhardt

Inspector IDPH License: 100-04208

Management Planner: Todd Huffer

Management Planner IDPH License: 100-09870

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.



Todd Huffer
100-09870

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: August 16, 2022

RE: Hirsch High School, Unit 47031
7740 S. Ingleside
Chicago, IL, 60619

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Hirsch High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Hirsch High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Hirsch High School
Address: 7740 S. Ingleside
IDPH ID: 14-016-2990-0019
Contact: Frieri, Anthony

Unit: 47031
Chicago, IL, 60619
Building ID: 1380
Phone: 3123300153

Region: 05

2. Description of Facility

Original Construction: 1926
Total Square Footage: 217770
Current Occupancy: 112

Additional Construction:
No of Floors: 3

3. LEA Designated Person

Contact: Richard J. Schleyer
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 251-7074

4. Managing Environmental Consultant


MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Phone: 630-790-0880

Fax: 630-790-0882

5. Inspector

Inspector Name: James Lehnhardt


Inspector IDPH license # 100-04208
Reinspection Date: 7/22/2022

Signature: 
Date: 7/22/2022

6. Management Planner

Management Planner Name: Todd Huffer

Management Planner IDPH license # 100-09870


Signature: 
Date: 08/16/2022

7. Review Date: 08/16/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

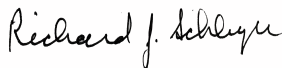

Date: 8/16/2022

Name: Richard J. Schleyer

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Hirsch High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1380:

NEW

Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 1380:

NEW

Newly Installed Suspect ACM

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02C	12x12 Tan Vinyl Floor Tile
10	Duct Vibration Sleeve
104	Transite Lab tables
105	Transite Panels
106	Beige Linoleum
107	Beige Linoleum Mastic
108	Transite Countertop
109	Transite Chalkboard
16A	Gray Linoleum w/Blue Streaks
17A	Gray Linoleum Mastic
20	12x12 Off-White Vinyl Floor Tile NOT OBSERVED
20M	12"x12" Off-White Vinyl Floor Tile Mastic NOT OBSERVED
22	Pipe Fittings
24A	White w/Tan Streaks Flooring
24B	White w/Tan Streaks Flooring Mastic
HA-100	2'x4' White Ceiling Tile
HA-101	1'x1' White Ceiling Tile
HA-102	12"x12" White Ceiling Tile Glue
HA-103	Spray-applied Ceiling Coating
N	Boiler Door Insulation
NEW	Newly Installed Suspect ACM
O	12x12 Off-White w/Streaks Vinyl Floor Tile
O-1	12x12 Off-White w/Streaks Floor Tile Mastic
P	12x12 White w/Black Streaks Vinyl Floor Tile
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic
Q	12x12 Light Pink (Beige) Vinyl Floor Tile
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic

The following areas were deemed to be inaccessible:

10	Duct Vibration Sleeve
107	Beige Linoleum Mastic
14A	9x9 Brown Vinyl Floor Tile Mastic
14B	9x9 Tan Vinyl Floor Tile Mastic
15C	12x12 Tan Vinyl Floor Tile Mastic
15D	12x12 Light Grey Floor Tile Mastic
15E	12x12 Light Green Vinyl Floor Tile Mastic

17A	Gray Linoleum Mastic
24B	White w/Tan Streaks Flooring Mastic
HA-102	12"x12" White Ceiling Tile Glue
M	Boiler Gasket
N	Boiler Door Insulation
O-1	12x12 Off-White w/Streaks Floor Tile Mastic
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by James Lehnhardt, IDPH License # 100-04208. The Management Plan was updated by Todd Huffer, IDPH License # 100-09870. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Hirsch High School Building 1380 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380

Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01A	9x9 Brown w/Streaks Vinyl Floor Tile	3,140	SF	Room 328's Vault and Room 227, 1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01B	9x9 Tan Vinyl Floor Tile	2,320	SF	1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02A	12x12 Light Olive Green Vinyl Floor Tile	2,489	SF	Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02B	12x12 Brown Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02C	12x12 Tan Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123	ASSUMED	MISC	N		20		No	ACBM with the potential for damage		LOW
02D	12x12 Light Gray Vinyl Floor Tile	5,715	SF	Main Office, Library Office, Room 320, 321, 220, 223, 126, 130, PE Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02E	12x12 Dark Green Vinyl Floor Tile	1,420	SF	Rooms 235, 206, 211, 137	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Duct Vibration Sleeve	15	SF	Band Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
104	Transite Lab tables	25	SF	Room 322, 326, 322 Office, 328	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
105	Transite Panels	30	SF	Room 322 Fume Hood	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
106	Beige Linoleum	1,266	SF	Room 321	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
107	Beige Linoleum Mastic	1,266	SF	Room 321	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
108	Transite Countertop	177	SF	Rooms 322, 326 & 328	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
109	Transite Chalkboard	2,000	SF	1st, 2nd & 3rd Floor Classrooms	ASSUMED	MISC	N	DIST	23		No	ACBM with potential for significant damage	3	LOW
12	Firewall	12,000	SF	Assembly Hall	CHR	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
14A	9x9 Brown Vinyl Floor Tile Mastic	2,190	SF	Room 328's Vault	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380

Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				and Room 227, 1st Floor Corridor								potential for damage		
14B	9x9 Tan Vinyl Floor Tile Mastic	2,320	SF	1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15A	12x12 Light Olive Vinyl Floor Tile Mastic ABATED			Kitchen, 315, 221, 211, 235, 206, 127	ABATED	MISC								
15B	Mastic 12x12 Brown Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15C	12x12 Tan Vinyl Floor Tile Mastic	14,725	SF	2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15D	12x12 Light Grey Floor Tile Mastic	5,715	SF	Main Office, Library Office, Rooms 320, 321, 220, 223, 126, 130	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15E	12x12 Light Green Vinyl Floor Tile Mastic	1,420	SF	Rooms 235, 206, 211, 137	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16A	Gray Linoleum w/Blue Streaks	5,705	SF	Rooms 222 & 225	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17A	Gray Linoleum Mastic	5,705	SF	Rooms 222 & 225	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12x12 Off-White Vinyl Floor Tile NOT OBSERVED			Room 321	ASSUMED	MISC								
20M	12"x12" Off-White Vinyl Floor Tile Mastic NOT OBSERVED			Room 321	ASSUMED	MISC								
22	Pipe Fittings	25	LF	Warm Air Tunnel and Unfinished Crawlspace	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
23	Plaster			1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area	NO_ACBM	SURFACE								
24A	White w/Tan Streaks Flooring	1,700	SF	Rooms 221, 211, 235, 206, 127, 322	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24B	White w/Tan Streaks Flooring Mastic	1,700	SF	Room 322, 221, 211, 235, 206, 127	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-1	Green Carpet Mastic			Room 230	NO_ACBM	MISC		None						

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380

Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
CM-2	Blue Carpet Mastic			Rooms 109, 128, 204	NO_ACBM	MISC		None						
CM-3	Red Carpet Mastic			Social Room, Room 131	NO_ACBM	MISC		None						
HA-100	2'x4' White Ceiling Tile	150,000	SF	Hallways and Classrooms	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-101	1'x1' White Ceiling Tile	3,000	SF	Kitchen	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-102	12"x12" White Ceiling Tile Glue	3,000	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-103	Spray-applied Ceiling Coating	7,000	SF	Pool	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
M	Boiler Gasket	140	LF	Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
N	Boiler Door Insulation	250	SF	Boiler Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKNO WN			Yes	ACBM with the potential for damage		
O	12x12 Off-White w/Streaks Vinyl Floor Tile	3,560	SF	Rooms 321, 322, 325 & 326	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
O-1	12x12 Off-White w/Streaks Floor Tile Mastic	3,560	SF	Rooms 321, 322, 325, 326	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
P	12x12 White w/Black Streaks Vinyl Floor Tile	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Q	12x12 Light Pink (Beige) Vinyl Floor Tile	750	SF	Room 128/Counselor's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic	750	SF	Room 128 (Counselor's Office)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380

Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 7/22/2022
Inspector Name James Lehnhardt
100-04208 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01A	
01B	
02A	
02B	
02C	Some damage in Rooms - Intact- 211, 235, 206, 205, 231, 233
02D	
02E	
10	
104	
105	
106	
107	
108	Removed 2021
109	Damage in Located in Rooms 132, 211, 233 & 236
12	
14A	
14B	
15A	VFT at HA-02 was observed in 2019 w/Damage
15B	
15C	
15D	
15E	
16A	
17A	

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380

Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
20	Not Observed Multiple Years
20M	Not Observed Multiple Years
22	Partially Removed- Room 133 Washroom 2021
23	
24A	
24B	
CM-1	
CM-2	
CM-3	
HA-100	
HA-101	
HA-102	
HA-103	
M	
N	
NEW	
O	
O-1	
P	
P-1	
Q	
Q-1	

Table II

Management Planner's Review

Chicago Public Schools

School Hirsch High School

Unit 47031

Building ID 1380

Address 7740 S. Ingleside

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	9x9 Brown w/Streaks Vinyl Floor Tile	3,140	SF	Room 328's Vault and Room 227, 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01B	9x9 Tan Vinyl Floor Tile	2,320	SF	1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02A	12x12 Light Olive Green Vinyl Floor Tile	2,489	SF	Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02B	12x12 Brown Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02C	12x12 Tan Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123	Assumed	MISC	No	20	SF	6 ACBM with the potential for damage	Follow O&M Plan
02D	12x12 Light Gray Vinyl Floor Tile	5,715	SF	Main Office, Library Office, Room 320, 321, 220, 223, 126, 130, PE Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02E	12x12 Dark Green Vinyl Floor Tile	1,420	SF	Rooms 235, 206, 211, 137	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Duct Vibration Sleeve	15	SF	Band Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104	Transite Lab tables	25	SF	Room 322, 326, 322 Office, 328	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
105	Transite Panels	30	SF	Room 322 Fume Hood	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
106	Beige Linoleum	1,266	SF	Room 321	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107	Beige Linoleum Mastic	1,266	SF	Room 321	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
108	Transite Countertop	177	SF	Rooms 322, 326 & 328	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	Transite Chalkboard	2,000	SF	1st, 2nd & 3rd Floor Classrooms	Assumed	MISC	No	23	SF	5 ACBM with potential for significant damage	Repair
12	Firewall	12,000	SF	Assembly Hall	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
14A	9x9 Brown Vinyl Floor Tile Mastic	2,190	SF	Room 328's Vault and Room 227, 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14B	9x9 Tan Vinyl Floor Tile Mastic	2,320	SF	1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	12x12 Light Olive Vinyl Floor Tile Mastic ABATED			Kitchen, 315, 221, 211, 235, 206, 127	Abated	MISC					
15B	Mastic 12x12 Brown Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15C	12x12 Tan Vinyl Floor Tile Mastic	14,725	SF	2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15D	12x12 Light Grey Floor Tile Mastic	5,715	SF	Main Office, Library Office, Rooms 320, 321, 220, 223, 126, 130	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Hirsch High School
Address 7740 S. Ingleside

Unit 47031
Chicago, IL, 60619

Building ID 1380
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
15E	12x12 Light Green Vinyl Floor Tile Mastic	1,420	SF	Rooms 235, 206, 211, 137	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A	Gray Linoleum w/Blue Streaks	5,705	SF	Rooms 222 & 225	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17A	Gray Linoleum Mastic	5,705	SF	Rooms 222 & 225	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12x12 Off-White Vinyl Floor Tile NOT OBSERVED			Room 321	Assumed	MISC					
20M	12"x12" Off-White Vinyl Floor Tile Mastic NOT OBSERVED			Room 321	Assumed	MISC					
22	Pipe Fittings	25	LF	Warm Air Tunnel and Unfinished Crawlspace	Assumed	MISC	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
23	Plaster			1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area	No ACBM	SURFACE					
24A	White w/Tan Streaks Flooring	1,700	SF	Rooms 221, 211, 235, 206, 127, 322	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24B	White w/Tan Streaks Flooring Mastic	1,700	SF	Room 322, 221, 211, 235, 206, 127	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-1	Green Carpet Mastic			Room 230	No ACBM	MISC					
CM-2	Blue Carpet Mastic			Rooms 109, 128, 204	No ACBM	MISC					
CM-3	Red Carpet Mastic			Social Room, Room 131	No ACBM	MISC					
HA-100	2'x4' White Ceiling Tile	150,000	SF	Hallways and Classrooms	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-101	1'x1' White Ceiling Tile	3,000	SF	Kitchen	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-102	12"x12" White Ceiling Tile Glue	3,000	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-103	Spray-applied Ceiling Coating	7,000	SF	Pool	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
M	Boiler Gasket	140	LF	Boiler Room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
N	Boiler Door Insulation	250	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC				6 ACBM with the potential for damage	Follow O&M Plan
O	12x12 Off-White w/Streaks Vinyl Floor Tile	3,560	SF	Rooms 321, 322, 325 & 326	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O-1	12x12 Off-White w/Streaks Floor Tile Mastic	3,560	SF	Rooms 321, 322, 325, 326	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P	12x12 White w/Black Streaks Vinyl Floor Tile	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Q	12x12 Light Pink (Beige) Vinyl Floor Tile	750	SF	Room 128/Counselor's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic	750	SF	Room 128 (Counselor's Office)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Hirsch High School
Address 7740 S. Ingleside

Unit 47031
 Chicago, IL, 60619

Building ID 1380
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	8/16/2022
Manager Planner Name	Todd Huffer
100-09870	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
01B	
02A	
02B	Continue O&M.
02C	Continue O&M.
02D	
02E	

Chicago Public Schools

School Hirsch High School
Address 7740 S. Ingleside

Unit 47031
 Chicago, IL, 60619

Building ID 1380
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
10	
104	
105	
106	
107	
108	
109	Patch & Repair. Follow O&M
12	
14A	
14B	
15A	
15B	
15C	
15D	
15E	
16A	
17A	
20	
20M	
22	
23	
24A	
24B	
CM-1	
CM-2	
CM-3	
HA-100	

Chicago Public Schools

School Hirsch High School
Address 7740 S. Ingleside

Unit 47031
Chicago, IL, 60619

Building ID 1380
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
HA-101	
HA-102	
HA-103	
M	
N	
NEW	
O	
O-1	
P	
P-1	
Q	
Q-1	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**
MATERIAL DESCRIPTION: **9x9 Brown w/Streaks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 328's Vault and Room 227, 1st Floor Corridor**

MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01A**
MATERIAL DESCRIPTION: **9x9 Brown w/Streaks Vinyl Floor Tile**
MATERIAL LOCATION: **Room 328's Vault and Room 227, 1st Floor Corridor**
MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01B**
MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **2320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01B**
MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **2320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A**
MATERIAL DESCRIPTION: **12x12 Light Olive Green Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105**

MATERIAL QUANTITY: **2489** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **2489** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02A**
MATERIAL DESCRIPTION: **12x12 Light Olive Green Vinyl Floor Tile**
MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105**
MATERIAL QUANTITY: **2489** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **12x12 Brown Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **12x12 Brown Vinyl Floor Tile**
MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**
MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Continue O&M.

Management Planner's Signature: _____



Date: 08/16/2022

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02C**
MATERIAL DESCRIPTION: **12x12 Tan Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Some damage in Rooms - Intact- 211, 235, 206, 205, 231, 233**

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02C**
MATERIAL DESCRIPTION: **12x12 Tan Vinyl Floor Tile**
MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123**
MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **20** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Continue O&M.

Management Planner's Signature: _____



Date: 08/16/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02D**
MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office, Library Office, Room 320, 321, 220, 223, 126, 130, PE Office**
MATERIAL QUANTITY: **5715** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02D**
MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile**
MATERIAL LOCATION: **Main Office, Library Office, Room 320, 321, 220, 223, 126, 130, PE Office**
MATERIAL QUANTITY: **5715** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02E**
MATERIAL DESCRIPTION: **12x12 Dark Green Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 235, 206, 211, 137**
MATERIAL QUANTITY: **1420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02E**
MATERIAL DESCRIPTION: **12x12 Dark Green Vinyl Floor Tile**
MATERIAL LOCATION: **Rooms 235, 206, 211, 137**
MATERIAL QUANTITY: **1420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Duct Vibration Sleeve**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Band Room**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Duct Vibration Sleeve**
MATERIAL LOCATION: **Band Room**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **Transite Lab tables**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 322, 326, 322 Office, 328**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **Transite Lab tables**
MATERIAL LOCATION: **Room 322, 326, 322 Office, 328**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Transite Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 322 Fume Hood**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Transite Panels**
MATERIAL LOCATION: **Room 322 Fume Hood**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Beige Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 321**
MATERIAL QUANTITY: **1266** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Beige Linoleum**
MATERIAL LOCATION: **Room 321**
MATERIAL QUANTITY: **1266** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Beige Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 321**
MATERIAL QUANTITY: **1266** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Beige Linoleum Mastic**
MATERIAL LOCATION: **Room 321**
MATERIAL QUANTITY: **1266** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **Transite Countertop**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 322, 326 & 328**
MATERIAL QUANTITY: **177** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Removed 2021**

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **Transite Countertop**
MATERIAL LOCATION: **Rooms 322, 326 & 328**
MATERIAL QUANTITY: **177** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **Transite Chalkboard**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Classrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in Located in Rooms 132, 211, 233 & 236**

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **Transite Chalkboard**
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Classrooms**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **23** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Patch & Repair. Follow O&M

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Firewall**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Firewall**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14A**
MATERIAL DESCRIPTION: **9x9 Brown Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 328's Vault and Room 227, 1st Floor Corridor**
MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **14A**
MATERIAL DESCRIPTION: **9x9 Brown Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Room 328's Vault and Room 227, 1st Floor Corridor**
MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14B**
MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **2320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **14B**
MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **2320** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **12x12 Light Olive Vinyl Floor Tile Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **VFT at HA-02 was observed in 2019 w/Damage**

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **12x12 Light Olive Vinyl Floor Tile Mastic ABATED**
MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15B**
MATERIAL DESCRIPTION: **Mastic 12x12 Brown Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**

MATERIAL QUANTITY: **14725**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **15B**
MATERIAL DESCRIPTION: **Mastic 12x12 Brown Vinyl Floor Tile**
MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**
MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15C**
MATERIAL DESCRIPTION: **12x12 Tan Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123**

MATERIAL QUANTITY: **14725**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **15C**
MATERIAL DESCRIPTION: **12x12 Tan Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123**
MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15D**
MATERIAL DESCRIPTION: **12x12 Light Grey Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office, Library Office, Rooms 320, 321, 220, 223, 126, 130**
MATERIAL QUANTITY: **5715** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **15D**
MATERIAL DESCRIPTION: **12x12 Light Grey Floor Tile Mastic**
MATERIAL LOCATION: **Main Office, Library Office, Rooms 320, 321, 220, 223, 126, 130**
MATERIAL QUANTITY: **5715** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15E**
MATERIAL DESCRIPTION: **12x12 Light Green Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 235, 206, 211, 137**
MATERIAL QUANTITY: **1420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **15E**
MATERIAL DESCRIPTION: **12x12 Light Green Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 235, 206, 211, 137**
MATERIAL QUANTITY: **1420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **Gray Linoleum w/Blue Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 222 & 225**
MATERIAL QUANTITY: **5705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **Gray Linoleum w/Blue Streaks**
MATERIAL LOCATION: **Rooms 222 & 225**
MATERIAL QUANTITY: **5705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **Gray Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 222 & 225**
MATERIAL QUANTITY: **5705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **Gray Linoleum Mastic**
MATERIAL LOCATION: **Rooms 222 & 225**
MATERIAL QUANTITY: **5705** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 47031 BUILDING ID: 1380
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: James Lehnhardt
SCHOOL NAME: Hirsch High School INSPECTION DATE: 7/22/2022
ADDRESS: 7740 S. Ingleside IDPH LICENSE NO: 100-04208

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 20
MATERIAL DESCRIPTION: 12x12 Off-White Vinyl Floor Tile NOT OBSERVED
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 321

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not Observed Multiple Years

Inspector's Signature:



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **12x12 Off-White Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Room 321**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20M**
MATERIAL DESCRIPTION: **12"x12" Off-White Vinyl Floor Tile Mastic NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 321**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **20M**
MATERIAL DESCRIPTION: **12"x12" Off-White Vinyl Floor Tile Mastic NOT OBSERVED**
MATERIAL LOCATION: **Room 321**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Pipe Fittings**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Warm Air Tunnel and Unfinished Crawlspace**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS: **Partially Removed- Room 133 Washroom 2021**

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Pipe Fittings**
MATERIAL LOCATION: **Warm Air Tunnel and Unfinished Crawlspace**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **White w/Tan Streaks Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 221, 211, 235, 206, 127, 322**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **White w/Tan Streaks Flooring**
MATERIAL LOCATION: **Rooms 221, 211, 235, 206, 127, 322**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24B**
MATERIAL DESCRIPTION: **White w/Tan Streaks Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 322, 221, 211, 235, 206, 127**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **24B**
MATERIAL DESCRIPTION: **White w/Tan Streaks Flooring Mastic**
MATERIAL LOCATION: **Room 322, 221, 211, 235, 206, 127**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-1**

MATERIAL DESCRIPTION: **Green Carpet Mastic**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022** _____

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 109, 128, 204**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Rooms 109, 128, 204**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **Red Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Social Room, Room 131**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **Red Carpet Mastic**
MATERIAL LOCATION: **Social Room, Room 131**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-100**
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallways and Classrooms**
MATERIAL QUANTITY: **150000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **HA-100**
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**
MATERIAL LOCATION: **Hallways and Classrooms**
MATERIAL QUANTITY: **150000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-101**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **HA-101**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-102**
MATERIAL DESCRIPTION: **12"x12" White Ceiling Tile Glue**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **HA-102**
MATERIAL DESCRIPTION: **12"x12" White Ceiling Tile Glue**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-103**
MATERIAL DESCRIPTION: **Spray-applied Ceiling Coating**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Pool**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **HA-103**
MATERIAL DESCRIPTION: **Spray-applied Ceiling Coating**
MATERIAL LOCATION: **Pool**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Boiler Gasket**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Boiler Gasket**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Boiler Door Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Boiler Door Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **12x12 Off-White w/Streaks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 321, 322, 325 & 326**
MATERIAL QUANTITY: **3560** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **12x12 Off-White w/Streaks Vinyl Floor Tile**
MATERIAL LOCATION: **Rooms 321, 322, 325 & 326**
MATERIAL QUANTITY: **3560** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **O-1**
MATERIAL DESCRIPTION: **12x12 Off-White w/Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 321, 322, 325, 326**
MATERIAL QUANTITY: **3560** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **O-1**
MATERIAL DESCRIPTION: **12x12 Off-White w/Streaks Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 321, 322, 325, 326**
MATERIAL QUANTITY: **3560** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **12x12 White w/Black Streaks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223**
MATERIAL QUANTITY: **9300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **07/22/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **12x12 White w/Black Streaks Vinyl Floor Tile**
MATERIAL LOCATION: **Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223**
MATERIAL QUANTITY: **9300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P-1**
MATERIAL DESCRIPTION: **12x12 White w/Black Streaks Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223**
MATERIAL QUANTITY: **9300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **P-1**
MATERIAL DESCRIPTION: **12x12 White w/Black Streaks Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223**
MATERIAL QUANTITY: **9300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **12x12 Light Pink (Beige) Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 128/Counsellor's Office**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **12x12 Light Pink (Beige) Vinyl Floor Tile**
MATERIAL LOCATION: **Room 128/Counsellor's Office**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hirsch High School** INSPECTION DATE: **7/22/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q-1**
MATERIAL DESCRIPTION: **12x12 Light Pink (Beige) Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 128 (Counselor's Office)**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 07/22/2022

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **Q-1**
MATERIAL DESCRIPTION: **12x12 Light Pink (Beige) Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Room 128 (Counselor's Office)**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **08/16/2022**

Chicago Public Schools

TEM Environmental, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUILDING ID: **1380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Hirsch High School** REVIEW DATE: **8/16/2022**
ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **NEW**
MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**
MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 08/16/2022

APPENDIX B

Inspector and Management Planner Licenses



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jim Lehnhardt

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082271

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JAMES D LEHNHARDT
15301 KILPATRICK AVE, APT. 4
OAK FOREST, IL 60452

3/15/2022


ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04208

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER	ISSUED	EXPIRES	INSPECTOR	10/8/2022
100 - 04208	3/15/2022	05/15/2023	PROJECT MANAGER	10/9/2022
JAMES D LEHNHARDT 15301 KILPATRICK AVE, APT. 4 OAK FOREST, IL 60452 Environmental Health			AIR SAMPLING PROFESSIONAL	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

James Lehnhardt

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: BIR2211033511

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Todd Huffer

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: BIR2111012557

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

TODD T HUFFER
315 HATLEN COURT
MT. PROSPECT, IL 60056

2/18/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 09870

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

			ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 09870	ISSUED 2/18/2022	EXPIRES 05/15/2023			INSPECTOR	11/1/2022
TODD T HUFFER 315 HATLEN COURT MT. PROSPECT, IL 60056 Environmental Health					MANAGEMENT PLANNER	11/19/2022
					PROJECT MANAGER	10/20/2022
					AIR SAMPLING PROFESSIONAL	
					Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Todd Huffer

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2021

Exam Date: 11/19/2021

Expiration Date: 11/19/2022

Certificate Number: MPR2111192815


Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Todd Huffer

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/11/2022

Exam Date: 10/11/2022

Expiration Date: 10/11/2023

Certificate Number: BIR2210113255


Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that
Todd Huffer

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/11/2022

Exam Date: 10/11/2022

Expiration Date: 10/11/2023

Certificate Number: MPR2210113265


Kathy DeSalvo, Director

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed