

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2350  
SCHOOL NAME: Chicago Technology Academy High School (Medill ES)  
ADDRESS OF SCHOOL: 1301 W. 14th  
CITY: Chicago, IL, 60608

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 5/21/2019

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 9/21/2022 ENROLLMENT 364  
IDPH INSPECTOR LICENSE NUMBER: 100-05020  
IDPH LICENSED INSPECTOR NAME (Please Print): Devon Jackson  
IDPH MP LICENSE NUMBER: 100-19466  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian  
  
DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

9/30/2022

Richard J. Schleyer

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Chicago Technology Academy High School (Medill ES)**

1301 W. 14th  
Chicago, IL, 60608

Unit: 63091  
Building ID: 4810

IDPH ID Number: 14-016-2990-2350

**REPORT DATE:**

Friday, September 30, 2022

**Prepared for:**

**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

09/30/2022

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 24481                      Region: 03                      IDPH ID: 14-016-2990-2350

School: Chicago Technology Academy High School (Medill ES)                      Building ID: 4810

Address: 1301 W. 14th

Chicago, IL, 60608

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 9/21/2022

Review Date: 09/30/2022

Inspector: Devon Jackson

Inspector IDPH License: 100-05020

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Evan Christian  
100-19466

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: September 30, 2022

RE: Chicago Technology Academy High School (Medill ES), Unit 63091  
1301 W. 14th  
Chicago, IL, 60608

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Chicago Technology Academy High School (Medill ES) , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Chicago Technology Academy High School (Medill ES), there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Chicago Technology Academy High School (Medill ES) Unit: 24481 Region: 03  
Address: 1301 W. 14th Chicago, IL, 60608  
IDPH ID: 14-016-2990-2350 Building ID: 4810  
Contact: Phone:

### 2. Description of Facility

Original Construction: Additional Construction:  
Total Square Footage: No of Floors:  
Current Occupancy: 364

### 3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Doug McCormick  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Devon Jackson


Inspector IDPH license # 100-05020  
Reinspection Date: 9/21/2022

Signature:   
Date: 9/21/2022

### 6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:   
Date: 09/30/2022

### 7. Review Date: 09/30/2022

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 9/30/2022

Name: Richard J.Schleyer



## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Chicago Technology Academy High School (Medill ES). This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4810:

31	12" x 12" White Floor Tile w/Specks & Streaks Mastic
34	12" x 12" Tan Floor Tile w/White and Brown Streaks
38	12" x 12" White Floor Tile w/Gray Specks
80	2' x 4' ceiling tile
81	Elbows on Runs
82	Wall board glue pucks
E	Aircell pipe insulation
F	Hard Joint Compound on Aircell Pipe Insulation



B. The following new homogenous areas have been identified for Building 4810:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

30	12" x 12" White Floor Tile w/Specks & Streaks
31	12" x 12" White Floor Tile w/Specks & Streaks Mastic
32	12" x 12" Beige Floor Tile w/White & Brown Streaks
34	12" x 12" Tan Floor Tile w/White and Brown Streaks
36	12" x 12" Brown Floor Tile w/Multi-Colored Specks
38	12" x 12" White Floor Tile w/Gray Specks
42	12" x 12" Tan Floor Tile w/Brown & White Specks
55	Carpet mastic
56	12" x 12" Beige w/Streaks Mottled Floor Tile
57	12" x 12" Beige w/Streaks Mottled Floor Tile Mastic
58	12" x 12"Off-White w/Mauve & Blue Streaks Floor Tile
59	12" x 12"Off-White w/Mauve & Blue Streaks Floor Tile Mastic
60	12" x 12" Beige w/Dark Beige Streaks Floor Tile
61	12" x 12" Brownish Gray w/Streaks Floor Tile
62	Mastic for HA 60 & 61 (Checkboard pattern)
63	12" x 12" White Floor Tile Patch
64	12" x 12" White Floor Tile Patch Mastic
65	9" x 9" Gray w/ White Specks
66	9" x 9" Gray w/ White Specks Mastic
67	Dark gray carpet mastic
68	Blue w/ Blue Specks
69	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile
70	Blue w/ Blue Specks Mastic
71	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile
72	Green grout floor (ceramic)
73	Beige floor grout (ceramic)
74	Brown floor grout (ceramic)
75	9" x 9" Salmon Floor Tile
76	9" x 9" Salmon Floor Tile Mastic
77	Ceramic floor tile
78	Yellow linoleum
79	Yellow linoleum mastic
80	2' x 4' ceiling tile
81	Elbows on Runs

82	Wall board glue pucks
D	Hard joint cmpd. On cardboard pipe insulation
K	Duct jacket

The following areas were deemed to be inaccessible:

11	9" x 9" Olive Floor Tile w/Dark Specks Mastic
13	9" x 9" Beige Floor Tile Mastic
15	9" x 9" Light Brown Floor Tile w/Specks Mastic
17	9" x 9" Olive Floor Tile w/White Specks Mastic
19	9" x 9" Brown Floor Tile Patch w/Multi-Colored Streaks Mastic
23	9" x 9" Cream Floor Tile Mastic Patch
25	9"x 9" tan floor tile mastic patch
31	12" x 12" White Floor Tile w/Specks & Streaks Mastic
33	12" x12" Beige Floor Tile w/ White & Brown Streaks Mastic
39	12" x 12" White Floor Tile w/Gray Specks Mastic
41	12" x 12" Dark Gray Floor Tile w/Brown Specks Mastic
43	12" x 12" Tan Floor Tile w/Brown & White Specks Mastic
57	12" x 12" Beige w/Streaks Mottled Floor Tile Mastic
59	12" x 12"Off-White w/Mauve & Blue Streaks Floor Tile Mastic
62	Mastic for HA 60 & 61 (Checkboard pattern)
64	12" x 12" White Floor Tile Patch Mastic
66	9" x 9" Gray w/ White Specks Mastic
67	Dark gray carpet mastic
70	Blue w/ Blue Specks Mastic
71	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile
76	9" x 9" Salmon Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Devon Jackson, IDPH License # 100-05020. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Chicago Technology Academy High School (Medill ES) Building 4810 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810  
 Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	1' x 1' Ceiling Tile w/Large Holes			Throughout Facility	NO_ACBM	MISC								
10	9" x 9" Olive Floor Tile w/Dark Specks	9,100	SF	Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall	CHR	MISC	N	LOC	19	SF	No	Damaged or significantly damaged friable misc. ACBM	5	LOW
11	9" x 9" Olive Floor Tile w/Dark Specks Mastic	9,100	SF	Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
12	9" x 9" Beige Floor Tile	350	SF	Office, Rooms 117, 121, 201, 202, 211, 213, 214, 215, 219	CHR	MISC	N	LOC	2	SF	No	Damaged or significantly damaged friable misc. ACBM	5	LOW
13	9" x 9" Beige Floor Tile Mastic	350	SF	Office, Rooms 117, 121, 201, 202, 211, 213, 214, 215, 219	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
14	9" x 9" Light Brown Floor Tile w/Specks	15,000	SF	117, 211, 213, 215, 217, 219, 221, Office	CHR	MISC	N	LOC	20	SF	No	Damaged or significantly damaged friable misc. ACBM	5	LOW
15	9" x 9" Light Brown Floor Tile w/Specks Mastic	15,000	SF	Rooms 117, 211, 213, 215, 217, 219, 221, Office	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
16	9" x 9" Olive Floor Tile w/White Specks	6,850	SF	Office, Rooms 201, 202, 203, 205, 207, 209, Storage	CHR	MISC	N	LOC	6	SF	No	Damaged or significantly damaged friable misc. ACBM	5	LOW
17	9" x 9" Olive Floor Tile w/White Specks Mastic	6,850	SF	Office, Rooms 201, 202, 203, 205, 207, 209, Storage	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
18	9" x 9" Brown Floor Tile patch w/Multi-Colored Streaks	200	SF	Rooms 115, 121, 203, 205, 207, 209, 213, 214	CHR	MISC	N	LOC	6	SF	No	Damaged or significantly damaged friable misc. ACBM	5	LOW
19	9" x 9" Brown Floor Tile Patch w/Multi-Colored Streaks Mastic	200	SF	2nd floor Corridor, Rooms 115, 121, 203, 205, 207, 209, 213, 214	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
2	2.5' x 8' Ceiling Tile			Gym	NO_ACBM	MISC								
20	9" x 9" Brown Floor Tile w/Orange Specks-Removed			Patches Throughout Second Floor Corridor	ABATED	MISC								
21	9" x 9" Brown Floor Tile w/ Orange Specks Mastic- Removed			Patches Throughout Second Floor Corridor	ABATED	MISC								
22	9" x 9" Cream Floor Tile Patch	200	SF	205, 207	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
23	9" x 9" Cream Floor Tile Mastic Patch	210	SF	205, 207	CHR	MISC	N	NONE	0	SF	No	ACBM with the		LOW

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810  
 Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
24	9" x 9" Tan Floor Tile Patch	20	SF	206	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
25	9"x 9" tan floor tile mastic patch	20	SF	Patches in 206	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
26	9" x 9" Aqua Floor Tile - REMOVED				ABATED	MISC								
27	9" x 9" Aqua Floor Tile Mastic - REMOVED				ABATED	MISC								
28	9" x 9" Gray Floor Tile w/Streaks - REMOVED				ABATED	MISC								
29	9" x 9" Gray Floor Tile w/ Streaks Mastic-Removed				ABATED	MISC								
3	Hard ceiling plaster			Throughout Facility	NO_ACBM	SURFACE								
30	12" x 12" White Floor Tile w/Specs & Streaks	220	SF	Various Locations Throughout First Floor	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
31	12" x 12" White Floor Tile w/Specs & Streaks Mastic	200	SF	Various Locations Throughout First Floor	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
32	12" x 12" Beige Floor Tile w/White & Brown Streaks	450	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
33	12" x 12" Beige Floor Tile w/ White & Brown Streaks Mastic	450	SF	Throughout Facility	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
34	12" x 12" Tan Floor Tile w/White and Brown Streaks	1,679	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
35	12" x 12" Tan Floor Tile w/White and Brown Streaks Mastic	1,679	SF	Throughout Facility, Main Office, Room 109, Lunch Room, 111, 2nd floor hallway	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
36	12" x 12" Brown Floor Tile w/Multi-Colored Specs	100	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
37	12" x 12" Brown Floor Tile w/Multi-Colored Spks Mastic			Kitchen Storage Room on platfoRoom	CHR	MISC								
38	12" x 12" White Floor Tile w/Gray Specs	2,500	SF	Gym	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
39	12" x 12" White Floor Tile w/Gray Specs Mastic	4,000	SF	Gym	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
40	12" x 12" Dark Gray Floor Tile w/Brown Specs	100	SF	Room 214	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
41	12" x 12" Dark Gray Floor Tile w/Brown Specs Mastic	100	SF	Room 214	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
42	12" x 12" Tan Floor Tile w/Brown & White	20	SF	As Patches in 2nd	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the		LOW

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810  
 Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Specks			Floor Corridor								potential for damage		
43	12" x 12" Tan Floor Tile w/Brown & White Specks Mastic	20	SF	As Patches in 1st Floor Corridor	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
44	1' x 1' Ceiling Tile With Small Holes Glue			Throughout Facility	NO_ACBM	MISC								
45	Vibration isolator cloth			Gym	NO_ACBM	MISC								
46	Interior window glaze			Throughout Facility	NO_ACBM	MISC								
47	Roof field - Non-AHERA			Roof	NO_ACBM	MISC								
48	Roof flashing - Non-AHERA			Roof	CHR	MISC								
49	Parapet wall light color caulk - Non-AHERA			Roof Parapet Wall	NO_ACBM	MISC								
50	Parapet wall dark color caulk - Non-AHERA			Roof Parapet Wall	CHR	MISC								
51	Exterior brick - Non-AHERA			Exterior	NO_ACBM	MISC								
52	Exterior brick mortar - Non-AHERA			Exterior	NO_ACBM	MISC								
53	Exterior window glaze - Non-AHERA			Exterior	NO_ACBM	MISC								
54	Exterior window caulk - Non-AHERA			Exterior	CHR	MISC								
55	Carpet mastic			Room 212	ASSUMED	MISC								
56	12" x 12" Beige w/Streaks Mottled Floor Tile	8,000	SF	2nd Floor Corridor, Principal's Office, Room 214 and 1A	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
57	12" x 12" Beige w/Streaks Mottled Floor Tile Mastic	8,000	SF	2nd Floor Corridor, Principal's Office, Room 214 and 1A	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
58	12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile	820	SF	Patches in Main Office, Library	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
59	12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile Mastic	820	SF	Patches in Main Office, Library	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
60	1' x 1' Ceiling Tile w/Small Holes			Throughout Facility	NO_ACBM	MISC								
60	12" x 12" Beige w/Dark Beige Streaks Floor Tile	5,000	SF	Rooms 107, 105, 102 & 101 (Checkboard pattern)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
61	12" x 12" Brownish Gray w/Streaks Floor Tile	5,000	SF	Rooms 107, 105, 102 & 101 (Checkboard pattern)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
62	Mastic for HA 60 & 61 (Checkboard pattern)	10,000	SF	Rooms 107, 105, 102 & 101	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
63	12" x 12" White Floor Tile Patch	10	SF	Room 109	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
64	12" x 12" White Floor Tile Patch Mastic	10	SF	Room 109	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
65	9" x 9" Gray w/ White Specks	72	SF	Room 104C in	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the		LOW



# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810  
 Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Boiler Room								potential for damage		
66	9" x 9" Gray w/ White Specks Mastic	72	SF	Room 104 C in Boiler Room	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
67	Dark gray carpet mastic	264	SF	Room 109	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
68	Blue w/ Blue Specks			Room 113, 115	ASSUMED	MISC								
69	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile	1,440	SF	Lunch Room, 109	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
70	Blue w/ Blue Specks Mastic	1,200	SF	Room 113, 115	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
71	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile	1,440	SF	Lunch Room, Room 109	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
72	Green grout floor (ceramic)	700	SF	1st Floor Men's Bathroom, Unisex Toilet	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
73	Beige floor grout (ceramic)	500	SF	1st Floor Women's Bathroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
74	Brown floor grout (ceramic)	1,000	SF	2nd Floor Girls/Boys Bathroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
75	9" x 9" Salmon Floor Tile	10	SF	Room 219	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
76	9" x 9" Salmon Floor Tile Mastic	10	SF	Room 219	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
77	Ceramic floor tile	3,000	SF	1st/2nd Floor Stair Wells & Landings	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
78	Yellow linoleum	3,000	SF	Rooms 101, 102	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
79	Yellow linoleum mastic	3,000	SF	Rooms 101, 102	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8	1' x 1' Ceiling Tile w/Large Holes Adhesive			Throughout Facility	NO_ACBM	MISC								
80	2' x 4' ceiling tile	3,000	SF	Rooms 101, 102	ASSUMED	MISC	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
81	Elbows on Runs	6	SF	Gym	ASSUMED	TSI	Y	LOC	2	SF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM	1	MODERATE
82	Wall board glue pucks	150	SF	All Classrooms	ASSUMED	MISC	N	LOC	2	SF	Yes	ACBM with the potential for damage	5	LOW
C	Cardboard Insulation on Piping			Boiler Room	CHR	TSI								
D	Hard joint compd. On cardboard pipe insulation			Boiler Room	ASSUMED	TSI								
E	Aircell pipe insulation	258	LF	Gym Storage, Boiler	CHR	TSI	Y	NONE	0	LF	Yes	Any remaining friable		LOW

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810  
 Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Room, Unexcavated Area, Above Corridor Ceilings, Teacher Storage Room 110B								ACBM or friable suspect ACBM		
F	Hard Joint Compound on Aircell Pipe Insulation	50	SF	Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings	CHR	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
G	Mag Block Insulation on Domestic Water Tank			Boiler Room	UNDEFINED									
H	Water main line insulation			Boiler Room	NO_ACBM	MISC								
J	Mag block insulation	10	LF	Boiler Room, Gym Storage	CHR	TSI	Y	NONE	0	LF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
K	Duct jacket	320	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810  
Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>9/21/2022</b>
Inspector Name <b>Devon Jackson</b>
<b>100-05020</b> <b>5/15/2023</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
1	
10	Not observed in Room 119. Damage found in 106,107,112
11	Not observed in Room 119
12	Damage found in Room 201
13	
14	Damage found in Room 117,214,217,219
15	
16	Damage found in Room 202,203
17	
18	Damage found in Room 203,214
19	
2	
20	Abated
21	Abated
22	
23	
24	
25	
26	Abated
27	Abated
28	Abated
29	Abated
3	
30	

# Chicago Public Schools

**School** Chicago Technology Academy High School (Medill ES) **Unit** 24481 **Building ID** 4810  
**Address** 1301 W. 14th **Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
31	
32	
33	
34	
35	
36	
37	Not observed 2022
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	Not observed 2022
56	
57	
58	
59	

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES) Unit 24481 Building ID 4810

Address 1301 W. 14th Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
6	
60	
61	
62	
63	
64	
65	
66	
67	
68	Not observed 2022
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
8	
80	
81	Damage located in Gym
82	Damage found in 205
C	Not observed 2022
D	Not observed 2022
E	
F	

# Chicago Public Schools

**School** Chicago Technology Academy High School (Medill ES) **Unit** 24481 **Building ID** 4810

**Address** 1301 W. 14th **Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
G	Not observed 2022
H	
J	
K	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES)

Unit 24481

Building ID 4810

Address 1301 W. 14th

Chicago, IL, 60608

Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	1' x 1' Ceiling Tile w/Large Holes			Throughout Facility	No ACBM	MISC					
10	9" x 9" Olive Floor Tile w/Dark Specks	9,100	SF	Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall	Chrysotile	MISC	No	19	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
11	9" x 9" Olive Floor Tile w/Dark Specks Mastic	9,100	SF	Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	9" x 9" Beige Floor Tile	350	SF	Office, Rooms 117, 121, 201, 202, 211, 213, 214, 215, 219	Chrysotile	MISC	No	2	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
13	9" x 9" Beige Floor Tile Mastic	350	SF	Office, Rooms 117, 121, 201, 202, 211, 213, 214, 215, 219	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	9" x 9" Light Brown Floor Tile w/Specks	15,000	SF	117, 211, 213, 215, 217, 219, 221, Office	Chrysotile	MISC	No	20	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
15	9" x 9" Light Brown Floor Tile w/Specks Mastic	15,000	SF	Rooms 117, 211, 213, 215, 217, 219, 221, Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9" x 9" Olive Floor Tile w/White Specks	6,850	SF	Office, Rooms 201, 202, 203, 205, 207, 209, Storage	Chrysotile	MISC	No	6	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
17	9" x 9" Olive Floor Tile w/White Specks Mastic	6,850	SF	Office, Rooms 201, 202, 203, 205, 207, 209, Storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	9" x 9" Brown Floor Tile patch w/Multi-Colored Streaks	200	SF	Rooms 115, 121, 203, 205, 207, 209, 213, 214	Chrysotile	MISC	No	6	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
19	9" x 9" Brown Floor Tile Patch w/Multi-Colored Streaks Mastic	200	SF	2nd floor Corridor, Rooms 115, 121, 203, 205, 207, 209, 213, 214	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2	2.5' x 8' Ceiling Tile			Gym	No ACBM	MISC					
20	9" x 9" Brown Floor Tile w/Orange Specks-Removed			Patches Throughout Second Floor Corridor	Abated	MISC					
21	9" x 9" Brown Floor Tile w/ Orange Specks Mastic-Removed			Patches Throughout Second Floor Corridor	Abated	MISC					
22	9" x 9" Cream Floor Tile Patch	200	SF	205, 207	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	9" x 9" Cream Floor Tile Mastic Patch	210	SF	205, 207	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	9" x 9" Tan Floor Tile Patch	20	SF	206	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	9" x 9" tan floor tile mastic patch	20	SF	Patches in 206	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	9" x 9" Aqua Floor Tile - REMOVED				Abated	MISC					
27	9" x 9" Aqua Floor Tile Mastic - REMOVED				Abated	MISC					
28	9" x 9" Gray Floor Tile w/Streaks - REMOVED				Abated	MISC					



# Chicago Public Schools

School Chicago Technology  
Academy High School  
(Medill ES)  
Address 1301 W. 14th

Unit 24481  
Chicago, IL, 60608

Building ID 4810  
Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
29	9" x 9" Gray Floor Tile w/ Streaks Mastic- Removed				Abated	MISC					
3	Hard ceiling plaster			Throughout Facility	No ACBM	SURFACE					
30	12" x 12" White Floor Tile w/Specks & Streaks	220	SF	Various Locations Throughout First Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12" x 12" White Floor Tile w/Specks & Streaks Mastic	200	SF	Various Locations Throughout First Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12" x 12" Beige Floor Tile w/White & Brown Streaks	450	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12" x 12" Beige Floor Tile w/ White & Brown Streaks Mastic	450	SF	Throughout Facility	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Tan Floor Tile w/White and Brown Streaks	1,679	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" Tan Floor Tile w/White and Brown Streaks Mastic	1,679	SF	Throughout Facility, Main Office, Room 109, Lunch Room, 111, 2nd floor hallway	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" x 12" Brown Floor Tile w/Multi-Colored Specks	100	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12" x 12" Brown Floor Tile w/Multi-Colored Spks Mastic			Kitchen Storage Room on platfoRoom	Chrysotile	MISC					Follow O&M Plan
38	12" x 12" White Floor Tile w/Gray Specks	2,500	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12" x 12" White Floor Tile w/Gray Specks Mastic	4,000	SF	Gym	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12" x 12" Dark Gray Floor Tile w/Brown Specks	100	SF	Room 214	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12" x 12" Dark Gray Floor Tile w/Brown Specks Mastic	100	SF	Room 214	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12" x 12" Tan Floor Tile w/Brown & White Specks	20	SF	As Patches in 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12" x 12" Tan Floor Tile w/Brown & White Specks Mastic	20	SF	As Patches in 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	1' x 1' Ceiling Tile With Small Holes Glue			Throughout Facility	No ACBM	MISC					
45	Vibration isolator cloth			Gym	No ACBM	MISC					
46	Interior window glaze			Throughout Facility	No ACBM	MISC					
47	Roof field - Non-AHERA			Roof	No ACBM	MISC					
48	Roof flashing - Non-AHERA			Roof	Chrysotile	MISC					Follow O&M Plan
49	Parapet wall light color caulk - Non-AHERA			Roof Parapet Wall	No ACBM	MISC					
50	Parapet wall dark color caulk - Non-AHERA			Roof Parapet Wall	Chrysotile	MISC					Follow O&M Plan
51	Exterior brick - Non-AHERA			Exterior	No ACBM	MISC					

# Chicago Public Schools

School Chicago Technology Academy High School (Medill ES)

Unit 24481

Building ID 4810

Address 1301 W. 14th

Chicago, IL, 60608

Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
52	Exterior brick mortar - Non-AHERA			Exterior	No ACBM	MISC					
53	Exterior window glaze - Non-AHERA			Exterior	No ACBM	MISC					
54	Exterior window caulk - Non-AHERA			Exterior	Chrysotile	MISC					Follow O&M Plan
55	Carpet mastic			Room 212	Assumed	MISC					Follow O&M Plan
56	12" x 12" Beige w/Streaks Mottled Floor Tile	8,000	SF	2nd Floor Corridor, Principal's Office, Room 214 and 1A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	12" x 12" Beige w/Streaks Mottled Floor Tile Mastic	8,000	SF	2nd Floor Corridor, Principal's Office, Room 214 and 1A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile	820	SF	Patches in Main Office, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile Mastic	820	SF	Patches in Main Office, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
6	1' x 1' Ceiling Tile w/Small Holes			Throughout Facility	No ACBM	MISC					
60	12" x 12" Beige w/Dark Beige Streaks Floor Tile	5,000	SF	Rooms 107, 105, 102 & 101 (Checkboard pattern)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12" x 12" Brownish Gray w/Streaks Floor Tile	5,000	SF	Rooms 107, 105, 102 & 101 (Checkboard pattern)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	Mastic for HA 60 & 61 (Checkboard pattern)	10,000	SF	Rooms 107, 105, 102 & 101	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	12" x 12" White Floor Tile Patch	10	SF	Room 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	12" x 12" White Floor Tile Patch Mastic	10	SF	Room 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	9" x 9" Gray w/ White Specks	72	SF	Room 104C in Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	9" x 9" Gray w/ White Specks Mastic	72	SF	Room 104 C in Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Dark gray carpet mastic	264	SF	Room 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	Blue w/ Blue Specks			Room 113, 115	Assumed	MISC					Follow O&M Plan
69	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile	1,440	SF	Lunch Room, 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	Blue w/ Blue Specks Mastic	1,200	SF	Room 113, 115	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	12" x 12" Gray w/ White Green Burgundy Specks Floor Tile	1,440	SF	Lunch Room, Room 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	Green grout floor (ceramic)	700	SF	1st Floor Men's Bathroom, Unisex Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	Beige floor grout (ceramic)	500	SF	1st Floor Women's Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
74	Brown floor grout (ceramic)	1,000	SF	2nd Floor Girls/Boys Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Chicago Technology  
Academy High School  
(Medill ES)  
Address 1301 W. 14th

Unit 24481  
Chicago, IL, 60608

Building ID 4810  
Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
75	9" x 9" Salmon Floor Tile	10	SF	Room 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	9" x 9" Salmon Floor Tile Mastic	10	SF	Room 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	Ceramic floor tile	3,000	SF	1st/2nd Floor Stair Wells & Landings	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
78	Yellow linoleum	3,000	SF	Rooms 101, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	Yellow linoleum mastic	3,000	SF	Rooms 101, 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8	1' x 1' Ceiling Tile w/Large Holes Adhesive			Throughout Facility	No ACBM	MISC					
80	2' x 4' ceiling tile	3,000	SF	Rooms 101, 102	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
81	Elbows on Runs	6	SF	Gym	Assumed	TSI	Yes	2	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
82	Wall board glue pucks	150	SF	All Classrooms	Assumed	MISC	No	2	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Cardboard Insulation on Piping			Boiler Room	Chrysotile	TSI					Follow O&M Plan
D	Hard joint compd. On cardboard pipe insulation			Boiler Room	Assumed	TSI					Follow O&M Plan
E	Aircell pipe insulation	258	LF	Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings, Teacher Storage Room 110B	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Hard Joint Compound on Aircell Pipe Insulation	50	SF	Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
G	Mag Block Insulation on Domestic Water Tank			Boiler Room	Undefined						
H	Water main line insulation			Boiler Room	No ACBM	MISC					
J	Mag block insulation	10	LF	Boiler Room, Gym Storage	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
K	Duct jacket	320	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

# Chicago Public Schools

**School** Chicago Technology  
Academy High School  
(Medill ES)  
**Address** 1301 W. 14th

**Unit** 24481  
Chicago, IL, 60608

**Building ID** 4810  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

*Management Planner's Comments Summarized at the End of the Report*

Review Date	9/30/2022
Manager Planner Name	Evan Christian
100-19466	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
2	

# Chicago Public Schools

**School** Chicago Technology  
Academy High School  
(Medill ES)  
**Address** 1301 W. 14th

**Unit** 24481  
Chicago, IL, 60608

**Building ID** 4810  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
3	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	

# Chicago Public Schools

**School** Chicago Technology  
Academy High School  
(Medill ES)  
**Address** 1301 W. 14th

**Unit** 24481  
Chicago, IL, 60608

**Building ID** 4810  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
6	
60	
61	
62	
63	
64	
65	
66	
67	

# Chicago Public Schools

**School** Chicago Technology  
Academy High School  
(Medill ES)  
**Address** 1301 W. 14th

**Unit** 24481  
Chicago, IL, 60608

**Building ID** 4810  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
8	
80	
81	Repair Damaged TSI to intact or Remove.
82	
C	
D	
E	
F	
G	
H	
J	
K	

# Chicago Public Schools

**School** Chicago Technology  
Academy High School  
(Medill ES)

**Unit** 24481

**Building ID** 4810

**Address** 1301 W. 14th

Chicago, IL, 60608

**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

***Management Planner's Comments Summarized at the End of the Report***



# APPENDIX A

## Assessment Sheets, Drawings and Photos

---

# Chicago Public Schools

Carnow, Conibear and Associates

*2022 AHERA REINSPECTION*

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/Large Holes**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:  
DISTURBANCE POTENTIAL:  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/Large Holes**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/Dark Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **4 Damaged or significantly damaged friable misc. ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall**  
MATERIAL QUANTITY: **9100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **9100** DAMAGE UNITS: **SF**  
COMMENTS: **Not observed in Room 119. Damage found in 106,107,112**

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/Dark Specks**  
MATERIAL LOCATION: **Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall**  
MATERIAL QUANTITY: **9100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **19** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/Dark Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall**

MATERIAL QUANTITY: **9100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed in Room 119**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/Dark Specks Mastic**  
MATERIAL LOCATION: **Rooms 106, 112, 114, 118, 119, 203-207, 218, Rec Room & Hall**  
MATERIAL QUANTITY: **9100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **4 Damaged or significantly damaged friable misc. ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Office, Rooms 117, 121, 201, 202, 211. 213, 214, 215, 219**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **350** DAMAGE UNITS: **SF**  
COMMENTS: **Damage found in Room 201**

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile**  
MATERIAL LOCATION: **Office, Rooms 117, 121, 201, 202, 211, 213, 214, 215, 219**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Office, Rooms 117, 121, 201, 202, 211. 213, 214, 215, 219**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile Mastic**  
MATERIAL LOCATION: **Office, Rooms 117, 121, 201, 202, 211. 213, 214, 215, 219**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Specks**  
HISTORICAL AHERA DAMAGE CATEGORY: **4 Damaged or significantly damaged friable misc. ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **117, 211, 213, 215, 217, 219, 221, Office**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS: **Damage found in Room 117,214,217,219**

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Specks**  
MATERIAL LOCATION: **117, 211, 213, 215, 217, 219, 221, Office**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **20** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 117, 211, 213, 215, 217, 219, 221, Office**

MATERIAL QUANTITY: **15000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Specks Mastic**  
MATERIAL LOCATION: **Rooms 117, 211, 213, 215, 217, 219, 221, Office**  
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/White Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **4 Damaged or significantly damaged friable misc. ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Office, Rooms 201, 202, 203, 205, 207, 209, Storage**  
MATERIAL QUANTITY: **6850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **6850** DAMAGE UNITS: **SF**  
COMMENTS: **Damage found in Room 202,203**

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/White Specks**  
MATERIAL LOCATION: **Office, Rooms 201, 202, 203, 205, 207, 209, Storage**  
MATERIAL QUANTITY: **6850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/White Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Office, Rooms 201, 202, 203, 205, 207, 209, Storage**

MATERIAL QUANTITY: **6850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **9" x 9" Olive Floor Tile w/White Specks Mastic**  
MATERIAL LOCATION: **Office, Rooms 201, 202, 203, 205, 207, 209, Storage**  
MATERIAL QUANTITY: **6850** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile patch w/Multi-Colored Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **4 Damaged or significantly damaged friable misc. ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 115,121, 203, 205, 207, 209, 213, 214**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **200** DAMAGE UNITS: **SF**  
COMMENTS: **Damage found in Room 203,214**

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile patch w/Multi-Colored Streaks**  
MATERIAL LOCATION: **Rooms 115,121, 203, 205, 207, 209, 213, 214**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Patch w/Multi-Colored Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd floor Corridor, Rooms 115, 121, 203, 205, 207, 209, 213, 214**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Patch w/Multi-Colored Streaks Mastic**  
MATERIAL LOCATION: **2nd floor Corridor, Rooms 115, 121, 203, 205, 207, 209, 213, 214**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **2.5' x 8' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **2.5' x 8' Ceiling Tile**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/Orange Specks- Removed**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Patches Throughout Second Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Abated**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/Orange Specks- Removed**  
MATERIAL LOCATION: **Patches Throughout Second Floor Corridor**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/ Orange Specks Mastic- Removed**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Patches Throughout Second Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Abated**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/ Orange Specks Mastic- Removed**  
MATERIAL LOCATION: **Patches Throughout Second Floor Corridor**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **9" x 9" Cream Floor Tile Patch**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **205, 207**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **9" x 9" Cream Floor Tile Patch**  
MATERIAL LOCATION: **205, 207**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **9" x 9" Cream Floor Tile Mastic Patch**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **205, 207**  
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **9" x 9" Cream Floor Tile Mastic Patch**  
MATERIAL LOCATION: **205, 207**  
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile Patch**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **206**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile Patch**  
MATERIAL LOCATION: **206**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **9"x 9" tan floor tile mastic patch**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Patches in 206**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **9"x 9" tan floor tile mastic patch**  
MATERIAL LOCATION: **Patches in 206**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 24481 BUIDLING ID: 4810  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Devon Jackson  
SCHOOL NAME: Chicago Technology Academy High School (Medill ES) INSPECTION DATE: 9/21/2022  
ADDRESS: 1301 W. 14th IDPH LICENSE NO: 100-05020

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 26  
MATERIAL DESCRIPTION: 9" x 9" Aqua Floor Tile - REMOVED  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Abated

Inspector's Signature:



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile - REMOVED**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic - REMOVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Abated**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic - REMOVED**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile w/Streaks - REMOVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Abated**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile w/Streaks - REMOVED**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile w/ Streaks Mastic- Removed**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Abated**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile w/ Streaks Mastic- Removed**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**  
MATERIAL DESCRIPTION: **Hard ceiling plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **3**  
MATERIAL DESCRIPTION: **Hard ceiling plaster**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Specks & Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Various Locations Throughout First Floor**

MATERIAL QUANTITY: **220**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Specks & Streaks**  
MATERIAL LOCATION: **Various Locations Throughout First Floor**  
MATERIAL QUANTITY: **220** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Specks & Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Various Locations Throughout First Floor**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Specks & Streaks Mastic**  
MATERIAL LOCATION: **Various Locations Throughout First Floor**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/White & Brown Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/White & Brown Streaks**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12" x12" Beige Floor Tile w/ White & Brown Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12" x12" Beige Floor Tile w/ White & Brown Streaks Mastic**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/White and Brown Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **1679**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/White and Brown Streaks**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **1679** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/White and Brown Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility, Main Office, Room 109, Lunch Room, 111, 2nd floor hallway**

MATERIAL QUANTITY: **1679** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/White and Brown Streaks Mastic**  
MATERIAL LOCATION: **Throughout Facility, Main Office, Room 109, Lunch Room, 111, 2nd floor hallway**  
MATERIAL QUANTITY: **1679** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/Multi-Colored Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/Multi-Colored Specks**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/Multi-Colored Spks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen Storage Room on platfoRoom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/Multi-Colored Spks Mastic**

MATERIAL LOCATION: **Kitchen Storage Room on platfoRoom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks Mastic**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **12" x 12" Dark Gray Floor Tile w/Brown Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 214**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **12" x 12" Dark Gray Floor Tile w/Brown Specks**  
MATERIAL LOCATION: **Room 214**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **12" x 12" Dark Gray Floor Tile w/Brown Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 214**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **12" x 12" Dark Gray Floor Tile w/Brown Specks Mastic**  
MATERIAL LOCATION: **Room 214**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown & White Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **As Patches in 2nd Floor Corridor**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown & White Specks**  
MATERIAL LOCATION: **As Patches in 2nd Floor Corridor**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown & White Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **As Patches in 1st Floor Corridor**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown & White Specks Mastic**  
MATERIAL LOCATION: **As Patches in 1st Floor Corridor**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile With Small Holes Glue**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile With Small Holes Glue**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 24481 BUIDLING ID: 4810  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Devon Jackson  
SCHOOL NAME: Chicago Technology Academy High School (Medill ES) INSPECTION DATE: 9/21/2022  
ADDRESS: 1301 W. 14th IDPH LICENSE NO: 100-05020

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 45  
MATERIAL DESCRIPTION: Vibration isolator cloth  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: No ACBM FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Gym

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **Vibration isolator cloth**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Interior window glaze**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Interior window glaze**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Roof field - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Roof field - Non-AHERA**  
MATERIAL LOCATION: **Roof**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **Roof flashing - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Roof flashing - Non-AHERA**

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **Parapet wall light color caulk - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof Parapet Wall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **Parapet wall light color caulk - Non-AHERA**  
MATERIAL LOCATION: **Roof Parapet Wall**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Parapet wall dark color caulk - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof Parapet Wall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **Parapet wall dark color caulk - Non-AHERA**

MATERIAL LOCATION: **Roof Parapet Wall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Exterior brick - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Exterior brick - Non-AHERA**  
MATERIAL LOCATION: **Exterior**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Exterior brick mortar - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Exterior brick mortar - Non-AHERA**  
MATERIAL LOCATION: **Exterior**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Exterior window glaze - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Exterior window glaze - Non-AHERA**  
MATERIAL LOCATION: **Exterior**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Exterior window caulk - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **Exterior window caulk - Non-AHERA**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **Carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **Carpet mastic**

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Streaks Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Corridor, Principal's Office, Room 214 and 1A**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Streaks Mottled Floor Tile**  
MATERIAL LOCATION: **2nd Floor Corridor, Principal's Office, Room 214 and 1A**  
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Streaks Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Corridor, Principal's Office, Room 214 and 1A**

MATERIAL QUANTITY: **8000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Streaks Mottled Floor Tile Mastic**  
MATERIAL LOCATION: **2nd Floor Corridor, Principal's Office, Room 214 and 1A**  
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Patches in Main Office, Library**

MATERIAL QUANTITY: **820**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile**  
MATERIAL LOCATION: **Patches in Main Office, Library**  
MATERIAL QUANTITY: **820** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Patches in Main Office, Library**

MATERIAL QUANTITY: **820**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Mauve & Blue Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Patches in Main Office, Library**  
MATERIAL QUANTITY: **820** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/Small Holes**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **6**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/Small Holes**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Dark Beige Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 107, 105, 102 & 101 (Checkboard pattern)**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Dark Beige Streaks Floor Tile**  
MATERIAL LOCATION: **Rooms 107, 105, 102 & 101 (Checkboard pattern)**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12" x 12" Brownish Gray w/Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 107, 105, 102 & 101 (Checkboard pattern)**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12" x 12" Brownish Gray w/Streaks Floor Tile**  
MATERIAL LOCATION: **Rooms 107, 105, 102 & 101 (Checkboard pattern)**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **Mastic for HA 60 & 61 (Checkboard pattern)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 107, 105, 102 & 101**

MATERIAL QUANTITY: **10000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **Mastic for HA 60 & 61 (Checkboard pattern)**  
MATERIAL LOCATION: **Rooms 107, 105, 102 & 101**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Patch**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 109**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Patch**  
MATERIAL LOCATION: **Room 109**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Patch Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 109**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Patch Mastic**  
MATERIAL LOCATION: **Room 109**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **9" x 9" Gray w/ White Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 104C in Boiler Room**

MATERIAL QUANTITY: **72**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **9" x 9" Gray w/ White Specks**  
MATERIAL LOCATION: **Room 104C in Boiler Room**  
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**  
MATERIAL DESCRIPTION: **9" x 9" Gray w/ White Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 104 C in Boiler Room**

MATERIAL QUANTITY: **72**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **66**  
MATERIAL DESCRIPTION: **9" x 9" Gray w/ White Specks Mastic**  
MATERIAL LOCATION: **Room 104 C in Boiler Room**  
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **Dark gray carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 109**  
MATERIAL QUANTITY: **264** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **Dark gray carpet mastic**  
MATERIAL LOCATION: **Room 109**  
MATERIAL QUANTITY: **264** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**  
MATERIAL DESCRIPTION: **Blue w/ Blue Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 113, 115**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **Blue w/ Blue Specks**

MATERIAL LOCATION: **Room 113, 115**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**  
MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Green Burgundy Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunch Room, 109**

MATERIAL QUANTITY: **1440**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **69**  
MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Green Burgundy Specks Floor Tile**  
MATERIAL LOCATION: **Lunch Room, 109**  
MATERIAL QUANTITY: **1440** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**  
MATERIAL DESCRIPTION: **Blue w/ Blue Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 113, 115**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **70**  
MATERIAL DESCRIPTION: **Blue w/ Blue Specks Mastic**  
MATERIAL LOCATION: **Room 113, 115**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Green Burgundy Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunch Room, Room 109**

MATERIAL QUANTITY: **1440**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **12" x 12" Gray w/ White Green Burgundy Specks Floor Tile**  
MATERIAL LOCATION: **Lunch Room, Room 109**  
MATERIAL QUANTITY: **1440** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**  
MATERIAL DESCRIPTION: **Green grout floor (ceramic)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Men's Bathroom, Unisex Toilet**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **72**  
MATERIAL DESCRIPTION: **Green grout floor (ceramic)**  
MATERIAL LOCATION: **1st Floor Men's Bathroom, Unisex Toilet**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**  
MATERIAL DESCRIPTION: **Beige floor grout (ceramic)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Women's Bathroom**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **73**  
MATERIAL DESCRIPTION: **Beige floor grout (ceramic)**  
MATERIAL LOCATION: **1st Floor Women's Bathroom**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **74**  
MATERIAL DESCRIPTION: **Brown floor grout (ceramic)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Girls/Boys Bathroom**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **74**  
MATERIAL DESCRIPTION: **Brown floor grout (ceramic)**  
MATERIAL LOCATION: **2nd Floor Girls/Boys Bathroom**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**  
MATERIAL DESCRIPTION: **9" x 9" Salmon Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 219**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **75**  
MATERIAL DESCRIPTION: **9" x 9" Salmon Floor Tile**  
MATERIAL LOCATION: **Room 219**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**  
MATERIAL DESCRIPTION: **9" x 9" Salmon Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 219**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **76**  
MATERIAL DESCRIPTION: **9" x 9" Salmon Floor Tile Mastic**  
MATERIAL LOCATION: **Room 219**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**  
MATERIAL DESCRIPTION: **Ceramic floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st/2nd Floor Stair Wells & Landings**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **77**  
MATERIAL DESCRIPTION: **Ceramic floor tile**  
MATERIAL LOCATION: **1st/2nd Floor Stair Wells & Landings**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**  
MATERIAL DESCRIPTION: **Yellow linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 101, 102**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **78**  
MATERIAL DESCRIPTION: **Yellow linoleum**  
MATERIAL LOCATION: **Rooms 101, 102**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**  
MATERIAL DESCRIPTION: **Yellow linoleum mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101, 102**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **79**  
MATERIAL DESCRIPTION: **Yellow linoleum mastic**  
MATERIAL LOCATION: **Rooms 101, 102**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/Large Holes Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **8**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/Large Holes Adhesive**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**  
MATERIAL DESCRIPTION: **2' x 4' ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 101, 102**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **80**  
MATERIAL DESCRIPTION: **2' x 4' ceiling tile**  
MATERIAL LOCATION: **Rooms 101, 102**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 24481 BUIDLING ID: 4810  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Devon Jackson  
SCHOOL NAME: Chicago Technology Academy High School (Medill ES) INSPECTION DATE: 9/21/2022  
ADDRESS: 1301 W. 14th IDPH LICENSE NO: 100-05020

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 81  
MATERIAL DESCRIPTION: Elbows on Runs  
HISTORICAL AHERA DAMAGE CATEGORY: 1 Damaged or significantly damaged friable thermal system insulating ACBM  
HISTORICAL DAMAGE REASON: Air Erosion/Flow Deterioration  
HISTORICAL RESPONSE ACTION: Follow O&M Plan  
ASBESTOS TYPE: Assumed FRIABLE: Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Air Erosion/Flow Deterioration  
DISTURBANCE POTENTIAL: MODERATE  
MATERIAL LOCATION: Gym  
MATERIAL QUANTITY: 6 MATERIAL UNITS: SF  
DAMAGE QUANTITY: DAMAGE UNITS: SF  
COMMENTS: Damage located in Gym

Inspector's Signature:



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **81**  
MATERIAL DESCRIPTION: **Elbows on Runs**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Repair Damaged TSI to intact or Remove.

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **82**  
MATERIAL DESCRIPTION: **Wall board glue pucks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **All Classrooms**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **Damage found in 205**

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **82**  
MATERIAL DESCRIPTION: **Wall board glue pucks**  
MATERIAL LOCATION: **All Classrooms**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Cardboard Insulation on Piping**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Cardboard Insulation on Piping**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: 09/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Hard joint cmpd. On cardboard pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Hard joint cmpd. On cardboard pipe insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings, Teacher Storage Room 110B**

MATERIAL QUANTITY: **258** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
MATERIAL LOCATION: **Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings, Teacher Storage Room 110B**  
MATERIAL QUANTITY: **258** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Aircell Pipe Insulation**  
MATERIAL LOCATION: **Gym Storage, Boiler Room, Unexcavated Area, Above Corridor Ceilings**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Mag Block Insulation on Domestic Water Tank**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Undefined** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Mag Block Insulation on Domestic Water Tank**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 09/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Water main line insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 09/21/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Water main line insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:  Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Mag block insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room, Gym Storage**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Mag block insulation**  
MATERIAL LOCATION: **Boiler Room, Gym Storage**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUIDLING ID: **4810**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Devon Jackson**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** INSPECTION DATE: **9/21/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Duct jacket**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/21/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24481** BUILDING ID: **4810**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Technology Academy High School (Medill ES)** REVIEW DATE: **9/30/2022**  
ADDRESS: **1301 W. 14th** IDPH LICENSE NO: **100-05020**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Duct jacket**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/30/2022**

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2022 AHERA REINSPECTION***

# APPENDIX B


## Inspector and Management Planner Licenses

---



7233 S. Adams Street | Willowbrook, IL 60527  
(630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2022

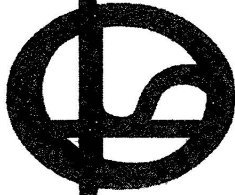

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Initial

Occupational Training & Supply, Inc. certifies that

**Devon Jackson**

has successfully completed the Asbestos Building Inspector Initial course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/1/2022 - 3/3/2022

Exam Date: 3/3/2022




Expiration Date: 3/3/2023

Certificate Number: ABI2203030658

Kathy DeSalvo, Director

# Devon Jackson

Illinois Licensed Building Inspector, Air Sampling Professional

 <b>IDPH</b> ILLINOIS DEPARTMENT OF PUBLIC HEALTH PROTECTING HEALTH. IMPROVING LIVES.	<b>ASBESTOS PROFESSIONAL LICENSE</b>	
ID NUMBER 100 - 05020	ISSUED 5/13/2022	EXPIRES 05/15/2023
<b>DEVON A JACKSON</b> 10657 SOUTH AVENUE D CHICAGO, IL 60617 Environmental Health		

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/3/2023
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	11/18/2022

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012581

Kathy DeSalvo, Director



# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: MPR2211033519

  
Kathy DeSalvo, Director



# ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

**100 - 19466**

ISSUED

**4/22/2022**

EXPIRES

**05/15/2023**

**EVAN I CHRISTIAN**  
**1119 N HOYNE AVE, APT 1**  
**CHICAGO, IL 60622**

Environmental Health



## ENDORSEMENTS

## TC EXPIRES

INSPECTOR

10/8/2022

MANAGEMENT PLANNER

11/1/2022

PROJECT MANAGER


3/28/2023

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**

This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

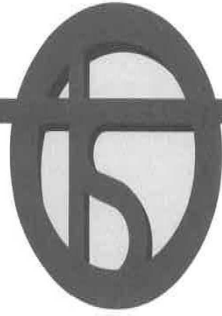

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082264

Kathy DeSalvo, Director



# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113639

Kathy DeSalvo, Director -

# APPENDIX C

## Laboratory Accreditations

---



# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed