

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 150162990253794  
SCHOOL NAME: Pathways Brighton  
ADDRESS OF SCHOOL: 3124 47  
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **7/18/2019**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 11/7/2022 ENROLLMENT 396  
IDPH INSPECTOR LICENSE NUMBER: 100-07278  
IDPH LICENSED INSPECTOR NAME (Please Print): Kenneth Karuhn  
IDPH MP LICENSE NUMBER: 100-19466  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian  
  
DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

*Richard J. Schleyer*

11/17/2022

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: N

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Pathways Brighton**

3124 47  
Chicago, IL, 60632

Unit: 66801  
Building ID: 59894

IDPH ID Number: 150162990253794

**REPORT DATE:**

Thursday, November 17, 2022

**Prepared for:**

**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

11/17/2022

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 66801                      Region:                      IDPH ID: 150162990253794

School: Pathways Brighton                      Building ID: 59894

Address: 3124 47

Chicago, IL, 60632

Building Contact:                      Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 11/7/2022

Review Date: 11/17/2022

Inspector: Kenneth Karuhn

Inspector IDPH License: 100-07278

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Evan Christian  
100-19466

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: November 17, 2022

RE: Pathways Brighton, Unit 66801  
3124 47  
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Pathways Brighton , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Pathways Brighton, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Pathways Brighton  
Address: 3124 47  
IDPH ID: 150162990253794  
Contact:

Unit: 66801  
Chicago, IL, 60632  
Building ID: 59894  
Phone:

Region:

### 2. Description of Facility

Original Construction:  
Total Square Footage:  
Current Occupancy: 396

Additional Construction:  
No of Floors:

### 3. LEA Designated Person

Contact: Richard J.Schleyer  
Address: 42 West Madison Street  
Chicago, IL 60602

Phone: (773) 251-7074

### 4. Managing Environmental Consultant


MEC: Carnow, Conibear and Associates  
Contact: Doug McCormick  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900

Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Kenneth Karuhn


Inspector IDPH license # 100-07278  
Reinspection Date: 11/7/2022

Signature:   
Date: 11/7/2022

### 6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466


Signature:   
Date: 11/17/2022

### 7. Review Date: 11/17/2022

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

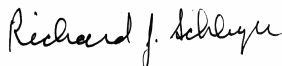

Date: 11/17/2022

Name: Richard J.Schleyer

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Pathways Brighton. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 59894:

1	Plaster
15A	4" Black vinyl baseboards
26	2' x 2' Ceiling Panels
2B	9" x 9" Tan Floor Tile w/Brown and White
2C	9" x 9" Brown Floor Tile w/White and Red
2H	9" x 9" Green Floor Tile w/White Streaks
2J	9" x 9" Aqua Floor Tile w/Black and White Specks
2K	9" x 9" Yellow Floor Tile w/White Streaks
3	Gray Carpet Mastic

32	Interior brick
39	Blue/green/gray/white ceramic tile grout
3D	12" x 12" White Floor Tile
42	Black border tile
47	Boiler wrap #1
48	Boiler wrap #2
49	Insulation over fiberglass
5	4" Gary Vinyl Baseboard Mastic
51	Duct insulation
52	Refractory Cement in Doors of #1 Boiler
53	Refractory Cement in Doors of #2 Boiler
54	Firebrick in Boiler #1
55	Firebrick in Boiler #2
5A	12" x 12" Multi-Gray Floor Tile
8	1' x 1' Ceiling Tile w/ Dots
86	12" x 12" Beige Floor Tile
87	Mastic Associated w/ 12" x 12" Beige Floor Tile
88	Vinyl Sheeting Glued on Plywood
89	2' x 4' Ceiling Tile
9	Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots
90	9" x 9" Brown w/ White streak Floor Tile
90A	9" x 9" Brown w/ White streak Floor Tile Mastic
91	9" x 9" Dark Brown Floor Tile patch



91A	9" x 9" Dark Brown w/ White streak Floor Tile Mastic
92	Brown carpet Mastic
93	12" x 12" gray Floor Tile w/ White Specks
93A	12" x 12" gray w/ White Floor Tile Mastic
94	12" x 12" Light Blue w/ White Floor Tile
94A	12" x 12" Light Blue w/ White Floor Tile Mastic
95	12" x 12" White Floor Tile w/ Beige streak
96	12" x 12" Brown Floor Tile
97	12" x 12" Light Blue w/ Dark Blue Specks Floor Tile
98	New building 12" x 12" White w/ gray and black Specks Floor Tile
B1	Cardboard pipe insulation

B. The following new homogenous areas have been identified for Building 59894:

11	Tan linoleum
13	Beige linoleum
15A	4" Black vinyl baseboards
15B	6" Black vinyl baseboard
16A	4" Black vinyl baseboard mastic
16B	6" Black vinyl baseboard mastic
19	Exterior brick - Non-AHERA
2 D	9" x 9" Beige Floor Tile
20	Exterior brick mortar
21	Exterior door caulk
22	Drywall
23	Black cementitious flooring
24	Green terrazzo
25	Brown terrazzo wall panels
26	2' x 2' Ceiling Panels
27	Terrazzo basin
28	Yellow baseboard
29	Yellow baseboard mastic
2A	9" x 9" Tan w/Yellow, Blue, and White Floor Tile
2B	9" x 9" Tan Floor Tile w/Brown and White
2C	9" x 9" Brown Floor Tile w/White and Red
2E	9" x 9" Black Floor Tile
2F	9" x 9" Maroon Floor Tile

2H	9" x 9" Green Floor Tile w/White Streaks
2I	9" x 9" Aqua Floor Tile w/White Streaks
2J	9" x 9" Aqua Floor Tile w/Black and White Specks
2K	9" x 9" Yellow Floor Tile w/White Streaks
2L	9" x 9" Gray Floor Tile w/White Streaks
2M	9" x 9" Light Brown Floor Tile w/White Swirls
30	Blue baseboard
31	Blue baseboard mastic
32	Interior brick
33	Interior brick mortar
34	Terrazzo baseboard
35	Ceramic tile grout
36	Glazed brick mortar
37	Interior door caulk
38	Block mortar
39	Blue/green/gray/white ceramic tile grout
3A	12" x 12" Beige Floor Tile w/Brown Streaks
3B	12" x 12" Beige Floor Tile w/Brown and White Specks
3C	12" x 12" Beige Floor Tile w/Brown and White Streaks
3D	12" x 12" White Floor Tile
40	Gray carpet mastic (brown)
41	Cinder block mortar
42	Black border tile
43	Black border tile mastic

44	2' x 4' Ceiling Panels
45	Terrazzo
46	12" x 12" Terrazzo
47	Boiler wrap #1
48	Boiler wrap #2
49	Insulation over fiberglass
50	Mag block insulation
51	Duct insulation
52	Refractory Cement in Doors of #1 Boiler
53	Refractory Cement in Doors of #2 Boiler
54	Firebrick in Boiler #1
55	Firebrick in Boiler #2
56	4" Black vinyl baseboard
57	4" Black vinyl baseboard mastic
5A	12" x 12" Multi-Gray Floor Tile
5B	12" x 12" Gray Floor Tile w/White Streaks
60	Green ceramic tile grout
61	Gray carpet mastic
65	Exterior door caulk
66	12" x 12" Multi-Gray Floor Tile Mastic
67	12" x 12" Gray Floor Tile w/White Streaks Mastic
68	Cementitious pipe joint insulation
70	Fiberglass insulation
71	Vault door liner
72	12" x 12" Tan w/ Light. Brown floor tile

- 73 Mastic w/ 12" x 12" tan w/ Light. Brown floor tile
- 74 12" x 12" Gray w/ Dark Gray & White Floor Tile
- 75 Mastic w/ 12" x 12" Gray w/ Dark Gray & White Floor Tile
- 76 Purple carpet adhesive
- 77 12" x 12" Tan Floor Tile
- 78 Mastic w/ 12" x 12" Tan Floor Tile
- 79 12" x 12" Light Gray w/ Dark Gray & White Floor Tile
- 80 Mastic w/ 12" x 12" Light Gray w/ Dark Gray & White Floor Tile
- 81 12" x 12" Light Blue w/ Dark Blue & White Floor Tile
- 82 Mastic w/ 12" x 12" Light Blue 2/ Dark Blue & White Floor Tile
- 83 Tan linoleum
- 84 Adhesive w/ Tan Linoleum
- 85 Brown carpet adhesive
- 86 12" x 12" Beige Floor Tile
- 87 Mastic Associated w/ 12" x 12" Beige Floor Tile
- 88 Vinyl Sheeting Glued on Plywood
- 89 2' x 4' Ceiling Tile
- 8A 9" x 9" Tan w/ Ye, Blue, and White Floor Tile Mastic
- 8B 9" x 9" Tan Floor Tile w/ Brown and White Mastic
- 8C 9" x 9" Brown Floor Tile w/ White and Red Mastic
- 8D 9" x 9" Beige Floor Tile Mastic
- 8E 9" x 9" Black Floor Tile Mastic

8F	9" x 9" Maroon Floor Tile Mastic
8G	9" x 9" Brown Floor Tile Mastic
8H	9" x 9" Green Floor Tile Mastic
8I	9" x 9" Aqua Floor Tile Mastic
8J	9" x 9" Aqua Floor Tile Mastic
8K	9" x 9" Yellow Floor Tile Mastic
8L	9" x 9" Gray Floor Tile Mastic
8M	9" x 9" Light Brown Floor Tile Mastic
90	9" x 9" Brown w/ White streak Floor Tile
90A	9" x 9" Brown w/ White streak Floor Tile Mastic
91	9" x 9" Dark Brown Floor Tile patch
91A	9" x 9" Dark Brown w/ White streak Floor Tile Mastic
92	Brown carpet Mastic
93	12" x 12" gray Floor Tile w/ White Specks
93A	12" x 12" gray w/ White Floor Tile Mastic
94	12" x 12" Light Blue w/ White Floor Tile
94A	12" x 12" Light Blue w/ White Floor Tile Mastic
95	12" x 12" White Floor Tile w/ Beige streak
95A	12" x 12" White w/ Beige Floor Tile Mastic
96	12" x 12" Brown Floor Tile
96A	12" x 12" Brown Floor Tile Mastic
97	12" x 12" Light Blue w/ Dark Blue Specks Floor Tile
97A	12" x 12" Light Blue w/ Dark Blue Floor Tile Mastic
98	New building 12" x 12" White w/ gray and black

Specks Floor Tile

98A	12" x 12" White w/ gray and black Specks Floor Tile Mastic
9A	12" x 12" Beige Floor Tile w/ Brown Streaks Mastic
9B	12" x 12" Beige Floor Tile w/ Brown & White Spks Mastic
9C	12" x 12" Beige Floor Tile w/ Brown & White Streaks Mastic
9D	12" x 12" White Floor Tile Mastic
A2	Cementitious Insulation on Joints off Fiberglass
B1	Cardboard pipe insulation
B2	Cementitious Insulation off Paper Wrap Pipe Runs
D1	Aircell pipe insulation

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	Plaster
11	Tan linoleum
13	Beige linoleum
15A	4" Black vinyl baseboards
15B	6" Black vinyl baseboard
16A	4" Black vinyl baseboard mastic
16B	6" Black vinyl baseboard mastic
19	Exterior brick - Non-AHERA
20	Exterior brick mortar
21	Exterior door caulk
22	Drywall
23	Black cementitious flooring
24	Green terrazzo
25	Brown terrazzo wall panels
26	2' x 2' Ceiling Panels
27	Terrazzo basin
28	Yellow baseboard
29	Yellow baseboard mastic
3	Gray Carpet Mastic
30	Blue baseboard
31	Blue baseboard mastic
32	Interior brick
33	Interior brick mortar
34	Terrazzo baseboard
35	Ceramic tile grout
36	Glazed brick mortar
37	Interior door caulk
38	Block mortar
39	Blue/green/gray/white ceramic tile grout
3A	12" x 12" Beige Floor Tile w/Brown Streaks
3C	12" x 12" Beige Floor Tile w/Brown and White Streaks
4	12" x 12" Ceiling Tile
40	Gray carpet mastic (brown)
41	Cinder block mortar
43	Black border tile mastic
44	2' x 4' Ceiling Panels
45	Terrazzo
46	12" x 12" Terrazzo
49	Insulation over fiberglass
5	4" Gary Vinyl Baseboard Mastic
51	Duct insulation



52	Refractory Cement in Doors of #1 Boiler
53	Refractory Cement in Doors of #2 Boiler
54	Firebrick in Boiler #1
55	Firebrick in Boiler #2
56	4" Black vinyl baseboard
57	4" Black vinyl baseboard mastic
5A	12" x 12" Multi-Gray Floor Tile
6	Brown linoleum
60	Green ceramic tile grout
61	Gray carpet mastic
65	Exterior door caulk
66	12" x 12" Multi-Gray Floor Tile Mastic
68	Cementitious pipe joint insulation
71	Vault door liner
72	12" x 12" Tan w/ Light. Brown floor tile
73	Mastic w/ 12" x 12" tan w/ Light. Brown floor tile
74	12" x 12" Gray w/ Dark Gray & White Floor Tile
75	Mastic w/ 12" x 12" Gray w/ Dark Gray & White Floor Tile
76	Purple carpet adhesive
77	12" x 12" Tan Floor Tile
78	Mastic w/ 12" x 12" Tan Floor Tile
79	12" x 12" Light Gray w/ Dark Gray & White Floor Tile
8	1' x 1' Ceiling Tile w/ Dots
80	Mastic w/ 12" x 12" Light Gray w/ Dark Gray & White Floor Tile
81	12" x 12" Light Blue w/ Dark Blue & White Floor Tile
82	Mastic w/ 12" x 12" Light Blue 2/ Dark Blue & White Floor Tile
83	Tan linoleum
84	Adhesive w/ Tan Linoleum
85	Brown carpet adhesive
86	12" x 12" Beige Floor Tile
87	Mastic Associated w/ 12" x 12" Beige Floor Tile
88	Vinyl Sheeting Glued on Plywood
89	2' x 4' Ceiling Tile
9	Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots
90	9" x 9" Brown w/ White streak Floor Tile
90A	9" x 9" Brown w/ White streak Floor Tile Mastic
91	9" x 9" Dark Brown Floor Tile patch
91A	9" x 9" Dark Brown w/ White streak Floor Tile Mastic
92	Brown carpet Mastic
93	12" x 12" gray Floor Tile w/ White Specks
93A	12" x 12" gray w/ White Floor Tile Mastic

94	12" x 12" Light Blue w/ White Floor Tile
94A	12" x 12" Light Blue w/ White Floor Tile Mastic
95	12" x 12" White Floor Tile w/ Beige streak
95A	12" x 12" White w/ Beige Floor Tile Mastic
96	12" x 12" Brown Floor Tile
96A	12" x 12" Brown Floor Tile Mastic
97	12" x 12" Light Blue w/ Dark Blue Specks Floor Tile
97A	12" x 12" Light Blue w/ Dark Blue Floor Tile Mastic
98	New building 12" x 12" White w/ gray and black Specks Floor Tile
98A	12" x 12" White w/ gray and black Specks Floor Tile Mastic
9A	12" x 12" Beige Floor Tile w/ Brown Streaks Mastic
9C	12" x 12" Beige Floor Tile w/ Brown & White Streaks Mastic
A2	Cementitious Insulation on Joints off Fiberglass
B2	Cementitious Insulation off Paper Wrap Pipe Runs

The following areas were deemed to be inaccessible:

16A	4" Black vinyl baseboard mastic
16B	6" Black vinyl baseboard mastic
29	Yellow baseboard mastic
3	Gray Carpet Mastic
31	Blue baseboard mastic
40	Gray carpet mastic (brown)
43	Black border tile mastic
5	4" Gary Vinyl Baseboard Mastic
61	Gray carpet mastic
66	12" x 12" Multi-Gray Floor Tile Mastic
67	12" x 12" Gray Floor Tile w/White Streaks Mastic
87	Mastic Associated w/ 12" x 12" Beige Floor Tile
8A	9" x 9" Tan w/Ye, Blue, and White Floor Tile Mastic
8B	9" x 9" Tan Floor Tile w/Brown and White Mastic
8C	9" x 9" Brown Floor Tile w/White and Red Mastic
8D	9" x 9" Beige Floor Tile Mastic
8E	9" x 9" Black Floor Tile Mastic
8F	9" x 9" Maroon Floor Tile Mastic
8G	9" x 9" Brown Floor Tile Mastic
8H	9" x 9" Green Floor Tile Mastic
8I	9" x 9" Aqua Floor Tile Mastic
8J	9" x 9" Aqua Floor Tile Mastic
8K	9" x 9" Yellow Floor Tile Mastic

- 9 Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots
- 9A 12" x 12" Beige Floor Tile w/ Brown Streaks Mastic
- 9B 12" x 12" Beige Floor Tile w/ Brown & White Spks Mastic
- 9C 12" x 12" Beige Floor Tile w/ Brown & White Streaks Mastic
- 9D 12" x 12" White Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Kenneth Karuhn, IDPH License # 100-07278. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Pathways Brighton Building 59894 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	Plaster	60,000	SF	Throughout 1909 Building	ASSUMED	SURFACE	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
10	Number skipped													
11	Tan linoleum		SF	Kitchen of 1909 Building	ASSUMED	MISC				SF				
13	Beige linoleum		SF	Lunchroom, 008, and 009 of 1909 Building	ASSUMED	MISC				SF				
15A	4" Black vinyl baseboards	1,800	LF	Classrooms in 1972 Annex	ASSUMED	MISC	N	LOC	10	LF	Yes	ACBM with the potential for damage	5	LOW
15B	6" Black vinyl baseboard	480	LF	Hallways of 1972 Annex	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
16A	4" Black vinyl baseboard mastic	1,800	LF	Classrooms of 1972 Annex	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
16B	6" Black vinyl baseboard mastic	480	LF	Hallways of 1972 Annex	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
19	Exterior brick - Non-AHERA			1909 Building	ASSUMED	MISC								
2	Drywall Joint Compound			Throughout Ground Floor	NO_ACBM	MISC								
2 D	9" x 9" Beige Floor Tile			104	CHR	MISC								
20	Exterior brick mortar	14,000	SF	1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
21	Exterior door caulk	120	LF	1909 Building	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
22	Drywall		SF	Teacher's Room, Lunchroom, 008, 009 of 1909 Building	ASSUMED	MISC				SF				
23	Black cementitious flooring	1,760	SF	First Floor Corridor and Stair Landings of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
24	Green terrazzo	40	SF	Women's Bathroom of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
25	Brown terrazzo wall panels	40	SF	Men's and Women's Bathrooms of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
26	2' x 2' Ceiling Panels	800	SF	Lunchroom of 1909 Building	ASSUMED	MISC	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
27	Terrazzo basin	20	SF	Kitchen and Sink Closet of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
28	Yellow baseboard	200	SF	Lunchroom of 1909	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the		LOW

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building								potential for damage		
29	Yellow baseboard mastic	200	SF	Lunchroom of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
2A	9" x 9" Tan w/Yellow, Blue, and White Floor Tile	800	SF	100 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
2B	9" x 9" Tan Floor Tile w/Brown and White	400	SF	100 and Room 208 of 1909 Building	CHR	MISC	N	LOC	20	SF	Yes	ACBM with potential for significant damage	5	LOW
2C	9" x 9" Brown Floor Tile w/White and Red	800	SF	208 and Faculty Bathroom of 1909 Building	CHR	MISC	N	LOC	2	SF	Yes	ACBM with the potential for damage	5	LOW
2E	9" x 9" Black Floor Tile	50	SF	Faculty Bathroom of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
2F	9" x 9" Maroon Floor Tile	20	SF	Faculty Bathroom of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
2H	9" x 9" Green Floor Tile w/White Streaks	400	SF	204 of 1909 Building	CHR	MISC	N	LOC	15	SF	Yes	ACBM with the potential for damage	5	LOW
2I	9" x 9" Aqua Floor Tile w/White Streaks	415	SF	Room 204 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
2J	9" x 9" Aqua Floor Tile w/Black and White Specks	40	SF	301 of 1909 Building	CHR	MISC	N	LOC	2	SF	Yes	ACBM with the potential for damage	3	LOW
2K	9" x 9" Yellow Floor Tile w/White Streaks	50	SF	301 of 1909 Building	CHR	MISC	N	LOC	2	SF	Yes	ACBM with the potential for damage	5	LOW
2L	9" x 9" Gray Floor Tile w/White Streaks			Gym of 1909 Building	CHR	MISC								
2M	9" x 9" Light Brown Floor Tile w/White Swirls			Gym of 1909 Building	CHR	MISC								
3	Gray Carpet Mastic	11,000	SF	Rms. 2, 3, 6, 7, 11-14, 20-27	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
30	Blue baseboard	108	SF	1st Room West of E Entrance of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
31	Blue baseboard mastic	100	SF	1st Room West of E Entrance of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
32	Interior brick	80,000	SF	Throughout 1909 Building	ASSUMED	MISC	N	LOC	4	SF	Yes	ACBM with potential for significant damage	5	LOW
33	Interior brick mortar	80,000	SF	Throughout 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
34	Terrazzo baseboard	300	SF	Throughout 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
35	Ceramic tile grout	70	SF	Throughout Entrances of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
36	Glazed brick mortar	400	SF	Throughout 1909	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the		LOW

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building								potential for damage		
37	Interior door caulk	200	LF	Throughout 1909 Building	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
38	Block mortar	10	SF	Auditorium	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
39	Blue/green/gray/white ceramic tile grout	500	SF	Throughout Boy's and Girl's Bathrooms of 1909 Building	ASSUMED	MISC	N	DIST	8	SF	Yes	ACBM with the potential for damage	5	LOW
3A	12" x 12" Beige Floor Tile w/Brown Streaks	700	SF	005 of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
3B	12" x 12" Beige Floor Tile w/Brown and White Specks	750	SF	101 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
3C	12" x 12" Beige Floor Tile w/Brown and White Streaks	750	SF	206 of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
3D	12" x 12" White Floor Tile	700	SF	301 of 1909 Building	CHR	MISC	N	LOC	10	SF	Yes	ACBM with the potential for damage	3	LOW
4	12" x 12" Ceiling Tile			Throughout Annex	ASSUMED	MISC								
40	Gray carpet mastic (brown)	500	SF	Office, 105, and 106 of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
41	Cinder block mortar	1,300	SF	Throughout 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
42	Black border tile	200	SF	204 of 1909 Building	CHR	MISC	N	NONE	0	SF	Yes	Damaged or significantly damaged friable misc. ACBM		LOW
43	Black border tile mastic	50	SF	204 of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
44	2' x 4' Ceiling Panels	200	SF	Kitchen of 1909 Building	ASSUMED	MISC	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
45	Terrazzo	150	SF	Bathroom in Room D of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
46	12" x 12" Terrazzo	150	SF	D Room of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
47	Boiler wrap #1	500	SF	Boiler Room of 1909 Building	CHR	MISC	Y	NONE	0	SF	Yes	Damaged or significantly damaged friable misc. ACBM		MODERATE
48	Boiler wrap #2	500	SF	Boiler Room of 1909 Building	CHR	MISC	Y	NONE	0	SF	Yes	Damaged or significantly damaged friable misc. ACBM		MODERATE
49	Insulation over fiberglass	140	LF	Maintenance Room of 1909 Building	ASSUMED	TSI	Y	NONE	0	LF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
5	4" Gary Vinyl Baseboard Mastic	1,500	LF	Throughout Ground	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the		LOW



# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Floor								potential for damage		
50	Mag block insulation	100	LF	Boiler Room of 1909 Building	CHR	TSI	Y	NONE	0	LF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
51	Duct insulation	300	SF	Boiler Room of 1909 Building	ASSUMED	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
52	Refractory Cement in Doors of #1 Boiler	20	SF	Boiler Room of 1909 Building	ASSUMED	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
53	Refractory Cement in Doors of #2 Boiler	20	SF	Boiler Room of 1909 Building	ASSUMED	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
54	Firebrick in Boiler #1	200	SF	Boiler Room of 1909 Building	ASSUMED	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
55	Firebrick in Boiler #2	200	SF	Boiler Room of 1909 Building	ASSUMED	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
56	4" Black vinyl baseboard			004 of 1909 Building	ASSUMED	MISC								
57	4" Black vinyl baseboard mastic			004 of 1909 Building	ASSUMED	MISC								
5A	12" x 12" Multi-Gray Floor Tile	1,900	SF	Hallways of 1972 Annex	ASSUMED	MISC	N	LOC	15	SF	Yes	ACBM with the potential for damage	5	LOW
5B	12" x 12" Gray Floor Tile w/White Streaks	600	SF	Book Room and Storage in 1972 Annex	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
6	Brown linoleum	400	SF	Basement Room D of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
60	Green ceramic tile grout	10	SF	Entrances of 1972 Annex	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
61	Gray carpet mastic	600	SF	Classrooms, Teacher's Lounge and Office of 1972 Annex	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
65	Exterior door caulk	84	LF	Throughout 1972 Annex	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
66	12" x 12" Multi-Gray Floor Tile Mastic	1,900	SF	Hallways of 1972 Annex	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
67	12" x 12" Gray Floor Tile w/White Streaks Mastic	600	SF	Book Room and Storage in 1972 Annex	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
68	Cementitious pipe joint insulation		LF	Electric Room	ASSUMED	TSI				LF				

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				(Behind Wall) in 1972 Annex										
7	Transite panels			Basement (Abated)	ABATED	MISC								
70	Fiberglass insulation			Electric Room of 1972 Annex	NOT_TESTED	TSI								
71	Vault door liner	15	SF	2nd Floor Landing N/E Stairwell	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
72	12" x 12" Tan w/ Light. Brown floor tile			Engineer's Office	ASSUMED	MISC								
73	Mastic w/ 12" x 12" tan w/ Light. Brown floor tile			Engineer's Office	ASSUMED	MISC								
74	12" x 12" Gray w/ Dark Gray & White Floor Tile	60	SF	Engineer's Bathroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
75	Mastic w/ 12" x 12" Gray w/ Dark Gray & White Floor Tile	60	SF	Engineer's Bathroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
76	Purple carpet adhesive			Principal's Office	ASSUMED	MISC								
77	12" x 12" Tan Floor Tile	400	SF	Principal's Office Room 104	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
78	Mastic w/ 12" x 12" Tan Floor Tile	400	SF	Principal's Office Room 104	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
79	12" x 12" Light Gray w/ Dark Gray & White Floor Tile	2,300	SF	Cafe	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8	1' x 1' Ceiling Tile w/ Dots	20	SF	Basement Corridor	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
80	Mastic w/ 12" x 12" Light Gray w/ Dark Gray & White Floor Tile	2,300	SF	Cafe	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
81	12" x 12" Light Blue w/ Dark Blue & White Floor Tile	100	SF	Cafe	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
82	Mastic w/ 12" x 12" Light Blue 2/ Dark Blue & White Floor Tile	100	SF	Cafe	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
83	Tan linoleum		SF	Basement Art Room	ASSUMED	MISC				SF				
84	Adhesive w/ Tan Linoleum		SF	Basement Art Room	ASSUMED	MISC				SF				
85	Brown carpet adhesive	3,000	SF	1972 Annex Classrooms	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
86	12" x 12" Beige Floor Tile	700	SF	Room 104	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
87	Mastic Associated w/ 12" x 12" Beige Floor Tile	700	SF	Room 104	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
88	Vinyl Sheeting Glued on Plywood	3,000	SF	Gym	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
89	2' x 4' Ceiling Tile	7,500	SF	N, S, E, W Corridor Entrances, Rooms 401-412	ASSUMED	MISC	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
8A	9" x 9" Tan w/ Ye, Blue, and White Floor	800	SF	Room 100 in 1909	CHR	MISC	N	NONE	0	SF	No	ACBM with the		LOW

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Tile Mastic			Building								potential for damage		
8B	9" x 9" Tan Floor Tile w/Brown and White Mastic	800	SF	Faculty Bathroom by Room 100 and Room 208 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8C	9" x 9" Brown Floor Tile w/White and Red Mastic	800	SF	Faculty Bathroom and Room 208 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8D	9" x 9" Beige Floor Tile Mastic	250	SF	Room 104 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8E	9" x 9" Black Floor Tile Mastic	50	SF	Faculty Bathroom of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8F	9" x 9" Maroon Floor Tile Mastic	20	SF	Faculty Bathroom of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8G	9" x 9" Brown Floor Tile Mastic	750	SF	Room 208 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8H	9" x 9" Green Floor Tile Mastic	400	SF	Room 204 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8I	9" x 9" Aqua Floor Tile Mastic	415	SF	Room 301 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8J	9" x 9" Aqua Floor Tile Mastic	40	SF	Room 301 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8K	9" x 9" Yellow Floor Tile Mastic	40	SF	Room 301 of 1909 Building	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
8L	9" x 9" Gray Floor Tile Mastic			Gym of 1909 Building	CHR	MISC								
8M	9" x 9" Light Brown Floor Tile Mastic			Gym of 1909 Building	CHR	MISC								
9	Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots	20	SF	Basement Corridor	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
90	9" x 9" Brown w/ White streak Floor Tile	20	SF	Room 301	ASSUMED	MISC	N	LOC	5	SF	Yes	ACBM with potential for significant damage	5	LOW
90A	9" x 9" Brown w/ White streak Floor Tile Mastic	20	SF	Room 301	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
91	9" x 9" Dark Brown Floor Tile patch	20	SF	Room 301	ASSUMED	MISC	N	LOC	5	SF	Yes	ACBM with the potential for damage	5	LOW
91A	9" x 9" Dark Brown w/ White streak Floor Tile Mastic	20	SF	Room 301	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
92	Brown carpet Mastic	1,000	SF	Room 105 and 106	ASSUMED	MISC	N	LOC	5	SF	Yes	ACBM with potential for significant damage	5	LOW
93	12" x 12" gray Floor Tile w/ White Specks	400	SF	Room 402 and 409	ASSUMED	MISC	N	LOC	5	SF	Yes	ACBM with the potential for damage	5	LOW
93A	12" x 12" gray w/ White Floor Tile Mastic	400	SF	Room 409 and 402	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
94	12" x 12" Light Blue w/ White Floor Tile	200	SF	Room 408	ASSUMED	MISC	N	LOC	2	SF	Yes	ACBM with the potential for damage	5	LOW
94A	12" x 12" Light Blue w/ White Floor Tile Mastic	200	SF	Room 408	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
95	12" x 12" White Floor Tile w/ Beige streak	1,000	SF	New building hallway by north entrance	ASSUMED	MISC	N	LOC	10	SF	Yes	ACBM with potential for significant damage	5	LOW
95A	12" x 12" White w/ Beige Floor Tile Mastic	1,000	SF	New building first floor hallway	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
96	12" x 12" Brown Floor Tile	10,000	SF	1st and 2nd floor hallway	ASSUMED	MISC	N	LOC	30	SF	Yes	ACBM with potential for significant damage	5	LOW
96A	12" x 12" Brown Floor Tile Mastic	10,000	SF	New building 1st and 2nd floor hallway	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
97	12" x 12" Light Blue w/ Dark Blue Specks Floor Tile	500	SF	Room 501, 502, and 505	ASSUMED	MISC	N	LOC	4	SF	Yes	ACBM with potential for significant damage	5	LOW
97A	12" x 12" Light Blue w/ Dark Blue Floor Tile Mastic	500	SF	Room 501, 502, and 505	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
98	New building 12" x 12" White w/ gray and black Specks Floor Tile	5,000	SF	New building halls and classrooms	ASSUMED	MISC	N	LOC	13	SF	Yes	ACBM with the potential for damage	5	LOW
98A	12" x 12" White w/ gray and black Specks Floor Tile Mastic	4,000	SF	New building halls and classrooms	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
9A	12" x 12" Beige Floor Tile w/ Brown Streaks Mastic	750	SF	Room 005 of 1909 Building	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
9B	12" x 12" Beige Floor Tile w/ Brown & White Spks Mastic	750	SF	101	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
9C	12" x 12" Beige Floor Tile w/ Brown & White Streaks Mastic	700	SF	206	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
9D	12" x 12" White Floor Tile Mastic	700	SF	301	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
A2	Cementitious Insulation on Joints off Fiberglass	350	LF	Throughout 1909 Building	ASSUMED	TSI	Y	NONE	0	LF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
B1	Cardboard pipe insulation	1,300	LF	Throughout 1909 Building	CHR	TSI	Y	LOC	5	LF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
B2	Cementitious Insulation off Paper Wrap Pipe Runs	100	LF	Throughout 1909 Building	ASSUMED	TSI	Y	NONE	0	LF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
D1	Aircell pipe insulation	300	LF	Boiler Room	CHR	TSI	Y	NONE	0	LF	No	Any remaining friable ACBM or friable suspect ACBM		LOW

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>11/7/2022</b>
Inspector Name <b><u>Kenneth Karuhn</u></b>
<b>100-07278</b> <b>5/15/2023</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
1	
10	
11	Not observed 2022
13	Not observed 2022
15A	Damage in room 411 10 ft missing
15B	
16A	
16B	
19	
2	
2 D	Not observed 2022
20	
21	
22	Not observed 2022
23	
24	
25	
26	
27	
28	
29	
2A	
2B	Not observed in Room 200, Damage in Room 204 20ft cracked
2C	Damage in men's restroom between 2nd and 3rd floor. 2 ft cracked or missing

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
2E	
2F	
2H	Damage in Room 204 15 ft cracked
2I	
2J	Damage is located in Room 301
2K	Damage in Room 301 2 ft cracked
2L	Not observed 2022
2M	Not observed 2022
3	
30	
31	
32	Damage in 1st floor girls restroom 4 ft cracked/crumbling
33	
34	
35	
36	
37	
38	
39	Damage in 3rd floor boys bathroom 5 feet cracked. 1st floor boys bathroom 3 ft cracked
3A	
3B	
3C	
3D	Damage is located in Room 301
4	Not observed 2022
40	Not observed in Room 105 and 106
41	
42	
43	

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
44	
45	
46	
47	
48	
49	
5	
50	
51	
52	
53	
54	
55	
56	Not observed 2022
57	Not observed 2022
5A	Damage in hallway by 410 5 ft cracked. Hallway by east side 10 ft cracked
5B	
6	
60	
61	
65	
66	
67	
68	Not observed 2022 - may be behind wall
7	
70	Not observed 2022
71	
72	Not observed 2022
73	Not observed 2022

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
74	
75	
76	Not observed 2022
77	
78	
79	
8	
80	
81	
82	
83	Not observed 2022
84	Not observed 2022
85	
86	
87	
88	
89	
8A	
8B	
8C	
8D	
8E	
8F	
8G	
8H	
8I	
8J	
8K	
8L	Not observed 2022



# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
8M	Not observed 2022
9	
90	Damage in Room 301 - 5 ft cracked
90A	
91	Damage in room 301 5 ft cracked
91A	
92	Damage in Room 105 5 ft worn carpet (mastic exposed)
93	Damage in Room 409 - 2 ft cracked Room 402 - 3 ft cracked
93A	
94	Damage in Room 408 - 2 ft cracked
94A	
95	Damage in New building first floor hall - 10 ft cracked
95A	
96	Damage in New building 1st and 2nd floor hallway
96A	
97	Damage in room 503 - 4 ft cracked
97A	
98	Damage in hall by room 504 - 13 feet cracked
98A	
9A	
9B	
9C	
9D	
A2	
B1	Damage in boiler room 5 ft worn
B2	
D1	

# Chicago Public Schools

School Pathways Brighton Unit 66801 Building ID 59894

Address 3124 47 Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School Pathways Brighton

Unit 66801

Building ID 59894

Address 3124 47

Chicago, IL, 60632

Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	Plaster	60,000	SF	Throughout 1909 Building	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
10	Number skipped										Follow O&M Plan
11	Tan linoleum		SF	Kitchen of 1909 Building	Assumed	MISC			SF		Follow O&M Plan
13	Beige linoleum		SF	Lunchroom, 008, and 009 of 1909 Building	Assumed	MISC			SF		Follow O&M Plan
15A	4" Black vinyl baseboards	1,800	LF	Classrooms in 1972 Annex	Assumed	MISC	No	10	LF	6 ACBM with the potential for damage	Repair
15B	6" Black vinyl baseboard	480	LF	Hallways of 1972 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
16A	4" Black vinyl baseboard mastic	1,800	LF	Classrooms of 1972 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
16B	6" Black vinyl baseboard mastic	480	LF	Hallways of 1972 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
19	Exterior brick - Non-AHERA			1909 Building	Assumed	MISC					Follow O&M Plan
2	Drywall Joint Compound			Throughout Ground Floor	No ACBM	MISC					
2 D	9" x 9" Beige Floor Tile			104	Chrysotile	MISC					Follow O&M Plan
20	Exterior brick mortar	14,000	SF	1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Exterior door caulk	120	LF	1909 Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
22	Drywall		SF	Teacher's Room, Lunchroom, 008, 009 of 1909 Building	Assumed	MISC			SF		Follow O&M Plan
23	Black cementitious flooring	1,760	SF	First Floor Corridor and Stair Landings of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Green terrazzo	40	SF	Women's Bathroom of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Brown terrazzo wall panels	40	SF	Men's and Women's Bathrooms of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	2' x 2' Ceiling Panels	800	SF	Lunchroom of 1909 Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
27	Terrazzo basin	20	SF	Kitchen and Sink Closet of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Yellow baseboard	200	SF	Lunchroom of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Yellow baseboard mastic	200	SF	Lunchroom of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2A	9" x 9" Tan w/Yellow, Blue, and White Floor Tile	800	SF	100 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2B	9" x 9" Tan Floor Tile w/Brown and White	400	SF	100 and Room 208 of 1909 Building	Chrysotile	MISC	No	20	SF	5 ACBM with potential for significant damage	Repair
2C	9" x 9" Brown Floor Tile w/White and Red	800	SF	208 and Faculty Bathroom of 1909 Building	Chrysotile	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
2E	9" x 9" Black Floor Tile	50	SF	Faculty Bathroom of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2F	9" x 9" Maroon Floor Tile	20	SF	Faculty Bathroom of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Pathways Brighton

Unit 66801

Building ID 59894

Address 3124 47

Chicago, IL, 60632

Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
2H	9" x 9" Green Floor Tile w/White Streaks	400	SF	204 of 1909 Building	Chrysotile	MISC	No	15	SF	6 ACBM with the potential for damage	Repair
2I	9" x 9" Aqua Floor Tile w/White Streaks	415	SF	Room 204 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2J	9" x 9" Aqua Floor Tile w/Black and White Specks	40	SF	301 of 1909 Building	Chrysotile	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
2K	9" x 9" Yellow Floor Tile w/White Streaks	50	SF	301 of 1909 Building	Chrysotile	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
2L	9" x 9" Gray Floor Tile w/White Streaks			Gym of 1909 Building	Chrysotile	MISC					Follow O&M Plan
2M	9" x 9" Light Brown Floor Tile w/White Swirls			Gym of 1909 Building	Chrysotile	MISC					Follow O&M Plan
3	Gray Carpet Mastic	11,000	SF	Rms. 2, 3, 6, 7, 11-14, 20-27	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
30	Blue baseboard	108	SF	1st Room West of E Entrance of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Blue baseboard mastic	100	SF	1st Room West of E Entrance of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Interior brick	80,000	SF	Throughout 1909 Building	Assumed	MISC	No	4	SF	5 ACBM with potential for significant damage	Follow O&M Plan
33	Interior brick mortar	80,000	SF	Throughout 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	Terrazzo baseboard	300	SF	Throughout 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Ceramic tile grout	70	SF	Throughout Entrances of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Glazed brick mortar	400	SF	Throughout 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Interior door caulk	200	LF	Throughout 1909 Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
38	Block mortar	10	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Blue/green/gray/white ceramic tile grout	500	SF	Throughout Boy's and Girl's Bathrooms of 1909 Building	Assumed	MISC	No	8	SF	6 ACBM with the potential for damage	Repair
3A	12" x 12" Beige Floor Tile w/Brown Streaks	700	SF	005 of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3B	12" x 12" Beige Floor Tile w/Brown and White Specks	750	SF	101 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3C	12" x 12" Beige Floor Tile w/Brown and White Streaks	750	SF	206 of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3D	12" x 12" White Floor Tile	700	SF	301 of 1909 Building	Chrysotile	MISC	No	10	SF	6 ACBM with the potential for damage	Repair
4	12" x 12" Ceiling Tile			Throughout Annex	Assumed	MISC					Follow O&M Plan
40	Gray carpet mastic (brown)	500	SF	Office, 105, and 106 of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Cinder block mortar	1,300	SF	Throughout 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	Black border tile	200	SF	204 of 1909 Building	Chrysotile	MISC	No	0	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
43	Black border tile mastic	50	SF	204 of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	2' x 4' Ceiling Panels	200	SF	Kitchen of 1909 Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

# Chicago Public Schools

**School** Pathways Brighton  
**Address** 3124 47

**Unit** 66801  
Chicago, IL, 60632

**Building ID** 59894  
**Region**

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
45	Terrazzo	150	SF	Bathroom in Room D of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12" x 12" Terrazzo	150	SF	D Room of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	Boiler wrap #1	500	SF	Boiler Room of 1909 Building	Chrysotile	MISC	Yes	0	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
48	Boiler wrap #2	500	SF	Boiler Room of 1909 Building	Chrysotile	MISC	Yes	0	SF	4 Damaged or significantly damaged friable misc. ACBM	Follow O&M Plan
49	Insulation over fiberglass	140	LF	Maintenance Room of 1909 Building	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
5	4" Gary Vinyl Baseboard Mastic	1,500	LF	Throughout Ground Floor	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
50	Mag block insulation	100	LF	Boiler Room of 1909 Building	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
51	Duct insulation	300	SF	Boiler Room of 1909 Building	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
52	Refractory Cement in Doors of #1 Boiler	20	SF	Boiler Room of 1909 Building	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
53	Refractory Cement in Doors of #2 Boiler	20	SF	Boiler Room of 1909 Building	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
54	Firebrick in Boiler #1	200	SF	Boiler Room of 1909 Building	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
55	Firebrick in Boiler #2	200	SF	Boiler Room of 1909 Building	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
56	4" Black vinyl baseboard			004 of 1909 Building	Assumed	MISC					Follow O&M Plan
57	4" Black vinyl baseboard mastic			004 of 1909 Building	Assumed	MISC					Follow O&M Plan
5A	12" x 12" Multi-Gray Floor Tile	1,900	SF	Hallways of 1972 Annex	Assumed	MISC	No	15	SF	6 ACBM with the potential for damage	Repair
5B	12" x 12" Gray Floor Tile w/White Streaks	600	SF	Book Room and Storage in 1972 Annex	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
6	Brown linoleum	400	SF	Basement Room D of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	Green ceramic tile grout	10	SF	Entrances of 1972 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	Gray carpet mastic	600	SF	Classrooms, Teacher's Lounge and Office of 1972 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	Exterior door caulk	84	LF	Throughout 1972 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
66	12" x 12" Multi-Gray Floor Tile Mastic	1,900	SF	Hallways of 1972 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	12" x 12" Gray Floor Tile w/White Streaks Mastic	600	SF	Book Room and Storage in 1972 Annex	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	Cementitious pipe joint insulation		LF	Electric Room (Behind Wall) in 1972 Annex	Assumed	TSI			LF		Follow O&M Plan
7	Transite panels			Basement (Abated)	Abated	MISC					
70	Fiberglass insulation			Electric Room of 1972 Annex	Not Tested	TSI					Follow O&M Plan

# Chicago Public Schools

School Pathways Brighton

Unit 66801

Building ID 59894

Address 3124 47

Chicago, IL, 60632

Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
71	Vault door liner	15	SF	2nd Floor Landing N/E Stairwell	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	12" x 12" Tan w/ Light. Brown floor tile			Engineer's Office	Assumed	MISC					Follow O&M Plan
73	Mastic w/ 12" x 12" tan w/ Light. Brown floor tile			Engineer's Office	Assumed	MISC					Follow O&M Plan
74	12" x 12" Gray w/ Dark Gray & White Floor Tile	60	SF	Engineer's Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
75	Mastic w/ 12" x 12" Gray w/ Dark Gray & White Floor Tile	60	SF	Engineer's Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	Purple carpet adhesive			Principal's Office	Assumed	MISC					Follow O&M Plan
77	12" x 12" Tan Floor Tile	400	SF	Principal's Office Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
78	Mastic w/ 12" x 12" Tan Floor Tile	400	SF	Principal's Office Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	12" x 12" Light Gray w/ Dark Gray & White Floor Tile	2,300	SF	Cafe	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8	1' x 1' Ceiling Tile w/ Dots	20	SF	Basement Corridor	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	
80	Mastic w/ 12" x 12" Light Gray w/ Dark Gray & White Floor Tile	2,300	SF	Cafe	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81	12" x 12" Light Blue w/ Dark Blue & White Floor Tile	100	SF	Cafe	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82	Mastic w/ 12" x 12" Light Blue 2/ Dark Blue & White Floor Tile	100	SF	Cafe	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
83	Tan linoleum		SF	Basement Art Room	Assumed	MISC			SF		Follow O&M Plan
84	Adhesive w/ Tan Linoleum		SF	Basement Art Room	Assumed	MISC			SF		Follow O&M Plan
85	Brown carpet adhesive	3,000	SF	1972 Annex Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
86	12" x 12" Beige Floor Tile	700	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
87	Mastic Associated w/ 12" x 12" Beige Floor Tile	700	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
88	Vinyl Sheeting Glued on Plywood	3,000	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
89	2' x 4' Ceiling Tile	7,500	SF	N, S, E, W Corridor Entrances, Rooms 401-412	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
8A	9" x 9" Tan w/ Ye, Blue, and White Floor Tile Mastic	800	SF	Room 100 in 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8B	9" x 9" Tan Floor Tile w/ Brown and White Mastic	800	SF	Faculty Bathroom by Room 100 and Room 208 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8C	9" x 9" Brown Floor Tile w/ White and Red Mastic	800	SF	Faculty Bathroom and Room 208 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8D	9" x 9" Beige Floor Tile Mastic	250	SF	Room 104 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8E	9" x 9" Black Floor Tile Mastic	50	SF	Faculty Bathroom of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8F	9" x 9" Maroon Floor Tile Mastic	20	SF	Faculty Bathroom of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8G	9" x 9" Brown Floor Tile Mastic	750	SF	Room 208 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Pathways Brighton

Unit 66801

Building ID 59894

Address 3124 47

Chicago, IL, 60632

Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
8H	9" x 9" Green Floor Tile Mastic	400	SF	Room 204 Of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8I	9" x 9" Aqua Floor Tile Mastic	415	SF	Room 301 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8J	9" x 9" Aqua Floor Tile Mastic	40	SF	Room 301 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8K	9" x 9" Yellow Floor Tile Mastic	40	SF	Room 301 of 1909 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8L	9" x 9" Gray Floor Tile Mastic			Gym of 1909 Building	Chrysotile	MISC					Follow O&M Plan
8M	9" x 9" Light Brown Floor Tile Mastic			Gym of 1909 Building	Chrysotile	MISC					Follow O&M Plan
9	Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots	20	SF	Basement Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
90	9" x 9" Brown w/ White streak Floor Tile	20	SF	Room 301	Assumed	MISC	No	5	SF	5 ACBM with potential for significant damage	Remove
90A	9" x 9" Brown w/ White streak Floor Tile Mastic	20	SF	Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91	9" x 9" Dark Brown Floor Tile patch	20	SF	Room 301	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Remove
91A	9" x 9" Dark Brown w/ White streak Floor Tile Mastic	20	SF	Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
92	Brown carpet Mastic	1,000	SF	Room 105 and 106	Assumed	MISC	No	5	SF	5 ACBM with potential for significant damage	Repair
93	12" x 12" gray Floor Tile w/ White Specks	400	SF	Room 402 and 409	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Repair
93A	12" x 12" gray w/ White Floor Tile Mastic	400	SF	Room 409 and 402	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
94	12" x 12" Light Blue w/ White Floor Tile	200	SF	Room 408	Assumed	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
94A	12" x 12" Light Blue w/ White Floor Tile Mastic	200	SF	Room 408	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
95	12" x 12" White Floor Tile w/ Beige streak	1,000	SF	New building hallway by north entrance	Assumed	MISC	No	10	SF	5 ACBM with potential for significant damage	Repair
95A	12" x 12" White w/ Beige Floor Tile Mastic	1,000	SF	New building first floor hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
96	12" x 12" Brown Floor Tile	10,000	SF	1st and 2nd floor hallway	Assumed	MISC	No	30	SF	5 ACBM with potential for significant damage	Repair
96A	12" x 12" Brown Floor Tile Mastic	10,000	SF	New building 1st and 2nd floor hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
97	12" x 12" Light Blue w/ Dark Blue Specks Floor Tile	500	SF	Room 501, 502, and 505	Assumed	MISC	No	4	SF	5 ACBM with potential for significant damage	Repair
97A	12" x 12" Light Blue w/ Dark Blue Floor Tile Mastic	500	SF	Room 501, 502, and 505	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
98	New building 12" x 12" White w/ gray and black Specks Floor Tile	5,000	SF	New building halls and classrooms	Assumed	MISC	No	13	SF	6 ACBM with the potential for damage	Repair
98A	12" x 12" White w/ gray and black Specks Floor Tile Mastic	4,000	SF	New building halls and classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
9A	12" x 12" Beige Floor Tile w/ Brown Streaks Mastic	750	SF	Room 005 of 1909 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
9B	12" x 12" Beige Floor Tile w/ Brown & White Spks	750	SF	101	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

School Pathways Brighton

Unit 66801

Building ID 59894

Address 3124 47

Chicago, IL, 60632

Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Mastic										
9C	12" x 12" Beige Floor Tile w/ Brown & White Streaks Mastic	700	SF	206	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
9D	12" x 12" White Floor Tile Mastic	700	SF	301	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A2	Cementitious Insulation on Joints off Fiberglass	350	LF	Throughout 1909 Building	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
B1	Cardboard pipe insulation	1,300	LF	Throughout 1909 Building	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Encapsulate
B2	Cementitious Insulation off Paper Wrap Pipe Runs	100	LF	Throughout 1909 Building	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
D1	Aircell pipe insulation	300	LF	Boiler Room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

# Chicago Public Schools

**School** Pathways Brighton  
**Address** 3124 47

**Unit** 66801  
 Chicago, IL, 60632

**Building ID** 59894  
**Region**

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

Review Date	11/17/2022
Manager Planner Name	Evan Christian
100-19466	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
13	
15A	Sample to determine ACM content
15B	
16A	
16B	
19	
2	
2 D	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
2A	
2B	
2C	

# Chicago Public Schools

**School** Pathways Brighton  
**Address** 3124 47

**Unit** 66801  
Chicago, IL, 60632

**Building ID** 59894  
**Region**

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
2E	
2F	
2H	
2I	
2J	
2K	
2L	
2M	
3	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	Sample to determine ACM content
3A	
3B	
3C	
3D	
4	
40	
41	
42	

# Chicago Public Schools

**School** Pathways Brighton  
**Address** 3124 47

**Unit** 66801  
Chicago, IL, 60632

**Building ID** 59894  
**Region**

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
43	
44	
45	
46	
47	
48	
49	
5	
50	
51	
52	
53	
54	
55	
56	
57	
5A	
5B	
6	
60	
61	
65	
66	
67	
68	
7	
70	

# Chicago Public Schools

School Pathways Brighton

Unit 66801

Building ID 59894

Address 3124 47

Chicago, IL, 60632

Region

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
71	
72	
73	
74	
75	
76	
77	
78	
79	
8	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
8A	
8B	
8C	
8D	
8E	
8F	
8G	

# Chicago Public Schools

**School** Pathways Brighton  
**Address** 3124 47

**Unit** 66801  
Chicago, IL, 60632

**Building ID** 59894  
**Region**

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
8H	
8I	
8J	
8K	
8L	
8M	
9	
90	Sample to determine ACM content
90A	
91	Sample to determine ACM content
91A	
92	Sample to determine ACM content
93	
93A	
94	
94A	
95	
95A	
96	
96A	
97	
97A	
98	
98A	
9A	
9B	
9C	

# Chicago Public Schools

**School** Pathways Brighton

**Unit** 66801

**Building ID** 59894

**Address** 3124 47

Chicago, IL, 60632

**Region**

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
9D	
A2	
B1	
B2	
D1	

# APPENDIX A

## Assessment Sheets, Drawings and Photos

---



# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2022 AHERA REINSPECTION***

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **7**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **Plaster**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Number skipped**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Number skipped**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **Drywall Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Ground Floor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **Drywall Joint Compound**

MATERIAL LOCATION: **Throughout Ground Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**  
MATERIAL DESCRIPTION: **Gray Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms. 2, 3, 6, 7, 11-14, 20-27**

MATERIAL QUANTITY: **11000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **3**

MATERIAL DESCRIPTION: **Gray Carpet Mastic**

MATERIAL LOCATION: **Rms. 2, 3, 6, 7, 11-14, 20-27**

MATERIAL QUANTITY: **11000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**  
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Annex**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **4**

MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile**

MATERIAL LOCATION: **Throughout Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**  
MATERIAL DESCRIPTION: **4" Gary Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Ground Floor**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **5**  
MATERIAL DESCRIPTION: **4" Gary Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **Throughout Ground Floor**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**  
MATERIAL DESCRIPTION: **Brown linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Room D of 1909 Building**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **6**  
MATERIAL DESCRIPTION: **Brown linoleum**  
MATERIAL LOCATION: **Basement Room D of 1909 Building**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**  
MATERIAL DESCRIPTION: **Transite panels**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement (Abated)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **Transite panels**

MATERIAL LOCATION: **Basement (Abated)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/ Dots**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Corridor**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **8**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/ Dots**  
MATERIAL LOCATION: **Basement Corridor**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**  
MATERIAL DESCRIPTION: **Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Corridor**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

HOMOGENEOUS AREA: **9**  
MATERIAL DESCRIPTION: **Adhesive Associated w/ 1' x 1' Smooth Ceiling Tile w/ Dots**  
MATERIAL LOCATION: **Basement Corridor**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **98A**  
MATERIAL DESCRIPTION: **12" x 12" White w/ gray and black Specks Floor Tile Mastic**  
MATERIAL LOCATION: **New building halls and classrooms**  
MATERIAL QUANTITY: **4000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **98A**  
MATERIAL DESCRIPTION: **12" x 12" White w/ gray and black Specks Floor Tile Mastic**  
MATERIAL LOCATION: **New building halls and classrooms**  
MATERIAL QUANTITY: **4000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

**Chicago Public Schools**

**Carnow, Conibear and Associates**  
**2022 AHERA REINSPECTION**

**Inspector Assessment Form (New Homogeneous Area)**

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

**INFORMATION FROM CURRENT INSPECTION**

HOMOGENEOUS AREA: **83**  
MATERIAL DESCRIPTION: **Tan linoleum**  
MATERIAL LOCATION: **Basement Art Room**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: CONDITION:  
AHERA DAMAGE CATEGORY:  
ACCESSIBILITY: DAMAGE REASON:  
DAMAGE QUANTITY: DAMAGE REASON: DAMAGE UNITS: **SF**  
COMMENTS: Not observed 2022

Inspector's Signature: *Kenneth Karuhn* Date: **11/07/2022**





# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **86**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**  
MATERIAL LOCATION: **Room 104**  
MATERIAL QUANTITY: **700**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **86**

MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **89**  
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile**  
MATERIAL LOCATION: **N, S, E, W Corridor Entrances, Rooms 401-412**  
MATERIAL QUANTITY: **7500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **89**  
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile**  
MATERIAL LOCATION: **N, S, E, W Corridor Entrances, Rooms 401-412**  
MATERIAL QUANTITY: **7500**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8C**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White and Red Mastic**  
MATERIAL LOCATION: **Faculty Bathroom and Room 208 of 1909 Building**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8C**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White and Red Mastic**  
MATERIAL LOCATION: **Faculty Bathroom and Room 208 of 1909 Building**  
MATERIAL QUANTITY: **800**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8G**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Room 208 of 1909 Building**  
MATERIAL QUANTITY: **750**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8G**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Room 208 of 1909 Building**  
MATERIAL QUANTITY: **750**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **78**  
MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Tan Floor Tile**  
MATERIAL LOCATION: **Principal's Office Room 104**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **78**

MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Tan Floor Tile**

MATERIAL LOCATION: **Principal's Office Room 104**

MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Yellow baseboard**  
MATERIAL LOCATION: **Lunchroom of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Yellow baseboard**  
MATERIAL LOCATION: **Lunchroom of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2J**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile w/Black and White Specks**  
MATERIAL LOCATION: **301 of 1909 Building**  
MATERIAL QUANTITY: **40**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **2**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage is located in Room 301

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2J**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile w/Black and White Specks**  
MATERIAL LOCATION: **301 of 1909 Building**  
MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2L**  
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile w/White Streaks**  
MATERIAL LOCATION: **Gym of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL:      CONDITION:  
AHERA DAMAGE CATEGORY:  
  
ACCESSIBILITY:      DAMAGE REASON:  
      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
      DAMAGE UNITS:  
  
COMMENTS:  
Not observed 2022

Inspector's Signature: \_\_\_\_\_



Date: **11/07/2022** \_\_\_\_\_



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2L**  
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile w/White Streaks**  
MATERIAL LOCATION: **Gym of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **Interior brick**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **80000** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:  
DAMAGE QUANTITY: **4** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in 1st floor girls restroom 4 ft cracked/crumbling

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **Interior brick**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **80000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **91A**  
MATERIAL DESCRIPTION: **9" x 9" Dark Brown w/ White streak Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301**  
MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **91A**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown w/ White streak Floor Tile Mastic**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **94**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ White Floor Tile**  
MATERIAL LOCATION: **Room 408**  
MATERIAL QUANTITY: **200**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **2**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in Room 408 - 2 ft cracked

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **94**

MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ White Floor Tile**

MATERIAL LOCATION: **Room 408**

MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **2**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **5B**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/White Streaks**  
MATERIAL LOCATION: **Book Room and Storage in 1972 Annex**  
MATERIAL QUANTITY: **600**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **5B**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/White Streaks**  
MATERIAL LOCATION: **Book Room and Storage in 1972 Annex**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **Fiberglass insulation**

MATERIAL LOCATION: **Electric Room of 1972 Annex**

MATERIAL QUANTITY:      MATERIAL UNITS:

DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **Vault door liner**  
MATERIAL LOCATION: **2nd Floor Landing N/E Stairwell**  
MATERIAL QUANTITY: **15**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **Vault door liner**  
MATERIAL LOCATION: **2nd Floor Landing N/E Stairwell**  
MATERIAL QUANTITY: **15**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **72**  
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Light. Brown floor tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL:      CONDITION:  
AHERA DAMAGE CATEGORY:  
  
ACCESSIBILITY:      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE UNITS:  
  
COMMENTS:  
Not observed 2022

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **72**  
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Light. Brown floor tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **Blue/green/gray/white ceramic tile grout**  
MATERIAL LOCATION: **Throughout Boy's and Girl's Bathrooms of 1909 Building**  
MATERIAL QUANTITY: **500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **8**    DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in 3rd floor boys bathroom 5 feet cracked. 1st floor boys bathroom 3 ft cracked

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Blue/green/gray/white ceramic tile grout**

MATERIAL LOCATION: **Throughout Boy's and Girl's Bathrooms of 1909 Building**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **8** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **Gray carpet mastic (brown)**  
MATERIAL LOCATION: **Office, 105, and 106 of 1909 Building**  
MATERIAL QUANTITY: **500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Not observed in Room 105 and 106

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Gray carpet mastic (brown)**

MATERIAL LOCATION: **Office, 105, and 106 of 1909 Building**

MATERIAL QUANTITY: **500**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Boiler wrap #1**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **MODERATE**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **4 Damaged or significantly damaged friable misc. ACBM**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Boiler wrap #1**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **500**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **Insulation over fiberglass**

MATERIAL LOCATION: **Maintenance Room of 1909 Building**

MATERIAL QUANTITY: **140**      MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**





# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard**  
MATERIAL LOCATION: **004 of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Exterior brick - Non-AHERA**

MATERIAL LOCATION: **1909 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

MATERIAL CATEGORY: **MISC** FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: CONDITION:

AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Exterior brick - Non-AHERA**

MATERIAL LOCATION: **1909 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Exterior brick mortar**  
MATERIAL LOCATION: **1909 Building**  
MATERIAL QUANTITY: **14000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Exterior brick mortar**  
MATERIAL LOCATION: **1909 Building**  
MATERIAL QUANTITY: **14000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **9B**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Brown & White Spks Mastic**  
MATERIAL LOCATION: **101**  
MATERIAL QUANTITY: **750**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **9B**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Brown & White Spks Mastic**  
MATERIAL LOCATION: **101**  
MATERIAL QUANTITY: **750**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8F**  
MATERIAL DESCRIPTION: **9" x 9" Maroon Floor Tile Mastic**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **20**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8F**  
MATERIAL DESCRIPTION: **9" x 9" Maroon Floor Tile Mastic**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8M**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Gym of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL:      CONDITION:  
AHERA DAMAGE CATEGORY:  
  
ACCESSIBILITY:      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE UNITS:  
  
COMMENTS:  
Not observed 2022

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8M**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Gym of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Terrazzo basin**  
MATERIAL LOCATION: **Kitchen and Sink Closet of 1909 Building**  
MATERIAL QUANTITY: **20**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Terrazzo basin**

MATERIAL LOCATION: **Kitchen and Sink Closet of 1909 Building**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Yellow baseboard mastic**  
MATERIAL LOCATION: **Lunchroom of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2K**  
MATERIAL DESCRIPTION: **9" x 9" Yellow Floor Tile w/White Streaks**  
MATERIAL LOCATION: **301 of 1909 Building**  
MATERIAL QUANTITY: **50**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **2**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in Room 301 2 ft cracked

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2K**  
MATERIAL DESCRIPTION: **9" x 9" Yellow Floor Tile w/White Streaks**  
MATERIAL LOCATION: **301 of 1909 Building**  
MATERIAL QUANTITY: **50**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools


## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **93**  
MATERIAL DESCRIPTION: **12" x 12" gray Floor Tile w/ White Specks**  
MATERIAL LOCATION: **Room 402 and 409**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **5** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in Room 409 - 2 ft cracked Room 402 - 3 ft cracked

Inspector's Signature: 

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **93**

MATERIAL DESCRIPTION: **12" x 12" gray Floor Tile w/ White Specks**

MATERIAL LOCATION: **Room 402 and 409**

MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**


## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	66801	BUIDLING ID:	59894
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Kenneth Karuhn		
SCHOOL NAME:	Pathways Brighton	INSPECTION DATE:	11/7/2022		
ADDRESS:	3124 47	IDPH LICENSE NO:	100-07278		

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	<b>76</b>		
MATERIAL DESCRIPTION:	<b>Purple carpet adhesive</b>		
MATERIAL LOCATION:	<b>Principal's Office</b>		
MATERIAL QUANTITY:		MATERIAL UNITS:	
MATERIAL CATEGORY:	<b>MISC</b>	FRIABLE:	
ASBESTOS TYPE:	<b>Assumed</b>		
DISTURBANCE POTENTIAL:		CONDITION:	
AHERA DAMAGE CATEGORY:			
ACCESSIBILITY:		DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:		DAMAGE UNITS:	
COMMENTS:	Not observed 2022		

Inspector's Signature: 

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **76**  
MATERIAL DESCRIPTION: **Purple carpet adhesive**  
MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **Block mortar**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **Block mortar**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	66801	BUILDING ID:	59894
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Kenneth Karuhn		
SCHOOL NAME:	Pathways Brighton	INSPECTION DATE:	11/7/2022		
ADDRESS:	3124 47	IDPH LICENSE NO:	100-07278		

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: 44

MATERIAL DESCRIPTION: 2' x 4' Ceiling Panels

MATERIAL LOCATION: Kitchen of 1909 Building

MATERIAL QUANTITY: 200 MATERIAL UNITS: SF

MATERIAL CATEGORY: MISC FRIABLE: Yes

ASBESTOS TYPE: Assumed

DISTURBANCE POTENTIAL: LOW CONDITION: No Damage

AHERA DAMAGE CATEGORY: 7 Any remaining friable ACBM or friable suspect ACBM

ACCESSIBILITY: Barely Reachable DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature:

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels**  
MATERIAL LOCATION: **Kitchen of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>66801</b>	BUILDING ID:	<b>59894</b>
CITY/STATE:	<b>Chicago, Illinois</b>	AHERA INSPECTOR:	<b>Kenneth Karuhn</b>		
SCHOOL NAME:	<b>Pathways Brighton</b>	INSPECTION DATE:	<b>11/7/2022</b>		
ADDRESS:	<b>3124 47</b>	IDPH LICENSE NO:	<b>100-07278</b>		

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	<b>98</b>		
MATERIAL DESCRIPTION:	<b>New building 12" x 12" White w/ gray and black Specks Floor Tile</b>		
MATERIAL LOCATION:	<b>New building halls and classrooms</b>		
MATERIAL QUANTITY:	<b>5000</b>	MATERIAL UNITS:	<b>SF</b>
MATERIAL CATEGORY:	<b>MISC</b>	FRIABLE:	<b>No</b>
ASBESTOS TYPE:	<b>Assumed</b>		
DISTURBANCE POTENTIAL:	<b>LOW</b>	CONDITION:	<b>Damaged</b>
AHERA DAMAGE CATEGORY:	<b>6 ACBM with the potential for damage</b>		
ACCESSIBILITY:	<b>Within Reach</b>	DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	<b>13</b>	DAMAGE REASON:	
		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			
	Damage in hall by room 504 - 13 feet cracked		

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **98**

MATERIAL DESCRIPTION: **New building 12" x 12" White w/ gray and black Specks Floor Tile**

MATERIAL LOCATION: **New building halls and classrooms**

MATERIAL QUANTITY: **5000**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **13**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **9D**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**  
MATERIAL LOCATION: **301**  
MATERIAL QUANTITY: **700**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **9D**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**  
MATERIAL LOCATION: **301**  
MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **80**  
MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Light Gray w/ Dark Gray & White Floor Tile**  
MATERIAL LOCATION: **Cafe**  
MATERIAL QUANTITY: **2300**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **80**

MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Light Gray w/ Dark Gray & White Floor Tile**

MATERIAL LOCATION: **Cafe**

MATERIAL QUANTITY: **2300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **82**  
MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Light Blue 2/ Dark Blue & White Floor Tile**  
MATERIAL LOCATION: **Cafe**  
MATERIAL QUANTITY: **100**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **82**  
MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Light Blue 2/ Dark Blue & White Floor Tile**  
MATERIAL LOCATION: **Cafe**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	66801	BUILDING ID:	59894
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Kenneth Karuhn		
SCHOOL NAME:	Pathways Brighton	INSPECTION DATE:	11/7/2022		
ADDRESS:	3124 47	IDPH LICENSE NO:	100-07278		

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	84			
MATERIAL DESCRIPTION:	Adhesive w/ Tan Linoleum			
MATERIAL LOCATION:	Basement Art Room			
MATERIAL QUANTITY:		MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:		
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:		CONDITION:		
AHERA DAMAGE CATEGORY:				
ACCESSIBILITY:		DAMAGE REASON:		
		DAMAGE REASON:		
DAMAGE QUANTITY:		DAMAGE REASON:		
		DAMAGE UNITS:	SF	
COMMENTS:	Not observed 2022			

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **84**

MATERIAL DESCRIPTION: **Adhesive w/ Tan Linoleum**

MATERIAL LOCATION: **Basement Art Room**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **90**  
MATERIAL DESCRIPTION: **9" x 9" Brown w/ White streak Floor Tile**  
MATERIAL LOCATION: **Room 301**  
MATERIAL QUANTITY: **20**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Significantly Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **5**    DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in Room 301 - 5 ft cracked

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **90**

MATERIAL DESCRIPTION: **9" x 9" Brown w/ White streak Floor Tile**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **90A**  
MATERIAL DESCRIPTION: **9" x 9" Brown w/ White streak Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301**  
MATERIAL QUANTITY: **20**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **90A**

MATERIAL DESCRIPTION: **9" x 9" Brown w/ White streak Floor Tile Mastic**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Green terrazzo**  
MATERIAL LOCATION: **Women's Bathroom of 1909 Building**  
MATERIAL QUANTITY: **40**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Green terrazzo**  
MATERIAL LOCATION: **Women's Bathroom of 1909 Building**  
MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2' x 2' Ceiling Panels**  
MATERIAL LOCATION: **Lunchroom of 1909 Building**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2' x 2' Ceiling Panels**  
MATERIAL LOCATION: **Lunchroom of 1909 Building**  
MATERIAL QUANTITY: **800**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2H**  
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**  
MATERIAL LOCATION: **204 of 1909 Building**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **15**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in Room 204 15 ft cracked

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2H**  
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**  
MATERIAL LOCATION: **204 of 1909 Building**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **15**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2M**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/White Swirls**  
MATERIAL LOCATION: **Gym of 1909 Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
MATERIAL CATEGORY: **MISC** FRIABLE:  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: CONDITION:  
AHERA DAMAGE CATEGORY:  
ACCESSIBILITY: DAMAGE REASON:  
DAMAGE QUANTITY: DAMAGE REASON:  
DAMAGE QUANTITY: DAMAGE REASON:  
DAMAGE UNITS:  
COMMENTS:  
Not observed 2022

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2M**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/White Swirls**  
MATERIAL LOCATION: **Gym of 1909 Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Ceramic tile grout**  
MATERIAL LOCATION: **Throughout Entrances of 1909 Building**  
MATERIAL QUANTITY: **70**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Ceramic tile grout**  
MATERIAL LOCATION: **Throughout Entrances of 1909 Building**  
MATERIAL QUANTITY: **70**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **94A**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ White Floor Tile Mastic**  
MATERIAL LOCATION: **Room 408**  
MATERIAL QUANTITY: **200**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **94A**

MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ White Floor Tile Mastic**

MATERIAL LOCATION: **Room 408**

MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **95A**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Beige Floor Tile Mastic**  
MATERIAL LOCATION: **New building first floor hallway**  
MATERIAL QUANTITY: **1000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **95A**  
MATERIAL DESCRIPTION: **12" x 12" White w/ Beige Floor Tile Mastic**  
MATERIAL LOCATION: **New building first floor hallway**  
MATERIAL QUANTITY: **1000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **5A**  
MATERIAL DESCRIPTION: **12" x 12" Multi-Gray Floor Tile**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **1900**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **15**    DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in hallway by 410 5 ft cracked. Hallway by east side 10 ft cracked

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **5A**  
MATERIAL DESCRIPTION: **12" x 12" Multi-Gray Floor Tile**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **1900**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **15**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **3B**  
MATERIAL DESCRIPTION: **12" x 12"Beige Floor Tile w/Brown and White Specks**  
MATERIAL LOCATION: **101 of 1909 Building**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **3B**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/Brown and White Specks**  
MATERIAL LOCATION: **101 of 1909 Building**  
MATERIAL QUANTITY: **750**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **Boiler wrap #2**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **MODERATE**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **4 Damaged or significantly damaged friable misc. ACBM**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **Boiler wrap #2**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **500**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **Refractory Cement in Doors of #1 Boiler**

MATERIAL LOCATION: **Boiler Room of 1909 Building**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**

ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **Refractory Cement in Doors of #1 Boiler**

MATERIAL LOCATION: **Boiler Room of 1909 Building**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Firebrick in Boiler #1**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **200**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **TSI**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Firebrick in Boiler #1**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **97**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ Dark Blue Specks Floor Tile**  
MATERIAL LOCATION: **Room 501, 502, and 505**  
MATERIAL QUANTITY: **500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **4**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in room 503 - 4 ft cracked

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **97**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ Dark Blue Specks Floor Tile**  
MATERIAL LOCATION: **Room 501, 502, and 505**  
MATERIAL QUANTITY: **500**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **9A**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Brown Streaks Mastic**  
MATERIAL LOCATION: **Room 005 of 1909 Building**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **9A**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Brown Streaks Mastic**  
MATERIAL LOCATION: **Room 005 of 1909 Building**  
MATERIAL QUANTITY: **750**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **9C**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Brown & White Streaks Mastic**  
MATERIAL LOCATION: **206**  
MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **D1**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **TSI**      FRIABLE: **Yes**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **D1**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022





# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8L**  
MATERIAL DESCRIPTION: **9" x 9" Gray Floor Tile Mastic**  
MATERIAL LOCATION: **Gym of 1909 Building**

MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Black cementitious flooring**  
MATERIAL LOCATION: **First Floor Corridor and Stair Landings of 1909 Building**  
MATERIAL QUANTITY: **1760**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Black cementitious flooring**

MATERIAL LOCATION: **First Floor Corridor and Stair Landings of 1909 Building**

MATERIAL QUANTITY: **1760**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **77**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**  
MATERIAL LOCATION: **Principal's Office Room 104**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **77**  
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**  
MATERIAL LOCATION: **Principal's Office Room 104**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **79**  
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/ Dark Gray & White Floor Tile**  
MATERIAL LOCATION: **Cafe**  
MATERIAL QUANTITY: **2300**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **79**

MATERIAL DESCRIPTION: **12" x 12" Light Gray w/ Dark Gray & White Floor Tile**

MATERIAL LOCATION: **Cafe**

MATERIAL QUANTITY: **2300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Blue baseboard mastic**  
MATERIAL LOCATION: **1st Room West of E Entrance of 1909 Building**  
MATERIAL QUANTITY: **100**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Blue baseboard mastic**  
MATERIAL LOCATION: **1st Room West of E Entrance of 1909 Building**  
MATERIAL QUANTITY: **100**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **Terrazzo baseboard**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **300**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **Terrazzo baseboard**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **Green ceramic tile grout**  
MATERIAL LOCATION: **Entrances of 1972 Annex**  
MATERIAL QUANTITY: **10**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **Exterior door caulk**  
MATERIAL LOCATION: **Throughout 1972 Annex**  
MATERIAL QUANTITY: **84**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **3A**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/Brown Streaks**  
MATERIAL LOCATION: **005 of 1909 Building**  
MATERIAL QUANTITY: **700**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **3A**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/Brown Streaks**  
MATERIAL LOCATION: **005 of 1909 Building**  
MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION


### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **3C**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/Brown and White Streaks**  
MATERIAL LOCATION: **206 of 1909 Building**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: 

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **3C**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/Brown and White Streaks**  
MATERIAL LOCATION: **206 of 1909 Building**  
MATERIAL QUANTITY: **750**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **3D**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**  
MATERIAL LOCATION: **301 of 1909 Building**  
MATERIAL QUANTITY: **700**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **10**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage is located in Room 301

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **3D**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**  
MATERIAL LOCATION: **301of 1909 Building**  
MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **10**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Duct insulation**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **300**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **TSI**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Duct insulation**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Beige linoleum**  
MATERIAL LOCATION: **Lunchroom, 008, and 009 of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL:      CONDITION:  
AHERA DAMAGE CATEGORY:  
  
ACCESSIBILITY:      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE REASON:      DAMAGE UNITS: **SF**  
  
COMMENTS:  
Not observed 2022

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Beige linoleum**

MATERIAL LOCATION: **Lunchroom, 008, and 009 of 1909 Building**

MATERIAL QUANTITY:      MATERIAL UNITS: **SF**

DAMAGE QUANTITY:      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **16A**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard mastic**  
MATERIAL LOCATION: **Classrooms of 1972 Annex**  
MATERIAL QUANTITY: **1800**    MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **16A**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard mastic**  
MATERIAL LOCATION: **Classrooms of 1972 Annex**  
MATERIAL QUANTITY: **1800**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **97A**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ Dark Blue Floor Tile Mastic**  
MATERIAL LOCATION: **Room 501, 502, and 505**  
MATERIAL QUANTITY: **500**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **97A**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ Dark Blue Floor Tile Mastic**  
MATERIAL LOCATION: **Room 501, 502, and 505**  
MATERIAL QUANTITY: **500**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **B1**  
MATERIAL DESCRIPTION: **Cardboard pipe insulation**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE QUANTITY: **5** DAMAGE UNITS: **LF**  
COMMENTS:  
Damage in boiler room 5 ft worn

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **B1**  
MATERIAL DESCRIPTION: **Cardboard pipe insulation**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **1300**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **5**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **88**  
MATERIAL DESCRIPTION: **Vinyl Sheeting Glued on Plywood**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **3000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **88**  
MATERIAL DESCRIPTION: **Vinyl Sheeting Glued on Plywood**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **3000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8B**  
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/Brown and White Mastic**  
MATERIAL LOCATION: **Faculty Bathroom by Room 100 and Room 208 of 1909 Building**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8B**  
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/Brown and White Mastic**  
MATERIAL LOCATION: **Faculty Bathroom by Room 100 and Room 208 of 1909 Building**  
MATERIAL QUANTITY: **800**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8H**  
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile Mastic**  
MATERIAL LOCATION: **Room 204 Of 1909 Building**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8H**  
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile Mastic**  
MATERIAL LOCATION: **Room 204 Of 1909 Building**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2F**  
MATERIAL DESCRIPTION: **9" x 9" Maroon Floor Tile**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2F**  
MATERIAL DESCRIPTION: **9" x 9" Maroon Floor Tile**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **92**  
MATERIAL DESCRIPTION: **Brown carpet Mastic**  
MATERIAL LOCATION: **Room 105 and 106**  
MATERIAL QUANTITY: **1000**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **5**      DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in Room 105 5 ft worn carpet (mastic exposed)

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **92**  
MATERIAL DESCRIPTION: **Brown carpet Mastic**  
MATERIAL LOCATION: **Room 105 and 106**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **73**  
MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" tan w/ Light. Brown floor tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL:      CONDITION:  
AHERA DAMAGE CATEGORY:  
  
ACCESSIBILITY:      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE UNITS:  
  
COMMENTS:  
Not observed 2022

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **73**  
MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" tan w/ Light. Brown floor tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>66801</b>	BUILDING ID:	<b>59894</b>
CITY/STATE:	<b>Chicago, Illinois</b>	AHERA INSPECTOR:	<b>Kenneth Karuhn</b>		
SCHOOL NAME:	<b>Pathways Brighton</b>	INSPECTION DATE:	<b>11/7/2022</b>		
ADDRESS:	<b>3124 47</b>	IDPH LICENSE NO:	<b>100-07278</b>		

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	<b>41</b>		
MATERIAL DESCRIPTION:	<b>Cinder block mortar</b>		
MATERIAL LOCATION:	<b>Throughout 1909 Building</b>		
MATERIAL QUANTITY:	<b>1300</b>	MATERIAL UNITS:	<b>SF</b>
MATERIAL CATEGORY:	<b>MISC</b>	FRIABLE:	<b>No</b>
ASBESTOS TYPE:	<b>Assumed</b>		
DISTURBANCE POTENTIAL:	<b>LOW</b>	CONDITION:	<b>No Damage</b>
AHERA DAMAGE CATEGORY:	<b>6 ACBM with the potential for damage</b>		
ACCESSIBILITY:	<b>Barely Reachable</b>	DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	<b>0</b>	DAMAGE REASON:	
		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **Cinder block mortar**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **1300**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Black border tile**  
MATERIAL LOCATION: **204 of 1909 Building**  
MATERIAL QUANTITY: **200**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **4 Damaged or significantly damaged friable misc. ACBM**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Black border tile**  
MATERIAL LOCATION: **204 of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **12" x 12" Terrazzo**  
MATERIAL LOCATION: **D Room of 1909 Building**  
MATERIAL QUANTITY: **150**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**

ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12" x 12" Terrazzo**

MATERIAL LOCATION: **D Room of 1909 Building**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **15B**  
MATERIAL DESCRIPTION: **6" Black vinyl baseboard**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **480**    MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **15B**  
MATERIAL DESCRIPTION: **6" Black vinyl baseboard**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **480**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **96**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**  
MATERIAL LOCATION: **1st and 2nd floor hallway**  
MATERIAL QUANTITY: **10000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **30**    DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in New building 1st and 2nd floor hallway

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **96**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**  
MATERIAL LOCATION: **1st and 2nd floor hallway**  
MATERIAL QUANTITY: **10000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **30**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **A2**

MATERIAL DESCRIPTION: **Cementitious Insulation on Joints off Fiberglass**

MATERIAL LOCATION: **Throughout 1909 Building**

MATERIAL QUANTITY: **350**      MATERIAL UNITS: **LF**

MATERIAL CATEGORY: **TSI**      FRIABLE: **Yes**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**

ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **A2**  
MATERIAL DESCRIPTION: **Cementitious Insulation on Joints off Fiberglass**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **350**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **B2**  
MATERIAL DESCRIPTION: **Cementitious Insulation off Paper Wrap Pipe Runs**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **100**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **TSI**      FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **B2**  
MATERIAL DESCRIPTION: **Cementitious Insulation off Paper Wrap Pipe Runs**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **100**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **85**  
MATERIAL DESCRIPTION: **Brown carpet adhesive**  
MATERIAL LOCATION: **1972 Annex Classrooms**  
MATERIAL QUANTITY: **3000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **85**  
MATERIAL DESCRIPTION: **Brown carpet adhesive**  
MATERIAL LOCATION: **1972 Annex Classrooms**  
MATERIAL QUANTITY: **3000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **87**  
MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Beige Floor Tile**  
MATERIAL LOCATION: **Room 104**  
MATERIAL QUANTITY: **700**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **87**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Beige Floor Tile**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8D**  
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile Mastic**  
MATERIAL LOCATION: **Room 104 of 1909 Building**  
MATERIAL QUANTITY: **250**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8D**  
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile Mastic**  
MATERIAL LOCATION: **Room 104 of 1909 Building**  
MATERIAL QUANTITY: **250**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Exterior door caulk**  
MATERIAL LOCATION: **1909 Building**  
MATERIAL QUANTITY: **120**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Exterior door caulk**  
MATERIAL LOCATION: **1909 Building**  
MATERIAL QUANTITY: **120**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2C**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White and Red**  
MATERIAL LOCATION: **208 and Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **2**    DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in men's restroom between 2nd and 3rd floor. 2 ft cracked or missing

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2C**  
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White and Red**  
MATERIAL LOCATION: **208 and Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **800**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **Interior brick mortar**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **80000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **Interior brick mortar**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **80000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **Glazed brick mortar**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **Glazed brick mortar**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

## Carnow, Conibear and Associates 2022 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **Interior door caulk**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **Interior door caulk**  
MATERIAL LOCATION: **Throughout 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **95**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Beige streak**  
MATERIAL LOCATION: **New building hallway by north entrance**  
MATERIAL QUANTITY: **1000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **10**    DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in New building first floor hall - 10 ft cracked

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **95**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Beige streak**  
MATERIAL LOCATION: **New building hallway by north entrance**  
MATERIAL QUANTITY: **1000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **10**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard mastic**  
MATERIAL LOCATION: **004 of 1909 Building**  
MATERIAL QUANTITY:      MATERIAL UNITS:  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL:      CONDITION:  
AHERA DAMAGE CATEGORY:  
  
ACCESSIBILITY:      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE QUANTITY:      DAMAGE REASON:  
DAMAGE UNITS:  
  
COMMENTS:  
Not observed 2022

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard mastic**  
MATERIAL LOCATION: **004 of 1909 Building**

MATERIAL QUANTITY:      MATERIAL UNITS:  
DAMAGE QUANTITY:      DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Gray w/ Dark Gray & White Floor Tile**

MATERIAL LOCATION: **Engineer's Bathroom**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **Mastic w/ 12" x 12" Gray w/ Dark Gray & White Floor Tile**

MATERIAL LOCATION: **Engineer's Bathroom**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Mag block insulation**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **100**    MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **TSI**    FRIABLE: **Yes**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Mag block insulation**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **100**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **Refractory Cement in Doors of #2 Boiler**

MATERIAL LOCATION: **Boiler Room of 1909 Building**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2 D**

MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile**

MATERIAL LOCATION: **104**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **96A**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**  
MATERIAL LOCATION: **New building 1st and 2nd floor hallway**  
MATERIAL QUANTITY: **10000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **96A**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**  
MATERIAL LOCATION: **New building 1st and 2nd floor hallway**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**      INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **81**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ Dark Blue & White Floor Tile**  
MATERIAL LOCATION: **Cafe**  
MATERIAL QUANTITY: **100**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **12" x 12" Light Blue w/ Dark Blue & White Floor Tile**

MATERIAL LOCATION: **Cafe**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8A**  
MATERIAL DESCRIPTION: **9" x 9" Tan w/Ye, Blue, and White Floor Tile Mastic**  
MATERIAL LOCATION: **Room 100 in 1909 Building**  
MATERIAL QUANTITY: **800**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8A**  
MATERIAL DESCRIPTION: **9" x 9" Tan w/Ye, Blue, and White Floor Tile Mastic**  
MATERIAL LOCATION: **Room 100 in 1909 Building**  
MATERIAL QUANTITY: **800**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8E**  
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile Mastic**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **50**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8E**  
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile Mastic**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8K**  
MATERIAL DESCRIPTION: **9" x 9" Yellow Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301 of 1909 Building**  
MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Brown terrazzo wall panels**  
MATERIAL LOCATION: **Men's and Women's Bathrooms of 1909 Building**  
MATERIAL QUANTITY: **40**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Brown terrazzo wall panels**

MATERIAL LOCATION: **Men's and Women's Bathrooms of 1909 Building**

MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2B**  
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/Brown and White**  
MATERIAL LOCATION: **100 and Room 208 of 1909 Building**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **20**    DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Not observed in Room 200, Damage in Room 204 20ft cracked

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2B**  
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/Brown and White**  
MATERIAL LOCATION: **100 and Room 208 of 1909 Building**  
MATERIAL QUANTITY: **400**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **20**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2E**  
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **50**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2E**  
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile**  
MATERIAL LOCATION: **Faculty Bathroom of 1909 Building**  
MATERIAL QUANTITY: **50**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Blue baseboard**  
MATERIAL LOCATION: **1st Room West of E Entrance of 1909 Building**  
MATERIAL QUANTITY: **108**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Blue baseboard**  
MATERIAL LOCATION: **1st Room West of E Entrance of 1909 Building**  
MATERIAL QUANTITY: **108**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **Gray carpet mastic**  
MATERIAL LOCATION: **Classrooms, Teacher's Lounge and Office of 1972 Annex**  
MATERIAL QUANTITY: **600**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **Gray carpet mastic**  
MATERIAL LOCATION: **Classrooms, Teacher's Lounge and Office of 1972 Annex**  
MATERIAL QUANTITY: **600**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **66**  
MATERIAL DESCRIPTION: **12" x 12" Multi-Gray Floor Tile Mastic**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **1900**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **66**  
MATERIAL DESCRIPTION: **12" x 12" Multi-Gray Floor Tile Mastic**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **1900**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/White Streaks Mastic**  
MATERIAL LOCATION: **Book Room and Storage in 1972 Annex**  
MATERIAL QUANTITY: **600**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/White Streaks Mastic**  
MATERIAL LOCATION: **Book Room and Storage in 1972 Annex**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Black border tile mastic**  
MATERIAL LOCATION: **204 of 1909 Building**  
MATERIAL QUANTITY: **50**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Black border tile mastic**  
MATERIAL LOCATION: **204 of 1909 Building**  
MATERIAL QUANTITY: **50**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**





# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **Firebrick in Boiler #2**  
MATERIAL LOCATION: **Boiler Room of 1909 Building**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **16B**  
MATERIAL DESCRIPTION: **6" Black vinyl baseboard mastic**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **480**    MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **11/07/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **16B**  
MATERIAL DESCRIPTION: **6" Black vinyl baseboard mastic**  
MATERIAL LOCATION: **Hallways of 1972 Annex**  
MATERIAL QUANTITY: **480**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUIDLING ID: **59894**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton** INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8I**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301 of 1909 Building**  
MATERIAL QUANTITY: **415** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8I**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301 of 1909 Building**  
MATERIAL QUANTITY: **415** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **8J**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301 of 1909 Building**  
MATERIAL QUANTITY: **40**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **8J**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic**  
MATERIAL LOCATION: **Room 301 of 1909 Building**  
MATERIAL QUANTITY: **40**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **91**  
MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile patch**  
MATERIAL LOCATION: **Room 301**  
MATERIAL QUANTITY: **20**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Significantly Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **5**    DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in room 301 5 ft cracked

Inspector's Signature: \_\_\_\_\_



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **91**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile patch**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **20**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Teacher's Room, Lunchroom, 008, 009 of 1909 Building**

MATERIAL QUANTITY:      MATERIAL UNITS: **SF**

DAMAGE QUANTITY:      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **11/17/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2A**  
MATERIAL DESCRIPTION: **9" x 9" Tan w/Yellow, Blue, and White Floor Tile**  
MATERIAL LOCATION: **100 of 1909 Building**  
MATERIAL QUANTITY: **800**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **2I**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile w/White Streaks**  
MATERIAL LOCATION: **Room 204 of 1909 Building**  
MATERIAL QUANTITY: **415**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Chrysotile**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **2I**  
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile w/White Streaks**  
MATERIAL LOCATION: **Room 204 of 1909 Building**  
MATERIAL QUANTITY: **415**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **93A**  
MATERIAL DESCRIPTION: **12" x 12" gray w/ White Floor Tile Mastic**  
MATERIAL LOCATION: **Room 409 and 402**  
MATERIAL QUANTITY: **400**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66801** BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton** REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47** IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **93A**

MATERIAL DESCRIPTION: **12" x 12" gray w/ White Floor Tile Mastic**

MATERIAL LOCATION: **Room 409 and 402**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022





# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **74**  
MATERIAL DESCRIPTION: **12" x 12" Gray w/ Dark Gray & White Floor Tile**  
MATERIAL LOCATION: **Engineer's Bathroom**  
MATERIAL QUANTITY: **60**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **74**  
MATERIAL DESCRIPTION: **12" x 12" Gray w/ Dark Gray & White Floor Tile**  
MATERIAL LOCATION: **Engineer's Bathroom**  
MATERIAL QUANTITY: **60**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **11/17/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Terrazzo**  
MATERIAL LOCATION: **Bathroom in Room D of 1909 Building**  
MATERIAL QUANTITY: **150**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

*Kenneth Karuhn*

Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **Terrazzo**  
MATERIAL LOCATION: **Bathroom in Room D of 1909 Building**  
MATERIAL QUANTITY: **150**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022







# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **66801**    BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Kenneth Karuhn**  
SCHOOL NAME: **Pathways Brighton**    INSPECTION DATE: **11/7/2022**  
ADDRESS: **3124 47**    IDPH LICENSE NO: **100-07278**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboards**  
MATERIAL LOCATION: **Classrooms in 1972 Annex**  
MATERIAL QUANTITY: **1800**    MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Barely Reachable**    DAMAGE REASON:  
DAMAGE QUANTITY: **10**    DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:  
Damage in room 411 10 ft missing

Inspector's Signature:



Date: 11/07/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **66801**      BUILDING ID: **59894**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Pathways Brighton**      REVIEW DATE: **11/17/2022**  
ADDRESS: **3124 47**      IDPH LICENSE NO: **100-07278**

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboards**  
MATERIAL LOCATION: **Classrooms in 1972 Annex**  
MATERIAL QUANTITY: **1800**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **10**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content

Management Planner's Signature: \_\_\_\_\_



Date: 11/17/2022

# APPENDIX B

## Inspector and Management Planner Licenses

---



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

## Kenneth Karuhn

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092154

Kathy DeSalvo, Director



# ASBESTOS PROFESSIONAL LICENSE

ID NUMBER  
**100 - 07278**

ISSUED  
**4/15/2022**

EXPIRES  
**05/15/2023**

**KENNETH A KARUHN**  
600 W VAN BUREN ST., STE 5  
CHICAGO, IL 60607

Environmental Health



## ENDORSEMENTS

## TC EXPIRES

INSPECTOR

10/8/2022

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

10/9/2022

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.



# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Kenneth Karuhn**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082269

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012581

Kathy DeSalvo, Director





OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: MPR2211033519

  
Kathy DeSalvo, Director



# ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

**100 - 19466**

ISSUED

**4/22/2022**

EXPIRES

**05/15/2023**

**EVAN I CHRISTIAN**  
**1119 N HOYNE AVE, APT 1**  
**CHICAGO, IL 60622**

Environmental Health



## ENDORSEMENTS

## TC EXPIRES

INSPECTOR

10/8/2022

MANAGEMENT PLANNER

11/1/2022

PROJECT MANAGER

3/28/2023

AIR SAMPLING PROFESSIONAL


**Alteration of this license shall result in legal action**

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid

training course certificate.

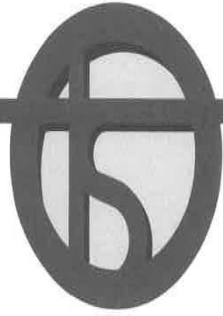

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082264

Kathy DeSalvo, Director



# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113639

Kathy DeSalvo, Director -

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed