

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-  
SCHOOL NAME: Chicago Military Academy at Bronzeville  
ADDRESS OF SCHOOL: 3516 South Giles Avenue  
CITY: Chicago, IL, 60653

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/3/2019**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 12/8/2022 ENROLLMENT 215  
IDPH INSPECTOR LICENSE NUMBER: 100-07134  
IDPH LICENSED INSPECTOR NAME (Please Print): Ron Brock  
IDPH MP LICENSE NUMBER: 100-19466  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



12/10/2022

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Chicago Military Academy at Bronzeville**

3516 South Giles Avenue  
Chicago, IL, 60653

Unit: 70070  
Building ID: 1800

IDPH ID Number: 14-016-2990-

**REPORT DATE:**

Saturday, December 10, 2022

**Prepared for:**

**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Chicago, IL, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

12/10/2022

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299            Unit: 70070            Region: 04            IDPH ID: 14-016-2990-

School: Chicago Military Academy at Bronzeville            Building ID: 1800

Address: 3516 South Giles Avenue

Chicago, IL, 60653

Building Contact: Salvati, James

Contact Phone: 3129564169

Current Building Owners: Chicago Public Schools

Reinspection Date: 12/8/2022

Review Date: 12/10/2022

Inspector: Ron Brock

Inspector IDPH License: 100-07134

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Evan Christian  
100-19466

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: December 10, 2022

RE: Chicago Military Academy at Bronzeville, Unit 70070  
3516 South Giles Avenue  
Chicago, IL, 60653

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Chicago Military Academy at Bronzeville , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Chicago Military Academy at Bronzeville, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Chicago Military Academy at Bronzeville Unit: 70070 Region: 04  
Address: 3516 South Giles Avenue Chicago, IL, 60653  
IDPH ID: 14-016-2990- Building ID: 1800  
Contact: Salvati, James Phone: 3129564169

### 2. Description of Facility

Original Construction: 2002 Additional Construction: 1915  
Total Square Footage: 53804 No of Floors: 4  
Current Occupancy: 215

### 3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Doug McCormick  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Ron Brock


Inspector IDPH license # 100-07134  
Reinspection Date: 12/8/2022

  
Signature:  
Date: 12/8/2022

### 6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

  
Signature:  
Date: 12/10/2022

### 7. Review Date: 12/10/2022

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

  
Signature:

Date: 12/10/2022

Name: Richard J.Schleyer



## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Chicago Military Academy at Bronzeville. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1800:

018	12" x 12" Blond Floor Tile
1	2' x 2' Lay In Ceiling Panels
101	12" x 12" Green vinyl Floor Tile
29	12" x 12" Tan w/ White & gray Specks Floor Tile
30	12" x 12" Tan w/ White & gray Specks Floor Tile Mastic
31	12" x 12" White w/ yellow Specks Floor Tile
32	12" x 12" White w/ yellow Specks Floor Tile Mastic
33	12" x 12" Beige w/ Dark Brown & Specks Floor Tile



- 34 12" x 12" Beige w/ Dark Brown & Specks Floor Tile Mastic
- 35 12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile
- 36 12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile Mastic
- 37 Tongue groove wooden floor

B. The following new homogenous areas have been identified for Building 1800:

- |    |   |
|----|---|
| 1  | 2' x 2' Lay In Ceiling Panels   |
| 29 | 12" x 12" Tan w/ White & gray Specks Floor Tile                         |
| 30 | 12" x 12" Tan w/ White &,gray Specks Floor Tile<br>Mastic               |
| 31 | 12" x 12" White w/ yellow Specks Floor Tile                             |
| 32 | 12" x 12" White w/ yellow Specks Floor Tile Mastic                      |
| 33 | 12" x 12" Beige w/ Dark Brown & Specks Floor<br>Tile                    |
| 34 | 12" x 12" Beige w/ Dark Brown & Specks Floor<br>Tile Mastic             |
| 35 | 12" x 12" Olive Green w/ Dark Green & White<br>Specks Floor Tile        |
| 36 | 12" x 12" Olive Green w/ Dark Green & White<br>Specks Floor Tile Mastic |
| 37 | Tongue groove wooden floor  |

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

001	2' x 2' Lay In Ceiling Panels
002	4" Green vinyl baseboard
003	4" Green vinyl baseboard adhesive
004	4" Blue vinyl baseboard
005	4" Blue vinyl baseboard adhesive
006	4" Gray vinyl baseboard
007	4" Gray vinyl baseboard adhesive
008	4" Blond vinyl baseboard
009	4" Blond vinyl baseboard adhesive
01	9" x 9" Black Vinyl Floor Tile - REMOVED
010	1" Light brown ceramic tile grout
011	1" Light brown ceramic tile grout adhesive
012	Drywall
013	Drywall compound
014	12" x 12" Blue/Gray Streaked Floor Tile
015	12" x 12" Blue/Gray Streaked Floor Tile Mastic
016	12" x 12" Green Mix Floor Tile
017	12" x 12" Green Mix Floor Tile Mastic
018	12" x 12" Blond Floor Tile
019	12" x 12" Blond Floor Tile Mastic
020	12" x 12" Gray Mix Floor Tile
021	12" x 12" Gray Mix Floor Tile Mastic
022	Quarry tile grout
023	Duct sealant
024	Adhesive
1	2' x 2' Lay In Ceiling Panels
101	12" x 12" Green vinyl Floor Tile
25	Carpet adhesive
26	Green, Red and Gray Terrazzo
27	12" x 12" White w/Blue Floor Tile
28	12" x 12" White w/Blue Floor Tile Mastic
29	12" x 12" Tan w/ White & gray Specks Floor Tile
30	12" x 12" Tan w/ White &,gray Specks Floor Tile Mastic
31	12" x 12" White w/ yellow Specks Floor Tile
32	12" x 12" White w/ yellow Specks Floor Tile Mastic
33	12" x 12" Beige w/ Dark Brown & Specks Floor Tile
34	12" x 12" Beige w/ Dark Brown & Specks Floor Tile Mastic
35	12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile

36	12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile Mastic
37	Tongue groove wooden floor
HA-100	2' x 4' White ceiling tile

The following areas were deemed to be inaccessible:

003	4" Green vinyl baseboard adhesive
005	4" Blue vinyl baseboard adhesive
007	4" Gray vinyl baseboard adhesive
009	4" Blond vinyl baseboard adhesive
010	1" Light brown ceramic tile grout
011	1" Light brown ceramic tile grout adhesive
013	Drywall compound
015	12" x 12" Blue/Gray Streaked Floor Tile Mastic
017	12" x 12" Green Mix Floor Tile Mastic
019	12" x 12" Blond Floor Tile Mastic
021	12" x 12" Gray Mix Floor Tile Mastic
022	Quarry tile grout
023	Duct sealant
024	Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ron Brock, IDPH License # 100-07134. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Chicago Military Academy at Bronzeville Building 1800 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Chicago Military Academy at Bronzeville Unit 70070 Building ID 1800

Address 3516 South Giles Avenue Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
001	2' x 2' Lay In Ceiling Panels	80,000	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	2		No	Any remaining friable ACBM or friable suspect ACBM		LOW
002	4" Green vinyl baseboard	700	LF	1st Floor Corridors, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
003	4" Green vinyl baseboard adhesive	700	LF	1st Floor Corridors, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
004	4" Blue vinyl baseboard	400	LF	1st Floor Southeast and Southwest Stairways	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
005	4" Blue vinyl baseboard adhesive	400	SF	1st Floor Southeast and Southwest Stairways	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
006	4" Gray vinyl baseboard	800	LF	3rd Floor Corridors, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
007	4" Gray vinyl baseboard adhesive	800	SF	3rd Floor Corridors, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
008	4" Blond vinyl baseboard	500	LF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
009	4" Blond vinyl baseboard adhesive	500	SF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
01	9" x 9" Black Vinyl Floor Tile - REMOVED				ASSUMED	MISC								
010	1" Light brown ceramic tile grout	1,800	SF	1st, 2nd & 3rd Floor Bathrooms	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
011	1" Light brown ceramic tile grout adhesive	1,800	SF	1st, 2nd & 3rd Floor Bathrooms	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
012	Drywall	30,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
013	Drywall compound	30,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
014	12" x 12" Blue/Gray Streaked Floor Tile	2,000	SF	1st Floor SE & SW Stairways and Kitchen	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Chicago Military Academy at Bronzeville Unit 70070 Building ID 1800

Address 3516 South Giles Avenue Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
015	12" x 12" Blue/Gray Streaked Floor Tile Mastic	2,000	SF	1st Floor SE & SW Stairways and Kitchen	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
016	12" x 12" Green Mix Floor Tile	3,000	SF	Classrooms 110, 111, 112 & 113	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with potential for significant damage		LOW
017	12" x 12" Green Mix Floor Tile Mastic	3,000	SF	Classrooms 110, 111, 112 & 113	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
018	12" x 12" Blond Floor Tile	4,000	SF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	DIST	50	SF	Yes	ACBM with the potential for damage	5	LOW
019	12" x 12" Blond Floor Tile Mastic	4,000	SF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	ASSUMED	MISC	N	DIST	50	SF	No	ACBM with the potential for damage	5	LOW
020	12" x 12" Gray Mix Floor Tile	10,800	SF	2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria	ASSUMED	MISC	N	LOC	50	SF	No	ACBM with the potential for damage	5	LOW
021	12" x 12" Gray Mix Floor Tile Mastic	10,800	SF	2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria	ASSUMED	MISC	N	DIST	50	SF	No	ACBM with the potential for damage	5	LOW
022	Quarry tile grout	500	SF	1st Floor Corridor	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
023	Duct sealant	2,000	SF	Basement	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
024	Adhesive	700	SF	Beneath All Marker Boards in the Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
1	2' x 2' Lay In Ceiling Panels	80,000	SF	Throughout Facility	ASSUMED	MISC	Y	LOC	2	SF	Yes	Damaged or significantly damaged friable misc. ACBM	9	LOW
101	12" x 12" Green vinyl Floor Tile	40	SF	Elevator	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
25	Carpet adhesive	1,650	SF	Offices, Media Center, Conference Room,	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW



# Chicago Public Schools

School Chicago Military Academy at Bronzeville Unit 70070 Building ID 1800

Address 3516 South Giles Avenue Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
26	Green, Red and Gray Terrazzo	10,000	SF	Entrance, stairwells, and hallways	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
27	12" x 12" White w/Blue Floor Tile		SF	Elevator	ASSUMED	MISC				SF				
28	12" x 12" White w/Blue Floor Tile Mastic		SF	Elevator	ASSUMED	MISC				SF				
29	12" x 12" Tan w/ White & gray Specks Floor Tile	200	SF	Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
30	12" x 12" Tan w/ White & gray Specks Floor Tile Mastic	200	SF	Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room	ASSUMED	MISC	N	LOC	2	SF	Yes	ACBM with the potential for damage	5	LOW
31	12" x 12" White w/ yellow Specks Floor Tile	500	SF	Rooms 1414, 1412, 1411	ASSUMED	MISC	N	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
32	12" x 12" White w/ yellow Specks Floor Tile Mastic	500	SF	Rooms 1414, 1412, 1411	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
33	12" x 12" Beige w/ Dark Brown & Specks Floor Tile	700	SF	Room 1319	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
34	12" x 12" Beige w/ Dark Brown & Specks Floor Tile Mastic	700	SF	Room 1319	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
35	12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile	700	SF	Room 1319	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
36	12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile Mastic	700	SF	Room 1319	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
37	Tongue groove wooden floor	500	SF	Rooms 200, Gymnasium	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
HA-100	2' x 4' White ceiling tile	5,000	SF	throughout the building	ASSUMED	MISC	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW

# Chicago Public Schools

School Chicago Military Academy at Bronzeville Unit 70070 Building ID 1800  
Address 3516 South Giles Avenue Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>12/8/2022</b>
Inspector Name <b>Ron Brock</b>
<b>100-07134</b> <b>5/15/2023</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
001	
002	
003	
004	
005	
006	
007	
008	
009	
01	Not observed 2022
010	
011	
012	
013	
014	
015	
016	
017	
018	Damage 2nd floor hallway through room 203
019	Damage 2nd floor hallway through room 203
020	Damage 2nd floor hallway through room 203
021	Damage 2nd floor hallway through room 203
022	
023	

# Chicago Public Schools

**School** Chicago Military Academy at Bronzeville **Unit** 70070 **Building ID** 1800

**Address** 3516 South Giles Avenue **Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
024	
1	Damage in Room 1212
101	
25	
26	
27	Not observed 2022
28	Not observed 2022
29	
30	Damage in 4th floor storage room
31	
32	
33	
34	
35	
36	
37	
HA-100	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Chicago Military Academy  
at Bronzeville

**Unit** 70070

**Building ID** 1800

**Address** 3516 South Giles Avenue

Chicago, IL, 60653

**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	2' x 2' Lay In Ceiling Panels	80,000	SF	Throughout Facility	Assumed	MISC	Yes	2	SF	7 Any remaining friable ACBM or friable suspect ACBM	
002	4" Green vinyl baseboard	700	LF	1st Floor Corridors, Classrooms, Alcoves & Offices	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
003	4" Green vinyl baseboard adhesive	700	LF	1st Floor Corridors, Classrooms, Alcoves & Offices	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
004	4" Blue vinyl baseboard	400	LF	1st Floor Southeast and Southwest Stairways	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
005	4" Blue vinyl baseboard adhesive	400	SF	1st Floor Southeast and Southwest Stairways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006	4" Gray vinyl baseboard	800	LF	3rd Floor Corridors, Classrooms, Alcoves & Offices	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
007	4" Gray vinyl baseboard adhesive	800	SF	3rd Floor Corridors, Classrooms, Alcoves & Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
008	4" Blond vinyl baseboard	500	LF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
009	4" Blond vinyl baseboard adhesive	500	SF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01	9" x 9" Black Vinyl Floor Tile - REMOVED				Assumed	MISC					Follow O&M Plan
010	1" Light brown ceramic tile grout	1,800	SF	1st, 2nd & 3rd Floor Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
011	1" Light brown ceramic tile grout adhesive	1,800	SF	1st, 2nd & 3rd Floor Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
012	Drywall	30,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
013	Drywall compound	30,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
014	12" x 12" Blue/Gray Streaked Floor Tile	2,000	SF	1st Floor SE & SW Stairways and Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
015	12" x 12" Blue/Gray Streaked Floor Tile Mastic	2,000	SF	1st Floor SE & SW Stairways and Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
016	12" x 12" Green Mix Floor Tile	3,000	SF	Classrooms 110, 111, 112 & 113	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Follow O&M Plan
017	12" x 12" Green Mix Floor Tile Mastic	3,000	SF	Classrooms 110, 111, 112 & 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
018	12" x 12" Blond Floor Tile	4,000	SF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	Assumed	MISC	No	50	SF	6 ACBM with the potential for damage	Repair
019	12" x 12" Blond Floor Tile Mastic	4,000	SF	2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices	Assumed	MISC	No	50	SF	6 ACBM with the potential for damage	Repair
020	12" x 12" Gray Mix Floor Tile	10,800	SF	2nd & 3rd Floor Classrooms, Corridors,	Assumed	MISC	No	50	SF	6 ACBM with the potential for damage	Repair

# Chicago Public Schools

School Chicago Military Academy  
at Bronzeville

Unit 70070

Building ID 1800

Address 3516 South Giles Avenue

Chicago, IL, 60653

Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria							
021	12" x 12" Gray Mix Floor Tile Mastic	10,800	SF	2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria	Assumed	MISC	No	50	SF	6 ACBM with the potential for damage	Repair
022	Quarry tile grout	500	SF	1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
023	Duct sealant	2,000	SF	Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
024	Adhesive	700	SF	Beneath All Marker Boards in the Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
1	2' x 2' Lay In Ceiling Panels	80,000	SF	Throughout Facility	Assumed	MISC	Yes	2	SF	4 Damaged or significantly damaged friable misc. ACBM	Remove
101	12" x 12" Green vinyl Floor Tile	40	SF	Elevator	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Carpet adhesive	1,650	SF	Offices, Media Center, Conference Room,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Green, Red and Gray Terrazzo	10,000	SF	Entrance, stairwells, and hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12" x 12" White w/Blue Floor Tile		SF	Elevator	Assumed	MISC			SF		Follow O&M Plan
28	12" x 12" White w/Blue Floor Tile Mastic		SF	Elevator	Assumed	MISC			SF		Follow O&M Plan
29	12" x 12" Tan w/ White & gray Specks Floor Tile	200	SF	Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12" x 12" Tan w/ White & gray Specks Floor Tile Mastic	200	SF	Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room	Assumed	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
31	12" x 12" White w/ yellow Specks Floor Tile	500	SF	Rooms 1414, 1412, 1411	Assumed	MISC	No	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
32	12" x 12" White w/ yellow Specks Floor Tile Mastic	500	SF	Rooms 1414, 1412, 1411	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12" x 12" Beige w/ Dark Brown & Specks Floor Tile	700	SF	Room 1319	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Beige w/ Dark Brown & Specks Floor Tile Mastic	700	SF	Room 1319	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile	700	SF	Room 1319	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile Mastic	700	SF	Room 1319	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Tongue groove wooden floor	500	SF	Rooms 200, Gymnasium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-100	2' x 4' White ceiling tile	5,000	SF	throughout the building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

# Chicago Public Schools

**School** Chicago Military Academy  
at Bronzeville  
**Address** 3516 South Giles Avenue

**Unit** 70070  
Chicago, IL, 60653

**Building ID** 1800  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

*Management Planner's Comments Summarized at the End of the Report*

Review Date	12/10/2022
Manager Planner Name	Evan Christian
100-19466	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002	
003	
004	
005	
006	

# Chicago Public Schools

**School** Chicago Military Academy  
at Bronzeville

**Unit** 70070

**Building ID** 1800

**Address** 3516 South Giles Avenue

Chicago, IL, 60653

**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
007	
008	
009	
01	
010	
011	
012	
013	
014	
015	
016	
017	
018	
019	
020	
021	
022	
023	
024	
1	Sample to Determine ACM Content
101	
25	
26	
27	
28	
29	



# Chicago Public Schools

**School** Chicago Military Academy  
at Bronzeville  
**Address** 3516 South Giles Avenue

**Unit** 70070  
Chicago, IL, 60653

**Building ID** 1800  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
30	Sample to determine ACM content.
31	
32	
33	
34	
35	
36	
37	
HA-100	

# APPENDIX A

## Assessment Sheets, Drawings and Photos

---

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2022 AHERA REINSPECTION***

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**  
MATERIAL DESCRIPTION: **2' x 2' Lay In Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **80000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **001**  
MATERIAL DESCRIPTION: **2' x 2' Lay In Ceiling Panels**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **80000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**  
MATERIAL DESCRIPTION: **4" Green vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridors, Classrooms, Alcoves & Offices**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **002**  
MATERIAL DESCRIPTION: **4" Green vinyl baseboard**  
MATERIAL LOCATION: **1st Floor Corridors, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**  
MATERIAL DESCRIPTION: **4" Green vinyl baseboard adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridors, Classrooms, Alcoves & Offices**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **003**  
MATERIAL DESCRIPTION: **4" Green vinyl baseboard adhesive**  
MATERIAL LOCATION: **1st Floor Corridors, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**  
MATERIAL DESCRIPTION: **4" Blue vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Southeast and Southwest Stairways**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **004**  
MATERIAL DESCRIPTION: **4" Blue vinyl baseboard**  
MATERIAL LOCATION: **1st Floor Southeast and Southwest Stairways**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005**  
MATERIAL DESCRIPTION: **4" Blue vinyl baseboard adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Southeast and Southwest Stairways**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **005**  
MATERIAL DESCRIPTION: **4" Blue vinyl baseboard adhesive**  
MATERIAL LOCATION: **1st Floor Southeast and Southwest Stairways**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Floor Corridors, Classrooms, Alcoves & Offices**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **006**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard**  
MATERIAL LOCATION: **3rd Floor Corridors, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Floor Corridors, Classrooms, Alcoves & Offices**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **007**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard adhesive**  
MATERIAL LOCATION: **3rd Floor Corridors, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**  
MATERIAL DESCRIPTION: **4" Blond vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **008**  
MATERIAL DESCRIPTION: **4" Blond vinyl baseboard**  
MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **009**  
MATERIAL DESCRIPTION: **4" Blond vinyl baseboard adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **009**  
MATERIAL DESCRIPTION: **4" Blond vinyl baseboard adhesive**  
MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **9" x 9" Black Vinyl Floor Tile - REMOVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **9" x 9" Black Vinyl Floor Tile - REMOVED**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **010**  
MATERIAL DESCRIPTION: **1" Light brown ceramic tile grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Bathrooms**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **010**  
MATERIAL DESCRIPTION: **1" Light brown ceramic tile grout**  
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Bathrooms**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011**  
MATERIAL DESCRIPTION: **1" Light brown ceramic tile grout adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Bathrooms**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **011**  
MATERIAL DESCRIPTION: **1" Light brown ceramic tile grout adhesive**  
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Bathrooms**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **012**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **013**  
MATERIAL DESCRIPTION: **Drywall compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **30000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **013**  
MATERIAL DESCRIPTION: **Drywall compound**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014**  
MATERIAL DESCRIPTION: **12" x 12" Blue/Gray Streaked Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor SE & SW Stairways and Kitchen**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **014**  
MATERIAL DESCRIPTION: **12" x 12" Blue/Gray Streaked Floor Tile**  
MATERIAL LOCATION: **1st Floor SE & SW Stairways and Kitchen**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015**  
MATERIAL DESCRIPTION: **12" x 12" Blue/Gray Streaked Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor SE & SW Stairways and Kitchen**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **015**  
MATERIAL DESCRIPTION: **12" x 12" Blue/Gray Streaked Floor Tile Mastic**  
MATERIAL LOCATION: **1st Floor SE & SW Stairways and Kitchen**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016**  
MATERIAL DESCRIPTION: **12" x 12" Green Mix Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 110, 111, 112 & 113**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **016**  
MATERIAL DESCRIPTION: **12" x 12" Green Mix Floor Tile**  
MATERIAL LOCATION: **Classrooms 110, 111, 112 & 113**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017**  
MATERIAL DESCRIPTION: **12" x 12" Green Mix Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 110, 111, 112 & 113**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **017**  
MATERIAL DESCRIPTION: **12" x 12" Green Mix Floor Tile Mastic**  
MATERIAL LOCATION: **Classrooms 110, 111, 112 & 113**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **018**  
MATERIAL DESCRIPTION: **12" x 12" Blond Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage  
Deterioration  
Other**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---


## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage  
Deterioration**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4000** DAMAGE UNITS: **SF**  
COMMENTS: **Damage 2nd floor hallway through room 203**

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **018**  
MATERIAL DESCRIPTION: **12" x 12" Blond Floor Tile**  
MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **019**  
MATERIAL DESCRIPTION: **12" x 12" Blond Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4000** DAMAGE UNITS: **SF**  
COMMENTS: **Damage 2nd floor hallway through room 203**

Inspector's Signature: \_\_\_\_\_



Date: 12/08/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **019**  
MATERIAL DESCRIPTION: **12" x 12" Blond Floor Tile Mastic**  
MATERIAL LOCATION: **2nd Floor Corridors, Lunchroom, Kitchen, Classrooms, Alcoves & Offices**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **020**  
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria**  
MATERIAL QUANTITY: **10800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS: **Damage 2nd floor hallway through room 203**

Inspector's Signature: \_\_\_\_\_



Date: 12/08/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **020**  
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile**  
MATERIAL LOCATION: **2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria**  
MATERIAL QUANTITY: **10800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **021**  
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria**  
MATERIAL QUANTITY: **10800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS: **Damage 2nd floor hallway through room 203**

Inspector's Signature: \_\_\_\_\_



Date: 12/08/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **021**  
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile Mastic**  
MATERIAL LOCATION: **2nd & 3rd Floor Classrooms, Corridors, Stairways, Alcoves, Kitchen, Kitchen Office & Cafeteria**  
MATERIAL QUANTITY: **10800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **022**  
MATERIAL DESCRIPTION: **Quarry tile grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **022**  
MATERIAL DESCRIPTION: **Quarry tile grout**  
MATERIAL LOCATION: **1st Floor Corridor**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **023**  
MATERIAL DESCRIPTION: **Duct sealant**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **023**  
MATERIAL DESCRIPTION: **Duct sealant**  
MATERIAL LOCATION: **Basement**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **024**  
MATERIAL DESCRIPTION: **Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Beneath All Marker Boards in the Facility**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **024**  
MATERIAL DESCRIPTION: **Adhesive**  
MATERIAL LOCATION: **Beneath All Marker Boards in the Facility**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **101**  
MATERIAL DESCRIPTION: **12" x 12" Green vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage  
Deterioration**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Elevator**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **101**  
MATERIAL DESCRIPTION: **12" x 12" Green vinyl Floor Tile**  
MATERIAL LOCATION: **Elevator**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Carpet adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Offices, Media Center, Conference Room,**

MATERIAL QUANTITY: **1650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Carpet adhesive**  
MATERIAL LOCATION: **Offices, Media Center, Conference Room,**  
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Green, Red and Gray Terrazzo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Entrance, stairwells, and hallways**

MATERIAL QUANTITY: **10000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Green, Red and Gray Terrazzo**  
MATERIAL LOCATION: **Entrance, stairwells, and hallways**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12" x 12" White w/Blue Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Elevator**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12" x 12" White w/Blue Floor Tile**  
MATERIAL LOCATION: **Elevator**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12" x 12" White w/Blue Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Elevator**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12" x 12" White w/Blue Floor Tile Mastic**  
MATERIAL LOCATION: **Elevator**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at  
Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-100**  
MATERIAL DESCRIPTION: **2' x 4' White ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **throughout the building**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

HOMOGENEOUS AREA: **HA-100**  
MATERIAL DESCRIPTION: **2' x 4' White ceiling tile**  
MATERIAL LOCATION: **throughout the building**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" White w/ yellow Specks Floor Tile**  
MATERIAL LOCATION: **Rooms 1414, 1412, 1411**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12" x 12" White w/ yellow Specks Floor Tile**

MATERIAL LOCATION: **Rooms 1414, 1412, 1411**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile**  
MATERIAL LOCATION: **Room 1319**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile**

MATERIAL LOCATION: **Room 1319**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Dark Brown & Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Room 1319**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **70070**      BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville**      REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue**      IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **12" x 12" Beige w/ Dark Brown & Specks Floor Tile Mastic**

MATERIAL LOCATION: **Room 1319**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:       Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White &,gray Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **2** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in 4th floor storage room

Inspector's Signature: \_\_\_\_\_



Date: 12/08/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**

ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ White &,gray Specks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content.

Management Planner's Signature: \_\_\_\_\_



Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **Tongue groove wooden floor**  
MATERIAL LOCATION: **Rooms 200, Gymnasium**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 12/08/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**

ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Tongue groove wooden floor**

MATERIAL LOCATION: **Rooms 200, Gymnasium**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Room 1319**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12" x 12" Olive Green w/ Dark Green & White Specks Floor Tile Mastic**

MATERIAL LOCATION: **Room 1319**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **12/10/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **2' x 2' Lay In Ceiling Panels**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **80000** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **4 Damaged or significantly damaged friable misc. ACBM**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **2** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:  
Damage in Room 1212

Inspector's Signature: \_\_\_\_\_



Date: 12/08/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **1**  
MATERIAL DESCRIPTION: **2' x 2' Lay In Ceiling Panels**  
MATERIAL LOCATION: **Throughout Facility**  
MATERIAL QUANTITY: **80000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to Determine ACM Content

Management Planner's Signature:  Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12" x 12" White w/ yellow Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 1414, 1412, 1411**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12" x 12" White w/ yellow Specks Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 1414, 1412, 1411**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Dark Brown & Specks Floor Tile**  
MATERIAL LOCATION: **Room 1319**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**

ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **12" x 12" Beige w/ Dark Brown & Specks Floor Tile**

MATERIAL LOCATION: **Room 1319**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 12/10/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUIDLING ID: **1800**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**  
SCHOOL NAME: **Chicago Military Academy at Bronzeville** INSPECTION DATE: **12/8/2022**  
ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White & gray Specks Floor Tile**  
MATERIAL LOCATION: **Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **12/08/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **70070** BUILDING ID: **1800**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Chicago Military Academy at Bronzeville** REVIEW DATE: **12/10/2022**

ADDRESS: **3516 South Giles Avenue** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ White & gray Specks Floor Tile**

MATERIAL LOCATION: **Rooms 1414, 1412, 1411, RTC supply room, 4th floor storage room**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature:  Date: **12/10/2022**

# APPENDIX B

## Inspector and Management Planner Licenses

---

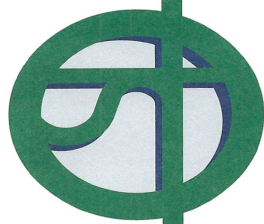

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that  
**Ron Brock**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/19/2022

Exam Date: 1/19/2022



Expiration Date: 1/19/2023

Certificate Number: B1R2201190225

Kathy DeSalvo, Director

# Ronald Brock

Illinois Licensed Building Inspector, Air Sampling Professional, Asbestos Project Manager

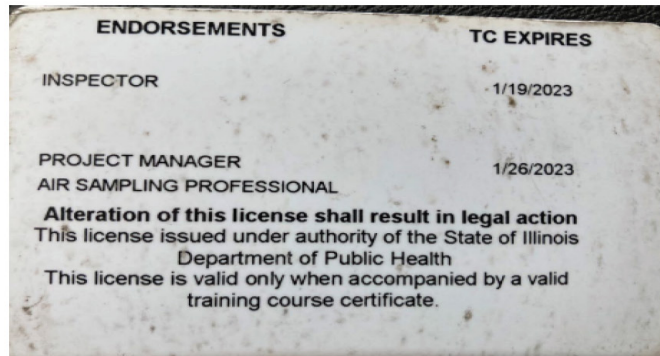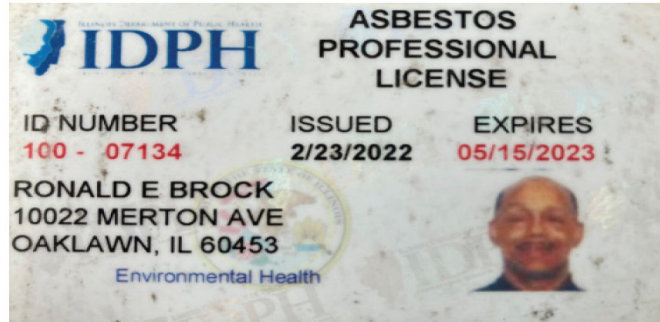





OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012581

Kathy DeSalvo, Director



# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: MPR2211033519

  
Kathy DeSalvo, Director



# ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

**100 - 19466**

ISSUED

**4/22/2022**

EXPIRES

**05/15/2023**

**EVAN I CHRISTIAN**  
**1119 N HOYNE AVE, APT 1**  
**CHICAGO, IL 60622**

Environmental Health



## ENDORSEMENTS

## TC EXPIRES

INSPECTOR

10/8/2022

MANAGEMENT PLANNER

11/1/2022

PROJECT MANAGER


3/28/2023

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**

This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

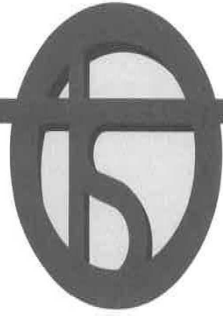

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082264

Kathy DeSalvo, Director



# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113639

Kathy DeSalvo, Director -

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---



## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed