

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2322
SCHOOL NAME: Burnham @ Lawrence School
ADDRESS OF SCHOOL: 9928 S. Crandon Avenue
CITY: Chicago, IL, 60617

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 10/27/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/9/2025 ENROLLMENT 417
IDPH INSPECTOR LICENSE NUMBER: 100-19716
IDPH LICENSED INSPECTOR NAME (Please Print): Imani Robinson
IDPH MP LICENSE NUMBER: 100-01784
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Steven Geneser

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 6/3/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Burnham @ Lawrence School

9928 S. Crandon Avenue
Chicago, IL, 60617

Unit: 22431
Building ID: 4550

IDPH ID Number: 14-016-2990-2322

REPORT DATE:
Tuesday, June 03, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
TEM Environmental, Inc.

174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone 630-790-0880
Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

06/02/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24261 Region: 06 IDPH ID: 14-016-2990-2322

School: Burnham @ Lawrence School Building ID: 4550

Address: 9928 S. Crandon Avenue

Chicago, IL, 60617

Building Contact: Cain, David Contact Phone: 7737096129

Current Building Owners: Chicago Public Schools

Reinspection Date: 5/9/2025

Review Date: 06/02/2025

Inspector: Imani Robinson


Inspector IDPH License: 100-19716

Management Planner: Steven Geneser

Management Planner IDPH License: 100-01784

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

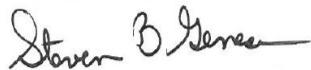

Steven Geneser
100-01784

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: June 03, 2025

RE: Burnham @ Lawrence School, Unit 22431
9928 S. Crandon Avenue
Chicago, IL, 60617

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Burnham @ Lawrence School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Burnham @ Lawrence School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Burnham @ Lawrence School
Address: 9928 S. Crandon Avenue
IDPH ID: 14-016-2990-2322
Contact: Cain, David

Unit: 24261
Chicago, IL, 60617
Building ID: 4550
Phone: 7737096129

Region: 06

2. Description of Facility

Original Construction: 1951
Total Square Footage: 29228
Current Occupancy: 417

Additional Construction: 1945,1948,1950
No of Floors: 2

3. LEA Designated Person

Contact: Richard J.Schleyer
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 251-7074

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Phone: 630-790-0880

Fax: 630-790-0882

5. Inspector

Inspector Name: Imani Robinson

Inspector IDPH license # 100-19716
Reinspection Date: 5/9/2025


Signature:
Date: 5/9/2025

6. Management Planner

Management Planner Name: Steven Geneser

Management Planner IDPH license # 100-01784


Signature:
Date: 06/02/2025

7. Review Date: 06/02/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.


Signature:

Date: 6/3/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Burnham @ Lawrence School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4550:

| | |
|-----|--|
| 86 | 12x12 Grey, White & Dark Grey Floor Tile |
| 86A | Mastic associated with 12x12 Grey White & Dark Grey Floor Tile |
| 87 | 12x12 Yellow, Blue & White w/Blue Specks Floor Tile |
| 87A | Mastic associated with 12x12 Yellow, Blue & White w/Blue Specks Floor Tile |
| 88 | Mastic associated with 24x24 Blue Green & Grey Rubber Floor Tile |
| 89 | 12"x12" Cream w/Specs Floor Tile |
| 89M | Mastic associated w/12"x12" Cream w/Specs Floor Tile |

| | |
|-----|--|
| 90 | 12"x12" Red & Brown Floor Tile (checker pattern) |
| 90M | Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern) |
| E | Aircell Pipe Insulation ABATED |
| F | Aircell Pipe Joint Insulation ABATED |
| G | Paperwrap Pipe Insulation ABATED |
| H | Paperwrap Pipe Joint Insulation ABATED |
| I | Paperwrap Pipe ABATED |
| J | Paperwrap Pipe Insulation ABATED |
| K | Aircell Pipe Insulation ABATED |
| M | Aircell Pipe Insulation ABATED |
| N | Aircell Pipe Joint Insulation ABATED |
| NEW | Newly Installed Suspect ACM |
| O | Paperwrap Joint Insulation ABATED |
| P | Paperwrap Pipe Insulation ABATED |
| Q | Mag Block Pipe Insulation ABATED |
| R | Paperwrap Pipe Joint Insulation ABATED |
| S | Paperwrap Pipe Joint Insulation ABATED |
| U | Fiberglass Joint Insulation ABATED |
| V | Duct Insulation Tape ABATED |

B. The following new homogenous areas have been identified for Building 4550:

- | | |
|-----|--|
| 89 | 12"x12" Cream w/Specs Floor Tile |
| 89M | Mastic associated w/12"x12" Cream w/Specs Floor Tile |
| 90 | 12"x12" Red & Brown Floor Tile (checker pattern) |
| 90M | Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern) |

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

| | |
|------|---|
| 01 | 12x12 Red w/Orange Vinyl Floor Tile NOT OBSERVED |
| 04 | 12x12 Blue Vinyl Floor Tile |
| 06 | Ceiling Stucco NOT OBSERVED |
| 09 | No Change NOT OBSERVED |
| 10 | 12x12 Red & Orange Vinyl Floor Tile |
| 100 | 12x12 White w/Blue Streaks Floor Tile |
| 100A | 12x12 White w/Blue Streaks Floor Tile Mastic |
| 101 | 12x12 Gold Floor Tile |
| 101A | 12x12 Gold Floor Tile Mastic |
| 102 | 12x12 Red w/Black Streaks Floor Tile |
| 102A | 12x12 Red w/Black Streaks Floor Tile Mastic |
| 15 | 12x12 Light Brown Vinyl Floor Tile |
| 16 | 12x12 Red & Orange Floor Tile Mastic |
| 23 | 12x12 Green Vinyl Floor Tile NOT OBSERVED |
| 24 | 12x12 White Vinyl Floor Tile NOT OBSERVED |
| 25 | 12x12 White Vinyl Floor Tile NOT OBSERVED |
| 28 | 12x12 Red & Orange Vinyl Floor Tile Mastic NOT OBSERVED |
| 29 | 12x12 Blue Vinyl Floor Tile Mastic |
| 31 | 12x12 Red & Tan Vinyl Floor Tile Mastic |
| 35 | 12x12 White Vinyl Floor Tile Mastic NOT OBSERVED |
| 36 | 12x12 White Vinyl Floor Tile Mastic-NOT OBSERVED |
| 40 | Blue Carpet Mastic NOT OBSERVED |
| 41 | Green Carpet Mastic NOT OBSERVED |
| 42 | Red Carpet Mastic NOT OBSERVED |
| 43 | Black Vinyl Baseboard |
| 44 | Black Vinyl Baseboard Mastic |
| 45 | 12x12 Ceiling Tile |
| 46 | 12x12 Ceiling Tile Mastic |
| 47 | Insulation in Fire Rated Doors |
| 48 | 2'x4' Ceiling Tile |
| 51 | 12x12 White Vinyl Floor Tile NOT OBSERVED |
| 52 | 12x12 Light Red Vinyl Floor Tile |
| 54 | 12x12 White Vinyl Floor Tile Mastic |
| 55 | 12x12 Light Red Vinyl Floor Tile Mastic |
| 56 | 12x12 Brown & Tan Vinyl Floor Tile Mastic |
| 57 | Plaster |
| 58 | Plaster |
| 59 | Plaster |

| | |
|-----|--|
| 60 | Plaster |
| 61 | Green Carpet Mastic NOT OBSERVED |
| 62 | Magenta Carpet Mastic NOT OBSERVED |
| 63 | Brown Carpet Mastic NOT OBSERVED |
| 64 | Blue Carpet Mastic NOT OBSERVED |
| 65 | Rust Carpet Mastic |
| 66 | 12x12 Light Pink Floor Tile NOT OBSERVED |
| 67 | 12x12 Light Pink Floor Tile Mastic NOT OBSERVED |
| 68 | 12x12 Maroon Floor Tile NOT OBSERVED |
| 69 | 12x12 Maroon Floor Tile Mastic NOT OBSERVED |
| 70 | 12x12 White w/Blue Specks Floor Tile NOT OBSERVED |
| 71 | 12x12 White w/Blue Specks Floor Tile Mastic NOT OBSERVED |
| 72 | 12x12 Dark Blue Floor Tile NOT OBSERVED |
| 73 | 12x12 Dark Blue Floor Tile Mastic NOT OBSERVED |
| 74 | Gray Terrazzo Floor |
| 75 | Brown Mosaic Ceramic Tile Grout |
| 76 | Brown Mosaic Ceramic Tile Adhesive |
| 77 | Ivory Ceramic Tile Grout |
| 78 | Ivory Ceramic Tile Adhesive |
| 79 | 12x12 Off-White w/Gray Specks Floor Tile |
| 79M | 12x12 Off-White w/Gray Specks Floor Tile Mastic |
| 80 | Blue Checkered Carpet Adhesive NOT OBSERVED |
| 81 | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic |
| 81A | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic |
| 82 | 12x12 White w/Multi-Color Single Tiles & Mastic |
| 82A | 12x12 White w/Multi-Color Single Tiles & Mastic |
| 83 | 12x12 Gray Streaked Vinyl Floor Tile & Mastic |
| 83A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic |
| 84 | 12x12 Gray Streaked Vinyl Floor Tile |
| 84A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic |
| 85 | 12x12 Maroon Vinyl Floor Tile |
| 85A | 12x12 Maroon Vinyl Floor Tile Mastic |
| 86 | 12x12 Grey, White & Dark Grey Floor Tile |
| 86A | Mastic associated with 12x12 Grey White & Dark Grey Floor Tile |
| 87 | 12x12 Yellow, Blue & White w/Blue Specks Floor Tile |
| 87A | Mastic associated with 12x12 Yellow, Blue & White w/Blue Specks Floor Tile |
| 88 | Mastic associated with 24x24 Blue Green & Grey Rubber Floor Tile |
| 89 | 12"x12" Cream w/Specks Floor Tile |

| | |
|-----|--|
| 89M | Mastic associated w/12"x12" Cream w/Specs Floor Tile |
| 90 | 12"x12" Red & Brown Floor Tile (checker pattern) |
| 90M | Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern) |
| NEW | Newly Installed Suspect ACM |

The following areas were deemed to be inaccessible:

| | |
|------|---|
| 100A | 12x12 White w/Blue Streaks Floor Tile Mastic |
| 101A | 12x12 Gold Floor Tile Mastic |
| 102A | 12x12 Red w/Black Streaks Floor Tile Mastic |
| 16 | 12x12 Red & Orange Floor Tile Mastic |
| 17 | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED |
| 18 | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED |
| 20 | 9x9 Tan Vinyl Floor Tile Mastic |
| 21 | Transite Insulation |
| 28 | 12x12 Red & Orange Vinyl Floor Tile Mastic NOT OBSERVED |
| 29 | 12x12 Blue Vinyl Floor Tile Mastic |
| 30 | 12x12 Red & Tan Vinyl Floor Tile Mastic |
| 31 | 12x12 Red & Tan Vinyl Floor Tile Mastic |
| 32 | Black Border Vinyl Floor Tile Mastic |
| 33 | Black Border Vinyl Floor Tile Mastic |
| 34 | 12x12 Green Vinyl Floor Tile Mastic NOT OBSERVED |
| 35 | 12x12 White Vinyl Floor Tile Mastic NOT OBSERVED |
| 37 | 12x12 Light Brown Vinyl Floor Tile Mastic |
| 38 | 12x12 Crème Vinyl Floor Tile Mastic |
| 39 | 9x9 Crème Vinyl Floor Tile Mastic NOT OBSERVED |
| 41 | Green Carpet Mastic NOT OBSERVED |
| 42 | Red Carpet Mastic NOT OBSERVED |
| 44 | Black Vinyl Baseboard Mastic |
| 46 | 12x12 Ceiling Tile Mastic |
| 47 | Insulation in Fire Rated Doors |
| 49 | 9x9 Green & Red Vinyl Floor Tile Mastic NOT OBSERVED |
| 50 | 9x9 Black & Green Vinyl Floor Tile Mastic NOT OBSERVED |
| 54 | 12x12 White Vinyl Floor Tile Mastic |
| 55 | 12x12 Light Red Vinyl Floor Tile Mastic |
| 56 | 12x12 Brown & Tan Vinyl Floor Tile Mastic |

| | |
|-----|--|
| 61 | Green Carpet Mastic NOT OBSERVED |
| 62 | Magenta Carpet Mastic NOT OBSERVED |
| 65 | Rust Carpet Mastic |
| 67 | 12x12 Light Pink Floor Tile Mastic NOT OBSERVED |
| 69 | 12x12 Maroon Floor Tile Mastic NOT OBSERVED |
| 71 | 12x12 White w/Blue Specks Floor Tile Mastic NOT OBSERVED |
| 73 | 12x12 Dark Blue Floor Tile Mastic NOT OBSERVED |
| 76 | Brown Mosaic Ceramic Tile Adhesive |
| 78 | Ivory Ceramic Tile Adhesive |
| 79M | 12x12 Off-White w/Gray Specks Floor Tile Mastic |
| 80 | Blue Checkered Carpet Adhesive NOT OBSERVED |
| 81 | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic |
| 81A | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic |
| 82 | 12x12 White w/Multi-Color Single Tiles & Mastic |
| 82A | 12x12 White w/Multi-Color Single Tiles & Mastic |
| 83 | 12x12 Gray Streaked Vinyl Floor Tile & Mastic |
| 83A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic |
| 84A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic |
| 85A | 12x12 Maroon Vinyl Floor Tile Mastic |

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Imani Robinson, IDPH License # 100-19716. The Management Plan was updated by Steven Geneser, IDPH License # 100-01784. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Burnham @ Lawrence School Building 4550 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|--|---------------|-----------------------|
| 01 | 12x12 Red w/Orange Vinyl Floor Tile NOT OBSERVED | 2,500 | SF | 1948 Addition-Corridors | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 02 | 9x9 Green & Red Vinyl Floor Tile NOT OBSERVED | 25 | SF | 1948 Addition-Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 03 | 9x9 Black & Gray Vinyl Floor Tile NOT OBSERVED | 25 | SF | 1948 Addition-Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 04 | 12x12 Blue Vinyl Floor Tile | 1,600 | SF | 1948 Addition-Room 101, 102, 106, 112, 115, 116, 117, 210, 212, 213, 215, 217 & 218 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 05 | 12x12 Red & Tan Vinyl Floor Tile NOT OBSERVED | 2,450 | SF | 1944 Addition-Classrooms | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 06 | Ceiling Stucco NOT OBSERVED | 6,025 | SF | 1958 Addition-Corridors & Classrooms | ASSUMED | SURFACE | Y | NONE | 0 | | No | Any remaining friable ACBM or friable suspect ACBM | | LOW |
| 07 | 12x12 Tan & Red Vinyl Floor Tile NOT OBSERVED | 3,700 | SF | 1948 Addition-Classrooms, Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 08 | Black Border Vinyl Floor Tile | 800 | SF | 1944 Addition-Classrooms 112, 116, 117, 210, 212, 215 & 217 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 09 | No Change NOT OBSERVED | | | This Material was Removed, but No Management Report or Records for the Removal were Ascertainable | ASSUMED | MISC | | | | | | | | |
| 10 | 12x12 Red & Orange Vinyl Floor Tile | 3,900 | SF | 1944 Addition-Corridors & Classroom 110 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 100 | 12x12 White w/Blue Streaks Floor Tile | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 100A | 12x12 White w/Blue Streaks Floor Tile Mastic | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 101 | 12x12 Gold Floor Tile | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 101A | 12x12 Gold Floor Tile Mastic | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 102 | 12x12 Red w/Black Streaks Floor Tile | 4,000 | SF | Rooms 112, 116, 117, 210, 212, 215, 217 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 102A | 12x12 Red w/Black Streaks Floor Tile | 4,000 | SF | Rooms 112, 116, | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the | | LOW |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| | Mastic | | | 117, 210, 212, 215, 217 | | | | | | | | potential for damage | | |
| 11 | 12x12 Green & Tan Vinyl Floor Tile | 1,125 | SF | 1948 Addition-Corridors; 1951 Addition-Lunchrooms | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 12 | 12x12 Green & Tan Vinyl Floor Tile | 5,200 | SF | 1951 Addition-Corridors & Classrooms | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 13 | 9x9 Tan Vinyl Floor Tile ABATED | | | 1958 Corridors | ABATED | MISC | | | | | | | | |
| 14 | 9x9 Tan Vinyl Floor Tile | 6,000 | SF | 1944 Addition-Classrooms 107-109, 201, 202, 205, 207 - 209, 211; 1st & 2nd Hallway S & SW | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 15 | 12x12 Light Brown Vinyl Floor Tile | 25 | SF | 1951 & 1958 Additions- Corridors | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 15J | 12x12 Red Vinyl Floor Tile NOT OBSERVED | | | Room 206 | CHR | MISC | | NONE | 0 | | | ACBM with the potential for damage | | |
| 16 | 12x12 Red & Orange Floor Tile Mastic | 3,900 | SF | 1944 Addition-Corridors & Classroom 110 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 17 | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED | 5,025 | SF | 1948 Addition-Corridors | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 18 | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED | 5,200 | SF | 1951 Addition-Corridors & Classrooms | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 19 | 9x9 Tan Vinyl Floor Tile Mastic ABATED | | | 1958 Addition-Corridors | ABATED | MISC | | | | | | | | |
| 20 | 9x9 Tan Vinyl Floor Tile Mastic | 1,350 | SF | 1944 Addition-Classrooms 211 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 21 | Transite Insulation | 30 | SF | Roof Access Panel | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 22 | 12x12 Black Border Vinyl Floor Tile | 675 | SF | 1948 Addition-Classrooms, Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 23 | 12x12 Green Vinyl Floor Tile NOT OBSERVED | | | 1944 Addition-Classroom 214 | ASSUMED | MISC | | | | | | | | |
| 24 | 12x12 White Vinyl Floor Tile NOT OBSERVED | 4,900 | SF | 1951 Addition-Lunchroom & Teachers' Lounge (Carpeted Over in Teachers' Lounge | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| | | | | w/Red Carpet) | | | | | | | | | | |
| 25 | 12x12 White Vinyl Floor Tile NOT OBSERVED | 675 | SF | 1944 Addition-Main Office | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 26 | 12x12 Crème Vinyl Floor Tile NOT OBSERVED | 25 | SF | 1951 Addition-Corridor | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 27 | 9x9 Crème Vinyl Floor Tile NOT OBSERVED | 10 | SF | 1958 Addition-Corridor | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 28 | 12x12 Red & Orange Vinyl Floor Tile Mastic NOT OBSERVED | 2,500 | SF | 1948 Addition-Corridors | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 29 | 12x12 Blue Vinyl Floor Tile Mastic | 950 | SF | 1948 Addition-Rooms 101, 102, 106, 115 & 218 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 30 | 12x12 Red & Tan Vinyl Floor Tile Mastic | 2,450 | SF | 1944 Addition-Classrooms, Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 31 | 12x12 Red & Tan Vinyl Floor Tile Mastic | 3,700 | SF | 1948 Building-Classrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 32 | Black Border Vinyl Floor Tile Mastic | 650 | SF | 1944 Addition-Classrooms | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 33 | Black Border Vinyl Floor Tile Mastic | 675 | SF | 1948 Addition-Classrooms, Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 34 | 12x12 Green Vinyl Floor Tile Mastic NOT OBSERVED | | SF | 1944 Addition-Classroom 214 | CHR | MISC | N | | 0 | | No | ACBM with the potential for damage | | LOW |
| 35 | 12x12 White Vinyl Floor Tile Mastic NOT OBSERVED | 1,000 | SF | 1951 Addition-Lunchrooms (Replaced) & Teachers' Lounge (Carpeted Over with Red Carpet) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 36 | 12x12 White Vinyl Floor Tile Mastic-NOT OBSERVED | | | 1944 Main Office | ASSUMED | MISC | | NONE | 0 | | | ACBM with the potential for damage | | |
| 37 | 12x12 Light Brown Vinyl Floor Tile Mastic | 25 | SF | 1951 & 1958 Buildings- Corridors | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 38 | 12x12 Crème Vinyl Floor Tile Mastic | 25 | SF | 1951 Addition-Corridor | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 39 | 9x9 Crème Vinyl Floor Tile Mastic NOT OBSERVED | 10 | SF | 1958 Corridor | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 40 | Blue Carpet Mastic NOT OBSERVED | | | 1948 Building-Room 218 | ASSUMED | MISC | | NONE | 0 | | | ACBM with the potential for damage | | |
| 41 | Green Carpet Mastic NOT OBSERVED | 675 | SF | 1951 Addition-Room 221 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 42 | Red Carpet Mastic NOT OBSERVED | 4,500 | SF | 1944, '48 & '51 Additions- | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|--|---------------|-----------------------|
| | | | | Classrooms & Offices | | | | | | | | | | |
| 43 | Black Vinyl Baseboard | 1,560 | LF | 1958 Addition-Classrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 44 | Black Vinyl Baseboard Mastic | 1,560 | LF | 1958 Addition-Classrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 45 | 12x12 Ceiling Tile | 900 | SF | 1951 Addition-Room 221 | ASSUMED | MISC | Y | NONE | 0 | | No | Any remaining friable ACBM or friable suspect ACBM | | LOW |
| 46 | 12x12 Ceiling Tile Mastic | 900 | SF | 1951 Addition-Room 221 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 47 | Insulation in Fire Rated Doors | 10 | EA | Basement | ASSUMED | TSI | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 48 | 2'x4' Ceiling Tile | 4,500 | SF | 1948 & 1951 Additions- Corridors & Lunchrooms | ASSUMED | MISC | Y | NONE | 0 | | No | Any remaining friable ACBM or friable suspect ACBM | | LOW |
| 49 | 9x9 Green & Red Vinyl Floor Tile Mastic NOT OBSERVED | 25 | SF | 1948 Addition-Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 50 | 9x9 Black & Green Vinyl Floor Tile Mastic NOT OBSERVED | 25 | SF | 1948 Addition-Room 116 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 51 | 12x12 White Vinyl Floor Tile NOT OBSERVED | 250 | SF | 1952 Addition-1st Floor Teachers' Lounge | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 52 | 12x12 Light Red Vinyl Floor Tile | 4,000 | SF | 1948 Building- 1 & 2 Hallway North Border, 110, 117, 118 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 53 | 12x12 Brown & Tan Vinyl Floor Tile | 4,000 | SF | 1948 Building-Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 54 | 12x12 White Vinyl Floor Tile Mastic | 250 | SF | 1951 Building- 1st Floor Teachers' Lounge | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 55 | 12x12 Light Red Vinyl Floor Tile Mastic | 4,000 | SF | 1948 Building- 1 & 2 Hallway North Border, 110, 118 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 56 | 12x12 Brown & Tan Vinyl Floor Tile | 4,000 | SF | 1948 Building- | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the | | LOW |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| | Mastic | | | Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom | | | | | | | | potential for damage | | |
| 57 | Plaster | 30,000 | SF | Throughout 1944 Building | ASSUMED | SURFACE | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 58 | Plaster | 28,000 | SF | Throughout 1948 Addition | ASSUMED | SURFACE | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 59 | Plaster | 28,000 | SF | Throughout 1951 Addition | ASSUMED | SURFACE | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 60 | Plaster | 62,000 | SF | Throughout 1958 Addition | ASSUMED | SURFACE | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 61 | Green Carpet Mastic NOT OBSERVED | 660 | SF | Room 221 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 62 | Magenta Carpet Mastic NOT OBSERVED | 1,500 | SF | 1951 Addition-Teachers' Lounge, Rooms 207A, 113A & 114 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 63 | Brown Carpet Mastic NOT OBSERVED | | | Rooms 216 & 219 | ASSUMED | MISC | | | 0 | | | | | |
| 64 | Blue Carpet Mastic NOT OBSERVED | | | Room 218 | ASSUMED | MISC | | NONE | 0 | | | ACBM with the potential for damage | | |
| 65 | Rust Carpet Mastic | 450 | SF | Room 111 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 66 | 12x12 Light Pink Floor Tile NOT OBSERVED | 600 | SF | Room 102 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 67 | 12x12 Light Pink Floor Tile Mastic NOT OBSERVED | 600 | SF | Room 102 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 68 | 12x12 Maroon Floor Tile NOT OBSERVED | 100 | SF | Room 102 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 69 | 12x12 Maroon Floor Tile Mastic NOT OBSERVED | 100 | SF | Room 102 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 70 | 12x12 White w/Blue Specks Floor Tile NOT OBSERVED | 800 | SF | Room 103 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 71 | 12x12 White w/Blue Specks Floor Tile Mastic NOT OBSERVED | 800 | SF | Room 103 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 72 | 12x12 Dark Blue Floor Tile NOT OBSERVED | 120 | SF | Room 103 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 73 | 12x12 Dark Blue Floor Tile Mastic NOT OBSERVED | 120 | SF | Room 103 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 74 | Gray Terrazzo Floor | 1,200 | SF | Stairways to 2nd Floor | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 75 | Brown Mosaic Ceramic Tile Grout | 3,550 | SF | 1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 76 | Brown Mosaic Ceramic Tile Adhesive | 3,550 | SF | 1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 77 | Ivory Ceramic Tile Grout | 1,100 | SF | 1st & 2nd Floor Center Boys' and Girls' Washrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 78 | Ivory Ceramic Tile Adhesive | 1,110 | SF | 1st & 2nd Floor Center Boys' and Girls' Washrooms | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 79 | 12x12 Off-White w/Gray Specks Floor Tile | 1,500 | SF | 114, 206, & Main Office (Public Area) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 79M | 12x12 Off-White w/Gray Specks Floor Tile Mastic | 1,500 | SF | 206, 207A & Main Office (Public Area) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 80 | Blue Checkered Carpet Adhesive NOT OBSERVED | 1,640 | SF | Main Office | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 81 | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic | 50 | SF | 2nd Floor Corridor (under Drinking Fountains) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 81A | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic | 50 | SF | 2nd Floor Corridor (under Drinking Fountains) | ASSUMED | MISC | N | | 0 | | No | ACBM with the potential for damage | | LOW |
| 82 | 12x12 White w/Multi-Color Single Tiles & Mastic | 1,600 | SF | Rooms 106 & 213 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 82A | 12x12 White w/Multi-Color Single Tiles & Mastic | 1,600 | SF | Room 106 & 213 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 83 | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | 1,200 | SF | Room 207, 209, 214, 216 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 83A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | 800 | SF | Room 214 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 84 | 12x12 Gray Streaked Vinyl Floor Tile | 1,600 | SF | Room 120/122 (Addition) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 84A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | 1,600 | SF | Room 120/122 (Addition) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 85 | 12x12 Maroon Vinyl Floor Tile | 100 | SF | 1st & 2nd Floor Corridor near | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| | | | | Elevator and Unisex Bathroom | | | | | | | | | | |
| 85A | 12x12 Maroon Vinyl Floor Tile Mastic | 100 | SF | 1st & 2nd Floor Corridor near Elevator and Unisex Bathroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 86 | 12x12 Grey, White & Dark Grey Floor Tile | 3,135 | SF | Teachers' Lounge (Room 101), 103, Main Office & Principal's Office | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 86A | Mastic associated with 12x12 Grey White & Dark Grey Floor Tile | 3,135 | SF | Teachers' Lounge (Room 101), 103, Main Office & Principal's Office | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 87 | 12x12 Yellow, Blue & White w/Blue Specks Floor Tile | 690 | SF | Room 115 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 87A | Mastic associated with 12x12 Yellow, Blue & White w/Blue Specks Floor Tile | 690 | SF | Room 115 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 88 | Mastic associated with 24x24 Blue Green & Grey Rubber Floor Tile | 906 | SF | Room 117 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 89 | 12"x12" Cream w/Speccks Floor Tile | 685 | SF | Room 206 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 89M | Mastic associated w/12"x12" Cream w/Speccks Floor Tile | 685 | SF | Room 206 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 90 | 12"x12" Red & Brown Floor Tile (checker pattern) | 650 | SF | Room 213 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 90M | Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern) | 650 | SF | Room 213 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| A | Bolier Cement ABATED | | | Basement | ABATED | SURFACE | | | | | | | | |
| E | Aircell Pipe Insulation ABATED | | | 1958 Building-Basement, Throughout Classrooms | ABATED | TSI | | | | | Yes | | | |
| F | Aircell Pipe Joint Insulation ABATED | | | 1958 Building-Throughout | ABATED | TSI | | | | | Yes | | | |
| G | Paperwrap Pipe Insulation ABATED | | | 1944 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| H | Paperwrap Pipe Joint Insulation ABATED | | | 1944 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| I | Paperwrap Pipe ABATED | | | 1948 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| J | Paperwrap Pipe Insulation ABATED | | | 1951 Building- Pipe Chase, Attic Crawlspace | ABATED | TSI | | | | | Yes | | | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| K | Aircell Pipe Insulation ABATED | | | 1944 Addition-Basement | ABATED | TSI | | | | | Yes | | | |
| M | Aircell Pipe Insulation ABATED | | | 1951 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| N | Aircell Pipe Joint Insulation ABATED | | | 1944 Addition-Basement | ABATED | TSI | | | | | Yes | | | |
| NEW | Newly Installed Suspect ACM | | | Installed After Implementation of Management Plan or After Renovations | ASSUMED | MISC | | NONE | 0 | | Yes | ACBM with the potential for damage | | |
| O | Paperwrap Joint Insulation ABATED | | | 1948 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| P | Paperwrap Pipe Insulation ABATED | | | 1958 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| Q | Mag Block Pipe Insulation ABATED | | | 1958 Addition- Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| R | Paperwrap Pipe Joint Insulation ABATED | | | Pipe Chase & Attic Crawlspace | ABATED | TSI | | | | | Yes | | | |
| S | Paperwrap Pipe Joint Insulation ABATED | | | 1958 Addition-Pipe Chase | ABATED | TSI | | | | | Yes | | | |
| U | Fiberglass Joint Insulation ABATED | | | Throughout All Buildings | ABATED | TSI | | | | | Yes | | | |
| V | Duct Insulation Tape ABATED | | | 1951 Building-Crawlspace | ABATED | TSI | | | | | Yes | | | |

Chicago Public Schools

School Burnham @ Lawrence School Unit 24261 Building ID 4550
Address 9928 S. Crandon Avenue Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 5/9/2025
Inspector Name Imani Robinson
100-19716 5/15/2026
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 01 | |
| 02 | |
| 03 | |
| 04 | |
| 05 | |
| 06 | |
| 07 | |
| 08 | |
| 09 | |
| 10 | |
| 100 | |
| 100A | |
| 101 | |
| 101A | |
| 102 | |
| 102A | |
| 11 | |
| 12 | |
| 13 | |
| 14 | |
| 15 | |
| 15J | |
| 16 | |
| 17 | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 18 | |
| 19 | |
| 20 | |
| 21 | |
| 22 | |
| 23 | |
| 24 | |
| 25 | |
| 26 | Not Observed 2025 |
| 27 | Not Observed 2025 |
| 28 | Not Observed 2025 |
| 29 | |
| 30 | |
| 31 | |
| 32 | |
| 33 | |
| 34 | Not Observed 2025 |
| 35 | Not Observed 2025 |
| 36 | Not Observed 2025 |
| 37 | |
| 38 | |
| 39 | Not Observed 2025 |
| 40 | Not Observed 2025 |
| 41 | Not Observed 2025 |
| 42 | Not Observed 2025 |
| 43 | |
| 44 | |
| 45 | |
| 46 | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 47 | |
| 48 | |
| 49 | |
| 50 | |
| 51 | |
| 52 | |
| 53 | |
| 54 | |
| 55 | |
| 56 | |
| 57 | |
| 58 | |
| 59 | |
| 60 | |
| 61 | |
| 62 | |
| 63 | |
| 64 | |
| 65 | |
| 66 | |
| 67 | |
| 68 | |
| 69 | |
| 70 | |
| 71 | |
| 72 | |
| 73 | |
| 74 | |
| 75 | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 76 | |
| 77 | |
| 78 | |
| 79 | |
| 79M | |
| 80 | |
| 81 | |
| 81A | |
| 82 | |
| 82A | |
| 83 | |
| 83A | |
| 84 | No Access 2025 |
| 84A | No Access 2025 |
| 85 | |
| 85A | |
| 86 | |
| 86A | |
| 87 | |
| 87A | |
| 88 | |
| 89 | |
| 89M | |
| 90 | |
| 90M | |
| A | |
| E | |
| F | |
| G | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| H | |
| I | |
| J | |
| K | |
| M | |
| N | |
| NEW | |
| O | |
| P | |
| Q | |
| R | |
| S | |
| U | |
| V | |

Table II
Management Planner's Review

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--|-----------------|
| 01 | 12x12 Red w/Orange Vinyl Floor Tile NOT OBSERVED | 2,500 | SF | 1948 Addition- Corridors | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 02 | 9x9 Green & Red Vinyl Floor Tile NOT OBSERVED | 25 | SF | 1948 Addition- Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 03 | 9x9 Black & Gray Vinyl Floor Tile NOT OBSERVED | 25 | SF | 1948 Addition- Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 04 | 12x12 Blue Vinyl Floor Tile | 1,600 | SF | 1948 Addition- Room 101, 102, 106, 112, 115, 116, 117, 210, 212, 213, 215, 217 & 218 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 05 | 12x12 Red & Tan Vinyl Floor Tile NOT OBSERVED | 2,450 | SF | 1944 Addition- Classrooms | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 06 | Ceiling Stucco NOT OBSERVED | 6,025 | SF | 1958 Addition- Corridors & Classrooms | Assumed | SURFACE | Yes | 0 | SF | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| 07 | 12x12 Tan & Red Vinyl Floor Tile NOT OBSERVED | 3,700 | SF | 1948 Addition- Classrooms, Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 08 | Black Border Vinyl Floor Tile | 800 | SF | 1944 Addition- Classrooms 112, 116, 117, 210, 212, 215 & 217 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 09 | No Change NOT OBSERVED | | | This Material was Removed, but No Management Report or Records for the Removal were Ascertainable | Assumed | MISC | | | | | |
| 10 | 12x12 Red & Orange Vinyl Floor Tile | 3,900 | SF | 1944 Addition- Corridors & Classroom 110 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 100 | 12x12 White w/Blue Streaks Floor Tile | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 100A | 12x12 White w/Blue Streaks Floor Tile Mastic | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 101 | 12x12 Gold Floor Tile | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 101A | 12x12 Gold Floor Tile Mastic | 1,000 | SF | Rooms 101, 102, 106, 115, 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 102 | 12x12 Red w/Black Streaks Floor Tile | 4,000 | SF | Rooms 112, 116, 117, 210, 212, 215, 217 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 102A | 12x12 Red w/Black Streaks Floor Tile Mastic | 4,000 | SF | Rooms 112, 116, 117, 210, 212, 215, 217 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 11 | 12x12 Green & Tan Vinyl Floor Tile | 1,125 | SF | 1948 Addition- Corridors; 1951 Addition- Lunchrooms | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 12 | 12x12 Green & Tan Vinyl Floor Tile | 5,200 | SF | 1951 Addition- Corridors & Classrooms | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 13 | 9x9 Tan Vinyl Floor Tile ABATED | | | 1958 Corridors | Abated | MISC | | | | | Follow O&M Plan |
| 14 | 9x9 Tan Vinyl Floor Tile | 6,000 | SF | 1944 Addition- Classrooms 107- 109, 201, 202, 205, 207 - 209, 211; 1st & 2nd Hallway S & SW | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 15 | 12x12 Light Brown Vinyl Floor Tile | 25 | SF | 1951 & 1958 Additions- Corridors | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 15J | 12x12 Red Vinyl Floor Tile NOT OBSERVED | | | Room 206 | Chrysotile | MISC | | 0 | | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|---|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|-----------------|
| 16 | 12x12 Red & Orange Floor Tile Mastic | 3,900 | SF | 1944 Addition- Corridors & Classroom 110 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 17 | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED | 5,025 | SF | 1948 Addition- Corridors | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 18 | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED | 5,200 | SF | 1951 Addition- Corridors & Classrooms | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 19 | 9x9 Tan Vinyl Floor Tile Mastic ABATED | | | 1958 Addition- Corridors | Abated | MISC | | | | | Follow O&M Plan |
| 20 | 9x9 Tan Vinyl Floor Tile Mastic | 1,350 | SF | 1944 Addition- Classrooms 211 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 21 | Transite Insulation | 30 | SF | Roof Access Panel | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 22 | 12x12 Black Border Vinyl Floor Tile | 675 | SF | 1948 Addition- Classrooms, Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 23 | 12x12 Green Vinyl Floor Tile NOT OBSERVED | | | 1944 Addition- Classroom 214 | Assumed | MISC | | | | | Follow O&M Plan |
| 24 | 12x12 White Vinyl Floor Tile NOT OBSERVED | 4,900 | SF | 1951 Addition- Lunchroom & Teachers' Lounge (Carpeted Over in Teachers' Lounge w/Red Carpet) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 25 | 12x12 White Vinyl Floor Tile NOT OBSERVED | 675 | SF | 1944 Addition- Main Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 26 | 12x12 Crème Vinyl Floor Tile NOT OBSERVED | 25 | SF | 1951 Addition- Corridor | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 27 | 9x9 Crème Vinyl Floor Tile NOT OBSERVED | 10 | SF | 1958 Addition- Corridor | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 28 | 12x12 Red & Orange Vinyl Floor Tile Mastic NOT OBSERVED | 2,500 | SF | 1948 Addition- Corridors | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 29 | 12x12 Blue Vinyl Floor Tile Mastic | 950 | SF | 1948 Addition- Rooms 101, 102, 106, 115 & 218 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 30 | 12x12 Red & Tan Vinyl Floor Tile Mastic | 2,450 | SF | 1944 Addition- Classrooms, Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 31 | 12x12 Red & Tan Vinyl Floor Tile Mastic | 3,700 | SF | 1948 Building- Classrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 32 | Black Border Vinyl Floor Tile Mastic | 650 | SF | 1944 Addition- Classrooms | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 33 | Black Border Vinyl Floor Tile Mastic | 675 | SF | 1948 Addition- Classrooms, Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 34 | 12x12 Green Vinyl Floor Tile Mastic NOT OBSERVED | | | 1944 Addition- Classroom 214 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 35 | 12x12 White Vinyl Floor Tile Mastic NOT OBSERVED | 1,000 | SF | 1951 Addition- Lunchrooms (Replaced) & Teachers' Lounge (Carpeted Over with Red Carpet) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 36 | 12x12 White Vinyl Floor Tile Mastic-NOT OBSERVED | | | 1944 Main Office | Assumed | MISC | | 0 | | 6 ACBM with the potential for damage | Follow O&M Plan |
| 37 | 12x12 Light Brown Vinyl Floor Tile Mastic | 25 | SF | 1951 & 1958 Buildings- Corridors | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 38 | 12x12 Crème Vinyl Floor Tile Mastic | 25 | SF | 1951 Addition- Corridor | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--|-----------------|
| 39 | 9x9 Crème Vinyl Floor Tile Mastic NOT OBSERVED | 10 | SF | 1958 Corridor | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 40 | Blue Carpet Mastic NOT OBSERVED | | | 1948 Building- Room 218 | Assumed | MISC | | 0 | | 6 ACBM with the potential for damage | Follow O&M Plan |
| 41 | Green Carpet Mastic NOT OBSERVED | 675 | SF | 1951 Addition- Room 221 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 42 | Red Carpet Mastic NOT OBSERVED | 4,500 | SF | 1944, '48 & '51 Additions- Classrooms & Offices | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 43 | Black Vinyl Baseboard | 1,560 | LF | 1958 Addition- Classrooms | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 44 | Black Vinyl Baseboard Mastic | 1,560 | LF | 1958 Addition- Classrooms | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 45 | 12x12 Ceiling Tile | 900 | SF | 1951 Addition- Room 221 | Assumed | MISC | Yes | 0 | SF | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| 46 | 12x12 Ceiling Tile Mastic | 900 | SF | 1951 Addition- Room 221 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 47 | Insulation in Fire Rated Doors | 10 | EA | Basement | Assumed | TSI | No | 0 | EA | 6 ACBM with the potential for damage | Follow O&M Plan |
| 48 | 2'x4' Ceiling Tile | 4,500 | SF | 1948 & 1951 Additions- Corridors & Lunchrooms | Assumed | MISC | Yes | 0 | SF | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| 49 | 9x9 Green & Red Vinyl Floor Tile Mastic NOT OBSERVED | 25 | SF | 1948 Addition- Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 50 | 9x9 Black & Green Vinyl Floor Tile Mastic NOT OBSERVED | 25 | SF | 1948 Addition- Room 116 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 51 | 12x12 White Vinyl Floor Tile NOT OBSERVED | 250 | SF | 19521 Addition- 1st Floor Teachers' Lounge | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 52 | 12x12 Light Red Vinyl Floor Tile | 4,000 | SF | 1948 Building- 1 & 2 Hallway North Border, 110, 117, 118 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 53 | 12x12 Brown & Tan Vinyl Floor Tile | 4,000 | SF | 1948 Building- Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 54 | 12x12 White Vinyl Floor Tile Mastic | 250 | SF | 1951 Building- 1st Floor Teachers' Lounge | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 55 | 12x12 Light Red Vinyl Floor Tile Mastic | 4,000 | SF | 1948 Building- 1 & 2 Hallway North Border, 110, 118 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 56 | 12x12 Brown & Tan Vinyl Floor Tile Mastic | 4,000 | SF | 1948 Building- Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|-----------------|
| | | | | Breakroom | | | | | | | |
| 57 | Plaster | 30,000 | SF | Throughout 1944 Building | Assumed | SURFACE | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 58 | Plaster | 28,000 | SF | Throughout 1948 Addition | Assumed | SURFACE | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 59 | Plaster | 28,000 | SF | Throughout 1951 Addition | Assumed | SURFACE | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 60 | Plaster | 62,000 | SF | Throughout 1958 Addition | Assumed | SURFACE | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 61 | Green Carpet Mastic NOT OBSERVED | 660 | SF | Room 221 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 62 | Magenta Carpet Mastic NOT OBSERVED | 1,500 | SF | 1951 Addition- Teachers' Lounge, Rooms 207A, 113A & 114 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 63 | Brown Carpet Mastic NOT OBSERVED | | | Rooms 216 & 219 | Assumed | MISC | | 0 | | | Follow O&M Plan |
| 64 | Blue Carpet Mastic NOT OBSERVED | | | Room 218 | Assumed | MISC | | 0 | | 6 ACBM with the potential for damage | Follow O&M Plan |
| 65 | Rust Carpet Mastic | 450 | SF | Room 111 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 66 | 12x12 Light Pink Floor Tile NOT OBSERVED | 600 | SF | Room 102 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 67 | 12x12 Light Pink Floor Tile Mastic NOT OBSERVED | 600 | SF | Room 102 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 68 | 12x12 Maroon Floor Tile NOT OBSERVED | 100 | SF | Room 102 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 69 | 12x12 Maroon Floor Tile Mastic NOT OBSERVED | 100 | SF | Room 102 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 70 | 12x12 White w/Blue Specks Floor Tile NOT OBSERVED | 800 | SF | Room 103 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 71 | 12x12 White w/Blue Specks Floor Tile Mastic NOT OBSERVED | 800 | SF | Room 103 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 72 | 12x12 Dark Blue Floor Tile NOT OBSERVED | 120 | SF | Room 103 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 73 | 12x12 Dark Blue Floor Tile Mastic NOT OBSERVED | 120 | SF | Room 103 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 74 | Gray Terrazzo Floor | 1,200 | SF | Stairways to 2nd Floor | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 75 | Brown Mosaic Ceramic Tile Grout | 3,550 | SF | 1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 76 | Brown Mosaic Ceramic Tile Adhesive | 3,550 | SF | 1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 77 | Ivory Ceramic Tile Grout | 1,100 | SF | 1st & 2nd Floor Center Boys' and Girls' Washrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 78 | Ivory Ceramic Tile Adhesive | 1,110 | SF | 1st & 2nd Floor Center Boys' and Girls' Washrooms | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|-----------------|
| 79 | 12x12 Off-White w/Gray Specks Floor Tile | 1,500 | SF | 114, 206, & Main Office (Public Area) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 79M | 12x12 Off-White w/Gray Specks Floor Tile Mastic | 1,500 | SF | 206, 207A & Main Office (Public Area) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 80 | Blue Checkered Carpet Adhesive NOT OBSERVED | 1,640 | SF | Main Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 81 | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic | 50 | SF | 2nd Floor Corridor (under Drinking Fountains) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 81A | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic | 50 | SF | 2nd Floor Corridor (under Drinking Fountains) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 82 | 12x12 White w/Multi-Color Single Tiles & Mastic | 1,600 | SF | Rooms 106 & 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 82A | 12x12 White w/Multi-Color Single Tiles & Mastic | 1,600 | SF | Room 106 & 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 83 | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | 1,200 | SF | Room 207, 209, 214, 216 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 83A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | 800 | SF | Room 214 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 84 | 12x12 Gray Streaked Vinyl Floor Tile | 1,600 | SF | Room 120/122 (Addition) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 84A | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | 1,600 | SF | Room 120/122 (Addition) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 85 | 12x12 Maroon Vinyl Floor Tile | 100 | SF | 1st & 2nd Floor Corridor near Elevator and Unisex Bathroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 85A | 12x12 Maroon Vinyl Floor Tile Mastic | 100 | SF | 1st & 2nd Floor Corridor near Elevator and Unisex Bathroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 86 | 12x12 Grey, White & Dark Grey Floor Tile | 3,135 | SF | Teachers' Lounge (Room 101), 103, Main Office & Principal's Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 86A | Mastic associated with 12x12 Grey White & Dark Grey Floor Tile | 3,135 | SF | Teachers' Lounge (Room 101), 103, Main Office & Principal's Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 87 | 12x12 Yellow, Blue & White w/Blue Specks Floor Tile | 690 | SF | Room 115 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 87A | Mastic associated with 12x12 Yellow, Blue & White w/Blue Specks Floor Tile | 690 | SF | Room 115 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 88 | Mastic associated with 24x24 Blue Green & Grey Rubber Floor Tile | 906 | SF | Room 117 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 89 | 12"x12" Cream w/Speccks Floor Tile | 685 | SF | Room 206 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 89M | Mastic associated w/12"x12" Cream w/Speccks Floor Tile | 685 | SF | Room 206 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 90 | 12"x12" Red & Brown Floor Tile (checker pattern) | 650 | SF | Room 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 90M | Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern) | 650 | SF | Room 213 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| A | Bolier Cement ABATED | | | Basement | Abated | SURFACE | | | | | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Chicago, IL, 60617** **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|-----------------|
| E | Aircell Pipe Insulation ABATED | | | 1958 Building- Basement, Throughout Classrooms | Abated | TSI | | | | | |
| F | Aircell Pipe Joint Insulation ABATED | | | 1958 Building- Throughout | Abated | TSI | | | | | |
| G | Paperwrap Pipe Insulation ABATED | | | 1944 Addition- Pipe Chase | Abated | TSI | | | | | |
| H | Paperwrap Pipe Joint Insulation ABATED | | | 1944 Addition- Pipe Chase | Abated | TSI | | | | | |
| I | Paperwrap Pipe ABATED | | | 1948 Addition- Pipe Chase | Abated | TSI | | | | | |
| J | Paperwrap Pipe Insulation ABATED | | | 1951 Building- Pipe Chase, Attic Crawlspace | Abated | TSI | | | | | |
| K | Aircell Pipe Insulation ABATED | | | 1944 Addition- Basement | Abated | TSI | | | | | |
| M | Aircell Pipe Insulation ABATED | | | 1951 Addition- Pipe Chase | Abated | TSI | | | | | |
| N | Aircell Pipe Joint Insulation ABATED | | | 1944 Addition- Basement | Abated | TSI | | | | | |
| NEW | Newly Installed Suspect ACM | | | Installed After Implementation of Management Plan or After Renovations | Assumed | MISC | | 0 | | 6 ACBM with the potential for damage | Follow O&M Plan |
| O | Paperwrap Joint Insulation ABATED | | | 1948 Addition- Pipe Chase | Abated | TSI | | | | | |
| P | Paperwrap Pipe Insulation ABATED | | | 1958 Addition- Pipe Chase | Abated | TSI | | | | | |
| Q | Mag Block Pipe Insulation ABATED | | | 1958 Addition- Pipe Chase | Abated | TSI | | | | | |
| R | Paperwrap Pipe Joint Insulation ABATED | | | Pipe Chase & Attic Crawlspace | Abated | TSI | | | | | |
| S | Paperwrap Pipe Joint Insulation ABATED | | | 1958 Addition-Pipe Chase | Abated | TSI | | | | | |
| U | Fiberglass Joint Insulation ABATED | | | Throughout All Buildings | Abated | TSI | | | | | |
| V | Duct Insulation Tape ABATED | | | 1951 Building- Crawlspace | Abated | TSI | | | | | |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| | |
|------------------------------------|----------------|
| Review Date | 6/2/2025 |
| Manager Planner Name | Steven Geneser |
| 100-01784 | 5/15/2026 |
| Manager IDPH License No/Expiration | |

| HA Number | Management Comments |
|-----------|---------------------|
| 01 | |
| 02 | |
| 03 | |
| 04 | |
| 05 | |
| 06 | |
| 07 | |
| 08 | |
| 09 | |
| 10 | |
| 100 | |
| 100A | |
| 101 | |
| 101A | |
| 102 | |
| 102A | |
| 11 | |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------|
| 12 | |
| 13 | |
| 14 | |
| 15 | |
| 15J | |
| 16 | |
| 17 | |
| 18 | |
| 19 | |
| 20 | |
| 21 | |
| 22 | |
| 23 | |
| 24 | |
| 25 | |
| 26 | |
| 27 | |
| 28 | |
| 29 | |
| 30 | |
| 31 | |
| 32 | |
| 33 | |
| 34 | |
| 35 | |
| 36 | |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------|
| 37 | |
| 38 | |
| 39 | |
| 40 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | |
| 47 | |
| 48 | |
| 49 | |
| 50 | |
| 51 | |
| 52 | |
| 53 | |
| 54 | |
| 55 | |
| 56 | |
| 57 | |
| 58 | |
| 59 | |
| 60 | |
| 61 | |
| 62 | |

Chicago Public Schools

School Burnham @ Lawrence School

Address 9928 S. Crandon Avenue

Unit 24261

Chicago, IL, 60617

Building ID 4550

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------|
| 63 | |
| 64 | |
| 65 | |
| 66 | |
| 67 | |
| 68 | |
| 69 | |
| 70 | |
| 71 | |
| 72 | |
| 73 | |
| 74 | |
| 75 | |
| 76 | |
| 77 | |
| 78 | |
| 79 | |
| 79M | |
| 80 | |
| 81 | |
| 81A | |
| 82 | |
| 82A | |
| 83 | |
| 83A | |
| 84 | |

Chicago Public Schools

School Burnham @ Lawrence School

Unit 24261

Building ID 4550

Address 9928 S. Crandon Avenue

Chicago, IL, 60617

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------|
| 84A | |
| 85 | |
| 85A | |
| 86 | |
| 86A | |
| 87 | |
| 87A | |
| 88 | |
| 89 | |
| 89M | |
| 90 | |
| 90M | |
| A | |
| E | |
| F | |
| G | |
| H | |
| I | |
| J | |
| K | |
| M | |
| N | |
| NEW | |
| O | |
| P | |
| Q | |

Chicago Public Schools

School Burnham @ Lawrence School **Unit** 24261 **Building ID** 4550
Address 9928 S. Crandon Avenue **Chicago, IL, 60617** **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------|
| R | |
| S | |
| U | |
| V | |

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 01

MATERIAL DESCRIPTION: 12x12 Red w/Orange Vinyl Floor Tile NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW

MATERIAL LOCATION: 1948 Addition- Corridors

MATERIAL QUANTITY: 2500 MATERIAL UNITS: SF

DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **12x12 Red w/Orange Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Corridors**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

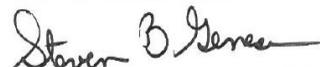

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 02 | | |
| MATERIAL DESCRIPTION: | 9x9 Green & Red Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Room 116 | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **9x9 Green & Red Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Room 116**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

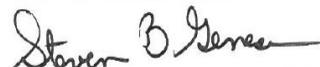

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 03 | | |
| MATERIAL DESCRIPTION: | 9x9 Black & Gray Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Room 116 | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **9x9 Black & Gray Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Room 116**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

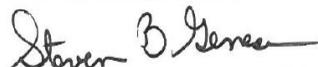

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 04 | | |
| MATERIAL DESCRIPTION: | 12x12 Blue Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Room 101, 102, 106, 112, 115, 116, 117, 210, 212, 213, 215, 217 & 218 | | |
| MATERIAL QUANTITY: | 1600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **12x12 Blue Vinyl Floor Tile**

MATERIAL LOCATION: **1948 Addition- Room 101, 102, 106, 112, 115, 116, 117, 210, 212, 213, 215, 217 & 218**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

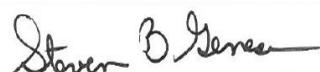

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 05 | | |
| MATERIAL DESCRIPTION: | 12x12 Red & Tan Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Classrooms | | |
| MATERIAL QUANTITY: | 2450 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **12x12 Red & Tan Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1944 Addition- Classrooms**

MATERIAL QUANTITY: **2450** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

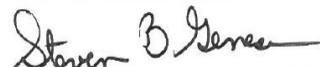

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|-----|
| HOMOGENEOUS AREA: | 06 | | |
| MATERIAL DESCRIPTION: | Ceiling Stucco NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 7 Any remaining friable ACBM or friable suspect ACBM | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | Yes |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1958 Addition- Corridors & Classrooms | | |
| MATERIAL QUANTITY: | 6025 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Ceiling Stucco NOT OBSERVED**

MATERIAL LOCATION: **1958 Addition- Corridors & Classrooms**

MATERIAL QUANTITY: **6025** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

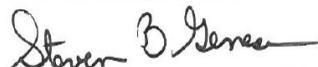

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 07 | | |
| MATERIAL DESCRIPTION: | 12x12 Tan & Red Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Classrooms, Room 116 | | |
| MATERIAL QUANTITY: | 3700 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **12x12 Tan & Red Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Classrooms, Room 116**

MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

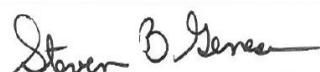

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 08 | | |
| MATERIAL DESCRIPTION: | Black Border Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Classrooms 112, 116, 117, 210, 212, 215 & 217 | | |
| MATERIAL QUANTITY: | 800 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **Black Border Vinyl Floor Tile**

MATERIAL LOCATION: **1944 Addition- Classrooms 112, 116, 117, 210, 212, 215 & 217**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

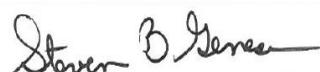

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **No Change NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **This Material was Removed, but No Management Report or Records for the Removal were Ascertainable**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **No Change NOT OBSERVED**

MATERIAL LOCATION: **This Material was Removed, but No Management Report or Records for the Removal were Ascertainable**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

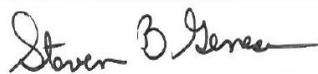

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 10 | | |
| MATERIAL DESCRIPTION: | 12x12 Red & Orange Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Corridors & Classroom 110 | | |
| MATERIAL QUANTITY: | 3900 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **12x12 Red & Orange Vinyl Floor Tile**

MATERIAL LOCATION: **1944 Addition- Corridors & Classroom 110**

MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

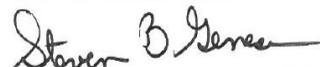

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 100 | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Blue Streaks Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 101, 102, 106, 115, 213 | | |
| MATERIAL QUANTITY: | 1000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **100**

MATERIAL DESCRIPTION: **12x12 White w/Blue Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 101, 102, 106, 115, 213**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

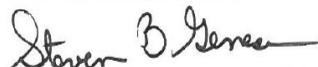

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 100A | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Blue Streaks Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 101, 102, 106, 115, 213 | | |
| MATERIAL QUANTITY: | 1000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **100A**

MATERIAL DESCRIPTION: **12x12 White w/Blue Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 101, 102, 106, 115, 213**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

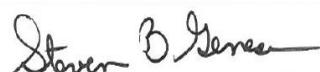

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 101 | | |
| MATERIAL DESCRIPTION: | 12x12 Gold Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 101, 102, 106, 115, 213 | | |
| MATERIAL QUANTITY: | 1000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **12x12 Gold Floor Tile**

MATERIAL LOCATION: **Rooms 101, 102, 106, 115, 213**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

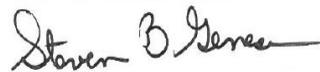

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 101A | | |
| MATERIAL DESCRIPTION: | 12x12 Gold Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 101, 102, 106, 115, 213 | | |
| MATERIAL QUANTITY: | 1000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **101A**

MATERIAL DESCRIPTION: **12x12 Gold Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 101, 102, 106, 115, 213**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

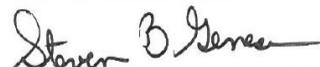

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 102 | | |
| MATERIAL DESCRIPTION: | 12x12 Red w/Black Streaks Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 112, 116, 117, 210, 212, 215, 217 | | |
| MATERIAL QUANTITY: | 4000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **102**

MATERIAL DESCRIPTION: **12x12 Red w/Black Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 112, 116, 117, 210, 212, 215, 217**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

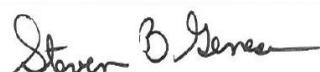

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 102A | | |
| MATERIAL DESCRIPTION: | 12x12 Red w/Black Streaks Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 112, 116, 117, 210, 212, 215, 217 | | |
| MATERIAL QUANTITY: | 4000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **102A**

MATERIAL DESCRIPTION: **12x12 Red w/Black Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 112, 116, 117, 210, 212, 215, 217**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

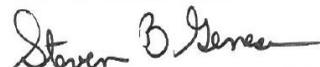

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 11 | | |
| MATERIAL DESCRIPTION: | 12x12 Green & Tan Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Corridors; 1951 Addition- Lunchrooms | | |
| MATERIAL QUANTITY: | 1125 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12x12 Green & Tan Vinyl Floor Tile**

MATERIAL LOCATION: **1948 Addition- Corridors; 1951 Addition- Lunchrooms**

MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

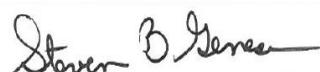

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 12 | | |
| MATERIAL DESCRIPTION: | 12x12 Green & Tan Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Corridors & Classrooms | | |
| MATERIAL QUANTITY: | 5200 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **12x12 Green & Tan Vinyl Floor Tile**

MATERIAL LOCATION: **1951 Addition- Corridors & Classrooms**

MATERIAL QUANTITY: **5200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

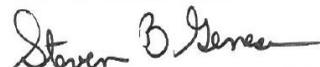

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 13

MATERIAL DESCRIPTION: 9x9 Tan Vinyl Floor Tile ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1958 Corridors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile ABATED**

MATERIAL LOCATION: **1958 Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

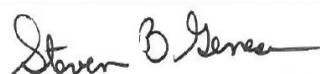

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 14 | | |
| MATERIAL DESCRIPTION: | 9x9 Tan Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1944 Addition- Classrooms 107- 109, 201, 202, 205, 207 - 209, 211; 1st & 2nd Hallway S & SW**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile**

MATERIAL LOCATION: **1944 Addition- Classrooms 107- 109, 201, 202, 205, 207 - 209, 211; 1st & 2nd Hallway S & SW**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

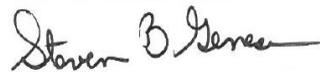

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 15 | | |
| MATERIAL DESCRIPTION: | 12x12 Light Brown Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 & 1958 Additions- Corridors | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **12x12 Light Brown Vinyl Floor Tile**

MATERIAL LOCATION: **1951 & 1958 Additions- Corridors**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

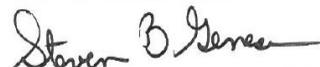

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|--|
| HOMOGENEOUS AREA: | 15J | | |
| MATERIAL DESCRIPTION: | 12x12 Red Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 206

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **15J**

MATERIAL DESCRIPTION: **12x12 Red Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Room 206**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

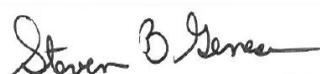

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 16 | | |
| MATERIAL DESCRIPTION: | 12x12 Red & Orange Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Corridors & Classroom 110 | | |
| MATERIAL QUANTITY: | 3900 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **12x12 Red & Orange Floor Tile Mastic**

MATERIAL LOCATION: **1944 Addition- Corridors & Classroom 110**

MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

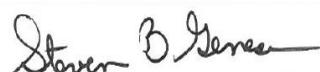

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 17 | | |
| MATERIAL DESCRIPTION: | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Corridors | | |
| MATERIAL QUANTITY: | 5025 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Corridors**

MATERIAL QUANTITY: **5025** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

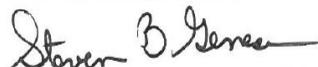

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 18 | | |
| MATERIAL DESCRIPTION: | 12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Corridors & Classrooms | | |
| MATERIAL QUANTITY: | 5200 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12x12 Green & Tan Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1951 Addition- Corridors & Classrooms**

MATERIAL QUANTITY: **5200** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

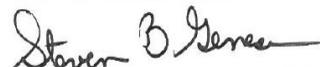

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1958 Addition- Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile Mastic ABATED**

MATERIAL LOCATION: **1958 Addition- Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

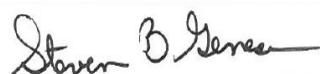

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 20 | | |
| MATERIAL DESCRIPTION: | 9x9 Tan Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Classrooms 211 | | |
| MATERIAL QUANTITY: | 1350 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1944 Addition- Classrooms 211**

MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

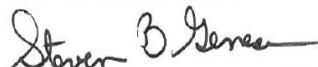

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 21 | | |
| MATERIAL DESCRIPTION: | Transite Insulation | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Roof Access Panel | | |
| MATERIAL QUANTITY: | 30 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Transite Insulation**

MATERIAL LOCATION: **Roof Access Panel**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

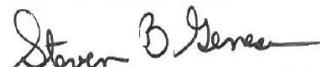

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 22 | | |
| MATERIAL DESCRIPTION: | 12x12 Black Border Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Classrooms, Room 116 | | |
| MATERIAL QUANTITY: | 675 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12x12 Black Border Vinyl Floor Tile**

MATERIAL LOCATION: **1948 Addition- Classrooms, Room 116**

MATERIAL QUANTITY: **675** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

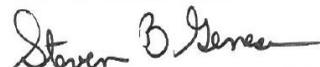

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 23

MATERIAL DESCRIPTION: 12x12 Green Vinyl Floor Tile NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1944 Addition- Classroom 214

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12x12 Green Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1944 Addition- Classroom 214**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

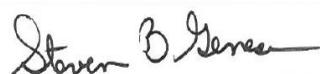

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 24 | | |
| MATERIAL DESCRIPTION: | 12x12 White Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Lunchroom & Teachers' Lounge (Carpeted Over in Teachers' Lounge w/Red Carpet) | | |
| MATERIAL QUANTITY: | 4900 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1951 Addition- Lunchroom & Teachers' Lounge (Carpeted Over in Teachers' Lounge w/Red Carpet)**

MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

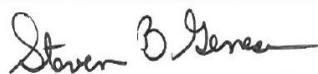

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 25 | | |
| MATERIAL DESCRIPTION: | 12x12 White Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Main Office | | |
| MATERIAL QUANTITY: | 675 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1944 Addition- Main Office**

MATERIAL QUANTITY: **675** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

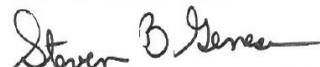

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 26 | | |
| MATERIAL DESCRIPTION: | 12x12 Crème Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Corridor | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12x12 Crème Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1951 Addition- Corridor**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

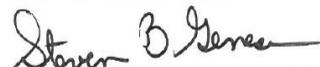

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 27 | | |
| MATERIAL DESCRIPTION: | 9x9 Crème Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1958 Addition- Corridor | | |
| MATERIAL QUANTITY: | 10 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **9x9 Crème Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1958 Addition- Corridor**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

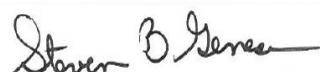

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 28 | | |
| MATERIAL DESCRIPTION: | 12x12 Red & Orange Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Corridors | | |
| MATERIAL QUANTITY: | 2500 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12x12 Red & Orange Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Corridors**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

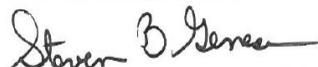

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 29 | | |
| MATERIAL DESCRIPTION: | 12x12 Blue Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Rooms 101, 102, 106, 115 & 218 | | |
| MATERIAL QUANTITY: | 950 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **12x12 Blue Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1948 Addition- Rooms 101, 102, 106, 115 & 218**

MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

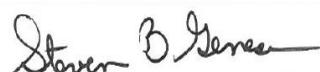

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 30 | | |
| MATERIAL DESCRIPTION: | 12x12 Red & Tan Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Classrooms, Room 116 | | |
| MATERIAL QUANTITY: | 2450 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12x12 Red & Tan Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1944 Addition- Classrooms, Room 116**

MATERIAL QUANTITY: **2450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

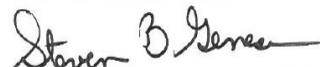

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 31 | | |
| MATERIAL DESCRIPTION: | 12x12 Red & Tan Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Building- Classrooms | | |
| MATERIAL QUANTITY: | 3700 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12x12 Red & Tan Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1948 Building- Classrooms**

MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

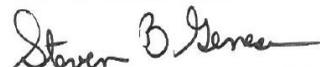

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 32 | | |
| MATERIAL DESCRIPTION: | Black Border Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944 Addition- Classrooms | | |
| MATERIAL QUANTITY: | 650 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Black Border Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1944 Addition- Classrooms**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

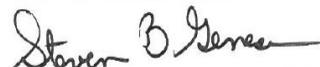

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 33 | | |
| MATERIAL DESCRIPTION: | Black Border Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Classrooms, Room 116 | | |
| MATERIAL QUANTITY: | 675 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **Black Border Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1948 Addition- Classrooms, Room 116**

MATERIAL QUANTITY: **675** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

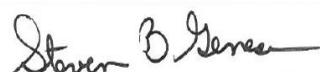

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 34 | | |
| MATERIAL DESCRIPTION: | 12x12 Green Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1944 Addition- Classroom 214**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not Observed 2025**

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: 34

MATERIAL DESCRIPTION: 12x12 Green Vinyl Floor Tile Mastic NOT OBSERVED

MATERIAL LOCATION: **1944 Addition- Classroom 214**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

Steven B. Genes

Date: 06/02/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 35 | | |
| MATERIAL DESCRIPTION: | 12x12 White Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Lunchrooms (Replaced) & Teachers' Lounge (Carpeted Over with Red Carpet) | | |
| MATERIAL QUANTITY: | 1000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1951 Addition- Lunchrooms (Replaced) & Teachers' Lounge (Carpeted Over with Red Carpet)**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

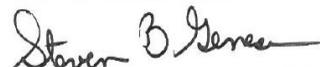

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | |
|----------------------------------|--|----------|
| HOMOGENEOUS AREA: | 36 | |
| MATERIAL DESCRIPTION: | 12x12 White Vinyl Floor Tile Mastic-NOT OBSERVED | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 | |
| HISTORICAL DAMAGE REASON: | | |
| HISTORICAL RESPONSE ACTION: | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1944 Main Office

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed 2025

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile Mastic-NOT OBSERVED**

MATERIAL LOCATION: **1944 Main Office**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

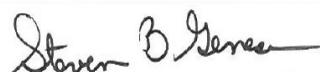

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 37 | | |
| MATERIAL DESCRIPTION: | 12x12 Light Brown Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 & 1958 Buildings- Corridors | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12x12 Light Brown Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1951 & 1958 Buildings- Corridors**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

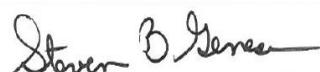

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 38 | | |
| MATERIAL DESCRIPTION: | 12x12 Crème Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Corridor | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **12x12 Crème Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1951 Addition- Corridor**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

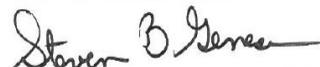

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 39 | | |
| MATERIAL DESCRIPTION: | 9x9 Crème Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1958 Corridor | | |
| MATERIAL QUANTITY: | 10 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **9x9 Crème Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1958 Corridor**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

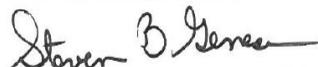

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | |
|----------------------------------|---------------------------------|----------|
| HOMOGENEOUS AREA: | 40 | |
| MATERIAL DESCRIPTION: | Blue Carpet Mastic NOT OBSERVED | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 | |
| HISTORICAL DAMAGE REASON: | | |
| HISTORICAL RESPONSE ACTION: | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1948 Building- Room 218

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: NOt Observed 2025

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Blue Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **1948 Building- Room 218**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

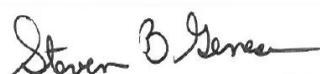

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 41 | | |
| MATERIAL DESCRIPTION: | Green Carpet Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Room 221 | | |
| MATERIAL QUANTITY: | 675 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Green Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **1951 Addition- Room 221**

MATERIAL QUANTITY: **675** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

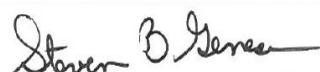

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 42 | | |
| MATERIAL DESCRIPTION: | Red Carpet Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1944, '48 & '51 Additions- Classrooms & Offices | | |
| MATERIAL QUANTITY: | 4500 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | Not Observed 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Red Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **1944, '48 & '51 Additions- Classrooms & Offices**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

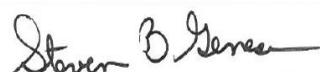

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 43 | | |
| MATERIAL DESCRIPTION: | Black Vinyl Baseboard | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1958 Addition- Classrooms | | |
| MATERIAL QUANTITY: | 1560 | MATERIAL UNITS: | LF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | LF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **Black Vinyl Baseboard**

MATERIAL LOCATION: **1958 Addition- Classrooms**

MATERIAL QUANTITY: **1560** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

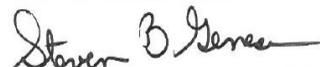

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 44 | | |
| MATERIAL DESCRIPTION: | Black Vinyl Baseboard Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1958 Addition- Classrooms | | |
| MATERIAL QUANTITY: | 1560 | MATERIAL UNITS: | LF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | LF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **Black Vinyl Baseboard Mastic**

MATERIAL LOCATION: **1958 Addition- Classrooms**

MATERIAL QUANTITY: **1560** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

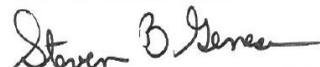

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|-----|
| HOMOGENEOUS AREA: | 45 | | |
| MATERIAL DESCRIPTION: | 12x12 Ceiling Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 7 Any remaining friable ACBM or friable suspect ACBM | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | Yes |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Room 221 | | |
| MATERIAL QUANTITY: | 900 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **12x12 Ceiling Tile**

MATERIAL LOCATION: **1951 Addition- Room 221**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

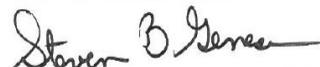

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 46 | | |
| MATERIAL DESCRIPTION: | 12x12 Ceiling Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Room 221 | | |
| MATERIAL QUANTITY: | 900 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12x12 Ceiling Tile Mastic**

MATERIAL LOCATION: **1951 Addition- Room 221**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

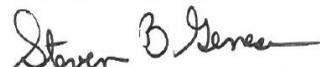

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 47 | | |
| MATERIAL DESCRIPTION: | Insulation in Fire Rated Doors | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Basement | | |
| MATERIAL QUANTITY: | 10 | MATERIAL UNITS: | EA |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | EA |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **Insulation in Fire Rated Doors**

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

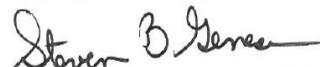

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|-----|
| HOMOGENEOUS AREA: | 48 | | |
| MATERIAL DESCRIPTION: | 2'x4' Ceiling Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 7 Any remaining friable ACBM or friable suspect ACBM | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | Yes |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 & 1951 Additions- Corridors & Lunchrooms | | |
| MATERIAL QUANTITY: | 4500 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**

MATERIAL LOCATION: **1948 & 1951 Additions- Corridors & Lunchrooms**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

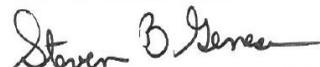

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 49 | | |
| MATERIAL DESCRIPTION: | 9x9 Green & Red Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Room 116 | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **9x9 Green & Red Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Room 116**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

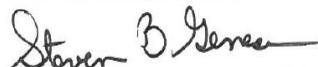

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 50 | | |
| MATERIAL DESCRIPTION: | 9x9 Black & Green Vinyl Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Addition- Room 116 | | |
| MATERIAL QUANTITY: | 25 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **9x9 Black & Green Vinyl Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1948 Addition- Room 116**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

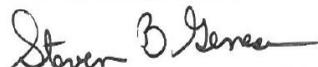

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 51 | | |
| MATERIAL DESCRIPTION: | 12x12 White Vinyl Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 19521 Addition- 1st Floor Teachers' Lounge | | |
| MATERIAL QUANTITY: | 250 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **19521 Addition- 1st Floor Teachers' Lounge**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

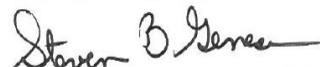

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 52 | | |
| MATERIAL DESCRIPTION: | 12x12 Light Red Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Building- 1 & 2 Hallway North Border, 110, 117, 118 | | |
| MATERIAL QUANTITY: | 4000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12x12 Light Red Vinyl Floor Tile**

MATERIAL LOCATION: **1948 Building- 1 & 2 Hallway North Border, 110, 117, 118**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

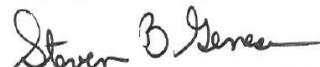

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 53 | | |
| MATERIAL DESCRIPTION: | 12x12 Brown & Tan Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Chrysotile | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1948 Building- Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12x12 Brown & Tan Vinyl Floor Tile**

MATERIAL LOCATION: **1948 Building- Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

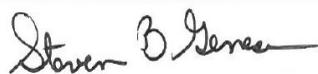

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 54 | | |
| MATERIAL DESCRIPTION: | 12x12 White Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Building- 1st Floor Teachers' Lounge | | |
| MATERIAL QUANTITY: | 250 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **12x12 White Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1951 Building- 1st Floor Teachers' Lounge**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

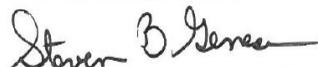

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 55 | | |
| MATERIAL DESCRIPTION: | 12x12 Light Red Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1948 Building- 1 & 2 Hallway North Border, 110, 118 | | |
| MATERIAL QUANTITY: | 4000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **12x12 Light Red Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1948 Building- 1 & 2 Hallway North Border, 110, 118**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

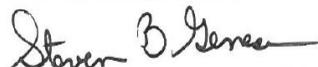

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 56 | | |
| MATERIAL DESCRIPTION: | 12x12 Brown & Tan Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1948 Building- Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **12x12 Brown & Tan Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1948 Building- Basement Breakroom, 112, 116, 117, NW Wing Hallway 1 & 2, Lunchroom, Kitchen, 121, 123, 210, 212, 215, 217, 220, 222, 223, Staff Breakroom**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

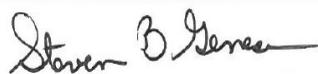

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 57 | | |
| MATERIAL DESCRIPTION: | Plaster | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Throughout 1944 Building | | |
| MATERIAL QUANTITY: | 30000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout 1944 Building**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

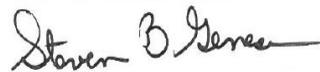

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 58 | | |
| MATERIAL DESCRIPTION: | Plaster | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

| | | | |
|------------------------|--------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Throughout 1948 Addition | | |
| MATERIAL QUANTITY: | 28000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout 1948 Addition**

MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

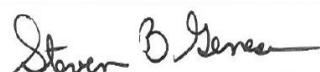

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 59 | | |
| MATERIAL DESCRIPTION: | Plaster | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Throughout 1951 Addition | | |
| MATERIAL QUANTITY: | 28000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout 1951 Addition**

MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

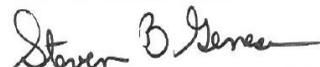

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 60 | | |
| MATERIAL DESCRIPTION: | Plaster | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Throughout 1958 Addition | | |
| MATERIAL QUANTITY: | 62000 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout 1958 Addition**

MATERIAL QUANTITY: **62000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

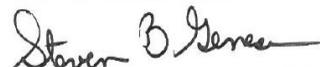

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 61 | | |
| MATERIAL DESCRIPTION: | Green Carpet Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 221 | | |
| MATERIAL QUANTITY: | 660 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **Green Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 221**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

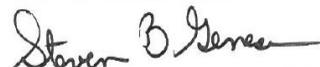

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 62 | | |
| MATERIAL DESCRIPTION: | Magenta Carpet Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1951 Addition- Teachers' Lounge, Rooms 207A, 113A & 114 | | |
| MATERIAL QUANTITY: | 1500 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **Magenta Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **1951 Addition- Teachers' Lounge, Rooms 207A, 113A & 114**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

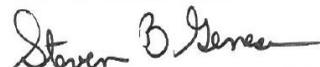

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | |
|----------------------------------|----------------------------------|----------|
| HOMOGENEOUS AREA: | 63 | |
| MATERIAL DESCRIPTION: | Brown Carpet Mastic NOT OBSERVED | |
| HISTORICAL AHERA DAMAGE CATEGORY | | |
| HISTORICAL DAMAGE REASON: | | |
| HISTORICAL RESPONSE ACTION: | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 216 & 219

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **Brown Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Rooms 216 & 219**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

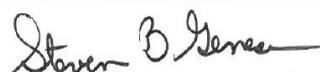

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | |
|----------------------------------|---------------------------------|----------|
| HOMOGENEOUS AREA: | 64 | |
| MATERIAL DESCRIPTION: | Blue Carpet Mastic NOT OBSERVED | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 | |
| HISTORICAL DAMAGE REASON: | | |
| HISTORICAL RESPONSE ACTION: | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 218

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Blue Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 218**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

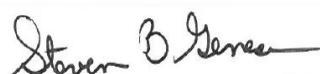

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 65 | | |
| MATERIAL DESCRIPTION: | Rust Carpet Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 111 | | |
| MATERIAL QUANTITY: | 450 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **Rust Carpet Mastic**

MATERIAL LOCATION: **Room 111**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

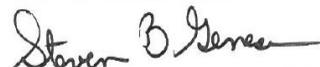

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 66 | | |
| MATERIAL DESCRIPTION: | 12x12 Light Pink Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 102 | | |
| MATERIAL QUANTITY: | 600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **12x12 Light Pink Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Room 102**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

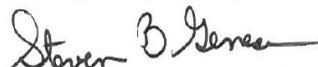

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 67 | | |
| MATERIAL DESCRIPTION: | 12x12 Light Pink Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 102 | | |
| MATERIAL QUANTITY: | 600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **12x12 Light Pink Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 102**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

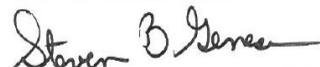

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 68 | | |
| MATERIAL DESCRIPTION: | 12x12 Maroon Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 102 | | |
| MATERIAL QUANTITY: | 100 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **12x12 Maroon Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Room 102**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

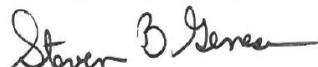

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 69 | | |
| MATERIAL DESCRIPTION: | 12x12 Maroon Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 102 | | |
| MATERIAL QUANTITY: | 100 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **69**

MATERIAL DESCRIPTION: **12x12 Maroon Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 102**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

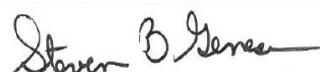

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 70 | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Blue Specks Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 103 | | |
| MATERIAL QUANTITY: | 800 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **12x12 White w/Blue Specks Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

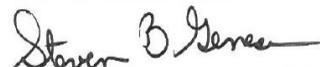

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 71 | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Blue Specks Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 103 | | |
| MATERIAL QUANTITY: | 800 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **12x12 White w/Blue Specks Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

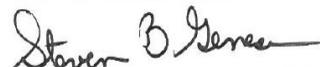

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 72 | | |
| MATERIAL DESCRIPTION: | 12x12 Dark Blue Floor Tile NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 103 | | |
| MATERIAL QUANTITY: | 120 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **72**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

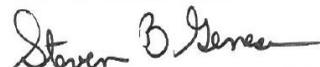

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 73 | | |
| MATERIAL DESCRIPTION: | 12x12 Dark Blue Floor Tile Mastic NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 103 | | |
| MATERIAL QUANTITY: | 120 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **73**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

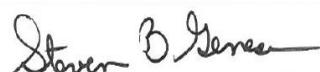

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 74 | | |
| MATERIAL DESCRIPTION: | Gray Terrazzo Floor | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Stairways to 2nd Floor | | |
| MATERIAL QUANTITY: | 1200 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **74**

MATERIAL DESCRIPTION: **Gray Terrazzo Floor**

MATERIAL LOCATION: **Stairways to 2nd Floor**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

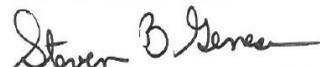

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 75 | | |
| MATERIAL DESCRIPTION: | Brown Mosaic Ceramic Tile Grout | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules | | |
| MATERIAL QUANTITY: | 3550 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **Brown Mosaic Ceramic Tile Grout**

MATERIAL LOCATION: **1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules**

MATERIAL QUANTITY: **3550** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

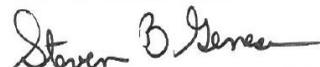

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 76 | | |
| MATERIAL DESCRIPTION: | Brown Mosaic Ceramic Tile Adhesive | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules | | |
| MATERIAL QUANTITY: | 3550 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **76**

MATERIAL DESCRIPTION: **Brown Mosaic Ceramic Tile Adhesive**

MATERIAL LOCATION: **1st & 2nd Floor North & South Boys' and Girls' Washrooms and All Vestibules**

MATERIAL QUANTITY: **3550** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

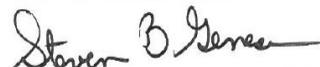

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 77 | | |
| MATERIAL DESCRIPTION: | Ivory Ceramic Tile Grout | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1st & 2nd Floor Center Boys' and Girls' Washrooms | | |
| MATERIAL QUANTITY: | 1100 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **77**

MATERIAL DESCRIPTION: **Ivory Ceramic Tile Grout**

MATERIAL LOCATION: **1st & 2nd Floor Center Boys' and Girls' Washrooms**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

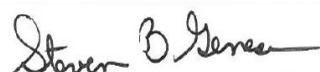

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 78 | | |
| MATERIAL DESCRIPTION: | Ivory Ceramic Tile Adhesive | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1st & 2nd Floor Center Boys' and Girls' Washrooms | | |
| MATERIAL QUANTITY: | 1110 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **78**

MATERIAL DESCRIPTION: **Ivory Ceramic Tile Adhesive**

MATERIAL LOCATION: **1st & 2nd Floor Center Boys' and Girls' Washrooms**

MATERIAL QUANTITY: **1110** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

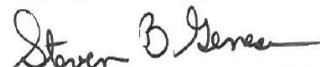

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 79 | | |
| MATERIAL DESCRIPTION: | 12x12 Off-White w/Gray Specks Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 114, 206, & Main Office (Public Area) | | |
| MATERIAL QUANTITY: | 1500 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **79**

MATERIAL DESCRIPTION: **12x12 Off-White w/Gray Specks Floor Tile**

MATERIAL LOCATION: **114, 206, & Main Office (Public Area)**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

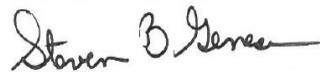

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 79M | | |
| MATERIAL DESCRIPTION: | 12x12 Off-White w/Gray Specks Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---------------------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 206, 207A & Main Office (Public Area) | | |
| MATERIAL QUANTITY: | 1500 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **79M**

MATERIAL DESCRIPTION: **12x12 Off-White w/Gray Specks Floor Tile Mastic**

MATERIAL LOCATION: **206, 207A & Main Office (Public Area)**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

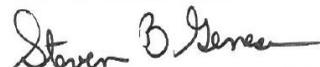

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 80 | | |
| MATERIAL DESCRIPTION: | Blue Checkered Carpet Adhesive NOT OBSERVED | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Main Office | | |
| MATERIAL QUANTITY: | 1640 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **80**

MATERIAL DESCRIPTION: **Blue Checkered Carpet Adhesive NOT OBSERVED**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY: **1640** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

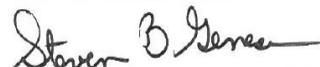

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 81 | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 2nd Floor Corridor (under Drinking Fountains) | | |
| MATERIAL QUANTITY: | 50 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic**

MATERIAL LOCATION: **2nd Floor Corridor (under Drinking Fountains)**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

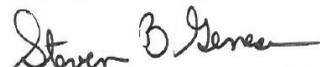

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 81A | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|---|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 2nd Floor Corridor (under Drinking Fountains) | | |
| MATERIAL QUANTITY: | 50 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **81A**

MATERIAL DESCRIPTION: **12x12 White w/Dark Streaks Vinyl Floor Tile & Mastic**

MATERIAL LOCATION: **2nd Floor Corridor (under Drinking Fountains)**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

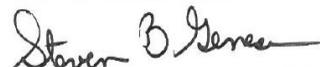

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 82 | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Multi-Color Single Tiles & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-----------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Rooms 106 & 213 | | |
| MATERIAL QUANTITY: | 1600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **82**

MATERIAL DESCRIPTION: **12x12 White w/Multi-Color Single Tiles & Mastic**

MATERIAL LOCATION: **Rooms 106 & 213**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

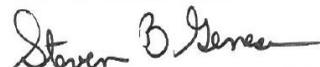

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 82A | | |
| MATERIAL DESCRIPTION: | 12x12 White w/Multi-Color Single Tiles & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 106 & 213 | | |
| MATERIAL QUANTITY: | 1600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **82A**

MATERIAL DESCRIPTION: **12x12 White w/Multi-Color Single Tiles & Mastic**

MATERIAL LOCATION: **Room 106 & 213**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

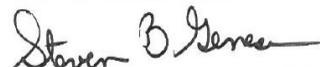

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 83 | | |
| MATERIAL DESCRIPTION: | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 207, 209, 214, 216 | | |
| MATERIAL QUANTITY: | 1200 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **83**

MATERIAL DESCRIPTION: **12x12 Gray Streaked Vinyl Floor Tile & Mastic**

MATERIAL LOCATION: **Room 207, 209, 214, 216**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

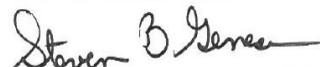

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 83A | | |
| MATERIAL DESCRIPTION: | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 214 | | |
| MATERIAL QUANTITY: | 800 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **83A**

MATERIAL DESCRIPTION: **12x12 Gray Streaked Vinyl Floor Tile & Mastic**

MATERIAL LOCATION: **Room 214**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

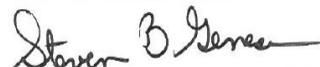

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 84 | | |
| MATERIAL DESCRIPTION: | 12x12 Gray Streaked Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 120/122 (Addition) | | |
| MATERIAL QUANTITY: | 1600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | No Access 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **84**

MATERIAL DESCRIPTION: **12x12 Gray Streaked Vinyl Floor Tile**

MATERIAL LOCATION: **Room 120/122 (Addition)**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

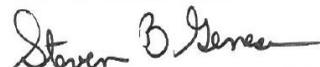

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 84A | | |
| MATERIAL DESCRIPTION: | 12x12 Gray Streaked Vinyl Floor Tile & Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|-------------------------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 120/122 (Addition) | | |
| MATERIAL QUANTITY: | 1600 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | No Access 2025 | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **84A**

MATERIAL DESCRIPTION: **12x12 Gray Streaked Vinyl Floor Tile & Mastic**

MATERIAL LOCATION: **Room 120/122 (Addition)**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

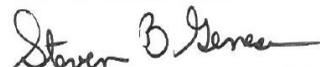

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 85 | | |
| MATERIAL DESCRIPTION: | 12x12 Maroon Vinyl Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1st & 2nd Floor Corridor near Elevator and Unisex Bathroom | | |
| MATERIAL QUANTITY: | 100 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **85**

MATERIAL DESCRIPTION: **12x12 Maroon Vinyl Floor Tile**

MATERIAL LOCATION: **1st & 2nd Floor Corridor near Elevator and Unisex Bathroom**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

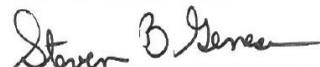

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|----|
| HOMOGENEOUS AREA: | 85A | | |
| MATERIAL DESCRIPTION: | 12x12 Maroon Vinyl Floor Tile Mastic | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | 1st & 2nd Floor Corridor near Elevator and Unisex Bathroom | | |
| MATERIAL QUANTITY: | 100 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | DAMAGE UNITS: SF | | |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **85A**

MATERIAL DESCRIPTION: **12x12 Maroon Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1st & 2nd Floor Corridor near Elevator and Unisex Bathroom**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

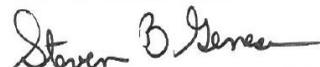

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 86 | | |
| MATERIAL DESCRIPTION: | 12x12 Grey, White & Dark Grey Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Teachers' Lounge (Room 101), 103, Main Office & Principal's Office | | |
| MATERIAL QUANTITY: | 3135 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **86**

MATERIAL DESCRIPTION: **12x12 Grey, White & Dark Grey Floor Tile**

MATERIAL LOCATION: **Teachers' Lounge (Room 101), 103, Main Office & Principal's Office**

MATERIAL QUANTITY: **3135** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

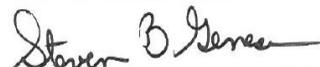

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 86A | | |
| MATERIAL DESCRIPTION: | Mastic associated with 12x12 Grey White & Dark Grey Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|--|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Teachers' Lounge (Room 101), 103, Main Office & Principal's Office | | |
| MATERIAL QUANTITY: | 3135 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **86A**

MATERIAL DESCRIPTION: **Mastic associated with 12x12 Grey White & Dark Grey Floor Tile**

MATERIAL LOCATION: **Teachers' Lounge (Room 101), 103, Main Office & Principal's Office**

MATERIAL QUANTITY: **3135** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

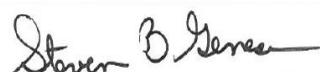

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|---|----------|----|
| HOMOGENEOUS AREA: | 87 | | |
| MATERIAL DESCRIPTION: | 12x12 Yellow, Blue & White w/Blue Specks Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 115 | | |
| MATERIAL QUANTITY: | 690 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **87**

MATERIAL DESCRIPTION: **12x12 Yellow, Blue & White w/Blue Specks Floor Tile**

MATERIAL LOCATION: **Room 115**

MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

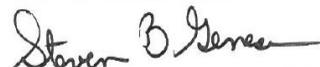

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 87A | | |
| MATERIAL DESCRIPTION: | Mastic associated with 12x12 Yellow, Blue & White w/Blue Specks Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 115**

MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **87A**

MATERIAL DESCRIPTION: **Mastic associated with 12x12 Yellow, Blue & White w/Blue Specks Floor Tile**

MATERIAL LOCATION: **Room 115**

MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

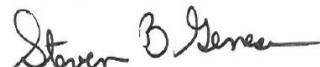

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--|----------|----|
| HOMOGENEOUS AREA: | 88 | | |
| MATERIAL DESCRIPTION: | Mastic associated with 24x24 Blue Green & Grey Rubber Floor Tile | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | No |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

| | | | |
|------------------------|----------|-----------------|----|
| DISTURBANCE POTENTIAL: | LOW | | |
| MATERIAL LOCATION: | Room 117 | | |
| MATERIAL QUANTITY: | 906 | MATERIAL UNITS: | SF |
| DAMAGE QUANTITY: | | DAMAGE UNITS: | SF |
| COMMENTS: | | | |

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **88**

MATERIAL DESCRIPTION: **Mastic associated with 24x24 Blue Green & Grey Rubber Floor Tile**

MATERIAL LOCATION: **Room 117**

MATERIAL QUANTITY: **906** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

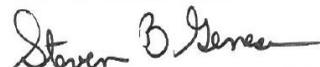

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: A

MATERIAL DESCRIPTION: Boiler Cement ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Basement

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Bolier Cement ABATED**

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

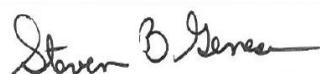

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: E

MATERIAL DESCRIPTION: Aircell Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1958 Building- Basement, Throughout Classrooms

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation ABATED**

MATERIAL LOCATION: **1958 Building- Basement, Throughout Classrooms**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

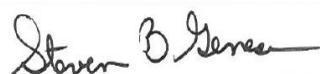

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: F

MATERIAL DESCRIPTION: Aircell Pipe Joint Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1958 Building- Throughout

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **Aircell Pipe Joint Insulation ABATED**

MATERIAL LOCATION: **1958 Building- Throughout**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

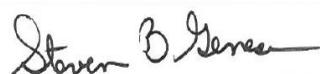

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: G

MATERIAL DESCRIPTION: Paperwrap Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1944 Addition- Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation ABATED**

MATERIAL LOCATION: **1944 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

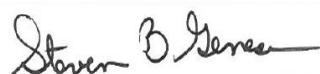

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: H

MATERIAL DESCRIPTION: Paperwrap Pipe Joint Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1944 Addition- Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Paperwrap Pipe Joint Insulation ABATED**

MATERIAL LOCATION: **1944 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

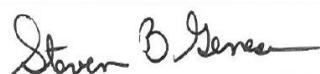

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: I

MATERIAL DESCRIPTION: Paperwrap Pipe ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1948 Addition- Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Paperwrap Pipe ABATED**

MATERIAL LOCATION: **1948 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

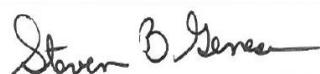

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: J

MATERIAL DESCRIPTION: Paperwrap Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1951 Building- Pipe Chase, Attic Crawlspace

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation ABATED**

MATERIAL LOCATION: **1951 Building- Pipe Chase, Attic Crawlspace**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

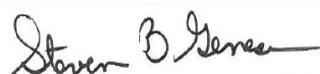

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: K

MATERIAL DESCRIPTION: Aircell Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1944 Addition- Basement

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation ABATED**

MATERIAL LOCATION: **1944 Addition- Basement**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

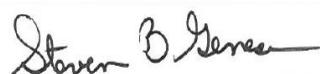

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: M

MATERIAL DESCRIPTION: Aircell Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1951 Addition- Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation ABATED**

MATERIAL LOCATION: **1951 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

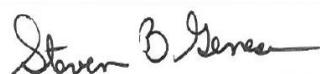

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: N

MATERIAL DESCRIPTION: Aircell Pipe Joint Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1944 Addition- Basement

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **Aircell Pipe Joint Insulation ABATED**

MATERIAL LOCATION: **1944 Addition- Basement**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

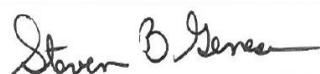

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

| | | | |
|----------------------------------|--------------------------------------|----------|--|
| HOMOGENEOUS AREA: | NEW | | |
| MATERIAL DESCRIPTION: | Newly Installed Suspect ACM | | |
| HISTORICAL AHERA DAMAGE CATEGORY | 6 ACBM with the potential for damage | | |
| HISTORICAL DAMAGE REASON: | | | |
| HISTORICAL RESPONSE ACTION: | Follow O&M Plan | | |
| ASBESTOS TYPE: | Assumed | FRIABLE: | |

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Installed After Implementation of Management Plan or After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

MATERIAL LOCATION: **Installed After Implementation of Management Plan or After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

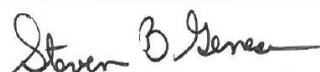

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **O**

MATERIAL DESCRIPTION: **Paperwrap Joint Insulation ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1948 Addition- Pipe Chase**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **O**

MATERIAL DESCRIPTION: **Paperwrap Joint Insulation ABATED**

MATERIAL LOCATION: **1948 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

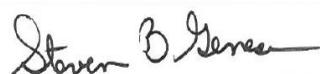

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: P

MATERIAL DESCRIPTION: Paperwrap Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1958 Addition- Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation ABATED**

MATERIAL LOCATION: **1958 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

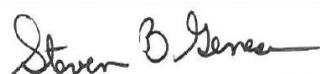

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: Q

MATERIAL DESCRIPTION: Mag Block Pipe Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1958 Addition- Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **Mag Block Pipe Insulation ABATED**

MATERIAL LOCATION: **1958 Addition- Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

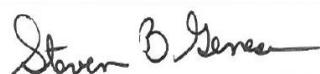

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: R

MATERIAL DESCRIPTION: Paperwrap Pipe Joint Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Pipe Chase & Attic Crawlspace

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **R**

MATERIAL DESCRIPTION: **Paperwrap Pipe Joint Insulation ABATED**

MATERIAL LOCATION: **Pipe Chase & Attic Crawlspace**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

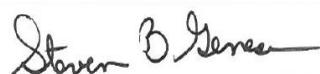

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: S

MATERIAL DESCRIPTION: Paperwrap Pipe Joint Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1958 Addition-Pipe Chase

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **S**

MATERIAL DESCRIPTION: **Paperwrap Pipe Joint Insulation ABATED**

MATERIAL LOCATION: **1958 Addition-Pipe Chase**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

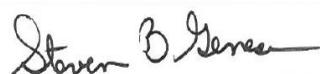

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: U

MATERIAL DESCRIPTION: Fiberglass Joint Insulation ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throuhgout All Buildings

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **U**

MATERIAL DESCRIPTION: **Fiberglass Joint Insulation ABATED**

MATERIAL LOCATION: **Throuhgout All Buildings**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

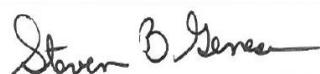

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

| | | | | | |
|--------------|---------------------------|------------------|----------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUIDLING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | Imani Robinson | | |
| SCHOOL NAME: | Burnham @ Lawrence School | INSPECTION DATE: | 5/9/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: V

MATERIAL DESCRIPTION: Duct Insulation Tape ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1951 Building- Crawlspace

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

| | | | | | |
|--------------|----------------------------------|---------------------|-----------------------|--------------|-------------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 24261 | BUILDING ID: | 4550 |
| CITY/STATE: | Chicago, Illinois | MANAGEMENT PLANNER: | Steven Geneser | | |
| SCHOOL NAME: | Burnham @ Lawrence School | REVIEW DATE: | 6/2/2025 | | |
| ADDRESS: | 9928 S. Crandon Avenue | IDPH LICENSE NO: | 100-19716 | | |

HOMOGENEOUS AREA: **V**

MATERIAL DESCRIPTION: **Duct Insulation Tape ABATED**

MATERIAL LOCATION: **1951 Building- Crawlspace**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

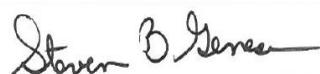

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**
SCHOOL NAME: **Burnham @ Lawrence School** INSPECTION DATE: **5/9/2025**
ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **89M**
MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Cream w/Specs Floor Tile**
MATERIAL LOCATION: **Room 206**
MATERIAL QUANTITY: **685** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Burnham @ Lawrence School** REVIEW DATE: **6/2/2025**

ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

HOMOGENEOUS AREA: **89M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Cream w/Specs Floor Tile**

MATERIAL LOCATION: **Room 206**

MATERIAL QUANTITY: **685** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

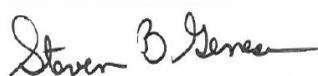

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**
SCHOOL NAME: **Burnham @ Lawrence School** INSPECTION DATE: **5/9/2025**
ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **90M**
MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern)**
MATERIAL LOCATION: **Room 213**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Burnham @ Lawrence School** REVIEW DATE: **6/2/2025**

ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

HOMOGENEOUS AREA: **90M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Red & Brown Floor Tile (checker pattern)**

MATERIAL LOCATION: **Room 213**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

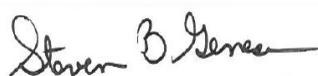

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**
SCHOOL NAME: **Burnham @ Lawrence School** INSPECTION DATE: **5/9/2025**
ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **12"x12" Red & Brown Floor Tile (checker pattern)**
MATERIAL LOCATION: **Room 213**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Burnham @ Lawrence School** REVIEW DATE: **6/2/2025**

ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

HOMOGENEOUS AREA: **90**

MATERIAL DESCRIPTION: **12"x12" Red & Brown Floor Tile (checker pattern)**

MATERIAL LOCATION: **Room 213**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

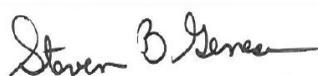

Date: **06/02/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Imani Robinson**
SCHOOL NAME: **Burnham @ Lawrence School** INSPECTION DATE: **5/9/2025**
ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **12"x12" Cream w/Specks Floor Tile**
MATERIAL LOCATION: **Room 206**
MATERIAL QUANTITY: **685** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24261** BUIDLING ID: **4550**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Burnham @ Lawrence School** REVIEW DATE: **6/2/2025**

ADDRESS: **9928 S. Crandon Avenue** IDPH LICENSE NO: **100-19716**

HOMOGENEOUS AREA: **89**

MATERIAL DESCRIPTION: **12"x12" Cream w/Speccks Floor Tile**

MATERIAL LOCATION: **Room 206**

MATERIAL QUANTITY: **685** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

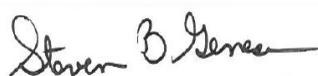

Date: **06/02/2025**

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that IMANI ROBINSON has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the examination on 03/19/2025 with a minimum score of 70% or better. Training was in accordance with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

Course Dates:
03/19/2025

Expires:
03/19/2026



Certificate Number:
2503BIR07

Director of Training
Nicholas J. Penefit
Doctor of Public Health

FORM # A-010B


A handwritten signature in black ink, appearing to read "Nicholas J. Penefit".

Phone: 312-491-0081

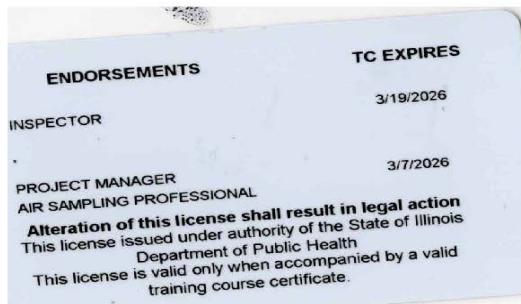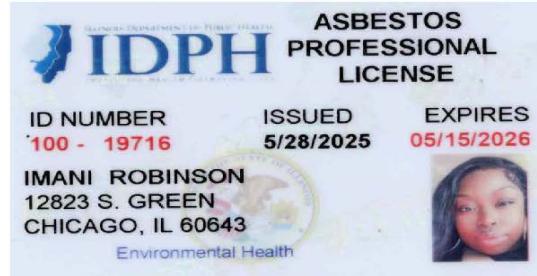



TEM ENVIRONMENTAL, INC.
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS

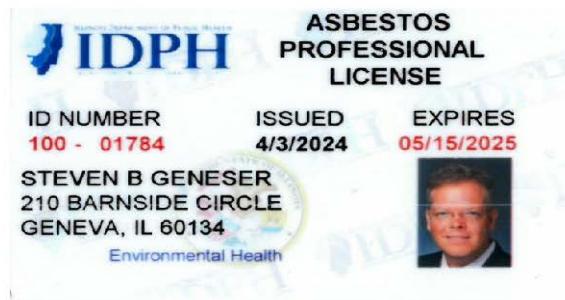

ENDORSEMENTS

TC EXPIRES

INSPECTOR 4/5/2024

MANAGEMENT PLANNER 4/5/2024

PROJECT MANAGER 4/4/2024

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

STEVEN B GENESER
210 BARNSIDE CIRCLE
GENEVA, IL 60134


6/6/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 01784

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

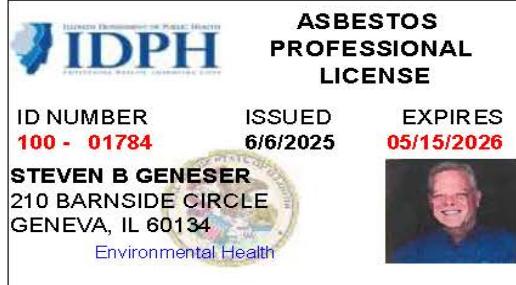

Back of License

| ENDORSEMENTS | TC EXPIRES |
|--|------------|
| INSPECTOR | 5/7/2026 |
| MANAGEMENT PLANNER | 5/7/2026 |
| PROJECT MANAGER | 5/6/2026 |
| AIR SAMPLING PROFESSIONAL | |
| <p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p> | |

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

**Reliable
Environmental
Solutions, Inc. R E S**

This is to certify that

Steve Geneser

*has on 5/7/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: May 7, 2025

COURSE LENGTH: 4 HOURS

Examination Date: May 7, 2025

Expiration Date: May 7, 2026

Certificate Number: MPR/0561

William S. Williams

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com

**Reliable
Environmental
Solutions, Inc. R E S**

This is to certify that

Steve Geneser

*has on 5/7/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher.*

Course Date: May 7, 2025

COURSE LENGTH: 4 HOURS

Examination Date: May 7, 2025

Expiration Date: May 7, 2026

Certificate Number: BIR/1252



Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com



This is to certify that

Steve Geneser

*has on 5/8/24, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: May 8, 2024

Examination Date: May 8, 2024

Expiration Date: May 8, 2025

Certificate Number: MPR/0531

COURSE LENGTH: 4 HOURS

A handwritten signature in black ink that reads "William S. Williams".

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

| | CODE | KEY |
|--------------------------|------|--|
| MATERIAL | ACBM | Asbestos Containing Building Materials |
| MATERIAL CATEGORY | MISC | Miscellaneous |
| | SURF | Surfacing |
| | TSI | Thermal System Insulation |
| MATERIAL UNITS | LF | Linear Feet |
| | SF | Square Feet |
| | CF | Cubic Feet |
| DAMAGE TYPE | Loc | Localized |
| | Dist | Distributed |