

ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2203  
SCHOOL NAME: Field School  
ADDRESS OF SCHOOL: 7019 N Ashland Avenue  
CITY: Chicago, IL, 60626

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 9/17/2022

If the address on this form is different than the address of the building, submit a written explanation.

**SECTION II** *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 2/12/2025 ENROLLMENT 131  
IDPH INSPECTOR LICENSE NUMBER: 100-11089  
IDPH LICENSED INSPECTOR NAME (Please Print): Panfilo Carrazco  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

*Richard J. Schleyer* 3/4/2025

Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Field School**

7019 N Ashland Avenue  
Chicago, IL, 60626

Unit: 23211  
Building ID: 3350

IDPH ID Number: 14-016-2990-2203

**REPORT DATE:**  
Tuesday, March 04, 2025

**Prepared for:**  
**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**  
**Specialty Consulting, Inc.**

2942 W. Van Buren Street  
Chicago, IL, 60612  
Phone (312) 319-7575  
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

03/04/2025

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299      Unit: 23211      Region: 01      IDPH ID: 14-016-2990-2203

School: Field School      Building ID: 3350

Address: 7019 N Ashland Avenue

Chicago, IL, 60626

Building Contact: Brewer, Jerome      Contact Phone: 7737105489

Current Building Owners: Chicago Public Schools

Reinspection Date: 2/12/2025

Review Date: 03/04/2025

Inspector: Panfilo Carrazco

Inspector IDPH License: 100-11089

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,  
Specialty Consulting, Inc.



Jigar Shah  
100-07342

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 04, 2025

RE: Field School, Unit 23211  
7019 N Ashland Avenue  
Chicago, IL, 60626

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Field School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Field School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J. Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074.

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Field School  
Address: 7019 N Ashland Avenue  
IDPH ID: 14-016-2990-2203  
Contact: Brewer, Jerome

Unit: 23211  
Chicago, IL, 60626  
Building ID: 3350  
Phone: 7737105489

Region: 01

### 2. Description of Facility

Original Construction: 1997  
Total Square Footage: 2100  
Current Occupancy: 131

Additional Construction:  
No of Floors: 1

### 3. LEA Designated Person

Contact: Richard J.Schleyer  
Address: 42 West Madison Street  
Chicago, IL 60602

Phone: (773) 251-7074

### 4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.  
Contact: Jigar Shah  
Address 2942 W. Van Buren Street  
Phone: (312) 319-7575

Fax: (312) 319-7580

### 5. Inspector

Inspector Name: Panfilo Carrazco



Signature:  
Date: 2/12/2025

### 6. Management Planner

Management Planner Name: Jigar Shah




Signature:  
Date: 03/04/2025

### 7. Review Date: 03/04/2025

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

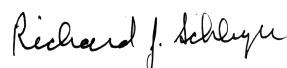

Date: 3/4/2025

Name: Richard J.Schleyer

## II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Field School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3350:

49	12"x12" Grey Streaked VFT
50	12"x12" Grey Streaked VFT

B. The following new homogenous areas have been identified for Building 3350:

64

Table Tops

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

05	12"x12" Tan w/Gray VFT
07	12"x12" Tan w/Streaks VFT
08	12"x12" Tan w/Streaks VFT Mastic
102	12"x12" Gray VFT
102A	12"x12" Gray VFT MASTIC
103	Carpet Mastic
104	12"x12" Light gray, white & gray streaks VFT
104A	12"x12" Light gray, white & gray streaks VFT MASTIC
106	Decorative plaster
107	12"x12" White w/gray specs VFT
107A	12"x12" White w/gray specs VFT MASTIC
109	12"x12" Light gray w/ white and gray streaks VFT
109A	12"x12" Light gray w/ white & gray streaks VFT MASTIC
11	Tan w/White Linoleum
110	Pink insulation
111	2'x4' ceiling tiles w/grooves
113	Flooring Sheeting 2' x 2' new carpet (Not observed)
114	Cloth electric wire insulation
115	Spray on Fire proofing on beams -1898
116	Spray on Fire proofing on beams overspray-1915
117	Sink Undercoating
118	Sink Undercoating - 1941 Bldg.
12	Tan Linoleum
15	Asphalt Floor
16	Asphalt Floor
17	Asphalt Floor
20	12"x12" Tan w/Gray VFT Mastic
21	Tan w/White Linoleum Mastic
22	12"x12" Brown VFT Mastic
23	Tan Linoleum Mastic
24	12"x12" White VFT
24A	12"x12" White VFT Mastic
25	12"x12" Tan Spotted VFT
25A	12"x12" Tan Spotted VFT Mastic
27A	12"x12" Cream VFT Mastic
29	Blue Linoleum
29A	Blue Linoleum Mastic
30	Tan Linoleum
30A	Tan Linoleum Mastic
33	12"x12" Tan w/Brown VFT

33A	12"x12" Tan w/Brown VFT Mastic
40	Light Brown Linoleum
40A	Light Brown Linoleum Mastic
42	12"x12" Light Brown w/Gray Streaks VFT
42A	12"x12" Light Brown w/Gray Streaks VFT Mastic
43	12"x12" Light Pink w/White Streaks VFT
43A	12"x12" Light Pink w/White Streaks VFT Mastic
44	2'x4' Dot/Wave Ceiling Tile
45	2'x2' Dot/Wave Ceiling Tile
46	Carpet Mastic
47	2'x4' Dot/Wave Ceiling Tile
48	2'x4' Dot/Wave Ceiling Tile
49	12"x12" Grey Streaked VFT
50	12"x12" Grey Streaked VFT
54	12"x12" Black with streaks VFT
54 A	12"x12" Black with streaks MASTIC
55	12"x12" Black with streaks VFT
56	Drywall, tape & compound
57	Drywall, tape & compound
58	Decorative Plaster
59	Terrazzo
60	Fire Doors
60 A	Fire Doors -1898
64	Table Tops
EE	1'x1' Ceiling Tile
FF	Transite Table Tops
HH	Hard Coat Plaster
II	Hard Coat Plaster
JJ	Hard Coat Plaster
KK	Canvas Wrap

The following areas were deemed to be inaccessible:

106	Decorative plaster
110	Pink insulation
111	2'x4' ceiling tiles w/grooves
58	Decorative Plaster
N	Cardboard Pipe Insulation
O	MJP E/F/V on Cardboard Pipe Insulation

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Panfilo Carrazco, IDPH License # 100-11089. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and

Management Planner Licenses are included in Appendix B.

### III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

#### IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 1/31/2024  
7/30/2024

## V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

## VI. CONCLUSIONS

The Field School Building 3350 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04	12" x 12" Gray VFT (not observed)					MISC								
05	12"x12" Tan w/Gray VFT	700	SF	Room 102 - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06	12"x12" Brown VFT	350	SF	Room 10 - 1941 Bldg. (room changed to 510)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07	12"x12" Tan w/Streaks VFT	700	SF	Room 115 & Closet - 1898 Bldg. (room changed to 510)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
08	12"x12" Tan w/Streaks VFT Mastic	700	SF	Room 115 & Closet - 1898 Bldg. (room is now 510)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	12" x 12" Brown VFT (not observed)					MISC								
10	Green Linoleum (not observed)					MISC								
102	12"x12" Gray VFT	700	SF	Engineer's office & storage room - 1898 building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
102A	12"x12" Gray VFT MASTIC	700	SF	Engineer's office & storage room -1898 building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
103	Carpet Mastic	2,000	SF	Room 215, Main Office, Principal's Office - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
104	12"x12" Light gray, white & gray streaks VFT	2,100	SF	Lunchroom - 1941 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
104A	12"x12" Light gray, white & gray streaks VFT MASTIC	2,100	SF	Lunchroom - 1941 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
106	Decorative plaster	4,000	SF	Auditorium, Balcony, & Storage - 1915 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
107	12"x12" White w/gray specs VFT	80	SF	2nd Floor Speech Room- 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
107A	12"x12" White w/gray specs VFT MASTIC	80	SF	2nd Floor Speech Room- 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
109	12"x12" Light gray w/ white and gray streaks VFT	1,100	SF	RM 3 (Lunchroom) -1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
109A	12"x12" Light gray w/ white & gray streaks VFT MASTIC	1,100	SF	RM 3 (Lunchroom) -1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	Tan w/White Linoleum	120	SF	1st Floor Teacher's Toilet - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
110	Pink insulation	20,000	SF	Attic of 1941, 1915 additions	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
111	2'x4' ceiling tiles w/grooves	1,500	SF	Rooms 111, 112 -1941 Bldg	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
112	Brown linoleum Flooring			Auditorium Stage-1915 Bldg	ABATED	MISC								
112A	Brown linoleum Flooring Mastic			Auditorium Stage-1915 Bldg	ABATED	MISC								
113	Flooring Sheeting 2' x 2' new carpet (Not observed)	1,000	SF	Auditorium Balcony- 1915 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
114	Cloth electric wire insulation	1	LF	1st Floor boys bathroom -1915	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
115	Spray on Fire proofing on beams -1898	1,000	SF	Attic 1898	ASSUMED	SURFACE	Y	NONE	0			ACBM with the potential for damage		LOW
116	Spray on Fire proofing on beams overspray-1915	1,000	SF	Attic -1915	ASSUMED	SURFACE	Y	NONE	0			ACBM with the potential for damage		LOW
117	Sink Undercoating	5	SF	Room 104 -1898	ASSUMED	MISC	N	NONE	0					LOW
118	Sink Undercoating - 1941 Bldg.	10	SF	Room 510 - sinks	ASSUMED	MISC	N	NONE	0					LOW
12	Tan Linoleum	300	SF	Room 108 - 1941 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
13	12" x 12" Brown VFT Mastic (not observed)					MISC								
15	Asphalt Floor	1,500	SF	2nd Floor Corridor, Exit 5 Staircase - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
16	Asphalt Floor	2,000	SF	Throughout - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
17	Asphalt Floor	3,000	SF	Throughout - 1941 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	12" x 12" Gray VFT Mastic (not observed)					MISC								
19	Green Linoleum Mastic (not observed)					MISC								
20	12"x12" Tan w/Gray VFT Mastic	700	SF	Room 102 - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Tan w/White Linoleum Mastic	120	SF	1st Floor Teacher's Toilet - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12"x12" Brown VFT Mastic	350	SF	Room 10 - 1941 Bldg. (room is now 510)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Tan Linoleum Mastic	300	SF	Room 108 - 1941 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
24	12"x12" White VFT	600	SF	Room 001 (501) - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
24A	12"x12" White VFT Mastic	600	SF	Room 001 (501) - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12"x12" Tan Spotted VFT	4,000	SF	Assembly Hall - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
25A	12"x12" Tan Spotted VFT Mastic	4,000	SF	Assembly Hall - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
27	12"x12" Cream VFT	350	SF	Room 10 - 1941 Bldg. (room is now 510)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
27A	12"x12" Cream VFT Mastic	350	SF	Room 10 - 1941 Bldg. (room is now 510)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Blue Linoleum	100	SF	Basement: Men Teacher's Toilet (removed/ Not observed), Kitchen - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29A	Blue Linoleum Mastic	100	SF	Basement: Men Teacher's Toilet (removed/ Not observed), Kitchen - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Tan Linoleum	90	SF	2nd Floor Teacher's Toilet - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30A	Tan Linoleum Mastic	90	SF	2nd Floor Teacher's Toilet - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12"x12" Light Green VFT (not observed)					MISC								
32A	12"x12" Light Green VFT (not observed)					MISC								
33	12"x12" Tan w/Brown VFT	850	SF	Room 114, Men's bathroom - 1915 Bldg.	ASSUMED	MISC	N	LOC	5		No	ACBM with the potential for damage		MODERATE
33A	12"x12" Tan w/Brown VFT Mastic	850	SF	Room 114, Men's bathroom - 1915 Bldg.	ASSUMED	MISC	N	LOC	5		No	ACBM with the potential for damage		LOW
40	Light Brown Linoleum	1,200	SF	Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
40A	Light Brown Linoleum Mastic	1,200	SF	Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12"x12" Light Brown w/Gray Streaks VFT	800	SF	Room 119, Room 119 Closet & Toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				- 1898 Bldg.										
42A	12"x12" Light Brown w/Gray Streaks VFT Mastic	800	SF	Room 119, Room 119 Closet & Toilet - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12"x12" Light Pink w/White Streaks VFT	600	SF	Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
43A	12"x12" Light Pink w/White Streaks VFT Mastic	600	SF	Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	2'x4' Dot/Wave Ceiling Tile	2,300	SF	Rooms 113, 114, Lunchroom #3 (1915 Addition)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
45	2'x2' Dot/Wave Ceiling Tile	300	SF	Kitchen by Lunch Room #3 in 1915 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
46	Carpet Mastic	1,700	SF	Library/Computer Room (215), MDF room - 1898 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	2'x4' Dot/Wave Ceiling Tile	1,600	SF	Room 112, 111 - 1941	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
48	2'x4' Dot/Wave Ceiling Tile	1,200	SF	Room 206, Principal's office - 1898	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
49	12"x12" Grey Streaked VFT	300	SF	Basement Lunchroom #3, Kitchen - 1915 Bldg	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
50	12"x12" Grey Streaked VFT	300	SF	Basement Lunchroom #3, Kitchen - 1915 Bldg	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
51	12"x12" White w/ Grey Streaks VFT (not observed)				ABATED	MISC								
52	12"x12" White w/ Grey Streaks VFT Mastic (not observed)				ABATED	MISC								
53	12"x12" Green w/ streaks VFT (ABATED)			Engineer's Office, Toilet & Storage - 1898 Bldg.	ABATED	MISC					No			

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
53A	12"x12" Green w/ streaks (ABATED)			Engineer's Office, Toilet & Storage - 1898 Bldg.	ABATED	MISC					No			
54	12"x12" Black with streaks VFT	550	SF	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
54 A	12"x12" Black with streaks MASTIC	550	SF	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12"x12" Black with streaks VFT	360	SF	Basement, 1st & 2nd floor, elevator vestibules - 2008 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Drywall, tape & compound	1,500	SF	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	Drywall, tape & compound	2,000	SF	Basement, 1st & 2nd floor elevator vestibule - 1898 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	Decorative Plaster	60	SF	Corridor in front of asst. principals office - 1898 Bldg	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
59	Terrazzo	500	SF	Stairwells & vestibules - 1941 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	Fire Doors	12	EA	Corridors between additions - 1915 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60 A	Fire Doors -1898	4	EA	Room 218 Wardrobe - 1898 Bldg.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
61	Drywall, Tape, and Compound (REMOVED)			Throughout Mobile Unit (REMOVED)		MISC			0					
62	12"X12" White VFT (REMOVED)			Throughout Mobile Unit (REMOVED) (no longer on-site)		MISC			0					
62A	12"X12" White VFT Mastic (REMOVED)			Throughout Mobile Unit (REMOVED) (no longer on-site)		MISC			0					

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
63	2'X4' Ceiling Tiles (REMOVED)			Throughout Mobile Unit (REMOVED)		MISC			0					
64	Table Tops	108	SF	Boiler Room	ASSUMED	MISC		NONE	0			ACBM with the potential for damage		MODERATE
A	Aircell Pipe Insulation	1,900	LF	Valve Rm, Engine Room, Engineer's Office & Toilet, Room 004 Closet, Basement Corridor - 1898 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage	3	LOW
B	MJP E/F/V on Aircell Pipe Insulation	95	FITTING	Valve Room, Engine Room, Engineer's Office & Toilet, Rm 004 Closet, Basement Corridor - 1898 Bldg.	CHR	TSI	Y	DIST	3		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW
C	Aircell Pipe Insulation	150	LF	Basement Corridor; Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet, auditorium crawl space - 1915	CHR	TSI	Y	LOC	3		No	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
D	MJP E/F/V on Aircell Pipe Insulation	18	FITTING	Basement: Hall, Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet - 1915	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
DD	Vibration Duct Sleeve	12	SF	Basement Corridor & Fan Room - 1941 Bldg.	AMO	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
E	Aircell Pipe Insulation	170	LF	Basement: Room 10, Fan Room - 1941 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
EE	1'x1' Ceiling Tile	750	SF	Room 206 & Closet - 1898 Bldg.	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	Aircell Duct Insulation	400	SF	Basement Corridor - 1898 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
FF	Transite Table Tops	40	SF	Room 115 - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
G	MJP E/F/V on Fiberglass Pipe Insulation	142	FITTING	Throughout Basement - 1898 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
GG	MJP E/F/V on Mag Block Pipe Insulation	60	FITTING	Valve Room by	CHR	TSI	Y	NONE	0		No	ACBM with the		LOW

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Engine Room, Air Plenum Chamber Cold Deck - 1898 Bldg.							potential for damage			
HH	Hard Coat Plaster	20,000	SF	Throughout - 1898 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
I	MJP E/F/V on Fiberglass Pipe Insulation	120	FITTING	Throughout Basement; 1st & 2nd Fl Toilets; Teacher's, Boy's & Girl's - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
II	Hard Coat Plaster	30,000	SF	Throughout - 1915 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
J	Aircell Duct Insulation	550	SF	Basement: Hallway, Lunchroom #3 - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
JJ	Hard Coat Plaster	20,000	SF	Throughout - 1941 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
K	MJP E/F/V on Aircell Pipe Insulation	32	FITTING	Basement: Room 10, Fan Room, Main Corridor, Room 504 wardrobe - 1941 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
KK	Canvas Wrap	100	SF	Rooms 006 & 216 - 1898 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
L	Cardboard Pipe Insulation	250	LF	Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
M	MJP E/F/V on Cardboard Pipe Insulation	40	FITTING	Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
N	Cardboard Pipe Insulation	160	LF	Basement: Platform, Main Corridor Store Rm (013), Boiler Rm; 2nd Fl Boy's Toilet - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
O	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Basement Main Corridor, Boiler Room, 2nd Floor Boy's Toilet - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350

**Address** 7019 N Ashland Avenue **Region** 01

## **ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS**

## Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC) Specialty Consulting, Inc.**

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

***Inspector's Comments are Summarized at the End of the Report***

# Chicago Public Schools

School Field School Unit 23211 Building ID 3350

Address 7019 N Ashland Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date	<u>2/12/2025</u>
Inspector Name	<u>Panfilo Carrasco</u>
<b>100-11089</b>	<b>5/15/2026</b>
Inspector's IDPH License Number / Expiration Date	

#### Inspector's Comments

HA Number:	Inspector Comments:
04	
05	
06	
07	
08	
09	
10	
102	
102A	
103	
104	
104A	
106	
107	
107A	
109	
109A	
11	
110	
111	
112	
112A	
113	
114	

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350  
**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA Number:	Inspector Comments:
115	
116	
117	
118	
12	
13	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
24A	
25	
25A	
27	
27A	
29	
29A	
30	
30A	
32	
32A	
33	damaged located in Room 114
33A	damaged located in Room 114

# Chicago Public Schools

School Field School Unit 23211 Building ID 3350

Address 7019 N Ashland Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA Number:	Inspector Comments:
40	
40A	
42	
42A	
43	
43A	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
53A	
54	
54 A	
55	
56	
57	
58	
59	
60	
60 A	
61	
62	
62A	

# Chicago Public Schools

School Field School Unit 23211 Building ID 3350

Address 7019 N Ashland Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA Number:	Inspector Comments:
63	
64	Material is Stored in the Boiler Room
A	
B	O & M Patch and repair needed in Engine Room and Engineer's Restroom
C	O & M Patch and repair needed in Boiler Room
D	
DD	
E	
EE	
F	
FF	
G	
GG	
HH	
I	
II	
J	
JJ	
K	
KK	
L	
M	
N	
O	
P	
Q	
R	
S	
T	O & M Patch and repair needed in Hall by 504, and Tank Room

# Chicago Public Schools

**School** Field School **Unit** 23211 **Building ID** 3350

**Address** 7019 N Ashland Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
U	
V	
W	
X	
Y	

**Table II**  
**Management Planner's Review**

---

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575      Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
04	12" x 12" Gray VFT (not observed)					MISC					
05	12"x12" Tan w/Gray VFT	700	SF	Room 102 - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" Brown VFT	350	SF	Room 10 - 1941 Bldg. (room changed to 510)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Tan w/Streaks VFT	700	SF	Room 115 & Closet - 1898 Bldg. (room changed to 510)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Tan w/Streaks VFT Mastic	700	SF	Room 115 & Closet - 1898 Bldg. (room is now 510)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12" x 12" Brown VFT (not observed)					MISC					
10	Green Linoleum (not observed)					MISC					
102	12"x12" Gray VFT	700	SF	Engineer's office & storage room - 1898 building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
102A	12"x12" Gray VFT MASTIC	700	SF	Engineer's office & storage room -1898 building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
103	Carpet Mastic	2,000	SF	Room 215, Main Office, Principal's Office - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104	12"x12" Light gray, white & gray streaks VFT	2,100	SF	Lunchroom - 1941 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104A	12"x12" Light gray, white & gray streaks VFT MASTIC	2,100	SF	Lunchroom - 1941 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
106	Decorative plaster	4,000	SF	Auditorium, Balcony, & Storage - 1915 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107	12"x12" White w/gray specs VFT	80	SF	2nd Floor Speech Room- 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107A	12"x12" White w/gray specs VFT MASTIC	80	SF	2nd Floor Speech Room- 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	12"x12" Light gray w/ white and gray streaks VFT	1,100	SF	RM 3 (Lunchroom) -1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109A	12"x12" Light gray w/ white & gray streaks VFT MASTIC	1,100	SF	RM 3 (Lunchroom) -1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Tan w/White Linoleum	120	SF	1st Floor Teacher's Toilet - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
110	Pink insulation	20,000	SF	Attic of 1941, 1915 additions	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
111	2'x4' ceiling tiles w/grooves	1,500	SF	Rooms 111, 112 -1941 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
112	Brown linoleum Flooring			Auditorium Stage- 1915 Bldg	Abated	MISC					
112A	Brown linoleum Flooring Mastic			Auditorium Stage- 1915 Bldg	Abated	MISC					
113	Flooring Sheeting 2' x 2' new carpet (Not observed)	1,000	SF	Auditorium Balcony- 1915 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
114	Cloth electric wire insulation	1	LF	1st Floor boys bathroom-1915	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
115	Spray on Fire proofing on beams -1898	1,000	SF	Attic 1898	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116	Spray on Fire proofing on beams overspray-1915	1,000	SF	Attic -1915	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
117	Sink Undercoating	5	SF	Room 104 -1898	Assumed	MISC	No	0	SF		Follow O&M Plan
118	Sink Undercoating - 1941 Bldg.	10	SF	Room 510 - sinks	Assumed	MISC	No	0	SF		Follow O&M Plan
12	Tan Linoleum	300	SF	Room 108 - 1941 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12" x 12" Brown VFT Mastic (not observed)					MISC					
15	Asphalt Floor	1,500	SF	2nd Floor Corridor, Exit 5 Staircase - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Asphalt Floor	2,000	SF	Throughout - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Asphalt Floor	3,000	SF	Throughout - 1941 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12" x 12" Gray VFT Mastic (not observed)					MISC					
19	Green Linoleum Mastic (not observed)					MISC					
20	12"x12" Tan w/Gray VFT Mastic	700	SF	Room 102 - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Tan w/White Linoleum Mastic	120	SF	1st Floor Teacher's Toilet - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Brown VFT Mastic	350	SF	Room 10 - 1941 Bldg. (room is now 510)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Tan Linoleum Mastic	300	SF	Room 108 - 1941 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" White VFT	600	SF	Room 001 (501) - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24A	12"x12" White VFT Mastic	600	SF	Room 001 (501) - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" Tan Spotted VFT	4,000	SF	Assembly Hall - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	12"x12" Tan Spotted VFT Mastic	4,000	SF	Assembly Hall - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" Cream VFT	350	SF	Room 10 - 1941 Bldg. (room is now 510)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27A	12"x12" Cream VFT Mastic	350	SF	Room 10 - 1941 Bldg. (room is now 510)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Blue Linoleum	100	SF	Basement: Men Teacher's Toilet (removed/ Not observed), Kitchen - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29A	Blue Linoleum Mastic	100	SF	Basement: Men Teacher's Toilet (removed/ Not observed), Kitchen - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Tan Linoleum	90	SF	2nd Floor Teacher's Toilet - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30A	Tan Linoleum Mastic	90	SF	2nd Floor Teacher's Toilet - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12"x12" Light Green VFT (not observed)					MISC					
32A	12"x12" Light Green VFT (not observed)					MISC					
33	12"x12" Tan w/Brown VFT	850	SF	Room 114, Men's bathroom - 1915 Bldg.	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575      Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
33A	12"x12" Tan w/Brown VFT Mastic	850	SF	Room 114, Men's bathroom - 1915 Bldg.	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	Light Brown Linoleum	1,200	SF	Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	Light Brown Linoleum Mastic	1,200	SF	Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12"x12" Light Brown w/Gray Streaks VFT	800	SF	Room 119, Room 119 Closet & Toilet - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12"x12" Light Brown w/Gray Streaks VFT Mastic	800	SF	Room 119, Room 119 Closet & Toilet - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12"x12" Light Pink w/White Streaks VFT	600	SF	Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43A	12"x12" Light Pink w/White Streaks VFT Mastic	600	SF	Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	2'x4' Dot/Wave Ceiling Tile	2,300	SF	Rooms 113, 114, Lunchroom #3 (1915 Addition)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	2'x2' Dot/Wave Ceiling Tile	300	SF	Kitchen by Lunch Room #3 in 1915 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Carpet Mastic	1,700	SF	Library/Computer Room (215), MDF room - 1898 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	2'x4' Dot/Wave Ceiling Tile	1,600	SF	Room 112, 111 - 1941	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	2'x4' Dot/Wave Ceiling Tile	1,200	SF	Room 206, Principal's office - 1898	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12"x12" Grey Streaked VFT	300	SF	Basement Lunchroom #3, Kitchen - 1915 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12"x12" Grey Streaked VFT	300	SF	Basement Lunchroom #3, Kitchen - 1915 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12"x12" White w/ Grey Streaks VFT (not observed)				Abated	MISC					
52	12"x12" White w/ Grey Streaks VFT Mastic (not observed)				Abated	MISC					
53	12"x12" Green w/ streaks VFT (ABATED)			Engineer's Office, Toilet & Storage - 1898 Bldg.	Abated	MISC					
53A	12"x12" Green w/ streaks (ABATED)			Engineer's Office, Toilet & Storage -	Abated	MISC					

# Chicago Public Schools

**School** Field School  
**Address** 7019 N Ashland Avenue

**Unit** 23211  
**Chicago, IL, 60626**

**Building ID** 3350  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575      Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				1898 Bldg.							
54	12"x12" Black with streaks VFT	550	SF	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54 A	12"x12" Black with streaks MASTIC	550	SF	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12"x12" Black with streaks VFT	360	SF	Basement, 1st & 2nd floor, elevator vestibules - 2008 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	Drywall, tape & compound	1,500	SF	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Drywall, tape & compound	2,000	SF	Basement, 1st & 2nd floor elevator vestibule -1989 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	Decorative Plaster	60	SF	Corridor in front of asst. principals office -1898 Bldg	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Terrazzo	500	SF	Stairwells & vestibules - 1941 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	Fire Doors	12	EA	Corridors between additions - 1915 Bldg.	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
60 A	Fire Doors -1898	4	EA	Room 218 Wardrobe - 1898 Bldg.	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
61	Drywall, Tape, and Compound (REMOVED)			Throughout Mobile Unit (REMOVED)		MISC		0			Follow O&M Plan
62	12'X12" White VFT (REMOVED)			Throughout Mobile Unit (REMOVED) (no longer on-site)		MISC		0			Follow O&M Plan
62A	12'X12" White VFT Mastic (REMOVED)			Throughout Mobile Unit (REMOVED) (no longer on-site)		MISC		0			Follow O&M Plan
63	2'X4' Ceiling Tiles (REMOVED)			Throughout Mobile Unit (REMOVED)		MISC		0			Follow O&M Plan
64	Table Tops	108	SF	Boiler Room	Assumed	MISC		0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Aircell Pipe Insulation	1,900	LF	Valve Rm, Engine Room, Engineer's Office & Toilet, Room 004 Closet, Basement Corridor - 1898 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Repair
B	MJP E/F/V on Aircell Pipe Insulation	95	FITTING	Valve Room, Engine Room, Engineer's Office & Toilet, Rm 004 Closet, Basement Corridor - 1898 Bldg.	Chrysotile	TSI	Yes	3	FITTING	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
C	Aircell Pipe Insulation	150	LF	Basement Corridor; Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet,	Chrysotile	TSI	Yes	3	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair

# Chicago Public Schools

School Field School

Unit 23211

Building ID 3350

Address 7019 N Ashland Avenue

Chicago, IL, 60626

Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
D	MJP E/F/V on Aircell Pipe Insulation	18	FITTING	auditorium crawl space - 1915 Basement: Hall, Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet - 1915	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
DD	Vibration Duct Sleeve	12	SF	Basement Corridor & Fan Room - 1941 Bldg.	Amosite	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	170	LF	Basement: Room 10, Fan Room - 1941 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
EE	1'x1' Ceiling Tile	750	SF	Room 206 & Closet - 1898 Bldg.	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F	Aircell Duct Insulation	400	SF	Basement Corridor - 1898 Bldg.	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FF	Transite Table Tops	40	SF	Room 115 - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	MJP E/F/V on Fiberglass Pipe Insulation	142	FITTING	Throughout Basement - 1898 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
GG	MJP E/F/V on Mag Block Pipe Insulation	60	FITTING	Valve Room by Engine Room, Air Plenum Chamber Cold Deck - 1898 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
HH	Hard Coat Plaster	20,000	SF	Throughout - 1898 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
I	MJP E/F/V on Fiberglass Pipe Insulation	120	FITTING	Throughout Basement; 1st & 2nd Fl Toilets: Teacher's, Boy's & Girl's - 1915 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
II	Hard Coat Plaster	30,000	SF	Throughout - 1915 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
J	Aircell Duct Insulation	550	SF	Basement: Hallway, Lunchroom #3 - 1915 Bldg.	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
JJ	Hard Coat Plaster	20,000	SF	Throughout - 1941 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K	MJP E/F/V on Aircell Pipe Insulation	32	FITTING	Basement: Room 10, Fan Room, Main Corridor, Room 504 wardrobe - 1941 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
KK	Canvas Wrap	100	SF	Rooms 006 & 216 - 1898 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
L	Cardboard Pipe Insulation	250	LF	Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M	MJP E/F/V on Cardboard Pipe Insulation	40	FITTING	Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
N	Cardboard Pipe Insulation	160	LF	Basement: Platform, Main Corridor Store Rm (013), Boiler Rm; 2nd Fl Boy's Toilet - 1915 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575      Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
O	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Basement Main Corridor, Boiler Room, 2nd Floor Boy's Toilet - 1915 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
P	Cardboard Pipe Insulation	80	LF	Basement Corridor - 1941 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
Q	MJP E/F/V on Cardboard Pipe Insulation	8	FITTING	Basement Corridor - 1941 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
R	Air Cell Duct Insulation	550	SF	Basement Corridor - 1898 Bldg.	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
S	Mag Block Duct Insulation	500	LF	Basement: Platform; Boiler, Pump, Tank Room & Room 13, Corridor, Teacher's Lounge - 1915 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
T	Mag Block Pipe Insulation	780	LF	Valve, Engine, Pit & Room 004 Closet, Corridor by 504, Air Plenum Chamber, Eng's Storage, Tank Room - 1898 Bldg.	Chrysotile	TSI	Yes	3	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
U	Mag Block Pipe Insulation	880	LF	Basement Corridor - 1915 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Repair
V	Mag Block on Boiler Insulation	750	SF	Basement Boiler Room - 1915 Bldg.	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
W	Vibration Duct	10	SF	Corridor -1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
X	Boiler Gasket	20	LF	Basement Boiler Room - 1915 Bldg.	Chrysotile	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
Y	Tank Insulation (ABATED summer 2013)			Boiler Room	Abated	TSI					

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

*Management Planner's Comments Summarized at the End of the Report*

Review Date	3/4/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
04	
05	
06	
07	
08	
09	
10	
102	
102A	
103	
104	
104A	
106	
107	
107A	
109	
109A	
11	
110	
111	

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
112	
112A	
113	
114	
115	
116	
117	
118	
12	
13	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
24A	
25	
25A	
27	
27A	
29	
29A	

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
30	
30A	
32	
32A	
33	
33A	
40	
40A	
42	
42A	
43	
43A	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
53A	
54	
54 A	
55	
56	

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
57	
58	
59	
60	
60 A	
61	
62	
62A	
63	
64	
A	Repair Damaged ACM, Maintain in Good condition
B	Repair Damaged ACM, maintain in Good condition
C	Repair Damaged ACM, maintain in good condition
D	
DD	
E	
EE	
F	
FF	
G	
GG	
HH	
I	
II	
J	
JJ	
K	

# Chicago Public Schools

**School** Field School

**Unit** 23211

**Building ID** 3350

**Address** 7019 N Ashland Avenue

Chicago, IL, 60626

**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
KK	
L	
M	
N	
O	
P	
Q	
R	
S	
T	Repair Damaged ACM, maintain in Good condition
U	Repair Damaged ACM, maintain in Good condition
V	
W	
X	
Y	

## APPENDIX A

---

### Assessment Sheets, Drawings and Photos

**Chicago Public Schools**

**Specialty Consulting, Inc.**

***2025 AHERA REINSPECTION***

# Chicago Public Schools

Specialty Consulting, Inc.

**2025 AHERA REINSPECTION**

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 04

MATERIAL DESCRIPTION: 12" x 12" Gray VFT (not observed)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **12" x 12" Gray VFT (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

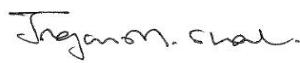

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12"x12" Tan w/Gray VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 102 - 1915 Bldg.		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **12"x12" Tan w/Gray VFT**

MATERIAL LOCATION: **Room 102 - 1915 Bldg.**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	12"x12" Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 10 - 1941 Bldg. (room changed to 510)		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **12"x12" Brown VFT**

MATERIAL LOCATION: **Room 10 - 1941 Bldg. (room changed to 510)**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	12"x12" Tan w/Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 115 & Closet - 1898 Bldg. (room changed to 510)		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **12"x12" Tan w/Streaks VFT**

MATERIAL LOCATION: **Room 115 & Closet - 1898 Bldg. (room changed to 510)**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	12"x12" Tan w/Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 115 & Closet - 1898 Bldg. (room is now 510)		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **12"x12" Tan w/Streaks VFT Mastic**

MATERIAL LOCATION: **Room 115 & Closet - 1898 Bldg. (room is now 510)**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **12" x 12" Brown VFT (not observed)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **12" x 12" Brown VFT (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

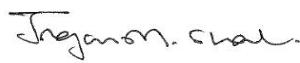

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUILDING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Green Linoleum (not observed)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: 10

MATERIAL DESCRIPTION: Green Linoleum (not observed)

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 03/04/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102		
MATERIAL DESCRIPTION:	12"x12" Gray VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer's office & storage room - 1898 building		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **102**

MATERIAL DESCRIPTION: **12"x12" Gray VFT**

MATERIAL LOCATION: **Engineer's office & storage room - 1898 building**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

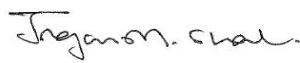

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102A		
MATERIAL DESCRIPTION:	12"x12" Gray VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer's office & storage room -1898 building.		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **102A**

MATERIAL DESCRIPTION: **12"x12" Gray VFT MASTIC**

MATERIAL LOCATION: **Engineer's office & storage room -1898 building.**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 215, Main Office, Principal's Office - 1898 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **103**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Room 215, Main Office, Principal's Office - 1898 Bldg.**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104		
MATERIAL DESCRIPTION:	12"x12" Light gray, white & gray streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Lunchroom - 1941 Addition		
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **104**

MATERIAL DESCRIPTION: **12"x12" Light gray, white & gray streaks VFT**

MATERIAL LOCATION: **Lunchroom - 1941 Addition**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

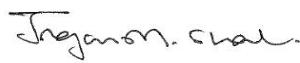

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104A		
MATERIAL DESCRIPTION:	12"x12" Light gray, white & gray streaks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom - 1941 Addition		
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **104A**

MATERIAL DESCRIPTION: **12"x12" Light gray, white & gray streaks VFT MASTIC**

MATERIAL LOCATION: **Lunchroom - 1941 Addition**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

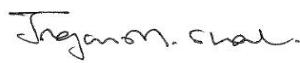

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	106		
MATERIAL DESCRIPTION:	Decorative plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium, Balcony, & Storage - 1915 Bldg.		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **Decorative plaster**

MATERIAL LOCATION: **Auditorium, Balcony, & Storage - 1915 Bldg.**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107		
MATERIAL DESCRIPTION:	12"x12" White w/gray specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Speech Room- 1898 Bldg.		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **12"x12" White w/gray specs VFT**

MATERIAL LOCATION: **2nd Floor Speech Room- 1898 Bldg.**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107A		
MATERIAL DESCRIPTION:	12"x12" White w/gray specs VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Speech Room- 1898 Bldg.		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: **107A**

MATERIAL DESCRIPTION: **12"x12" White w/gray specs VFT MASTIC**

MATERIAL LOCATION: **2nd Floor Speech Room- 1898 Bldg.**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109		
MATERIAL DESCRIPTION:	12"x12" Light gray w/ white and gray streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	RM 3 (Lunchroom) -1915 Bldg.		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **109**

MATERIAL DESCRIPTION: **12"x12" Light gray w/ white and gray streaks VFT**

MATERIAL LOCATION: **RM 3 (Lunchroom) -1915 Bldg.**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

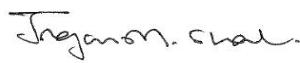

Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109A		
MATERIAL DESCRIPTION:	12"x12" Light gray w/ white & gray streaks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	RM 3 (Lunchroom) -1915 Bldg.		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **109A**

MATERIAL DESCRIPTION: **12"x12" Light gray w/ white & gray streaks VFT MASTIC**

MATERIAL LOCATION: **RM 3 (Lunchroom) -1915 Bldg.**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Tan w/White Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Teacher's Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **Tan w/White Linoleum**

MATERIAL LOCATION: **1st Floor Teacher's Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

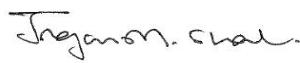

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	110		
MATERIAL DESCRIPTION:	Pink insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Attic of 1941, 1915 additions		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **110**

MATERIAL DESCRIPTION: **Pink insulation**

MATERIAL LOCATION: **Attic of 1941, 1915 additions**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111		
MATERIAL DESCRIPTION:	2'x4' ceiling tiles w/grooves		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 111, 112 -1941 Bldg		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **111**

MATERIAL DESCRIPTION: **2'x4' ceiling tiles w/grooves**

MATERIAL LOCATION: **Rooms 111, 112 -1941 Bldg**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 112

MATERIAL DESCRIPTION: Brown linoleum Flooring

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Auditorium Stage- 1915 Bldg

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **112**

MATERIAL DESCRIPTION: **Brown linoleum Flooring**

MATERIAL LOCATION: **Auditorium Stage- 1915 Bldg**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 112A

MATERIAL DESCRIPTION: Brown linoleum Flooring Mastic

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Auditorium Stage- 1915 Bldg

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **112A**

MATERIAL DESCRIPTION: **Brown linoleum Flooring Mastic**

MATERIAL LOCATION: **Auditorium Stage- 1915 Bldg**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	113		
MATERIAL DESCRIPTION:	Flooring Sheeting 2' x 2' new carpet (Not observed)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium Balcony- 1915 Bldg		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **113**

MATERIAL DESCRIPTION: **Flooring Sheeting 2' x 2' new carpet (Not observed)**

MATERIAL LOCATION: **Auditorium Balcony- 1915 Bldg**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	114		
MATERIAL DESCRIPTION:	Cloth electric wire insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor boys bathroom -1915		
MATERIAL QUANTITY:	1	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **114**

MATERIAL DESCRIPTION: **Cloth electric wire insulation**

MATERIAL LOCATION: **1st Floor boys bathroom -1915**

MATERIAL QUANTITY: **1** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	115		
MATERIAL DESCRIPTION:	Spray on Fire proofing on beams -1898		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Attic 1898		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: 115

MATERIAL DESCRIPTION: Spray on Fire proofing on beams -1898

MATERIAL LOCATION: Attic 1898

MATERIAL QUANTITY: 1000 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 03/04/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116		
MATERIAL DESCRIPTION:	Spray on Fire proofing on beams overspray-1915		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Attic -1915		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **116**

MATERIAL DESCRIPTION: **Spray on Fire proofing on beams overspray-1915**

MATERIAL LOCATION: **Attic -1915**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	117		
MATERIAL DESCRIPTION:	Sink Undercoating		
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 104 -1898		
MATERIAL QUANTITY:	5	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **117**

MATERIAL DESCRIPTION: **Sink Undercoating**

MATERIAL LOCATION: **Room 104 -1898**

MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	118		
MATERIAL DESCRIPTION:	Sink Undercoating - 1941 Bldg.		
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 510 - sinks		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **118**

MATERIAL DESCRIPTION: **Sink Undercoating - 1941 Bldg.**

MATERIAL LOCATION: **Room 510 - sinks**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Tan Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 108 - 1941 Bldg.		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Tan Linoleum**

MATERIAL LOCATION: **Room 108 - 1941 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 13

MATERIAL DESCRIPTION: 12" x 12" Brown VFT Mastic (not observed)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **12" x 12" Brown VFT Mastic (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

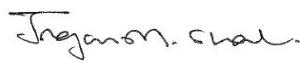

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	Asphalt Floor		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	2nd Floor Corridor, Exit 5 Staircase - 1898 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Asphalt Floor**

MATERIAL LOCATION: **2nd Floor Corridor, Exit 5 Staircase - 1898 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	Asphalt Floor		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1915 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Asphalt Floor**

MATERIAL LOCATION: **Throughout - 1915 Bldg.**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	Asphalt Floor		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Throughout - 1941 Bldg.		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Asphalt Floor**

MATERIAL LOCATION: **Throughout - 1941 Bldg.**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12" x 12" Gray VFT Mastic (not observed)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12" x 12" Gray VFT Mastic (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

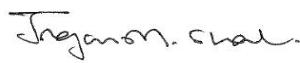

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Green Linoleum Mastic (not observed)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Green Linoleum Mastic (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

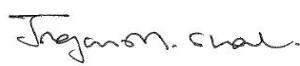

Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12"x12" Tan w/Gray VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 102 - 1915 Bldg.		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **12"x12" Tan w/Gray VFT Mastic**

MATERIAL LOCATION: **Room 102 - 1915 Bldg.**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	Tan w/White Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Teacher's Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Tan w/White Linoleum Mastic**

MATERIAL LOCATION: **1st Floor Teacher's Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12"x12" Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 10 - 1941 Bldg. (room is now 510)		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**

MATERIAL LOCATION: **Room 10 - 1941 Bldg. (room is now 510)**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	Tan Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 108 - 1941 Bldg.		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Tan Linoleum Mastic**

MATERIAL LOCATION: **Room 108 - 1941 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12"x12" White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 001 (501) - 1915 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12"x12" White VFT**

MATERIAL LOCATION: **Room 001 (501) - 1915 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24A		
MATERIAL DESCRIPTION:	12"x12" White VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 001 (501) - 1915 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **24A**

MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**

MATERIAL LOCATION: **Room 001 (501) - 1915 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12"x12" Tan Spotted VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Assembly Hall - 1915 Bldg.		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12"x12" Tan Spotted VFT**

MATERIAL LOCATION: **Assembly Hall - 1915 Bldg.**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

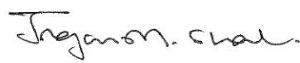

Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25A		
MATERIAL DESCRIPTION:	12"x12" Tan Spotted VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Assembly Hall - 1915 Bldg.		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **25A**

MATERIAL DESCRIPTION: **12"x12" Tan Spotted VFT Mastic**

MATERIAL LOCATION: **Assembly Hall - 1915 Bldg.**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12"x12" Cream VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 10 - 1941 Bldg. (room is now 510)		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12"x12" Cream VFT**

MATERIAL LOCATION: **Room 10 - 1941 Bldg. (room is now 510)**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27A		
MATERIAL DESCRIPTION:	12"x12" Cream VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 10 - 1941 Bldg. (room is now 510)		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **27A**

MATERIAL DESCRIPTION: **12"x12" Cream VFT Mastic**

MATERIAL LOCATION: **Room 10 - 1941 Bldg. (room is now 510)**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	Blue Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement: Men Teacher's Toilet ( removed/ Not observed), Kitchen - 1915 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Blue Linoleum**

MATERIAL LOCATION: **Basement: Men Teacher's Toilet ( removed/ Not observed), Kitchen - 1915 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

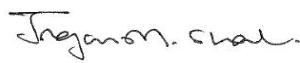

Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29A		
MATERIAL DESCRIPTION:	Blue Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement: Men Teacher's Toilet ( removed/ Not observed), Kitchen - 1915 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **29A**

MATERIAL DESCRIPTION: **Blue Linoleum Mastic**

MATERIAL LOCATION: **Basement: Men Teacher's Toilet ( removed/ Not observed), Kitchen - 1915 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Tan Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Teacher's Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Tan Linoleum**

MATERIAL LOCATION: **2nd Floor Teacher's Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30A		
MATERIAL DESCRIPTION:	Tan Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Teacher's Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **30A**

MATERIAL DESCRIPTION: **Tan Linoleum Mastic**

MATERIAL LOCATION: **2nd Floor Teacher's Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 32

MATERIAL DESCRIPTION: 12"x12" Light Green VFT (not observed)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12"x12" Light Green VFT (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

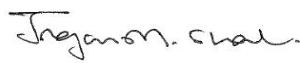

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 32A

MATERIAL DESCRIPTION: 12"x12" Light Green VFT (not observed)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **32A**

MATERIAL DESCRIPTION: **12"x12" Light Green VFT (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

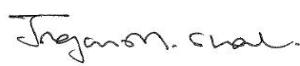

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	12"x12" Tan w/Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 114, Men's bathroom - 1915 Bldg.		
MATERIAL QUANTITY:	850	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:	damaged located in Room 114		

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **12"x12" Tan w/Brown VFT**

MATERIAL LOCATION: **Room 114, Men's bathroom - 1915 Bldg.**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33A		
MATERIAL DESCRIPTION:	12"x12" Tan w/Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 114, Men's bathroom - 1915 Bldg.		
MATERIAL QUANTITY:	850	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	damaged located in Room 114		

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **33A**

MATERIAL DESCRIPTION: **12"x12" Tan w/Brown VFT Mastic**

MATERIAL LOCATION: **Room 114, Men's bathroom - 1915 Bldg.**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	Light Brown Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/12/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Light Brown Linoleum**

MATERIAL LOCATION: **Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40A		
MATERIAL DESCRIPTION:	Light Brown Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/12/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: **40A**

MATERIAL DESCRIPTION: **Light Brown Linoleum Mastic**

MATERIAL LOCATION: **Rooms 205, 116 Toilet, Main Office & Toilet, Asst. Prin office, 1st flr toilet inside Rm east of elevator corridor. - 1898 Bldg.**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12"x12" Light Brown w/Gray Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 119, Room 119 Closet & Toilet - 1898 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **12"x12" Light Brown w/Gray Streaks VFT**

MATERIAL LOCATION: **Room 119, Room 119 Closet & Toilet - 1898 Bldg.**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42A		
MATERIAL DESCRIPTION:	12"x12" Light Brown w/Gray Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 119, Room 119 Closet & Toilet - 1898 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **42A**

MATERIAL DESCRIPTION: **12"x12" Light Brown w/Gray Streaks VFT Mastic**

MATERIAL LOCATION: **Room 119, Room 119 Closet & Toilet - 1898 Bldg.**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12"x12" Light Pink w/White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **12"x12" Light Pink w/White Streaks VFT**

MATERIAL LOCATION: **Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43A		
MATERIAL DESCRIPTION:	12"x12" Light Pink w/White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **43A**

MATERIAL DESCRIPTION: **12"x12" Light Pink w/White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 116 (counselor office), Rm east of elevator corridor 1st Fl - 1898 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	2'x4' Dot/Wave Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 113, 114, Lunchroom #3 (1915 Addition)		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **2'x4' Dot/Wave Ceiling Tile**

MATERIAL LOCATION: **Rooms 113, 114, Lunchroom #3 (1915 Addition)**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	2'x2' Dot/Wave Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen by Lunch Room #3 in 1915 Addition		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **2'x2' Dot/Wave Ceiling Tile**

MATERIAL LOCATION: **Kitchen by Lunch Room #3 in 1915 Addition**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library/Computer Room (215), MDF room - 1898 Building		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Library/Computer Room (215), MDF room - 1898 Building**

MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	2'x4' Dot/Wave Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112, 111 - 1941		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **2'x4' Dot/Wave Ceiling Tile**

MATERIAL LOCATION: **Room 112, 111 - 1941**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	2'x4' Dot/Wave Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 206, Principal's office - 1898		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **2'x4' Dot/Wave Ceiling Tile**

MATERIAL LOCATION: **Room 206, Principal's office - 1898**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12"x12" Grey Streaked VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement Lunchroom #3, Kitchen - 1915 Bldg		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **12"x12" Grey Streaked VFT**

MATERIAL LOCATION: **Basement Lunchroom #3, Kitchen  
- 1915 Bldg**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	12"x12" Grey Streaked VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement Lunchroom #3, Kitchen - 1915 Bldg		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **12"x12" Grey Streaked VFT**

MATERIAL LOCATION: **Basement Lunchroom #3, Kitchen  
- 1915 Bldg**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 51

MATERIAL DESCRIPTION: 12"x12" White w/ Grey Streaks VFT (not observed)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12"x12" White w/ Grey Streaks VFT (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

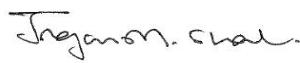

Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUILDING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52	
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT Mastic (not observed)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12"x12" White w/ Grey Streaks VFT Mastic (not observed)**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

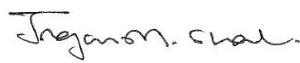

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 53

MATERIAL DESCRIPTION: 12"x12" Green w/ streaks VFT (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engineer's Office, Toilet & Storage - 1898 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12"x12" Green w/ streaks VFT (ABATED)**

MATERIAL LOCATION: **Engineer's Office, Toilet & Storage - 1898 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

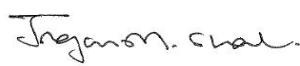

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 53A

MATERIAL DESCRIPTION: 12"x12" Green w/ streaks (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engineer's Office, Toilet & Storage - 1898 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **53A**

MATERIAL DESCRIPTION: **12"x12" Green w/ streaks (ABATED)**

MATERIAL LOCATION: **Engineer's Office, Toilet & Storage - 1898 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

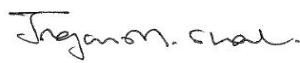

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	12"x12" Black with streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.		
MATERIAL QUANTITY:	550	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **12"x12" Black with streaks VFT**

MATERIAL LOCATION: **Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.**

MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54 A		
MATERIAL DESCRIPTION:	12"x12" Black with streaks MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.		
MATERIAL QUANTITY:	550	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **54 A**

MATERIAL DESCRIPTION: **12"x12" Black with streaks MASTIC**

MATERIAL LOCATION: **Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.**

MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	12"x12" Black with streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement, 1st & 2nd floor, elevator vestibules - 2008 Bldg.		
MATERIAL QUANTITY:	360	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **12"x12" Black with streaks VFT**

MATERIAL LOCATION: **Basement, 1st & 2nd floor, elevator vestibules - 2008 Bldg.**

MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	Drywall, tape & compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **Drywall, tape & compound**

MATERIAL LOCATION: **Basement, 1st & 2nd floor corridor leading to elevator vestibule - 1989 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	Drywall, tape & compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement, 1st & 2nd floor elevator vestibule -1989 Bldg		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **Drywall, tape & compound**

MATERIAL LOCATION: **Basement, 1st & 2nd floor elevator vestibule -1989 Bldg**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	Decorative Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridor in front of asst. principals office -1898 Bldg		
MATERIAL QUANTITY:	60	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **Decorative Plaster**

MATERIAL LOCATION: **Corridor in front of asst. principals office -1898 Bldg**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

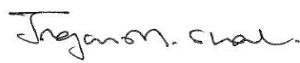

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairwells & vestibules - 1941 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **Stairwells & vestibules - 1941 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	Fire Doors		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridors between additions - 1915 Bldg.		
MATERIAL QUANTITY:	12	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **Fire Doors**

MATERIAL LOCATION: **Corridors between additions - 1915 Bldg.**

MATERIAL QUANTITY: **12** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60 A		
MATERIAL DESCRIPTION:	Fire Doors -1898		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 218 Wardrobe - 1898 Bldg.		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **60 A**

MATERIAL DESCRIPTION: **Fire Doors -1898**

MATERIAL LOCATION: **Room 218 Wardrobe - 1898 Bldg.**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 61

MATERIAL DESCRIPTION: Drywall, Tape, and Compound (REMOVED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout Mobile Unit (REMOVED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **Drywall, Tape, and Compound (REMOVED)**

MATERIAL LOCATION: **Throughout Mobile Unit (REMOVED)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

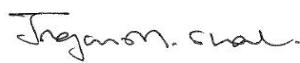

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUILDING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 62  
MATERIAL DESCRIPTION: 12"X12" White VFT (REMOVED)  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout Mobile Unit (REMOVED)  
(no longer on-site)

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

**Specialty Consulting, Inc.**  
**2025 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:		<b>Jigar Shah</b>	
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:			<b>3/4/2025</b>
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:			<b>100-11089</b>

HOMOGENEOUS AREA: 62

MATERIAL DESCRIPTION: 12"X12" White VFT (REMOVED)

MATERIAL LOCATION: **Throughout Mobile Unit (REMOVED)  
(no longer on-site)**

#### MATERIAL QUANTITY:

## MATERIAL UNITS:

DAMAGE QUANTITY: **0**

#### DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Comments:

Management Planner's Signature:

Tregaron. chal.

Date: 03/04/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 62A

MATERIAL DESCRIPTION: 12"X12" White VFT Mastic (REMOVED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout Mobile Unit (REMOVED)  
(no longer on-site)

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

**Specialty Consulting, Inc.**  
**2025 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:		<b>Jigar Shah</b>	
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:			<b>3/4/2025</b>
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:			<b>100-11089</b>

HOMOGENEOUS AREA: 62A

MATERIAL DESCRIPTION: 12"X12" White VFT Mastic (REMOVED)

MATERIAL LOCATION: **Throughout Mobile Unit (REMOVED)  
(no longer on-site)**

**MATERIAL QUANTITY:**

## MATERIAL UNITS:

**DAMAGE QUANTITY:**

### DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Comments:

Management Planner's Signature:

Tregaron. Chal.

Date: 03/04/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **2'X4' Ceiling Tiles (REMOVED)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Mobile Unit (REMOVED)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/12/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **2'X4' Ceiling Tiles (REMOVED)**

MATERIAL LOCATION: **Throughout Mobile Unit (REMOVED)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

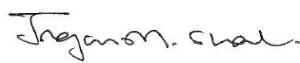

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	A		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Valve Rm, Engine Room, Engineer's Office & Toilet, Room 004 Closet, Basement Corridor - 1898 Bldg.		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUILDING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Valve Rm, Engine Room, Engineer's Office & Toilet, Room 004 Closet, Basement Corridor - 1898 Bldg.**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Repair Damaged ACM, Maintain in Good condition

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	B		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Valve Room, Engine Room, Engineer's Office & Toilet, Rm 004 Closet, Basement Corridor - 1898 Bldg.		
MATERIAL QUANTITY:	95	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:	O & M Patch and repair needed in Engine Room and Engineer's Restroom		

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Field School	REVIEW DATE:	3/4/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**

MATERIAL LOCATION: **Valve Room, Engine Room, Engineer's Office & Toilet, Rm 004 Closet, Basement Corridor - 1898 Bldg.**

MATERIAL QUANTITY: **95** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **3** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Repair Damaged ACM, maintain in Good condition

Management Planner's Signature:



Date: 03/04/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	C		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor; Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet, auditorium crawl space - 1915		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:	O & M Patch and repair needed in Boiler Room		

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement Corridor; Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet, auditorium crawl space - 1915**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **3** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Repair Damaged ACM, maintain in good condition

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement: Hall, Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet - 1915		
MATERIAL QUANTITY:	18	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement: Hall, Boiler, Pump Room, Assembly Hall, Teacher's Lounge; 2nd Fl Teacher's Toilet - 1915**

MATERIAL QUANTITY: **18** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	DD		
MATERIAL DESCRIPTION:	Vibration Duct Sleeve		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Amosite	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement Corridor & Fan Room - 1941 Bldg.		
MATERIAL QUANTITY:	12	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

  
Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **DD**

MATERIAL DESCRIPTION: **Vibration Duct Sleeve**

MATERIAL LOCATION: **Basement Corridor & Fan Room - 1941 Bldg.**

MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement: Room 10, Fan Room - 1941 Bldg.		
MATERIAL QUANTITY:	170	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement: Room 10, Fan Room - 1941 Bldg.**

MATERIAL QUANTITY: **170** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	EE		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 206 & Closet - 1898 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **EE**

MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**

MATERIAL LOCATION: **Room 206 & Closet - 1898 Bldg.**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor - 1898 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **Aircell Duct Insulation**

MATERIAL LOCATION: **Basement Corridor - 1898 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FF		
MATERIAL DESCRIPTION:	Transite Table Tops		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 115 - 1898 Bldg.		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **FF**

MATERIAL DESCRIPTION: **Transite Table Tops**

MATERIAL LOCATION: **Room 115 - 1898 Bldg.**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Basement - 1898 Bldg.		
MATERIAL QUANTITY:	142	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout Basement - 1898 Bldg.**

MATERIAL QUANTITY: **142** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	GG		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Valve Room by Engine Room, Air Plenum Chamber Cold Deck - 1898 Bldg.		
MATERIAL QUANTITY:	60	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **GG**

MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**

MATERIAL LOCATION: **Valve Room by Engine Room, Air Plenum Chamber Cold Deck - 1898 Bldg.**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HH		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1898 Bldg.		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **HH**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout - 1898 Bldg.**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	I		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Basement; 1st & 2nd Fl Toilets: Teacher's, Boy's & Girl's - 1915 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout Basement; 1st & 2nd Fl Toilets: Teacher's, Boy's & Girl's - 1915 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	II		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Throughout - 1915 Bldg.		
MATERIAL QUANTITY:	30000	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **II**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout - 1915 Bldg.**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	J		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement: Hallway, Lunchroom #3 - 1915 Bldg.		
MATERIAL QUANTITY:	550	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Aircell Duct Insulation**

MATERIAL LOCATION: **Basement: Hallway, Lunchroom #3 - 1915 Bldg.**

MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:

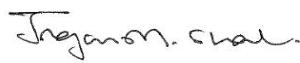

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	JJ		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1941 Bldg.		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **JJ**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout - 1941 Bldg.**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	K		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement: Room 10, Fan Room, Main Corridor, Room 504 wardrobe - 1941 Bldg.		
MATERIAL QUANTITY:	32	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement: Room 10, Fan Room, Main Corridor, Room 504 wardrobe - 1941 Bldg.**

MATERIAL QUANTITY: **32** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	KK		
MATERIAL DESCRIPTION:	Canvas Wrap		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 006 & 216 - 1898 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **KK**

MATERIAL DESCRIPTION: **Canvas Wrap**

MATERIAL LOCATION: **Rooms 006 & 216 - 1898 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	L		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Room 004 Closet; Pump, Engine & Pit Rooms, Basement Hallway - 1898 Bldg.**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement: Platform, Main Corridor Store Rm (013), Boiler Rm; 2nd Fl Boy's Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	160	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **Basement: Platform, Main Corridor Store Rm (013), Boiler Rm; 2nd Fl Boy's Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **160** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Main Corridor, Boiler Room, 2nd Floor Boy's Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Basement Main Corridor, Boiler Room, 2nd Floor Boy's Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor - 1941 Bldg.		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **Basement Corridor - 1941 Bldg.**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor - 1941 Bldg.		
MATERIAL QUANTITY:	8	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Basement Corridor - 1941 Bldg.**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	R		
MATERIAL DESCRIPTION:	Air Cell Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor - 1898 Bldg.		
MATERIAL QUANTITY:	550	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **R**

MATERIAL DESCRIPTION: **Air Cell Duct Insulation**

MATERIAL LOCATION: **Basement Corridor - 1898 Bldg.**

MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	S		
MATERIAL DESCRIPTION:	Mag Block Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement: Platform; Boiler, Pump, Tank Room & Room 13, Corridor, Teacher's Lounge - 1915 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **S**

MATERIAL DESCRIPTION: **Mag Block Duct Insulation**

MATERIAL LOCATION: **Basement: Platform; Boiler, Pump, Tank Room & Room 13, Corridor, Teacher's Lounge - 1915 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Valve, Engine, Pit & Room 004 Closet, Corridor by 504, Air Plenum Chamber, Eng's Storage, Tank Room - 1898 Bldg.		
MATERIAL QUANTITY:	780	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:	O & M Patch and repair needed in Hall by 504, and Tank Room		

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **T**

MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**

MATERIAL LOCATION: **Valve, Engine, Pit & Room 004 Closet, Corridor by 504, Air Plenum Chamber, Eng's Storage, Tank Room - 1898 Bldg.**

MATERIAL QUANTITY: **780** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **3** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Repair Damaged ACM, maintain in Good condition

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	U		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor - 1915 Bldg.		
MATERIAL QUANTITY:	880	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **U**

MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**

MATERIAL LOCATION: **Basement Corridor - 1915 Bldg.**

MATERIAL QUANTITY: **880** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Repair Damaged ACM, maintain in Good condition

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	V		
MATERIAL DESCRIPTION:	Mag Block on Boiler Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Boiler Room - 1915 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUILDING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **V**

MATERIAL DESCRIPTION: **Mag Block on Boiler Insulation**

MATERIAL LOCATION: **Basement Boiler Room - 1915 Bldg.**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	W		
MATERIAL DESCRIPTION:	Vibration Duct		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Corridor -1915 Bldg.		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **W**

MATERIAL DESCRIPTION: **Vibration Duct**

MATERIAL LOCATION: **Corridor -1915 Bldg.**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	X		
MATERIAL DESCRIPTION:	Boiler Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Boiler Room - 1915 Bldg.		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **X**

MATERIAL DESCRIPTION: **Boiler Gasket**

MATERIAL LOCATION: **Basement Boiler Room - 1915 Bldg.**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: Y

MATERIAL DESCRIPTION: Tank Insulation (ABATED summer 2013)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Boiler Room

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>23211</b>	BUIDLING ID:	<b>3350</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Field School</b>	REVIEW DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>7019 N Ashland Avenue</b>	IDPH LICENSE NO:	<b>100-11089</b>		

---

HOMOGENEOUS AREA: **Y**

MATERIAL DESCRIPTION: **Tank Insulation (ABATED summer 2013)**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

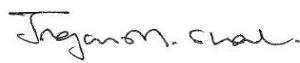

Date: **03/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23211	BUIDLING ID:	3350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Field School	INSPECTION DATE:	2/12/2025		
ADDRESS:	7019 N Ashland Avenue	IDPH LICENSE NO:	100-11089		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	Table Tops		
MATERIAL LOCATION:	Boiler Room		
MATERIAL QUANTITY:	108	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:	Material is Stored in the Boiler Room		

Inspector's Signature:



Date: 02/12/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23211** BUIDLING ID: **3350**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Field School** REVIEW DATE: **3/4/2025**

ADDRESS: **7019 N Ashland Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Table Tops**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **108** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/04/2025**

## APPENDIX B

---


### Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois

**PANFILO CARRAZCO**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

2/28/2022

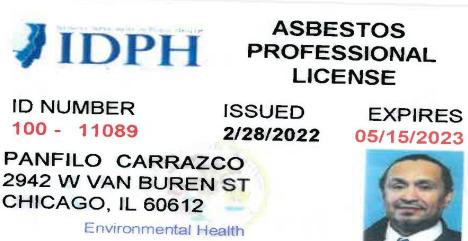

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

Front of License		Back of License	
	<b>ASBESTOS PROFESSIONAL LICENSE</b>	<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
ID NUMBER 100 - 11089	ISSUED 2/28/2022	EXPIRES 05/15/2023	INSPECTOR 1/15/2023
<b>PANFILO CARRAZCO</b> 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL <b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	1/22/2023

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**

*Nationally Accredited by PHAB*

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/28/2023 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • [www.public-health-safety.com](http://www.public-health-safety.com)

01/28/2023

Course Dates:

01/28/2024

Expires:

2301BIR14

Certificate Number:

A handwritten signature in black ink that appears to read "Nicholas J. Penef".

Phone: 312-491-0081

Director of Training

Nicholas J. Penef


Doctor of Public Health

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois

**PANFILO CARRAZCO**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

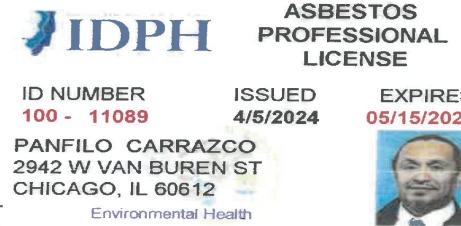

4/5/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11089	ISSUED 4/5/2024	EXPIRES 05/15/2025	INSPECTOR	1/27/2025
PANFILO CARRAZCO 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/13/2025
<p><b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH. IMPROVING LIVES**  
*Nationally Accredited by PHAB*

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • [www.public-health-safety.com](http://www.public-health-safety.com)

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR04

Certificate Number:

Director of Training

Nicholas J. Peneff  
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

A handwritten signature in black ink that reads "Nicholas J. Peneff" followed by "D.P.H." in smaller letters.

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • [www.public-health-safety.com](http://www.public-health-safety.com)

01/15/2022

Course Dates:

01/15/2023

Expires:

2201BIR02

Certificate Number:

A handwritten signature in black ink that reads "Nicholas J. Penef".

Phone: 312-491-0081

Director of Training

Nicholas J. Penef

Doctor of Public Health


FORM # A-010B



525-535 West Jefferson Street • Springfield, IL

**PANFILO CARRAZCO**  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

4/30/

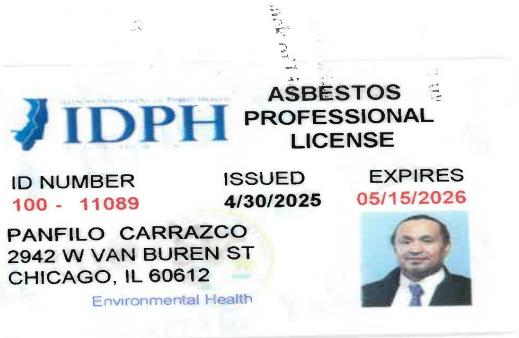


ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

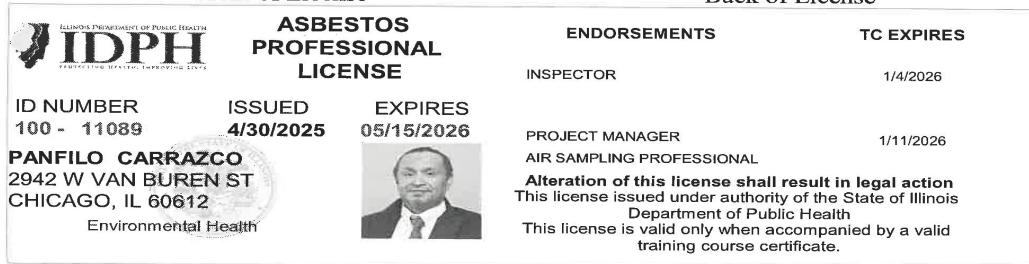

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER <b>100 - 07342</b>	ISSUED <b>6/9/2025</b>	EXPIRES <b>05/15/2026</b>	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH, IMPROVING LIVES  
*Nationally Accredited by PHAB*

7233 S. Adams Street | Willowbrook, IL 60527  
(630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2023



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023


Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

*Kathy DeSalvo*

Kathy DeSalvo, Director

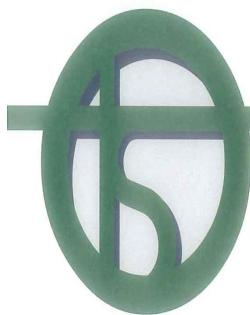

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

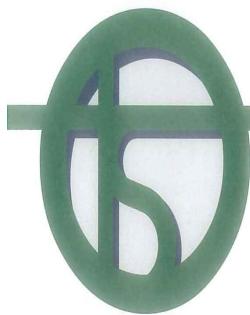

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS  
PROFESSIONAL  
LICENSE

ID NUMBER  
100 - 07342

ISSUED  
4/1/2022

EXPIRES  
05/15/2023

JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612


4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

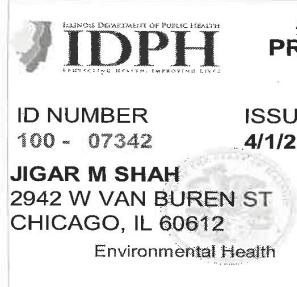

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	
<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS  
PROFESSIONAL  
LICENSE

ID NUMBER  
100 - 07342

ISSUED  
4/8/2024

EXPIRES  
05/15/2025

JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

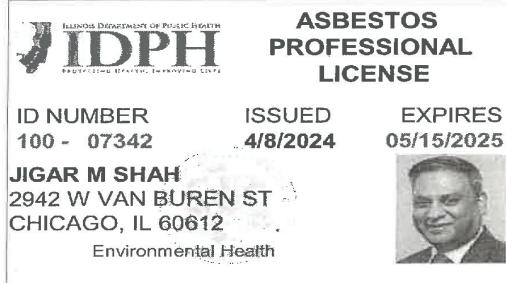

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<b>Alteration of this license shall result in legal action</b>	
This license issued under authority of the State of Illinois	
Department of Public Health	
This license is valid only when accompanied by a valid	
training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH. IMPROVING LIVES

*Nationally Accredited by PHAB*



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2024

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2025

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

---

Kristina Miczek, Training Manager

## APPENDIX C

---

### **Laboratory Accreditations**

## APPENDIX D

---

### Laboratory Results

## APPENDIX E

---

### Chain of Custody Forms

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>	Loc	Localized
	Dist	Distributed