

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2260
SCHOOL NAME: Henry School
ADDRESS OF SCHOOL: 4250 N St Louis Avenue
CITY: Chicago, IL, 60618

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 10/15/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 1/17/2025 ENROLLMENT 411
IDPH INSPECTOR LICENSE NUMBER: 100-11089
IDPH LICENSED INSPECTOR NAME (Please Print): Panfilo Carrazco
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 2/7/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Henry School

4250 N St Louis Avenue
Chicago, IL, 60618

Unit: 23731
Building ID: 3940

IDPH ID Number: 14-016-2990-2260

REPORT DATE:
Friday, February 07, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street
Chicago, IL, 60612
Phone (312) 319-7575
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

02/07/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23731 Region: 01 IDPH ID: 14-016-2990-2260

School: Henry School Building ID: 3940

Address: 4250 N St Louis Avenue

Chicago, IL, 60618

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 1/17/2025

Review Date: 02/07/2025

Inspector: Panfilo Carrazco

Inspector IDPH License: 100-11089

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: February 07, 2025

RE: Henry School, Unit 23731
4250 N St Louis Avenue
Chicago, IL, 60618

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Henry School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Henry School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Henry School Unit: 23731 Region: 01
Address: 4250 N St Louis Avenue Chicago, IL, 60618
IDPH ID: 14-016-2990-2260 Building ID: 3940
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 411

3. LEA Designated Person

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Panfilo Carrazco

Signature:
Date: 1/17/2025

Inspector IDPH license # 100-11089
Reinspection Date: 1/17/2025

6. Management Planner

Management Planner Name: Jigar Shah

Joe
Signature:
Date: 02/07/2025

Management Planner IDPH license # 100-07342

7. Review Date: 02/07/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: Richard J. Schleyer

Signature:

Date: 2/7/2025

Name: Richard J. Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Henry School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3940:

22	12"x12" Tan w/ Grey Speckles VFT
31	9"x9" Brown w/ Orange Specks VFT
46	12"X 12" Blue Floor Tile
53	12"X12" White w/Gray Specks VFT
53A	12"X12" White w/Gray Specks VFT Mastic
60	12" x 12" Beige with tan streaks VFT
60A	12" x 12" Beige with tan streaks VFT Mastic
61	12" x 12" Off-white VFT
I	MJP on Pre-Formed Pipe Insulation

B. The following new homogenous areas have been identified for Building 3940:

65	12"x12" Gray with Multicolor floor tile
65M	12"x12" Gray with Multicolor floor tile mastic
66	Carpet Matic
67	Terrazzo
68	Undersink Coating

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

08	Drywall System
22	12"x12" Tan w/ Grey Speckles VFT
23	12"x12" Tan w/ Grey Speckles VFT Mastic
26	12"x12" Off White w/ Grey Streaks VFT
35	12"x12" Gray VFT
36	12"x12" Gray VFT Mastic
46	12"X 12" Blue Floor Tile
47	12"X 12" Blue Floor Tile Mastic
48	Carpet Mastic
49	Carpet Mastic
50	Terrazzo
51	Terrazzo
52	12"X12" Gray Streaked VFT
52A	12"X12" Gray Streaked VFT Mastic
53	12"X12" White w/Gray Specks VFT
53A	12"X12" White w/Gray Specks VFT Mastic
54	Fire Door
57	12"X12" Gray Streaked VFT
57A	12"X12" Gray Streaked VFT Mastic
58	12" X 12" Black with white specks VFT
59	12" X 12" Black with white specks VFT Mastic
60	12" x 12" Beige with tan streaks VFT
60A	12" x 12" Beige with tan streaks VFT Mastic
61	12" x 12" Off-white VFT
61A	12" x 12" Off-white VFT Mastic
62	12" x 12" White w/ Gray Specks VFT
62A	12" x 12" White w/ Gray Specks VFT Mastic
63	Red Fire Stop
64	12 x 12 Beige w/ streaks VFT
65	12"x12" Gray with Multicolor floor tile
65M	12"x12" Gray with Multicolor floor tile mastic
66	Carpet Matic
67	Terrazzo
68	Undersink Coating
L	MJP on Cardboard Pipe Insulation

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Panfilo Carrazco, IDPH License # 100-11089. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Henry School Building 3940 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Annex										
46	12"X 12" Blue Floor Tile	1,000	SF	Room B1 - 1907 Bldg.	ASSUMED	MISC	N	NONE	12		Yes	ACBM with the potential for damage	3	MODERATE
47	12"X 12" Blue Floor Tile Mastic	1,000	SF	Room B1 - 1907 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	Carpet Mastic	2,000	SF	Room 208, Auditorium (1907 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	Carpet Mastic	350	SF	304A (1904 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	Terrazzo	600	SF	1st Floor Stair Landings (1904 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	Terrazzo	150	SF	Auditorium Vestibule (1907 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	12"X12" Gray Streaked VFT	700	SF	Room 202 and 203 Teachers Washroom (1907 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
52A	12"X12" Gray Streaked VFT Mastic	700	SF	Room 202 and 203 Teachers Washroom (1907 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12"X12" White w/Gray Specks VFT	700	SF	Room 107 (1907 Bldg)	ASSUMED	MISC	N	LOC	16		Yes	ACBM with the potential for damage	3	MODERATE
53A	12"X12" White w/Gray Specks VFT Mastic	700	SF	Room 107 - 1907 Bldg.	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
54	Fire Door	3	EA	Sprinkler Rm, Engine Rm, Pump Rm (1904 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	12"X12" Gray Streaked VFT	1,000	SF	Rooms 203, 204A Women (1904 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
57A	12"X12" Gray Streaked VFT Mastic	1,000	SF	Rooms 203, 204A Women (1904 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	12" X 12" Black with white specks VFT	900	SF	Main Office (1904 Bldg)	ASSUMED	MISC	N	LOC	25		No	ACBM with the potential for damage		MODERATE
59	12" X 12" Black with white specks VFT Mastic	900	SF	Main Office (1904 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	12" x 12" Beige with tan streaks VFT	3,000	SF	Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm 304A	ASSUMED	MISC	N	LOC	8		Yes	ACBM with the potential for damage	3	MODERATE
60A	12" x 12" Beige with tan streaks VFT Mastic	3,000	SF	Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm	ASSUMED	MISC	N		0		Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				304A										
61	12" x 12" Off-white VFT	200	SF	Room 304	ASSUMED	MISC	N	LOC	5		Yes	ACBM with the potential for damage	3	MODERATE
61A	12" x 12" Off-white VFT Mastic	200	SF	Room 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	12" x 12" White w/ Gray Specks VFT	700	SF	Room 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62A	12" x 12" White w/ Gray Specks VFT Mastic	700	SF	Room 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Red Fire Stop	6	LF	Throughout Various Locations	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	12 x 12 Beige w/ streaks VFT	40	SF	1st floor vault	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	12"x12" Gray with Multicolor floor tile	70	SF	IDF Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65M	12"x12" Gray with Multicolor floor tile mastic	70	SF	IDF Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
66	Carpet Matic		SF	Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	Terrazzo	60	SF	Room 101 Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	Undersink Coating	9	SF	B2	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B	MJP on Fiberglass Pipe Insulation			Engineers Toliet, Supply Room, Hall D - 1907	NO_ACBM									
C	Cardboard Pipe Insulation	300	LF	Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toliet - 1904 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
D	MJP on Cardboard Pipe Insulation	100	FITTING	Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toliet - 1904 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Aircell Pipe Insulation	300	LF	Basement Girls Toliet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Vest. - 1904 Bldg.										
F	MJP on Aircell Pipe Insulation	77	FITTING	Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Bass Boy Tol Vest. - 1904 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
G	Aircell Duct Covering	300	SF	Basement Hall B & C - 1904 Bldg.	CHR	TSI	Y	NONE			No	ACBM with the potential for damage		LOW
H	Pre-Formed Pipe Insulation (mag block)	180	LF	Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C, both Cold decks - 1904 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
I	MJP on Pre-Formed Pipe Insulation	50	FITTING	Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C - 1904 Bldg.	CHR	TSI	Y	LOC	5		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	3	HIGH
J	MJP on Fiberglass Pipe Insulation			Basement Boys & Girls Toliet, Engine, Tank, Boiler Rooms, Lunchroom 1, Helps Store, Halls C & D - 1904 Bldg.	NO_ACBM									
K	Cardboard Pipe Insulation	286	LF	Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.	CHR	TSI	Y	LOC	1		No	ACBM with the potential for damage		MODERATE
L	MJP on Cardboard Pipe Insulation	100	FITTING	Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
M	Aircell Pipe Insulation	30	LF	Hall D - 1907 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
O	Aircell Duct Covering	400	SF	Hall A - 1907 Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
P	Pre-Formed Pipe Insulation	100	LF	Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
Q	MJP on Pre-Formed Pipe Insulation	3	FITTING	Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Henry School Unit 23731 Building ID 3940
Address 4250 N St Louis Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 1/17/2025
Inspector Name Panfilo Carrasco
100-11089 5/15/2026
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	108 Wardrobe
23	
24	

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
25	
26	
27	
28	
29	
30	
31	Helps Room
32	
35	
36	
37	
38	
39	
40	
41	
46	Lunchroom - B-1
47	
48	
49	
50	
51	
52	
52A	
53	Room 107
53A	
54	
57	
57A	
58	

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
59	
60	Room 304 Wardrobe, Room 306
60A	
61	Room 304
61A	
62	
62A	
63	
64	
65	
65M	
66	
67	
68	
B	
C	
D	
E	
F	
G	
H	
I	Fan room, South Blastroom, North Blastroom
J	
K	
L	
M	
O	
P	
Q	

Chicago Public Schools

School Henry School **Unit** 23731 **Building ID** 3940
Address 4250 N St Louis Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Table II
Management Planner's Review

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Plaster			Throughout - 1904 Bldg.	No ACBM						
02	12"x12" Brown w/ White Streaks VFT	1,200	SF	Princ. Office, Rooms 204, 301 - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	9"x9" Brown VFT	400	SF	Principals Office (under the carpet) - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	Green Linoleum			Room 304 - 1904 Bldg. REMOVED	No ACBM						
05	12"x12" Brown w/ White Streaks VFT Mastic	1,200	SF	Princ. Office, Rooms 204, 301 - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	9"x9" Brown VFT Mastic	400	SF	Principals Office (under carpet) - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Green Linoleum Mastic			Room 304 - 1904 Bldg. REMOVED	No ACBM						
08	Drywall System	2,000	SF	Various Locations - 1904 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12"x12" Brown w/ White Streaks VFT	1,500	SF	Room 301 - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	9"x9" Black VFT	200	SF	Aud. Balcony, Room B2- 1907 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12"x12" Brown w/ White Streaks VFT Mastic	1,500	SF	Room 301 - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	9"x9" Black VFT Mastic	200	SF	Aud. Balcony, Room B2 - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12"x12" Ceiling Tile w/ Grooves			Throughout - 1904 Bldg.	No ACBM						
14	12"x12" Grey w/ Tan Spots VFT	2,300	SF	Room 308, Basement Kitchen - 1907 Bldg.	Chrysotile	MISC	No	25	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" Grey w/ Tan Spots VFT Mastic	2,300	SF	Room 308, Basement Kitchen - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Dark Green Linoleum - REMOVED			Room 304 - 1904 Bldg. - REMOVED	No ACBM						
17	Dark Green Linoleum Mastic - REMOVED			Room 304 - 1904 Bldg. - REMOVED	No ACBM						
18	Multi-Color Linoleum			Room 304 (counter tops) - 1904 Bldg.	No ACBM						
19	Multi-Color Linoleum Mastic			Room 304 (counter tops) - 1904 Bldg.	No ACBM						
20	9"x9" Tan VFT	600	SF	Principals Office (under carpet), Vault - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	9"x9" Tan VFT Mastic	600	SF	Principals Office (under carpet), Vault - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Tan w/ Grey Speckles VFT	800	SF	Room 108 - 1907 Bldg.	Assumed	MISC	No	3	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" Tan w/ Grey Speckles VFT Mastic	800	SF	Room 108 - 1907 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	9"x9" Brown w/ White Streaks VFT	1,100	SF	Room 001, B1, 107 - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	9"x9" Brown w/ White Streaks VFT Mastic	1,100	SF	Room 001, B1, 107 - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Off White w/ Grey Streaks VFT	400	SF	Basement Kitchen, Kitchen Store Rm - 1907 Bldg.	Assumed	MISC	No	10	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
27	12"x12" Off White w/ Grey Streaks VFT Mastic	400	SF	Basement Kitchen, Kitchen Store Rm - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Hard Coat Plaster			1907 Bldg.	No ACBM						
29	9"x9" Brown w/ Orange Specks VFT	40	SF	Engineers Toilet - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	9"x9" Brown w/ Orange Specks VFT Mastic	40	SF	Engineers Toilet - 1907 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	9"x9" Brown w/ Orange Specks VFT	300	SF	Basement Helps Room - 1904 Bldg.	Chrysotile	MISC	No	12	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	9"x9" Brown w/ Orange Specks VFT mastic	300	SF	Basement Helps Room - 1904 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12"x12" Gray VFT	8,000	SF	Throughout 1996 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12"x12" Gray VFT Mastic	8,000	SF	Throughout 1996 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	2'x4' White w/ Grooves Ceiling Tile			Throughout 1996 Annex	No ACBM						
38	Gray Vinyl Baseboard			Throughout 1996 Annex	No ACBM						
39	Gray Vinyl Baseboard Mastic			Throughout 1996 Annex	No ACBM						
40	Drywall			Throughout 1996 Annex	No ACBM	SURFACE					
41	Drywall Compound			Throughout 1996 Annex	No ACBM						
46	12'X 12" Blue Floor Tile	1,000	SF	Room B1 - 1907 Bldg.	Assumed	MISC	No	12	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12'X 12" Blue Floor Tile Mastic	1,000	SF	Room B1 - 1907 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	Carpet Mastic	2,000	SF	Room 208, Auditorium (1907 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	Carpet Mastic	350	SF	304A (1904 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	Terrazzo	600	SF	1st Floor Stair Landings (1904 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Terrazzo	150	SF	Auditorium Vestibule (1907 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	12'X12" Gray Streaked VFT	700	SF	Room 202 and 203 Teachers Washroom (1907 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52A	12'X12" Gray Streaked VFT Mastic	700	SF	Room 202 and 203 Teachers Washroom (1907 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12'X12" White w/Gray Specks VFT	700	SF	Room 107 (1907 Bldg)	Assumed	MISC	No	16	SF	6 ACBM with the potential for damage	Follow O&M Plan
53A	12'X12" White w/Gray Specks VFT Mastic	700	SF	Room 107 - 1907 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Fire Door	3	EA	Sprinkler Rm, Engine Rm, Pump Rm (1904 Bldg)	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
57	12'X12" Gray Streaked VFT	1,000	SF	Rooms 203, 204A Women (1904 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57A	12'X12" Gray Streaked VFT Mastic	1,000	SF	Rooms 203, 204A Women (1904 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12' X 12" Black with white specks VFT	900	SF	Main Office (1904 Bldg)	Assumed	MISC	No	25	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	12' X 12" Black with white specks VFT Mastic	900	SF	Main Office (1904 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12" x 12" Beige with tan streaks VFT	3,000	SF	Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm 304A	Assumed	MISC	No	8	SF	6 ACBM with the potential for damage	Follow O&M Plan
60A	12" x 12" Beige with tan streaks VFT Mastic	3,000	SF	Rooms 304, 305, 306, 307, 308, 303;	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Men's Toilet by Rm 304A							
61	12" x 12" Off-white VFT	200	SF	Room 304	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Follow O&M Plan
61A	12" x 12" Off-white VFT Mastic	200	SF	Room 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12" x 12" White w/ Gray Specks VFT	700	SF	Room 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62A	12" x 12" White w/ Gray Specks VFT Mastic	700	SF	Room 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	Red Fire Stop	6	LF	Throughout Various Locations	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
64	12 x 12 Beige w/ streaks VFT	40	SF	1st floor vault	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	12"x12" Gray with Multicolor floor tile	70	SF	IDF Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65M	12"x12" Gray with Multicolor floor tile mastic	70	SF	IDF Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	Carpet Matic		SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Terrazzo	60	SF	Room 101 Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	Undersink Coating	9	SF	B2	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	MJP on Fiberglass Pipe Insulation			Engineers Toliet, Supply Room, Hall D - 1907	No ACBM						
C	Cardboard Pipe Insulation	300	LF	Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toliet - 1904 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
D	MJP on Cardboard Pipe Insulation	100	FITTING	Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toliet - 1904 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	300	LF	Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol Vest. - 1904 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
F	MJP on Aircell Pipe Insulation	77	FITTING	Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol Vest. - 1904 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
G	Aircell Duct Covering	300	SF	Basement Hall B & C - 1904 Bldg.	Chrysotile	TSI	Yes		SF	6 ACBM with the potential for damage	Follow O&M Plan
H	Pre-Formed Pipe Insulation (mag block)	180	LF	Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C, both Cold decks - 1904 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
I	MJP on Pre-Formed Pipe Insulation	50	FITTING	Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C - 1904 Bldg.	Chrysotile	TSI	Yes	5	FITTING	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
J	MJP on Fiberglass Pipe Insulation			Basement Boys & Girls Toliet, Engine,	No ACBM						

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Tank, Boiler Rooms, Lunchroom 1, Helps Store, Halls C & D - 1904 Bldg.							
K	Cardboard Pipe Insulation	286	LF	Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.	Chrysotile	TSI	Yes	1	LF	6 ACBM with the potential for damage	Repair
L	MJP on Cardboard Pipe Insulation	100	FITTING	Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.	Assumed	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
M	Aircell Pipe Insulation	30	LF	Hall D - 1907 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
O	Aircell Duct Covering	400	SF	Hall A - 1907 Building	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P	Pre-Formed Pipe Insulation	100	LF	Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
Q	MJP on Pre-Formed Pipe Insulation	3	FITTING	Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	2/7/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
25	
26	
27	
28	
29	
30	
31	
32	
35	
36	
37	
38	
39	
40	
41	
46	
47	
48	
49	
50	
51	
52	
52A	
53	
53A	
54	
57	

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
57A	
58	
59	
60	
60A	
61	
61A	
62	
62A	
63	
64	
65	
65M	
66	
67	
68	
B	
C	
D	
E	
F	
G	
H	
I	Repair Damaged Insulation, Maintain in Good condition
J	
K	Repair Damaged ACM, Maintain in Good condition
L	

Chicago Public Schools

School Henry School

Unit 23731

Building ID 3940

Address 4250 N St Louis Avenue

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
M	
O	
P	
Q	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 01

MATERIAL DESCRIPTION: Plaster

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout - 1904 Bldg.

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout - 1904 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

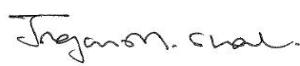

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Princ. Office, Rooms 204, 301 - 1904 Bldg.		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT**

MATERIAL LOCATION: **Princ. Office, Rooms 204, 301 - 1904 Bldg.**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	9"x9" Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals Office (under the carpet) - 1904 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **9"x9" Brown VFT**

MATERIAL LOCATION: **Principals Office (under the carpet) - 1904 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Green Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 304 - 1904 Bldg. REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **Green Linoleum**

MATERIAL LOCATION: **Room 304 - 1904 Bldg. REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Princ. Office, Rooms 204, 301 - 1904 Bldg.		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Princ. Office, Rooms 204, 301 - 1904 Bldg.**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	9"x9" Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals Office (under carpet) - 1904 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **9"x9" Brown VFT Mastic**

MATERIAL LOCATION: **Principals Office (under carpet) - 1904 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

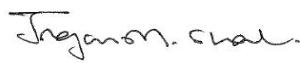

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07

MATERIAL DESCRIPTION: Green Linoleum Mastic

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 304 - 1904 Bldg. REMOVED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **Green Linoleum Mastic**

MATERIAL LOCATION: **Room 304 - 1904 Bldg. REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

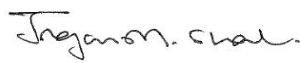

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	Drywall System		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Various Locations - 1904 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **Drywall System**

MATERIAL LOCATION: **Various Locations - 1904 Bldg.**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 301 - 1907 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT**

MATERIAL LOCATION: **Room 301 - 1907 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

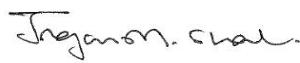

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	9"x9" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Aud. Balcony, Room B2- 1907 Bldg		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **9"x9" Black VFT**

MATERIAL LOCATION: **Aud. Balcony, Room B2- 1907 Bldg**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 301 - 1907 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 301 - 1907 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	9"x9" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Aud. Balcony, Room B2 - 1907 Bldg.		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **9"x9" Black VFT Mastic**

MATERIAL LOCATION: **Aud. Balcony, Room B2 - 1907 Bldg.**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 13

MATERIAL DESCRIPTION: 12"x12" Ceiling Tile w/ Grooves

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout - 1904 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **12"x12" Ceiling Tile w/ Grooves**

MATERIAL LOCATION: **Throughout - 1904 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12"x12" Grey w/ Tan Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 308, Basement Kitchen - 1907 Bldg.		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **12"x12" Grey w/ Tan Spots VFT**

MATERIAL LOCATION: **Room 308, Basement Kitchen - 1907 Bldg.**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **25** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	12"x12" Grey w/ Tan Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 308, Basement Kitchen - 1907 Bldg.		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **12"x12" Grey w/ Tan Spots VFT Mastic**

MATERIAL LOCATION: **Room 308, Basement Kitchen - 1907 Bldg.**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

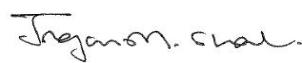

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Dark Green Linoleum - REMOVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 304 - 1904 Bldg. - REMOVED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Dark Green Linoleum - REMOVED**

MATERIAL LOCATION: **Room 304 - 1904 Bldg. - REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 17

MATERIAL DESCRIPTION: Dark Green Linoleum Mastic - REMOVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 304 - 1904 Bldg. - REMOVED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Dark Green Linoleum Mastic - REMOVED**

MATERIAL LOCATION: **Room 304 - 1904 Bldg. - REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

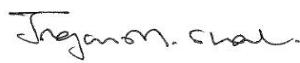

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Multi-Color Linoleum**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 304 (counter tops) - 1904 Bldg.**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Multi-Color Linoleum**

MATERIAL LOCATION: **Room 304 (counter tops) - 1904 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

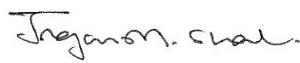

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Multi-Color Linoleum Mastic**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 304 (counter tops) - 1904 Bldg.**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Multi-Color Linoleum Mastic**

MATERIAL LOCATION: **Room 304 (counter tops) - 1904 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

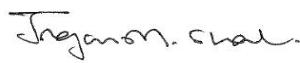

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	9"x9" Tan VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals Office (under carpet), Vault - 1904 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **9"x9" Tan VFT**

MATERIAL LOCATION: **Principals Office (under carpet), Vault - 1904 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	9"x9" Tan VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals Office (under carpet), Vault - 1904 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **9"x9" Tan VFT Mastic**

MATERIAL LOCATION: **Principals Office (under carpet), Vault - 1904 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Grey Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 108 - 1907 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	108 Wardrobe		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Grey Speckles VFT**

MATERIAL LOCATION: **Room 108 - 1907 Bldg.**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **3** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Grey Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 108 - 1907 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Grey Speckles VFT Mastic**

MATERIAL LOCATION: **Room 108 - 1907 Bldg.**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 001, B1, 107 - 1907 Bldg.		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White Streaks VFT**

MATERIAL LOCATION: **Room 001, B1, 107 - 1907 Bldg.**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 001, B1, 107 - 1907 Bldg.		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 001, B1, 107 - 1907 Bldg.**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Grey Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Kitchen, Kitchen Store Rm - 1907 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Grey Streaks VFT**

MATERIAL LOCATION: **Basement Kitchen, Kitchen Store Rm - 1907 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Grey Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Kitchen, Kitchen Store Rm - 1907 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Grey Streaks VFT Mastic**

MATERIAL LOCATION: **Basement Kitchen, Kitchen Store Rm - 1907 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 28

MATERIAL DESCRIPTION: Hard Coat Plaster

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1907 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **1907 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

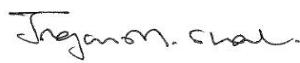

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Orange Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers Toilet - 1907 Bldg.		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **9"x9" Brown w/ Orange Specks VFT**

MATERIAL LOCATION: **Engineers Toilet - 1907 Bldg.**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Orange Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers Toilet - 1907 Bldg.		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **9"x9" Brown w/ Orange Specks VFT Mastic**

MATERIAL LOCATION: **Engineers Toilet - 1907 Bldg.**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Orange Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement Helps Room - 1904 Bldg.		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Helps Room		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **9"x9" Brown w/ Orange Specks VFT**

MATERIAL LOCATION: **Basement Helps Room - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **12** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Orange Specks VFT mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Helps Room - 1904 Bldg.		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **9"x9" Brown w/ Orange Specks VFT mastic**

MATERIAL LOCATION: **Basement Helps Room - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12"x12" Gray VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout 1996 Annex		
MATERIAL QUANTITY:	8000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12"x12" Gray VFT**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12"x12" Gray VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout 1996 Annex		
MATERIAL QUANTITY:	8000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12"x12" Gray VFT Mastic**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

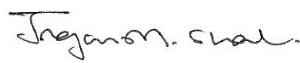

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 37

MATERIAL DESCRIPTION: 2'x4' White w/ Grooves Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1996 Annex

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **2'x4' White w/ Grooves Ceiling Tile**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

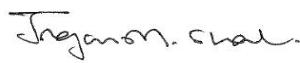

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 38
MATERIAL DESCRIPTION: Gray Vinyl Baseboard
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1996 Annex

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Gray Vinyl Baseboard**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 39

MATERIAL DESCRIPTION: Gray Vinyl Baseboard Mastic

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1996 Annex

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Gray Vinyl Baseboard Mastic**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

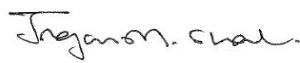

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 40
MATERIAL DESCRIPTION: Drywall
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1996 Annex

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

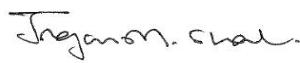

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 41
MATERIAL DESCRIPTION: Drywall Compound
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1996 Annex

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Drywall Compound**

MATERIAL LOCATION: **Throughout 1996 Annex**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

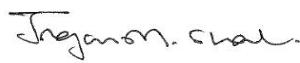

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"X 12" Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room B1 - 1907 Bldg.		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Lunchroom - B-1		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12"X 12" Blue Floor Tile**

MATERIAL LOCATION: **Room B1 - 1907 Bldg.**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **12** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	12"X 12" Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room B1 - 1907 Bldg.		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12"X 12" Blue Floor Tile Mastic**

MATERIAL LOCATION: **Room B1 - 1907 Bldg.**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 208, Auditorium (1907 Bldg)		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Room 208, Auditorium (1907 Bldg)**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

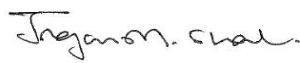

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	304A (1904 Bldg)		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **304A (1904 Bldg)**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

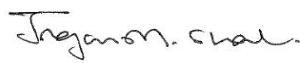

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Stair Landings (1904 Bldg)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **1st Floor Stair Landings (1904 Bldg)**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium Vestibule (1907 Bldg)		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **Auditorium Vestibule (1907 Bldg)**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12"X12" Gray Streaked VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 202 and 203 Teachers Washroom (1907 Bldg)		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12"X12" Gray Streaked VFT**

MATERIAL LOCATION: **Room 202 and 203 Teachers Washroom (1907 Bldg)**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52A		
MATERIAL DESCRIPTION:	12"X12" Gray Streaked VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 202 and 203 Teachers Washroom (1907 Bldg)		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **52A**

MATERIAL DESCRIPTION: **12"X12" Gray Streaked VFT Mastic**

MATERIAL LOCATION: **Room 202 and 203 Teachers Washroom (1907 Bldg)**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	12"X12" White w/Gray Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 107 (1907 Bldg)		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Room 107		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12"X12" White w/Gray Specks VFT**

MATERIAL LOCATION: **Room 107 (1907 Bldg)**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **16** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53A		
MATERIAL DESCRIPTION:	12"X12" White w/Gray Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107 - 1907 Bldg.		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **53A**

MATERIAL DESCRIPTION: **12"X12" White w/Gray Specks VFT Mastic**

MATERIAL LOCATION: **Room 107 - 1907 Bldg.**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	Fire Door		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Sprinkler Rm, Engine Rm, Pump Rm (1904 Bldg)		
MATERIAL QUANTITY:	3	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **Fire Door**

MATERIAL LOCATION: **Sprinkler Rm, Engine Rm, Pump Rm (1904 Bldg)**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	12"X12" Gray Streaked VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 203, 204A Women (1904 Bldg)		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **12"X12" Gray Streaked VFT**

MATERIAL LOCATION: **Rooms 203, 204A Women (1904 Bldg)**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57A		
MATERIAL DESCRIPTION:	12"X12" Gray Streaked VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 203, 204A Women (1904 Bldg)		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **57A**

MATERIAL DESCRIPTION: **12"X12" Gray Streaked VFT Mastic**

MATERIAL LOCATION: **Rooms 203, 204A Women (1904 Bldg)**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	12" X 12" Black with white specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Main Office (1904 Bldg)		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **12" X 12" Black with white specks VFT**

MATERIAL LOCATION: **Main Office (1904 Bldg)**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **25** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	12" X 12" Black with white specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office (1904 Bldg)		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **12" X 12" Black with white specks VFT Mastic**

MATERIAL LOCATION: **Main Office (1904 Bldg)**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

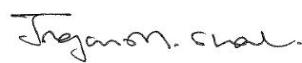

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	12" x 12" Beige with tan streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm 304A		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Room 304 Wardrobe, Room 306		

Inspector's Signature:


Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **12" x 12" Beige with tan streaks VFT**

MATERIAL LOCATION: **Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm 304A**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **8** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60A		
MATERIAL DESCRIPTION:	12" x 12" Beige with tan streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm 304A		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **60A**

MATERIAL DESCRIPTION: **12" x 12" Beige with tan streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 304, 305, 306, 307, 308, 303; Men's Toilet by Rm 304A**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	12" x 12" Off-white VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 304		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Room 304		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **12" x 12" Off-white VFT**

MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

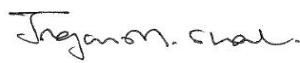

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61A		
MATERIAL DESCRIPTION:	12" x 12" Off-white VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 304		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **61A**

MATERIAL DESCRIPTION: **12" x 12" Off-white VFT Mastic**

MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	12" x 12" White w/ Gray Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **12" x 12" White w/ Gray Specks VFT**

MATERIAL LOCATION: **Room 107**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62A		
MATERIAL DESCRIPTION:	12" x 12" White w/ Gray Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **62A**

MATERIAL DESCRIPTION: **12" x 12" White w/ Gray Specks VFT Mastic**

MATERIAL LOCATION: **Room 107**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	Red Fire Stop		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Various Locations		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **Red Fire Stop**

MATERIAL LOCATION: **Throughout Various Locations**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	12 x 12 Beige w/ streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st floor vault		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **12 x 12 Beige w/ streaks VFT**

MATERIAL LOCATION: **1st floor vault**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Toliet, Supply Room, Hall D - 1907**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Engineers Toliet, Supply Room, Hall D - 1907**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

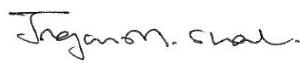

Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	C		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toilet - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: MATERIAL UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toliet - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	MJP on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toilet - 1904 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: MATERIAL UNITS: **FITTING**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Lunchroom 2, Engine Room, Tank Room, Boiler Room, Halls C & D, Basement Boys Toliet - 1904 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol Vest. - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: MATERIAL UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol Vest. - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	MJP on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol Vest. - 1904 Bldg.**

MATERIAL QUANTITY: **77** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: MATERIAL UNITS: **FITTING**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **MJP on Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement Girls Toilet Store Room, Lunchroom 1 & 2, Engine, Tank, & Boiler Rooms, Hall C, Base. Boy Tol Vest. - 1904 Bldg.**

MATERIAL QUANTITY: **77** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	Aircell Duct Covering		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Hall B & C - 1904 Bldg.		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Aircell Duct Covering**

MATERIAL LOCATION: **Basement Hall B & C - 1904 Bldg.**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	H		
MATERIAL DESCRIPTION:	Pre-Formed Pipe Insulation (mag block)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C, both Cold decks - 1904 Bldg.		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Pre-Formed Pipe Insulation (mag block)**

MATERIAL LOCATION: **Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C, both Cold decks - 1904 Bldg.**

MATERIAL QUANTITY: **180** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	1		
MATERIAL DESCRIPTION:	MJP on Pre-Formed Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Deterioration Delamination		
DISTURBANCE POTENTIAL:	HIGH		
MATERIAL LOCATION:	Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C - 1904 Bldg.		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:	DAMAGE UNITS: FITTING		
COMMENTS:	Fan room, South Blastroom, North Blastroom		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **MJP on Pre-Formed Pipe Insulation**

MATERIAL LOCATION: **Lunchroom 1&2, Tank Room, Engine Room, Boiler Room, Hall C - 1904 Bldg.**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **5** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair Damaged Insulation, Maintain in Good condition

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: J

MATERIAL DESCRIPTION: MJP on Fiberglass Pipe Insulation

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Basement Boys & Girls Toliet, Engine, Tank, Boiler Rooms, Lunchroom 1, Helps Store, Halls C & D - 1904 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Basement Boys & Girls Toilets, Engine, Tank, Boiler Rooms, Lunchroom 1, Helps Store, Halls C & D - 1904 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	K		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.		
MATERIAL QUANTITY:	286	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.**

MATERIAL QUANTITY: **286** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **1** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM, Maintain in Good condition

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	L		
MATERIAL DESCRIPTION:	MJP on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Engineers Toliet, Kitchen, Fan Room - 1907 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hall D - 1907 Bldg.		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Hall D - 1907 Bldg.**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	Aircell Duct Covering		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hall A - 1907 Building		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUILDING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **Aircell Duct Covering**

MATERIAL LOCATION: **Hall A - 1907 Building**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	Pre-Formed Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **Pre-Formed Pipe Insulation**

MATERIAL LOCATION: **Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Panfilo Carrazco		
SCHOOL NAME:	Henry School	INSPECTION DATE:	1/17/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	MJP on Pre-Formed Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.		
MATERIAL QUANTITY:	3	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23731	BUIDLING ID:	3940
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Henry School	REVIEW DATE:	2/7/2025		
ADDRESS:	4250 N St Louis Avenue	IDPH LICENSE NO:	100-11089		

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **MJP on Pre-Formed Pipe Insulation**

MATERIAL LOCATION: **Engineers Store Room, Hall D, Kitchen, Fan Room - 1907 Bldg.**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Henry School** INSPECTION DATE: **1/17/2025**
ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Room 101 Restroom**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Henry School** REVIEW DATE: **2/7/2025**

ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **Room 101 Restroom**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Henry School** INSPECTION DATE: **1/17/2025**
ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Carpet Matic**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Henry School** REVIEW DATE: **2/7/2025**

ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **Carpet Matic**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Henry School** INSPECTION DATE: **1/17/2025**
ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" Gray with Multicolor floor tile**
MATERIAL LOCATION: **IDF Room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Henry School** REVIEW DATE: **2/7/2025**

ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **12"x12" Gray with Multicolor floor tile**

MATERIAL LOCATION: **IDF Room**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Henry School** INSPECTION DATE: **1/17/2025**
ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **Undersink Coating**
MATERIAL LOCATION: **B2**
MATERIAL QUANTITY: **9** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Henry School** REVIEW DATE: **2/7/2025**

ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **Undersink Coating**

MATERIAL LOCATION: **B2**

MATERIAL QUANTITY: **9** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Henry School** INSPECTION DATE: **1/17/2025**
ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **65M**
MATERIAL DESCRIPTION: **12"x12" Gray with Multicolor floor tile mastic**
MATERIAL LOCATION: **IDF Room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23731** BUIDLING ID: **3940**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Henry School** REVIEW DATE: **2/7/2025**

ADDRESS: **4250 N St Louis Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **65M**

MATERIAL DESCRIPTION: **12"x12" Gray with Multicolor floor tile mastic**

MATERIAL LOCATION: **IDF Room**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/07/2025**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois

PANFILO CARRAZCO
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 11089

ISSUED
2/28/2022

EXPIRES
05/15/2023

PANFILO CARRAZCO
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

Front of License		Back of License	
	ASBESTOS PROFESSIONAL LICENSE	ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11089	ISSUED 2/28/2022	EXPIRES 05/15/2023	INSPECTOR 1/15/2023
PANFILO CARRAZCO 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	1/22/2023

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/28/2023 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/28/2023

Course Dates:

01/28/2024

Expires:

2301BIR14

Certificate Number:

A handwritten signature in black ink that appears to read "Nicholas J. Penef".

Phone: 312-491-0081

Director of Training

Nicholas J. Penef


Doctor of Public Health

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois

PANFILO CARRAZCO
2942 W VAN BUREN ST
CHICAGO, IL 60612

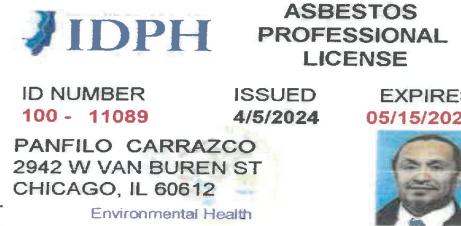

4/5/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE	ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11089	ISSUED 4/5/2024	EXPIRES 05/15/2025	INSPECTOR	1/27/2025
PANFILO CARRAZCO 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/13/2025
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR04

Certificate Number:

Director of Training

Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

A handwritten signature in black ink that reads "Nicholas J. Peneff" followed by "D.P.H." in smaller letters.

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/15/2022

Course Dates:

01/15/2023

Expires:

2201BIR02

Certificate Number:

A handwritten signature in black ink that reads "Nicholas J. Penef".

Phone: 312-491-0081

Director of Training

Nicholas J. Penef

Doctor of Public Health


FORM # A-010B



525-535 West Jefferson Street • Springfield, IL

PANFILO CARRAZCO
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/30/

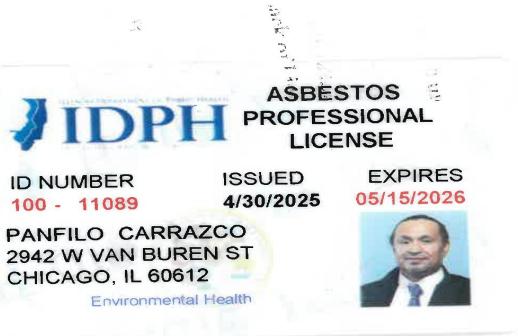

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07342	ISSUED 6/9/2025	EXPIRES 05/15/2026	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	


If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023

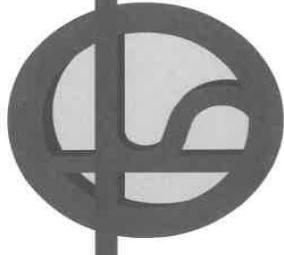

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo

Kathy DeSalvo, Director



Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

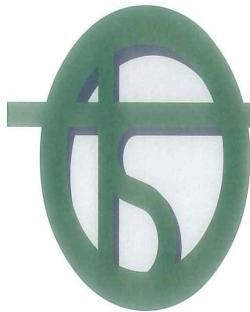

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License



Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	
Alteration of this license shall result in legal action	
This license issued under authority of the State of Illinois	
Department of Public Health	
This license is valid only when accompanied by a valid	
training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/8/2024

EXPIRES
05/15/2025

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

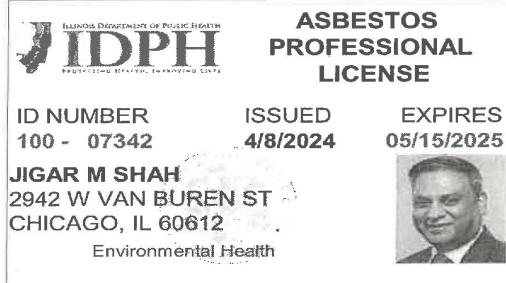

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES
Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2025

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

Kristina Miczek, Training Manager

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed