

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2030
SCHOOL NAME: Lozano Annex
ADDRESS OF SCHOOL: 1501 N. GREENVIEW
CITY: Chicago, IL,

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 6/6/2025 ENROLLMENT 246
IDPH INSPECTOR LICENSE NUMBER: 100-11093
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

 7/7/2025
Richard J. Schleyer
Signature of Designated Person Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Lozano Annex

1501 N. GREENVIEW
Chicago, IL,

Unit: 24101
Building ID: 4381

IDPH ID Number: 14-016-2990-2030

REPORT DATE:
Monday, July 07, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street
Chicago, IL, 60612
Phone (312) 319-7575
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

07/07/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24101 Region: 02 IDPH ID: 14-016-2990-2030

School: Lozano Annex Building ID: 4381

Address: 1501 N. GREENVIEW

Chicago, IL,

Building Contact: Coleman, Timothy Contact Phone: 3126185169

Current Building Owners: Chicago Public Schools

Reinspection Date: 6/6/2025

Review Date: 07/07/2025

Inspector: David Avila

Inspector IDPH License: 100-11093

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: July 07, 2025

RE: Lozano Annex, Unit 24101
1501 N. GREENVIEW
Chicago, IL,

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Lozano Annex , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Lozano Annex, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Lozano Annex Unit: 24101 Region: 02
Address: 1501 N. GREENVIEW Chicago, IL,
IDPH ID: 14-016-2990-2030 Building ID: 4381
Contact: Coleman, Timothy Phone: 3126185169

2. Description of Facility

Original Construction: 1993 Additional Construction:
Total Square Footage: 57885 No of Floors: 3
Current Occupancy: 246

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: David Avila

Inspector IDPH license # 100-11093
Reinspection Date: 6/6/2025


Signature:
Date: 6/6/2025

6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342


Signature:
Date: 07/07/2025

7. Review Date: 07/07/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 7/7/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Lozano Annex. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

- A. The following HAs have changed assessment categories for Building 4381:

B. The following new homogenous areas have been identified for Building 4381:

- 01 Spray-On Fireproofing
- 02 Drywall System
- 03 2" x 2" Rough Ceiling Tile
- 04 12" x 12" Cream w/ Blue and Beige Specs VFT
- 05 12" x 12" Cream w/ Blue and Beige Specs VFT Mastic
- 06 Replacement 12" x 12" Cream w/ Specs VFT
- 07 Replacement 12" x 12" Cream w/ Specs VFT Mastic
- 08 12" x 12" Green w/ Specs VFT
- 09 12" x 12" Green w/ Specs VFT Mastic
- 10 Carpet Mastic
- 11 Replacement 2' x 2' Pinhole Ceiling Tile
- 12 Linoleum Flooring
- 13 Textume Wall Panels
- 14 Table & Counter Tops
- 15 2' x 4' Pinhole Ceiling Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Spray-On Fireproofing
02	Drywall System
03	2" x 2" Rough Ceiling Tile
04	12" x 12" Cream w/ Blue and Beige Specs VFT
05	12" x 12" Cream w/ Blue and Beige Specs VFT Mastic
06	Replacement 12" x 12" Cream w/ Specs VFT
07	Replacement 12" x 12" Cream w/ Specs VFT Mastic
08	12" x 12" Green w/ Specs VFT
09	12" x 12" Green w/ Specs VFT Mastic
10	Carpet Mastic
11	Replacement 2' x 2' Pinhole Ceiling Tile
12	Linoleum Flooring
13	Textume Wall Panels
14	Table & Counter Tops
15	2' x 4' Pinhole Ceiling Tile

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Lozano Annex Building 4381 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Lozano Annex **Unit** 24101 **Building ID** 4381
Address 1501 N. GREENVIEW **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Spray-On Fireproofing	10,000	SF	Throughout	ASSUMED	SURFACE	Y	NONE	0			ACBM with the potential for damage		LOW
02	Drywall System	45,000	SF	Throughout	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
03	2" x 2" Rough Ceiling Tile	30,000	SF	Throughout	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		MODERATE
04	12" x 12" Cream w/ Blue and Beige Specs VFT	30,000	SF	Throughout	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
05	12" x 12" Cream w/ Blue and Beige Specs VFT Mastic	30,000	SF	Throughout	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
06	Replacement 12" x 12" Cream w/ Specs VFT	1,000	SF	1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
07	Replacement 12" x 12" Cream w/ Specs VFT Mastic	1,000	SF	1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
08	12" x 12" Green w/ Specs VFT	3,000	SF	1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
09	12" x 12" Green w/ Specs VFT Mastic	3,000	SF	1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
10	Carpet Mastic	1,500	SF	AP Office, Principal's Office, Conference Room, Library (310)	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
11	Replacement 2' x 2' Pinhole Ceiling Tile	700	SF	Throughout	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
12	Linoleum Flooring	3,000	SF	Gym	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
13	Textume Wall Panels	2,000	SF	Gym	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		MODERATE
14	Table & Counter Tops	400	SF	Room 212	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
15	2' x 4' Pinhole Ceiling Tile	1,500	SF	Kitchen (124), Office (127), Storage (126), Dishwash (125)	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Lozano Annex Unit 24101 Building ID 4381
Address 1501 N. GREENVIEW Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>6/6/2025</u>
Inspector Name <u>David Avila</u>
<u>100-11093</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	

Table II
Management Planner's Review

Chicago Public Schools

School Lozano Annex

Unit 24101

Building ID 4381

Address 1501 N. GREENVIEW

Chicago, IL,

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Spray-On Fireproofing	10,000	SF	Throughout	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	Drywall System	45,000	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	2" x 2" Rough Ceiling Tile	30,000	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12" x 12" Cream w/ Blue and Beige Specs VFT	30,000	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12" x 12" Cream w/ Blue and Beige Specs VFT Mastic	30,000	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	Replacement 12" x 12" Cream w/ Specs VFT	1,000	SF	1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Replacement 12" x 12" Cream w/ Specs VFT Mastic	1,000	SF	1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12" x 12" Green w/ Specs VFT	3,000	SF	1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12" x 12" Green w/ Specs VFT Mastic	3,000	SF	1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Carpet Mastic	1,500	SF	AP Office, Principal's Office, Conference Room, Library (310)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Replacement 2' x 2' Pinhole Ceiling Tile	700	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Linoleum Flooring	3,000	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Textume Wall Panels	2,000	SF	Gym	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Table & Counter Tops	400	SF	Room 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	2' x 4' Pinhole Ceiling Tile	1,500	SF	Kitchen (124), Office (127), Storage (126), Dishwash (125)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Lozano Annex

Unit 24101

Building ID 4381

Address 1501 N. GREENVIEW

Chicago, IL,

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	7/7/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	

Chicago Public Schools

School Lozano Annex

Unit 24101

Building ID 4381

Address 1501 N. GREENVIEW

Chicago, IL,

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	12" x 12" Green w/ Specs VFT Mastic		
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **12" x 12" Green w/ Specs VFT Mastic**

MATERIAL LOCATION: **1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	13			
MATERIAL DESCRIPTION:	Texture Wall Panels			
MATERIAL LOCATION:	Gym			
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	MODERATE			CONDITION:
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Barely Reachable	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
		DAMAGE REASON:		
		DAMAGE UNITS:	SF	
COMMENTS:				

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Textume Wall Panels**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	Spray-On Fireproofing		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	SURFACE	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **Spray-On Fireproofing**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12" x 12" Cream w/ Blue and Beige Specs VFT Mastic		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	30000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **12" x 12" Cream w/ Blue and Beige Specs VFT Mastic**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	2' x 4' Pinhole Ceiling Tile		
MATERIAL LOCATION:	Kitchen (124), Office (127), Storage (126), Dishwash (125)		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Barely Reachable	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **2' x 4' Pinhole Ceiling Tile**

MATERIAL LOCATION: **Kitchen (124), Office (127), Storage (126), Dishwash (125)**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	06			
MATERIAL DESCRIPTION:	Replacement 12" x 12" Cream w/ Specs VFT			
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311			
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	No	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	MODERATE		CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Within Reach	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
		DAMAGE REASON:		
COMMENTS:				

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Replacement 12" x 12" Cream w/ Specs VFT**

MATERIAL LOCATION: **1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	14			
MATERIAL DESCRIPTION:	Table & Counter Tops			
MATERIAL LOCATION:	Room 212			
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	No	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	MODERATE			CONDITION:
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Within Reach	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
		DAMAGE REASON:		
		DAMAGE UNITS:	SF	

COMMENTS:

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Table & Counter Tops**

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	Drywall System		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	45000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **Drywall System**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **45000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12" x 12" Cream w/ Blue and Beige Specs VFT		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	30000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **12" x 12" Cream w/ Blue and Beige Specs VFT**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	07			
MATERIAL DESCRIPTION:	Replacement 12" x 12" Cream w/ Specs VFT Mastic			
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311			
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	No	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	LOW	CONDITION:		
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Within Reach	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
		DAMAGE REASON:		
COMMENTS:				

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **Replacement 12" x 12" Cream w/ Specs VFT Mastic**

MATERIAL LOCATION: **1st, 2nd, and 3rd Floor: 134, 133, 212, 213, 214, 216, 217, 218, 200, 202, 203, 304, 303, 302, 300, 311**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	AP Office, Principal's Office, Conference Room, Library (310)		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **AP Office, Principal's Office, Conference Room, Library (310)**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	12" x 12" Green w/ Specs VFT		
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **12" x 12" Green w/ Specs VFT**

MATERIAL LOCATION: **1st, 2nd, and 3rd Floor Corridors, Cafeteria (122/123)**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Linoleum Flooring		
MATERIAL LOCATION:	Gym		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Linoleum Flooring**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	2" x 2" Rough Ceiling Tile		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	30000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Barely Reachable	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **2" x 2" Rough Ceiling Tile**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **07/07/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24101	BUIDLING ID:	4381
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Lozano Annex	INSPECTION DATE:	6/6/2025		
ADDRESS:	1501 N. GREENVIEW	IDPH LICENSE NO:	100-11093		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	11				
MATERIAL DESCRIPTION:	Replacement 2' x 2' Pinhole Ceiling Tile				
MATERIAL LOCATION:	Throughout				
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Barely Reachable	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		
COMMENTS:					

Inspector's Signature:



Date: 06/06/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24101** BUIDLING ID: **4381**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Lozano Annex** REVIEW DATE: **7/7/2025**

ADDRESS: **1501 N. GREENVIEW** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **Replacement 2' x 2' Pinhole Ceiling Tile**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:




Date: **07/07/2025**

APPENDIX B

Inspector and Management Planner Licenses

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2022

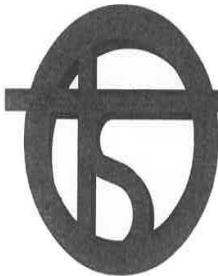

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092141

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 9/10/2021

Exam Date: 9/10/2021

Expiration Date: 9/10/2022

Certificate Number: BIR2109101942


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, IL

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/30/2025

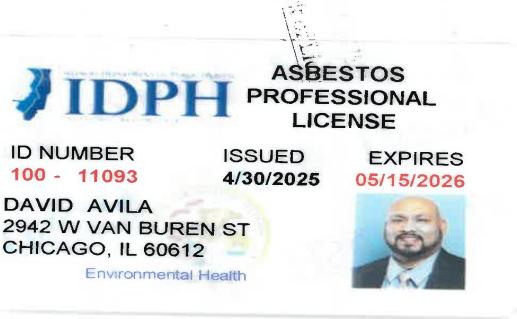

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11093	ISSUED 4/30/2025	EXPIRES 05/15/2026	INSPECTOR 9/13/2025
DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	9/14/2025
PROTECTING HEALTH, IMPROVING LIVES Nationally Accredited by PHAB			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. This course is accredited by the State of Wisconsin, Department of Health Services under ch. DHS 159, Wis. Admin. Code, The Illinois Department of Public Health and The Indiana Department of Environmental Management, under 326 IAC 18. Training was in accordance with requirements listed under EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Location: 12304 75th Street
Kenosha, WI 53142

Certificate Number: BIRWI2409132631
Course Date: 9/13/2024
Exam Date: 9/13/2024
Expiration Date: 9/13/2025



Issue Date: 9/13/2024

Tyler Nicholson, Authorized Signer

Course Credit Hours: BIR WI 4 Hours

A handwritten signature in blue ink, appearing to read 'Tyler Nicholson'.



525-535 West Jefferson Street • Springfield, Illinois

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 11093

ISSUED
2/28/2022 EXPIRES
05/15/2023

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: **11093**

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11093	ISSUED 2/28/2022	EXPIRES 05/15/2023		INSPECTOR	9/10/2022
DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL <i>Alteration of this license shall result in legal action.</i> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 11093

ISSUED
4/8/2024

EXPIRES
05/15/2025

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11093	ISSUED 4/8/2024	EXPIRES 05/15/2025	INSPECTOR	9/15/2024
DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health				PROJECT MANAGER AIR SAMPLING PROFESSIONAL
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07342	ISSUED 6/9/2025	EXPIRES 05/15/2026	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	


If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023

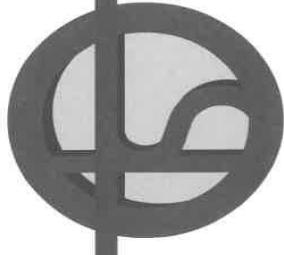

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023


Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo

Kathy DeSalvo, Director

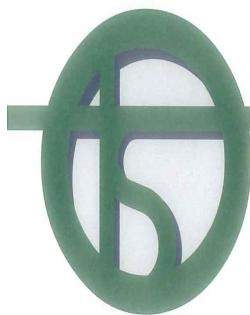

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

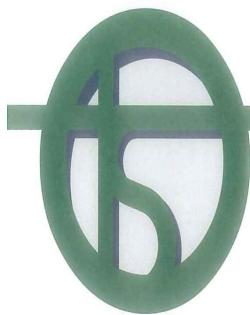

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761

IDPH

ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612


4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: **07342**

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

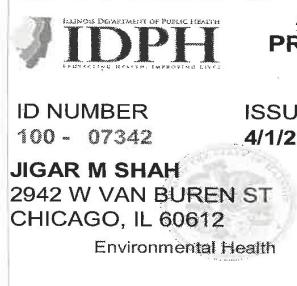

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/8/2024

EXPIRES
05/15/2025

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

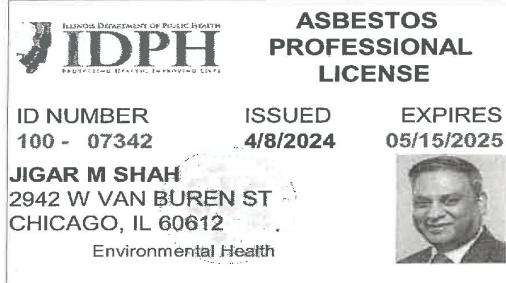

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES

Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2025

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

Kristina Miczek, Training Manager

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed