

ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2048  
SCHOOL NAME: Green School  
ADDRESS OF SCHOOL: 1150 W 96th Street  
CITY: Chicago, IL, 60643

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 11/9/2022

**If the address on this form is different than the address of the building, submit a written explanation.**

**SECTION II (Please type or print)**

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 3/4/2025 ENROLLMENT 254  
IDPH INSPECTOR LICENSE NUMBER: 100-05730  
IDPH LICENSED INSPECTOR NAME (Please Print): Prins Sales  
IDPH MP LICENSE NUMBER: 100-01784  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Steven Geneser

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

*Richard J. Schleyer* 3/28/2025

Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Green School**

1150 W 96th Street  
Chicago, IL, 60643

Unit: 24131  
Building ID: 4410

IDPH ID Number: 14-016-2990-2048

**REPORT DATE:**  
Friday, March 28, 2025

**Prepared for:**  
**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**  
**TEM Environmental, Inc.**

174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone 630-790-0880  
Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

03/26/2025

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299      Unit: 24131      Region: 06      IDPH ID: 14-016-2990-2048

School: Green School      Building ID: 4410

Address: 1150 W 96th Street

Chicago, IL, 60643

Building Contact: Bliss, Michael      Contact Phone: 3129613445

Current Building Owners: Chicago Public Schools

Reinspection Date: 3/4/2025

Review Date: 03/26/2025

Inspector: Prins Sales


Inspector IDPH License: 100-05730

Management Planner: Steven Geneser

Management Planner IDPH License: 100-01784

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.

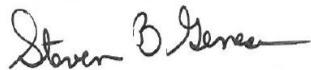

Steven Geneser  
100-01784

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 28, 2025

RE: Green School, Unit 24131  
1150 W 96th Street  
Chicago, IL, 60643

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Green School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Green School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J. Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074.

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

## 1. School Information

School: Green School Unit: 24131 Region: 06  
Address: 1150 W 96th Street Chicago, IL, 60643  
IDPH ID: 14-016-2990-2048 Building ID: 4410  
Contact: Bliss, Michael Phone: 3129613445

## 2. Description of Facility

Original Construction: 1972 Additional Construction:  
Total Square Footage: 40088 No of Floors: 3  
Current Occupancy: 254

### 3. LEA Designated Person

#### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Phone: 630-790-0880 Fax: 630-790-0882

## 5. Inspector

Inspector Name: Prins Sales

Inspector IDPH license # 100-05730  
Reinspection Date: 3/4/2025

Signature:  
Date: 3/4/2025

*Dale*

## 6. Management Planner

Management Planner Name: Steven Geneser

Management Planner IDPH license # 100-01784

Signature: 

7. Review Date: 03/26/2025

## 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: Richard J. Schleyer

Signature:

Date: 3/28/2025

Name: Richard J.Schleyer

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Green School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4410:

17	2'x2' Smooth Ceiling Tiles
18	12x12 Yellow Floor Tile
19	12x12 Yellow Floor Tile Mastic
20	Sink Undercoating
21	12x12 Green Floor Tile
22	12x12 Green Floor Tile Mastic
27	2'x2' White Thick Ceiling Tile
28	12"x12" Beige w/White Specks Floor Tile
28M	Mastic associated w/12"x12" Beige w/White Specks Floor Tlle

29	4" Black Baseboard
29M	Adhesive associated w/4" Black Baseboard
30	12"x12" Tan Mix Floor Tile
30M	Mastic associated w/12"x12" Tan Mix Floor Tile
31	12"x12" Brown Mix Floor Tile
31M	Mastic associated w/12"x12" Brown Mix Floor Tile
NEW	Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 4410:

27	2'x2' White Thick Ceiling Tile
28	12"x12" Beige w/White Specks Floor Tile
28M	Mastic associated w/12"x12" Beige w/White Specks Floor Tlle
29	4" Black Baseboard
29M	Adhesive associated w/4" Black Baseboard
30	12"x12" Tan Mix Floor Tile
30M	Mastic associated w/12"x12" Tan Mix Floor Tile
31	12"x12" Brown Mix Floor Tile
31M	Mastic associated w/12"x12" Brown Mix Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01A	12"x12" Off-White Specked Floor Tile
01B	12"x12" Gray Specked Floor Tile
01E	12"x12" Beige Floor Tile w/ Brown Streaks
01F	12"x12" Brown Specked Floor Tile
03A	Black Mopboard
04A	12"x12" Off-White Specked Floor Tile Mastic
04B	12"x12" Gray Specked Floor Tile Mastic
04C	12"x12" Beige Specked Floor Tile Mastic
04E	12"x12" Beige w/Brown Streaks Floor Tile Mastic
04F	12"x12" Brown Specked Floor Tile Mastic
07E	Mauve Carpet Mastic NOT OBSERVED
09	Muddled Joints
10	2'x4' White Fissured Celing Tile
100	2'x2' Floor Tile White w/Blue Streaks NOT OBSERVED
100A	2'x2' Floor Tile White w/Blue Streaks Mastic NOT OBSERVED
101	12"x12" Floor Tile White w/Brown Streaks
101A	12" x 12" Floor Tile White w/Brown Streaks Mastic
11	12"x12" Tan w/Brown Streaks Floor Tile
11M	12"x12" Tan w/Brown Streaks Floor Tile Mastic
12	12"x12" Off-White w/Multicolor Floor Tile
12M	12"x12" Off-White w/Multicolor Floor Tile Mastic
13	12"x12" Off-White w/Beige Streaks Floor Tile NOT OBSERVED
13M	12"x12" Off-White w/Beige Streaks Floor Tile Mastic NOT OBSERVED
14	Yellow Mosaic Ceramic Tile Grout
15	Yellow Mosaic Ceramic Tile Adhesive
16	Tan w/Yellow and Brown Speckles Terrazzo Flooring
17	2'x2' Smooth Ceiling Tiles
18	12x12 Yellow Floor Tile
19	12x12 Yellow Floor Tile Mastic
20	Sink Undercoating
21	12x12 Green Floor Tile
22	12x12 Green Floor Tile Mastic
23	12x12 Brown Floor Tile
24	12x12 Brown Floor Tile Mastic
25	12x12 Orange Floor Tile
26	12x12 Orange Floor Tile Mastic
27	2'x2' White Thick Ceiling Tile

28	12"x12" Beige w/White Specks Floor Tile
28M	Mastic associated w/12"x12" Beige w/White Specks Floor TIle
29	4" Black Baseboard
29M	Adhesive associated w/4" Black Baseboard
30	12"x12" Tan Mix Floor Tile
30M	Mastic associated w/12"x12" Tan Mix Floor Tile
31	12"x12" Brown Mix Floor Tile
31M	Mastic associated w/12"x12" Brown Mix Floor Tile
NEW	Newly Installed Suspect ACM

The following areas were deemed to be inaccessible:

04A	12"x12" Off-White Specked Floor Tile Mastic
04B	12"x12" Gray Specked Floor Tile Mastic
04C	12"x12" Beige Specked Floor Tile Mastic
04D	12"x12" Gray Floor Tile Mastic
04E	12"x12" Beige w/Brown Streaks Floor Tile Mastic
04F	12"x12" Brown Specked Floor Tile Mastic
05B	Brown Mopboard Mastic
07B	Blue & Mauve Carpet Mastic NOT OBSERVED
100A	2'x2' Floor Tile White w/Blue Streaks Mastic NOT OBSERVED
101A	12" x 12" Floor Tile White w/Brown Streaks Mastic
11M	12"x12" Tan w/Brown Streaks Floor Tile Mastic
12M	12"x12" Off-White w/Multicolor Floor Tile Mastic
15	Yellow Mosaic Ceramic Tile Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Prins Sales, IDPH License # 100-05730. The Management Plan was updated by Steven Geneser, IDPH License # 100-01784. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Green School Building 4410 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

**School** Green School **Unit** 24131 **Building ID** 4410  
**Address** 1150 W 96th Street **Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01A	12"x12" Off-White Specked Floor Tile	2,765	SF	2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01B	12"x12" Gray Specked Floor Tile	2,688	SF	2nd & 3rd Floor Corridors, Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01C	12"x12" Beige Specked Floor Tile	1,470	SF	Rooms 105, 301, & 306 (Counselor's Office) and the SW Corridor on the 1st Floor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01D	12"x12" Gray Floor Tile	10,270	SF	Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01E	12"x12" Beige Floor Tile w/ Brown Streaks	3,600	SF	1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 & Faculty Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01F	12"x12" Brown Specked Floor Tile	270	SF	Two Stage Entries and Patch in Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03A	Black Mopboard	1,500	LF	1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym	ASSUMED	MISC	N		0		No	ACBM with the potential for damage		LOW
04A	12"x12" Off-White Specked Floor Tile Mastic	2,765	SF	2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04B	12"x12" Gray Specked Floor Tile Mastic	2,688	SF	2nd & 3rd Floor Corridors and Rooms 101, 203,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Green School **Unit** 24131 **Building ID** 4410  
**Address** 1150 W 96th Street **Region** 06

## **ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS**

## Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

***Inspector's Comments are Summarized at the End of the Report***

# Chicago Public Schools

**School** Green School **Unit** 24131 **Building ID** 4410  
**Address** 1150 W 96th Street **Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				OBSERVED										
07E	Mauve Carpet Mastic NOT OBSERVED			Rooms 204, 206, 208 and 209 NOT OBSERVED	ASSUMED	MISC			0			ACBM with the potential for damage		LOW
08	Wallboard			Throughout All Interior Walls	NO_ACBM	MISC	N	NONE			No			LOW
09	Muddled Joints	19	EA	Water Meter Room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
10	2'x4' White Fissured Ceiling Tile	25,000	SF	Throughout	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
100	2'x2' Floor Tile White w/Blue Streaks NOT OBSERVED	250	SF	Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
100A	2'x2' Floor Tile White w/Blue Streaks Mastic NOT OBSERVED	250	SF	Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
101	12"x12" Floor Tile White w/Brown Streaks	9,400	SF	Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
101A	12" x 12" Floor Tile White w/Brown Streaks Mastic	9,400	SF	Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12"x12" Tan w/Brown Streaks Floor Tile	4,000	SF	Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11M	12"x12" Tan w/Brown Streaks Floor Tile Mastic	4,000	SF	Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12"x12" Off-White w/Multicolor Floor Tile	3,600	SF	Rooms 104, 106, 108, 205 & 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12M	12"x12" Off-White w/Multicolor Floor Tile Mastic	3,600	SF	Rooms 104, 106, 108, 205 & 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	12"x12" Off-White w/Beige Streaks Floor Tile NOT OBSERVED	4,320	SF	Rooms 205, 207, 209, 303, 305 and 309	ASSUMED	MISC						ACBM with the potential for damage		
13M	12"x12" Off-White w/Beige Streaks Floor Tile Mastic NOT OBSERVED	4,320	SF	Rooms 205, 207, 209, 303, 305 and 309	ASSUMED	MISC			0			ACBM with the potential for damage		
14	Yellow Mosaic Ceramic Tile Grout	2,820	SF	All Washrooms, Locker Room, All Vestibules and the	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Green School **Unit** 24131 **Building ID** 4410  
**Address** 1150 W 96th Street **Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				1st Floor Janitor's Closet										
15	Yellow Mosaic Ceramic Tile Adhesive	2,820	SF	All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Tan w/Yellow and Brown Speckles Terrazzo Flooring	800	SF	2nd and 3rd Floor Stairways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	2'x2' Smooth Ceiling Tiles	25,000	SF	Throughout Building	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
18	12x12 Yellow Floor Tile	500	SF	Rooms 105, 203, 205-208, 301, 303, 305-310	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
19	12x12 Yellow Floor Tile Mastic	500	SF	Rooms 105, 203, 205-208, 301, 303, 305-310	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
20	Sink Undercoating	6	EA	Rooms 101, 103-105, 303 & 308	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
21	12x12 Green Floor Tile	320	SF	Library, Lunchroom & Main Office	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
22	12x12 Green Floor Tile Mastic	320	SF	Library, Lunchroom & Main Office	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
23	12x12 Brown Floor Tile	2,000	SF	Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12x12 Brown Floor Tile Mastic	2,000	SF	Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12x12 Orange Floor Tile	200	SF	Rooms 101, 103, 104, 106 & 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12x12 Orange Floor Tile Mastic	200	SF	Rooms 101, 103, 104, 106 & 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	2'x2' White Thick Ceiling Tile	1,220	SF	Kitchen, Kitchen Office, Kitchen Locker room & Kitchen Washroom	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
28	12"x12" Beige w/White Specks Floor Tile	70	SF	Kitchen Office	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
28M	Mastic associated w/12"x12" Beige	70	SF	Kitchen Office	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the		LOW

# Chicago Public Schools

**School** Green School **Unit** 24131 **Building ID** 4410  
**Address** 1150 W 96th Street **Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	w/White Specks Floor Tile											potential for damage		
29	4" Black Baseboard	1,835	SF	Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teachers Lunchroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
29M	Adhesive associated w/4" Black Baseboard	1,835	SF	Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teacher's Lunchroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
30	12"x12" Tan Mix Floor Tile	1,080	SF	Room 103	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
30M	Mastic associated w/12"x12" Tan Mix Floor Tile	1,080	SF	Room 103	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
31	12"x12" Brown Mix Floor Tile	3,930	SF	Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
31M	Mastic associated w/12"x12" Brown Mix Floor Tile	3,930	SF	Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
A	Brown Carpet Mastic NOT OBSERVED	460	SF	Room 201	NO_ACBM	MISC			0					
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		NONE	0		Yes	ACBM with the potential for damage		

# Chicago Public Schools

School Green School Unit 24131 Building ID 4410  
Address 1150 W 96th Street Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date	<u>3/4/2025</u>
Inspector Name	<u>Prins Sales</u>
<b>100-05730</b>	<b>5/15/2026</b>
Inspector's IDPH License Number / Expiration Date	

#### Inspector's Comments

HA Number:	Inspector Comments:
01A	Not observed in 300, 307 & 310
01B	Not observed in 300, 307 & 310
01C	Not observed in 306
01D	
01E	
01F	
03A	
04A	Not observed in Kitchen
04B	Not observed in 300 & 310
04C	Not observed in 306
04D	
04E	
04F	
05A	
05B	
07B	Not Observed 2025
07C	Not Observed
07D	Not Observed
07E	Not Observed
08	
09	
10	
100	Not Observed 2025
100A	Not Observed 2025

# Chicago Public Schools

School Green School Unit 24131 Building ID 4410  
Address 1150 W 96th Street Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA Number:	Inspector Comments:
101	Not Observed in 206
101A	Not Observed in 206
11	
11M	
12	Not Observed in 104
12M	Not Observed in 104
13	Not Observed 2025
13M	Not Observed 2025
14	
15	
16	
17	
18	110 SF per room
19	110 SF per room
20	
21	
22	
23	
24	
25	
26	
27	
28	
28M	
29	
29M	
30	
30M	
31	

# Chicago Public Schools

**School** Green School **Unit** 24131 **Building ID** 4410  
**Address** 1150 W 96th Street **Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
31M	
A	
NEW	

**Table II**  
**Management Planner's Review**

---

# Chicago Public Schools

**School** Green School

**Unit** 24131

**Building ID** 4410

**Address** 1150 W 96th Street

Chicago, IL, 60643

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	12"x12" Off-White Specked Floor Tile	2,765	SF	2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01B	12"x12" Gray Specked Floor Tile	2,688	SF	2nd & 3rd Floor Corridors, Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01C	12"x12" Beige Specked Floor Tile	1,470	SF	Rooms 105, 301, & 306 (Counselor's Office) and the SW Corridor on the 1st Floor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01D	12"x12" Gray Floor Tile	10,270	SF	Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01E	12"x12" Beige Floor Tile w/ Brown Streaks	3,600	SF	1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 & Faculty Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01F	12"x12" Brown Specked Floor Tile	270	SF	Two Stage Entries and Patch in Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03A	Black Mopboard	1,500	LF	1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
04A	12"x12" Off-White Specked Floor Tile Mastic	2,765	SF	2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04B	12"x12" Gray Specked Floor Tile Mastic	2,688	SF	2nd & 3rd Floor Corridors and Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04C	12"x12" Beige Specked Floor Tile Mastic	2,200	SF	Rooms 105, 301, 306, Counselor's Office, and the 1st Floor SW Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04D	12"x12" Gray Floor Tile Mastic	10,270	SF	Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04E	12"x12" Beige w/Brown Streaks Floor Tile Mastic	2,200	SF	1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 & Faculty Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04F	12"x12" Brown Specked Floor Tile Mastic	270	SF	Two Stage Entries and Patch in Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Green School

**Unit** 24131

**Building ID** 4410

**Address** 1150 W 96th Street

Chicago, IL, 60643

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
05A	Black Mopboard Mastic	1,500	LF	1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym	No ACBM	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
05B	Brown Mopboard Mastic	2,000	LF	Rooms 103, 104, 106, 201, 202, 204, 205-209, 303-306, 308 and 309, Lunch Room, Kitchen, Coach's Office and Storage and Teacher's Lounge	No ACBM	MISC	No	0	LF		
07B	Blue & Mauve Carpet Mastic NOT OBSERVED	500	SF	Room 103 NOT OBSERVED	No ACBM	MISC	No	0	SF		
07C	Blue Carpet Mastic NOT OBSERVED			Rooms 303-307 NOT OBSERVED		MISC					
07D	Green Carpet Mastic NOT OBSERVED			Room 202 (Library), Library Closet and the Teacher's Lounge Closet NOT OBSERVED		MISC					
07E	Mauve Carpet Mastic NOT OBSERVED			Rooms 204, 206, 208 and 209 NOT OBSERVED	Assumed	MISC		0		6 ACBM with the potential for damage	Follow O&M Plan
08	Wallboard			Throughout All Interior Walls	No ACBM	MISC	No				
09	Muddled Joints	19	EA	Water Meter Room	Assumed	TSI	Yes	0	EA	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
10	2'x4' White Fissured Ceiling Tile	25,000	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
100	2'x2' Floor Tile White w/Blue Streaks NOT OBSERVED	250	SF	Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
100A	2'x2' Floor Tile White w/Blue Streaks Mastic NOT OBSERVED	250	SF	Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101	12"x12" Floor Tile White w/Brown Streaks	9,400	SF	Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101A	12" x 12" Floor Tile White w/Brown Streaks Mastic	9,400	SF	Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12"x12" Tan w/Brown Streaks Floor Tile	4,000	SF	Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11M	12"x12" Tan w/Brown Streaks Floor Tile Mastic	4,000	SF	Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12"x12" Off-White w/Multicolor Floor Tile	3,600	SF	Rooms 104, 106, 108, 205 & 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12M	12"x12" Off-White w/Multicolor Floor Tile Mastic	3,600	SF	Rooms 104, 106, 108, 205 & 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12"x12" Off-White w/Beige Streaks Floor Tile NOT OBSERVED	4,320	SF	Rooms 205, 207, 209, 303, 305 and 309	Assumed	MISC			SF	6 ACBM with the potential for damage	Follow O&M Plan
13M	12"x12" Off-White w/Beige Streaks Floor Tile Mastic NOT OBSERVED	4,320	SF	Rooms 205, 207, 209, 303, 305 and 309	Assumed	MISC		0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Green School

**Unit** 24131

**Building ID** 4410

**Address** 1150 W 96th Street

Chicago, IL, 60643

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
14	Yellow Mosaic Ceramic Tile Grout	2,820	SF	All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Yellow Mosaic Ceramic Tile Adhesive	2,820	SF	All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Tan w/Yellow and Brown Speckles Terrazzo Flooring	800	SF	2nd and 3rd Floor Stairways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	2'x2' Smooth Ceiling Tiles	25,000	SF	Throughout Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12x12 Yellow Floor Tile	500	SF	Rooms 105, 203, 205-208, 301, 303, 305-310	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12x12 Yellow Floor Tile Mastic	500	SF	Rooms 105, 203, 205-208, 301, 303, 305-310	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Sink Undercoating	6	EA	Rooms 101, 103-105, 303 & 308	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
21	12x12 Green Floor Tile	320	SF	Library, Lunchroom & Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12x12 Green Floor Tile Mastic	320	SF	Library, Lunchroom & Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12x12 Brown Floor Tile	2,000	SF	Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12x12 Brown Floor Tile Mastic	2,000	SF	Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12x12 Orange Floor Tile	200	SF	Rooms 101, 103, 104, 106 & 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12x12 Orange Floor Tile Mastic	200	SF	Rooms 101, 103, 104, 106 & 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	2'x2' White Thick Ceiling Tile	1,220	SF	Kitchen, Kitchen Office, Kitchen Locker room & Kitchen Washroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" Beige w/White Specks Floor Tile	70	SF	Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28M	Mastic associated w/12"x12" Beige w/White Specks Floor Tile	70	SF	Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	4" Black Baseboard	1,835	SF	Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teachers Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29M	Adhesive associated w/4" Black Baseboard	1,835	SF	Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teacher's Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12"x12" Tan Mix Floor Tile	1,080	SF	Room 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Green School

**Unit** 24131

**Building ID** 4410

**Address** 1150 W 96th Street

Chicago, IL, 60643

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
30M	Mastic associated w/12"x12" Tan Mix Floor Tile	1,080	SF	Room 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"x12" Brown Mix Floor Tile	3,930	SF	Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31M	Mastic associated w/12"x12" Brown Mix Floor Tile	3,930	SF	Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Brown Carpet Mastic NOT OBSERVED	460	SF	Room 201	No ACBM	MISC		0	SF		
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC		0		6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Green School  
**Address** 1150 W 96th Street

**Unit** 24131  
**Chicago, IL, 60643**

**Building ID** 4410  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

*Management Planner's Comments Summarized at the End of the Report*

Review Date	3/26/2025
Manager Planner Name	Steven Geneser
100-01784	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
01B	
01C	
01D	
01E	
01F	
03A	
04A	
04B	
04C	
04D	
04E	
04F	
05A	
05B	
07B	
07C	
07D	
07E	
08	
09	
10	
100	
100A	

# Chicago Public Schools

**School** Green School

**Unit** 24131

**Building ID** 4410

**Address** 1150 W 96th Street

Chicago, IL, 60643

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
101	
101A	
11	
11M	
12	
12M	
13	
13M	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
28M	
29	
29M	
30	

# Chicago Public Schools

**School** Green School

**Unit** 24131

**Building ID** 4410

**Address** 1150 W 96th Street

Chicago, IL, 60643

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
30M	
31	
31M	
A	
NEW	

## APPENDIX A

---

### Assessment Sheets, Drawings and Photos

**Chicago Public Schools**

**TEM Environmental, Inc.**

***2025 AHERA REINSPECTION***

# Chicago Public Schools

TEM Environmental, Inc.

**2025 AHERA REINSPECTION**

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUILDING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	AHERA INSPECTOR:	<b>Prins Sales</b>		
SCHOOL NAME:	<b>Green School</b>	INSPECTION DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	<b>01A</b>		
MATERIAL DESCRIPTION:	<b>12"x12" Off-White Speckled Floor Tile</b>		
HISTORICAL AHERA DAMAGE CATEGORY	<b>6 ACBM with the potential for damage</b>		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	<b>Follow O&amp;M Plan</b>		
ASBESTOS TYPE:	<b>Assumed</b>	FRIABLE:	<b>No</b>

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>LOW</b>		
MATERIAL LOCATION:	<b>2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen</b>		
MATERIAL QUANTITY:	<b>2765</b>	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:			
COMMENTS:	<b>Not observed in 300, 307 &amp; 310</b>		

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **01A**

MATERIAL DESCRIPTION: **12"x12" Off-White Speckled Floor Tile**

MATERIAL LOCATION: **2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen**

MATERIAL QUANTITY: **2765** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

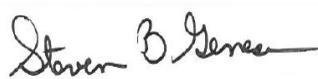

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01B		
MATERIAL DESCRIPTION:	12"x12" Gray Speckled Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors, Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office		
MATERIAL QUANTITY:	2688	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not observed in 300, 307 & 310		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **01B**

MATERIAL DESCRIPTION: **12"x12" Gray Speckled Floor Tile**

MATERIAL LOCATION: **2nd & 3rd Floor Corridors, Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office**

MATERIAL QUANTITY: **2688** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

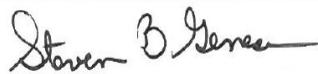

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01C		
MATERIAL DESCRIPTION:	12"x12" Beige Specked Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105, 301, & 306 (Counselor's Office) and the SW Corridor on the 1st Floor		
MATERIAL QUANTITY:	1470	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not observed in 306		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **01C**

MATERIAL DESCRIPTION: **12"x12" Beige Speckled Floor Tile**

MATERIAL LOCATION: **Rooms 105, 301, & 306 (Counselor's Office) and the SW Corridor on the 1st Floor**

MATERIAL QUANTITY: **1470** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

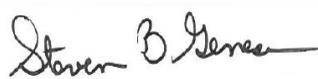

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01D		
MATERIAL DESCRIPTION:	12"x12" Gray Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom		
MATERIAL QUANTITY:	10270	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **01D**

MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile**

MATERIAL LOCATION: **Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom**

MATERIAL QUANTITY: **10270** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

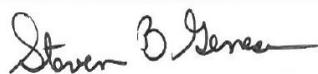

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01E		
MATERIAL DESCRIPTION:	12"x12" Beige Floor Tile w/ Brown Streaks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 & Faculty Room		
MATERIAL QUANTITY:	3600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA:	<b>01E</b>				
MATERIAL DESCRIPTION:	<b>12"x12" Beige Floor Tile w/ Brown Streaks</b>				
MATERIAL LOCATION:	<b>1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 &amp; Faculty Room</b>				
MATERIAL QUANTITY:	<b>3600</b>	MATERIAL UNITS:	<b>SF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>		

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

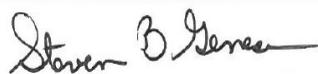

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01F		
MATERIAL DESCRIPTION:	12"x12" Brown Specked Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Two Stage Entries and Patch in Gym		
MATERIAL QUANTITY:	270	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUILDING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **01F**

MATERIAL DESCRIPTION: **12"x12" Brown Speckled Floor Tile**

MATERIAL LOCATION: **Two Stage Entries and Patch in Gym**

MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

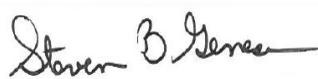

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03A		
MATERIAL DESCRIPTION:	Black Mopboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **03A**

MATERIAL DESCRIPTION: **Black Mopboard**

MATERIAL LOCATION: **1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

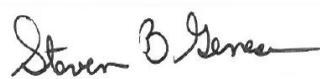

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04A		
MATERIAL DESCRIPTION:	12"x12" Off-White Speckled Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen		
MATERIAL QUANTITY:	2765	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:	Not observed in Kitchen		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **04A**

MATERIAL DESCRIPTION: **12"x12" Off-White Speckled Floor Tile Mastic**

MATERIAL LOCATION: **2nd and 3rd Floor Corridors, Rooms 101, 203, 300, 307 and 310 and the Kitchen**

MATERIAL QUANTITY: **2765** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

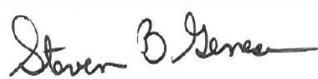

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04B		
MATERIAL DESCRIPTION:	12"x12" Gray Speckled Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors and Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office		
MATERIAL QUANTITY:	2688	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not observed in 300 & 310		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **04B**

MATERIAL DESCRIPTION: **12"x12" Gray Speckled Floor Tile Mastic**

MATERIAL LOCATION: **2nd & 3rd Floor Corridors and Rooms 101, 203, 300, 307, 310 & Assistant Principal's Office**

MATERIAL QUANTITY: **2688** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

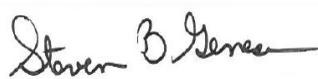

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04C		
MATERIAL DESCRIPTION:	12"x12" Beige Specked Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105, 301, 306, Counselor's Office, and the 1st Floor SW Corridor		
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not observed in 306		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **04C**

MATERIAL DESCRIPTION: **12"x12" Beige Specked Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 105, 301, 306, Counselor's Office, and the 1st Floor SW Corridor**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

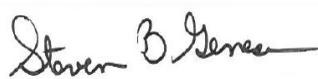

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04D		
MATERIAL DESCRIPTION:	12"x12" Gray Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom		
MATERIAL QUANTITY:	10270	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **04D**

MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile Mastic**

MATERIAL LOCATION: **Gym, Gym Office, Lunchroom, Kitchen, 2nd Floor Engineer's Office, Storeroom, Corridor, Electrician's Room, 103 Washroom & 105 Washroom**

MATERIAL QUANTITY: **10270** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

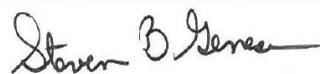

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04E		
MATERIAL DESCRIPTION:	12"x12" Beige w/Brown Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 & Faculty Room**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA:	<b>04E</b>				
MATERIAL DESCRIPTION:	<b>12"x12" Beige w/Brown Streaks Floor Tile Mastic</b>				
MATERIAL LOCATION:	<b>1st Floor Corridor (except SW Vestibule), Library, Computer Lab, Rooms 204, 206, 210 &amp; Faculty Room</b>				
MATERIAL QUANTITY:	<b>2200</b>	MATERIAL UNITS:	<b>SF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>		

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

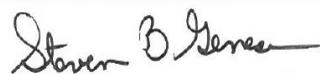

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04F		
MATERIAL DESCRIPTION:	12"x12" Brown Specked Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Two Stage Entries and Patch in Gym		
MATERIAL QUANTITY:	270	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **04F**

MATERIAL DESCRIPTION: **12"x12" Brown Speckled Floor Tile Mastic**

MATERIAL LOCATION: **Two Stage Entries and Patch in Gym**

MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

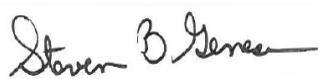

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05A		
MATERIAL DESCRIPTION:	Black Mopboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	No ACBM	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **05A**

MATERIAL DESCRIPTION: **Black Mopboard Mastic**

MATERIAL LOCATION: **1st, 2nd and 3rd Floor Corridors, Rooms 101, 203, 301, 307 and 310 and the Gym**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

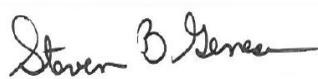

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05B		
MATERIAL DESCRIPTION:	Brown Mopboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	No ACBM	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103, 104, 106, 201, 202, 204, 205-209, 303-306, 308 and 309, Lunch Room, Kitchen, Coach's Office and Storage and Teacher's Lounge		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA:	<b>05B</b>				
MATERIAL DESCRIPTION:	<b>Brown Mopboard Mastic</b>				
MATERIAL LOCATION:	<b>Rooms 103, 104, 106, 201, 202, 204, 205-209, 303-306, 308 and 309, Lunch Room, Kitchen, Coach's Office and Storage and Teacher's Lounge</b>				
MATERIAL QUANTITY:	<b>2000</b>	MATERIAL UNITS:	<b>LF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>LF</b>		

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

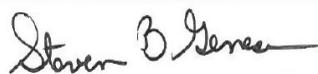

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**

MATERIAL DESCRIPTION: **Blue & Mauve Carpet Mastic NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 103 NOT OBSERVED**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not Observed 2025**

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **07B**

MATERIAL DESCRIPTION: **Blue & Mauve Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 103 NOT OBSERVED**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

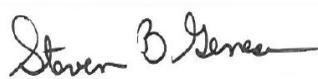

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07C**

MATERIAL DESCRIPTION: **Blue Carpet Mastic NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **FRIABLE**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 303-307 NOT OBSERVED**

MATERIAL QUANTITY:  MATERIAL UNITS:

DAMAGE QUANTITY:  DAMAGE UNITS:

COMMENTS: **Not Observed**

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **07C**

MATERIAL DESCRIPTION: **Blue Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Rooms 303-307 NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

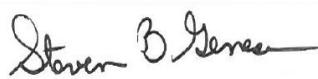

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07D  
MATERIAL DESCRIPTION: Green Carpet Mastic NOT OBSERVED  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 202 (Library), Library Closet and the Teacher's Lounge Closet NOT OBSERVED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **07D**

MATERIAL DESCRIPTION: **Green Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 202 (Library), Library Closet and the Teacher's Lounge Closet NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

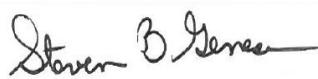

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07E	
MATERIAL DESCRIPTION:	Mauve Carpet Mastic NOT OBSERVED	
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Assumed	FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 204, 206, 208 and 209 NOT OBSERVED**

MATERIAL QUANTITY:  MATERIAL UNITS:

DAMAGE QUANTITY:  DAMAGE UNITS:

COMMENTS: **Not Observed**

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **07E**

MATERIAL DESCRIPTION: **Mauve Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Rooms 204, 206, 208 and 209 NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

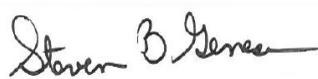

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Wallboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout All Interior Walls**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **Wallboard**

MATERIAL LOCATION: **Throughout All Interior Walls**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

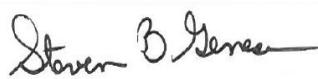

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	Muddled Joints		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Water Meter Room		
MATERIAL QUANTITY:	19	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **Mudded Joints**

MATERIAL LOCATION: **Water Meter Room**

MATERIAL QUANTITY: **19** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

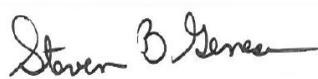

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	2'x4' White Fissured Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	25000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **2'x4' White Fissured Ceiling Tile**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

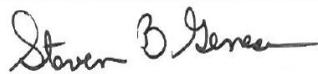

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	100		
MATERIAL DESCRIPTION:	2'x2' Floor Tile White w/Blue Streaks NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 202		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2025		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **100**

MATERIAL DESCRIPTION: **2'x2' Floor Tile White w/Blue Streaks NOT OBSERVED**

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

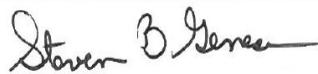

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	100A		
MATERIAL DESCRIPTION:	2'x2' Floor Tile White w/Blue Streaks Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 202		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2025		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **100A**

MATERIAL DESCRIPTION: **2'x2' Floor Tile White w/Blue Streaks Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

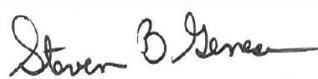

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101		
MATERIAL DESCRIPTION:	12"x12" Floor Tile White w/Brown Streaks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex		
MATERIAL QUANTITY:	9400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed in 206		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **12"x12" Floor Tile White w/Brown Streaks**

MATERIAL LOCATION: **Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex**

MATERIAL QUANTITY: **9400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

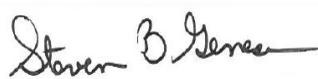

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101A		
MATERIAL DESCRIPTION:	12" x 12" Floor Tile White w/Brown Streaks Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex		
MATERIAL QUANTITY:	9400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed in 206		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **101A**

MATERIAL DESCRIPTION: **12" x 12" Floor Tile White w/Brown Streaks Mastic**

MATERIAL LOCATION: **Rooms 104, 106, 205 - 209, 303, 305, 308 & 309, Main Office & Annex**

MATERIAL QUANTITY: **9400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

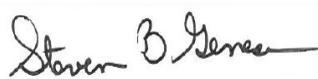

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12"x12" Tan w/Brown Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12"x12" Tan w/Brown Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

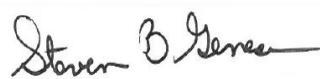

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11M		
MATERIAL DESCRIPTION:	12"x12" Tan w/Brown Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **11M**

MATERIAL DESCRIPTION: **12"x12" Tan w/Brown Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 100, 202 and 302, Teacher's Lounge and 1st Floor Storage**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

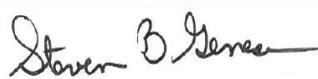

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	12"x12" Off-White w/Multicolor Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 104, 106, 108, 205 & 208		
MATERIAL QUANTITY:	3600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed in 104		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **12"x12" Off-White w/Multicolor Floor Tile**

MATERIAL LOCATION: **Rooms 104, 106, 108, 205 & 208**

MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

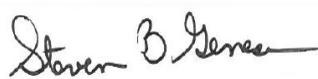

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12M		
MATERIAL DESCRIPTION:	12"x12" Off-White w/Multicolor Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 104, 106, 108, 205 & 208		
MATERIAL QUANTITY:	3600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed in 104		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **12M**

MATERIAL DESCRIPTION: **12"x12" Off-White w/Multicolor Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 104, 106, 108, 205 & 208**

MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

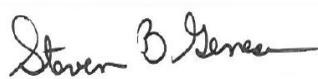

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13	
MATERIAL DESCRIPTION:	12"x12" Off-White w/Beige Streaks Floor Tile NOT OBSERVED	
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Assumed	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 205, 207, 209, 303, 305 and 309

MATERIAL QUANTITY: 4320 MATERIAL UNITS: SF

DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS: Not Observed 2025

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **12"x12" Off-White w/Beige Streaks Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **Rooms 205, 207, 209, 303, 305 and 309**

MATERIAL QUANTITY: **4320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

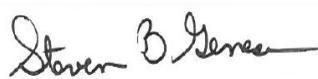

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	AHERA INSPECTOR:	<b>Prins Sales</b>		
SCHOOL NAME:	<b>Green School</b>	INSPECTION DATE:	<b>3/4/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	<b>13M</b>		
MATERIAL DESCRIPTION:	<b>12"x12" Off-White w/Beige Streaks Floor Tile Mastic NOT OBSERVED</b>		
HISTORICAL AHERA DAMAGE CATEGORY	<b>6 ACBM with the potential for damage</b>		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	<b>Follow O&amp;M Plan</b>		
ASBESTOS TYPE:	<b>Assumed</b>	FRIABLE:	

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 205, 207, 209, 303, 305 and 309**

MATERIAL QUANTITY: **4320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS: **Not Observed 2025**

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **13M**

MATERIAL DESCRIPTION: **12"x12" Off-White w/Beige Streaks Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **Rooms 205, 207, 209, 303, 305 and 309**

MATERIAL QUANTITY: **4320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

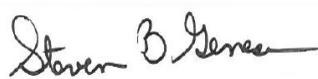

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	Yellow Mosaic Ceramic Tile Grout		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet		
MATERIAL QUANTITY:	2820	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Yellow Mosaic Ceramic Tile Grout**

MATERIAL LOCATION: **All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet**

MATERIAL QUANTITY: **2820** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

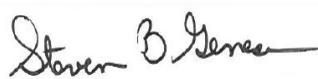

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	Yellow Mosaic Ceramic Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet		
MATERIAL QUANTITY:	2820	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Yellow Mosaic Ceramic Tile Adhesive**

MATERIAL LOCATION: **All Washrooms, Locker Room, All Vestibules and the 1st Floor Janitor's Closet**

MATERIAL QUANTITY: **2820** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

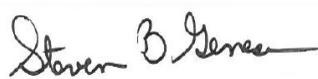

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	Tan w/Yellow and Brown Speckles Terrazzo Flooring		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd and 3rd Floor Stairways		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Tan w/Yellow and Brown Speckles Terrazzo Flooring**

MATERIAL LOCATION: **2nd and 3rd Floor Stairways**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

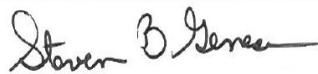

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	2'x2' Smooth Ceiling Tiles		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	25000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **2'x2' Smooth Ceiling Tiles**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

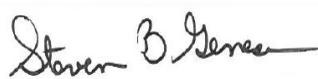

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12x12 Yellow Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105, 203, 205-208, 301, 303, 305-310		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	110 SF per room		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12x12 Yellow Floor Tile**

MATERIAL LOCATION: **Rooms 105, 203, 205-208, 301, 303, 305-310**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

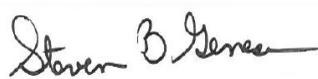

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12x12 Yellow Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105, 203, 205-208, 301, 303, 305-310		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	110 SF per room		

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **12x12 Yellow Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 105, 203, 205-208, 301, 303, 305-310**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:

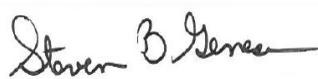

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	Sink Undercoating		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 103-105, 303 & 308		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Sink Undercoating**

MATERIAL LOCATION: **Rooms 101, 103-105, 303 & 308**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

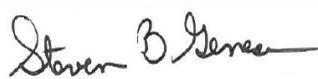

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12x12 Green Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library, Lunchroom & Main Office		
MATERIAL QUANTITY:	320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **12x12 Green Floor Tile**

MATERIAL LOCATION: **Library, Lunchroom & Main Office**

MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:

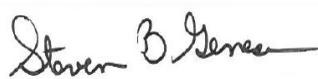

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12x12 Green Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library, Lunchroom & Main Office		
MATERIAL QUANTITY:	320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12x12 Green Floor Tile Mastic**

MATERIAL LOCATION: **Library, Lunchroom & Main Office**

MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:

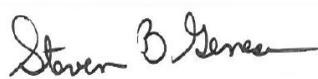

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	12x12 Brown Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12x12 Brown Floor Tile**

MATERIAL LOCATION: **Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

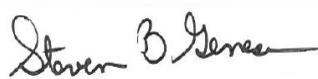

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12x12 Brown Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12x12 Brown Floor Tile Mastic**

MATERIAL LOCATION: **Lunchroom, Kitchen, Kitchen Storage, Kitchen Locker room & Kitchen Washroom**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

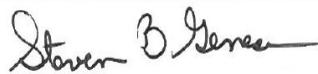

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12x12 Orange Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 103, 104, 106 & 108		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12x12 Orange Floor Tile**

MATERIAL LOCATION: **Rooms 101, 103, 104, 106 & 108**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:

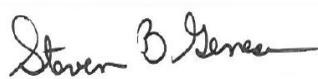

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12x12 Orange Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 103, 104, 106 & 108		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12x12 Orange Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 101, 103, 104, 106 & 108**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature:

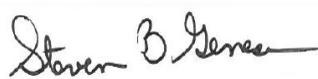

Date: **03/26/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	A	
MATERIAL DESCRIPTION:	Brown Carpet Mastic NOT OBSERVED	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 201

MATERIAL QUANTITY: 460 MATERIAL UNITS: SF

DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUILDING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

---

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Brown Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 201**

MATERIAL QUANTITY: **460** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

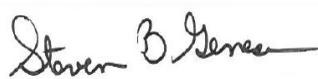

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	NEW		
MATERIAL DESCRIPTION:	Newly Installed Suspect ACM		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
**2025 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

## HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

**MATERIAL LOCATION: Installed After Implementation of Management Plan and After Renovations**

**MATERIAL QUANTITY:**

## MATERIAL UNITS:

DAMAGE QUANTITY: **0**

### DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

## Follow O&M Plan

### Comments:

Management Planner's Signature:

Steven B. Genes

Date: 03/26/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	28M				
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" Beige w/White Specks Floor Tile				
MATERIAL LOCATION:	Kitchen Office				
MATERIAL QUANTITY:	70	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUILDING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **28M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Beige w/White Specks Floor Tile**

MATERIAL LOCATION: **Kitchen Office**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

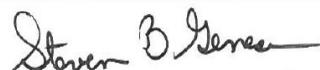

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	31M			
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" Brown Mix Floor Tile			
MATERIAL LOCATION:	Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule			
MATERIAL QUANTITY:	3930	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	No	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	LOW	CONDITION:		
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Within Reach	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
		DAMAGE REASON:		
		DAMAGE UNITS:	SF	
COMMENTS:				

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

HOMOGENEOUS AREA: **31M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Brown Mix Floor Tile**

MATERIAL LOCATION: **Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule**

MATERIAL QUANTITY: **3930** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

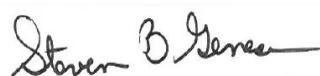

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	2'x2' White Thick Ceiling Tile		
MATERIAL LOCATION:	Kitchen, Kitchen Office, Kitchen Locker room & Kitchen Washroom		
MATERIAL QUANTITY:	1220	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUIDLING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **2'x2' White Thick Ceiling Tile**

MATERIAL LOCATION: **Kitchen, Kitchen Office, Kitchen Locker room & Kitchen Washroom**

MATERIAL QUANTITY: **1220** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

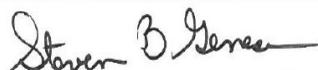

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12"x12" Brown Mix Floor Tile		
MATERIAL LOCATION:	Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule		
MATERIAL QUANTITY:	3930	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24131</b>	BUIDLING ID:	<b>4410</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Steven Geneser</b>		
SCHOOL NAME:	<b>Green School</b>	REVIEW DATE:	<b>3/26/2025</b>		
ADDRESS:	<b>1150 W 96th Street</b>	IDPH LICENSE NO:	<b>100-05730</b>		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12"x12" Brown Mix Floor Tile**

MATERIAL LOCATION: **Room 104, 210, 306, 3rd Floor Office, 317, Front Entry Vestibule, Southwest Vestibule & East Vestibule**

MATERIAL QUANTITY: **3930** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

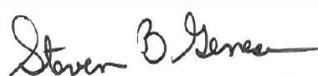

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	29M				
MATERIAL DESCRIPTION:	Adhesive associated w/4" Black Baseboard				
MATERIAL LOCATION:	Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teacher's Lunchroom				
MATERIAL QUANTITY:	1835	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUIDLING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **29M**

MATERIAL DESCRIPTION: **Adhesive associated w/4" Black Baseboard**

MATERIAL LOCATION: **Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teacher's Lunchroom**

MATERIAL QUANTITY: **1835** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

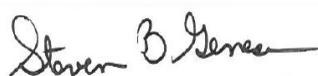

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	12"x12" Tan Mix Floor Tile		
MATERIAL LOCATION:	Room 103		
MATERIAL QUANTITY:	1080	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUIDLING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12"x12" Tan Mix Floor Tile**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **1080** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

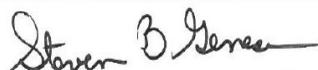

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	4" Black Baseboard		
MATERIAL LOCATION:	Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teachers Lunchroom		
MATERIAL QUANTITY:	1835	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUIDLING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **4" Black Baseboard**

MATERIAL LOCATION: **Half the sides only of kitchen, Kitchen Office, Kitchen Lockers & Lunchroom, Teachers Lunchroom**

MATERIAL QUANTITY: **1835** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

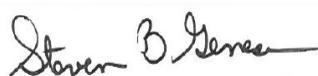

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	12"x12" Beige w/White Specks Floor Tile		
MATERIAL LOCATION:	Kitchen Office		
MATERIAL QUANTITY:	70	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUIDLING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12"x12" Beige w/White Specks Floor Tile**

MATERIAL LOCATION: **Kitchen Office**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

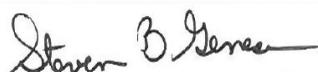

Date: **03/26/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24131	BUIDLING ID:	4410
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Prins Sales		
SCHOOL NAME:	Green School	INSPECTION DATE:	3/4/2025		
ADDRESS:	1150 W 96th Street	IDPH LICENSE NO:	100-05730		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	30M				
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" Tan Mix Floor Tile				
MATERIAL LOCATION:	Room 103				
MATERIAL QUANTITY:	1080	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 03/04/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24131** BUIDLING ID: **4410**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Green School** REVIEW DATE: **3/26/2025**

ADDRESS: **1150 W 96th Street** IDPH LICENSE NO: **100-05730**

HOMOGENEOUS AREA: **30M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Tan Mix Floor Tile**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **1080** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

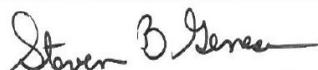


Date: **03/26/2025**

## APPENDIX B

---

### Inspector and Management Planner Licenses

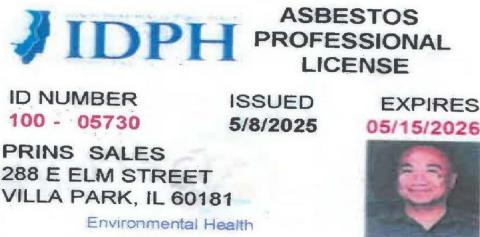**ENDORSEMENTS**

INSPECTOR


**TC EXPIRES**

10/29/2025

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

10/28/2025

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
.. Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

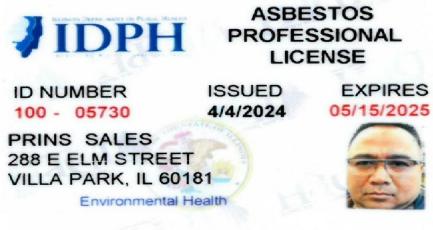

Alteration of this license shall result in legal action  
SUPERVISOR CERTIFICATE EXPIRES  
2/1/2026

This license issued under authority of the State  
of Illinois -Department of Public Health

This license is valid only when accompanied by  
a valid training course certificate

If found return to 525 W Jefferson St Springfield, IL 62761



**EarthTech, Inc.**

211 Gum Hollow Road Unit 1 Oak Ridge TN 37830

## ASBESTOS INSPECTOR REFRESHER

*This Is To Certify That*

# Prins Sales

Has successfully completed the IL and IN approved Asbestos Training Course and passed the examination for the purposes of accreditation under Section 206 of Title II 15 USC 2646 of the Toxic Substances Control Act (TSCA) and IAC

18-2, Conducted by EarthTech, Inc. 630-417-6951

Class Date: 10-29-24

Examination date: 10-29-24

Location: On-Site


Expiration: 10-29-25

Patrick Fosnacht, Instructor

Certificate Number: 110275x77s113



**TEM ENVIRONMENTAL, INC.**  
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS

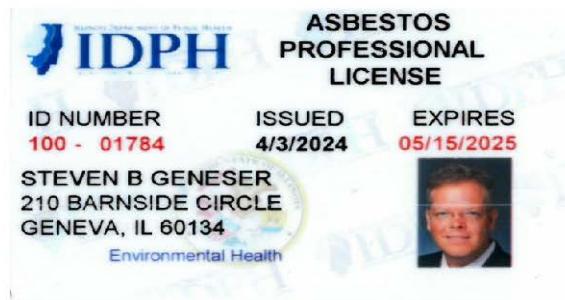

**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR 4/5/2024

MANAGEMENT PLANNER 4/5/2024

PROJECT MANAGER 4/4/2024

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid

training course certificate.



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

STEVEN B GENESER  
210 BARNSIDE CIRCLE  
GENEVA, IL 60134


6/6/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 01784

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

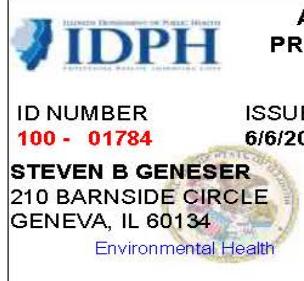

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	5/7/2026
MANAGEMENT PLANNER	5/7/2026
PROJECT MANAGER	5/6/2026
AIR SAMPLING PROFESSIONAL	
<p><b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*

**Reliable  
Environmental  
Solutions, Inc.  R E S**

*This is to certify that*

**Steve Geneser**

*has on 5/7/25, in Springfield, Illinois,  
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

**Asbestos Management Planner Refresher Training**

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)  
and passed the associated examination with a score of 70% or higher*

Course Date: May 7, 2025

**COURSE LENGTH: 4 HOURS**

Examination Date: May 7, 2025

Expiration Date: May 7, 2026

Certificate Number: MPR/0561

*William S. Williams*

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois  217.787.9800  [www.ReliableEnv.com](http://www.ReliableEnv.com)

**Reliable  
Environmental  
Solutions, Inc.      R E S**

*This is to certify that*

**Steve Geneser**

*has on 5/7/25, in Springfield, Illinois,  
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

**Asbestos Building Inspector Refresher Training**

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)  
and passed the associated examination with a score of 70% or higher.*

Course Date: May 7, 2025

**COURSE LENGTH: 4 HOURS**

Examination Date: May 7, 2025

Expiration Date: May 7, 2026

Certificate Number: BIR/1252



Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois  217.787.9800  [www.ReliableEnv.com](http://www.ReliableEnv.com)



*This is to certify that*

**Steve Geneser**

*has on 5/8/24, in Springfield, Illinois,  
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

**Asbestos Management Planner Refresher Training**

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)  
and passed the associated examination with a score of 70% or higher*

Course Date: May 8, 2024

Examination Date: May 8, 2024

Expiration Date: May 8, 2025

Certificate Number: MPR/0531

**COURSE LENGTH: 4 HOURS**

A handwritten signature in black ink that reads "William S. Williams".

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois  217.787.9800  [www.ReliableEnv.com](http://www.ReliableEnv.com)

## APPENDIX C

---

### **Laboratory Accreditations**

## APPENDIX D

---

### Laboratory Results

## APPENDIX E

---

### Chain of Custody Forms

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>	Loc	Localized
	Dist	Distributed