

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2315
SCHOOL NAME: Linne School
ADDRESS OF SCHOOL: 3221 N Sacramento
CITY: Chicago, IL, 60618

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 8/24/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 2/24/2025 ENROLLMENT 679
IDPH INSPECTOR LICENSE NUMBER: 100-07210
IDPH LICENSED INSPECTOR NAME (Please Print): Michael Holvay
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 3/25/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Linne School

3221 N Sacramento
Chicago, IL, 60618

Unit: 24201
Building ID: 4490

IDPH ID Number: 14-016-2990-2315

REPORT DATE:

Tuesday, March 25, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

03/25/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24201 Region: 01 IDPH ID: 14-016-2990-2315

School: Linne School Building ID: 4490

Address: 3221 N Sacramento

Chicago, IL, 60618

Building Contact: Hayden, Andrew Contact Phone: 3125226761

Current Building Owners: Chicago Public Schools

Reinspection Date: 2/24/2025

Review Date: 03/25/2025

Inspector: Michael Holvay

Inspector IDPH License: 100-07210

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 25, 2025

RE: Linne School, Unit 24201
3221 N Sacramento
Chicago, IL, 60618

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Linne School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Linne School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Linne School Unit: 24201 Region: 01
Address: 3221 N Sacramento Chicago, IL, 60618
IDPH ID: 14-016-2990-2315 Building ID: 4490
Contact: Hayden, Andrew Phone: 3125226761

2. Description of Facility

Original Construction: 1904 Additional Construction: 1895,1996
Total Square Footage: 50650 No of Floors: 3
Current Occupancy: 679

3. LEA Designated Person

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Michael Holvay


Michael Holvay
Project Manager

Signature: _____
Date: 2/24/2025

6. Management Planner

Management Planner Name: Jigar Shah

Jayson M. Chal-

Management Planner IDPH license # 100-07342

7. Review Date: 03/25/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: Richard J. Schlegel

Date: 3/25/2025

Name: Richard J Schleifer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Linne School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

- A. The following HAs have changed assessment categories for Building 4490:

B. The following new homogenous areas have been identified for Building 4490:

82A	12"x12" White w/ Specks Floor Tile Mastic
83A	12"x12" Beige w/ Specks Floor Tiles Mastic
84A	12"x12" White, Red, Black w/ Specks Floor tile Mastic
85	Hard Plaster
86	Hard Plaster
87	9"x9" Beige Replacement VFT
87A	9"x9" Beige Replacement VFT Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

06	Green Linoleum
11	Green Linoleum Mastic
12	Rust Color Linoleum Mastic
14	12"x12" Brown w/ Speckles VFT
18	12"x12" Brown w/ Speckles VFT Mastic
22	1'x1' Ceiling Tile Mastic
25	Rust Color Linoleum
26	12"x12" Off White w/ Brown Speckles VFT
28	12"x12" Brown w/ Speckles VFT
29	12"x12" Brown w/ Speckles VFT Mastic
34	12"x12" White w/ Brown Speckles VFT
36	12"x12" White w/ Gray Speckles VFT
37	12"x12" White w/ Gray Speckles VFT Mastic
38	12"x12" White w/ Gray Speckles VFT
39	12"x12" White w/ Gray Speckles VFT Mastic
40	12"x12" White w/ Tan VFT
41	12"x12" White w/ Tan VFT Mastic
42	12"x12" White w/ Grey Streaks VFT
43	12"x12" White w/ Grey Streaks VFT Mastic
44	12"x12" Black w/ White Streaks VFT
45	12"x12" Black w/ White Streaks VFT Mastic
46	12"x12" Sand VFT
47	12"x12" Sand VFT Mastic
48	12"x12" Red VFT
49	12"x12" Red VFT Mastic
50	12"x12" Blue VFT
51	12"x12" Blue VFT Mastic
52	Textured Blue Linoleum
53	Textured Blue Linoleum Mastic
54	Red Linoleum
55	Red Linoleum Mastic
56	Beige Linoleum
57	Beige Linoleum Mastic
58	Blue Linoleum
59	Blue Linoleum Mastic
60	2'x2' Dot Ceiling Tile
61	2'x2' Smooth Ceiling Tile
62	Vinyl Baseboard
63	Vinyl Baseboard Mastic
64	Drywall
65	Drywall Compound
66	Spray-On Fireproofing Insulation

67	Carpet Mastic
68	12"x12" with Grey Streaks VFT
68 A	12"x12" White with Grey Streaks VFT (MASTIC)
69	12"x12" Red VFT - 1903 bldg.
69 A	12"x12" Red VFT & (MASTIC) - 1903 bldg.
70	12"x12" Black with White Streaks VFT
70 A	12"x12" Black with White Streaks VFT (MASTIC)
71	2'x2' Dot Ceiling Tile - bldg. 1903
72	Canvas Wall Cover
74	Incinerator Gasket
75	Decorative Plaster Trim
76	Insulation Lining
77	Fire Doors
78	2'x4' Ceiling Tile with Grooves
79	12"x12" Gray Speckled VFT
79A	12"x12" Gray Speckled VFT Mastic
80	12"x12" Light Beige w/ Off-White & Tan Speckles VFT
80A	12"x12" Light Beige w/ Off-White & Tan Speckles VFT Mastic
81	Carpet mastic
82	12"x12" White w/ Specks Floor Tile
82A	12"x12" White w/ Specks Floor Tile Mastic
83	12"x12" Beige w/ Specks Floor Tiles
83A	12"x12" Beige w/ Specks Floor Tiles Mastic
84	12"x12" White, Red, Black w/ Specks Floor Tile
84A	12"x12" White, Red, Black w/ Specks Floor tile Mastic
85	Hard Plaster
86	Hard Plaster
87	9"x9" Beige Replacement VFT
87A	9"x9" Beige Replacement VFT Mastic
T	Canvas Wall Cover
U	2'x4' Off White/Smooth Ceiling Tile

The following areas were deemed to be inaccessible:

22	1'x1' Ceiling Tile Mastic
66	Spray-On Fireproofing Insulation
78	2'x4' Ceiling Tile with Grooves
87A	9"x9" Beige Replacement VFT Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Holvay, IDPH License # 100-07210. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Linne School Building 4490 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
05	1'x1' Ceiling Tile			4th Floor Stage and Assembly Hall - 1903	NO_ACBM	MISC								
06	Green Linoleum	1,000	SF	Room 212 - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
11	Green Linoleum Mastic	1,000	SF	Room 212 and wardrobe - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Rust Color Linoleum Mastic	2,000	SF	4th Floor Auditorium - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	12"x12" Brown w/ White Speckles VFT	500	SF	1st Floor Kitchen 1895 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
14	12"x12" Brown w/ Speckles VFT	600	SF	4th Floor Stage - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
15	9"x9" Dark Brown w/ White & Red Streaks VFT	300	SF	2nd Floor Corridor Border - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
16	9"x9" Gray w/ White Streaks VFT	600	SF	Room 103 Storage - 1903 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
17	12"x12" Brown w/ White Speckles VFT Mastic	500	SF	1st Floor Kitchen - 1895 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12"x12" Brown w/ Speckles VFT Mastic	600	SF	4th Floor Stage - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic	300	SF	2nd Floor Corridor Border - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	9"x9" Gray w/ White Streaks VFT Mastic	600	SF	Room 103 storage - 1903 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Drywall Joint Compound			Throughout 1903	NO_ACBM									
21A	Drywall			Throughout 1903	NO_ACBM									
22	1'x1' Ceiling Tile Mastic	2,300	SF	4th Floor Stage and Assembly Hall - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Rust Color Linoleum	2,000	SF	4th Floor Auditorium - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
26	12"x12" Off White w/ Brown Speckles VFT	500	SF	1st Floor Kitchen-1895 (Basement)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
27	12"x12" Off White w/ Brown Speckles VFT Mastic	500	SF	1st Floor Kitchen-1895 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	12"x12" Brown w/ Speckles VFT	1,000	SF	Room 211 and Wardrobe - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
29	12"x12" Brown w/ Speckles VFT Mastic	1,000	SF	Room 211 and Wardrobe - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	9"x9" Tan w/ White & Brown Streaks VFT	2,000	SF	2nd Floor Corridors & Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
31	9"x9" Tan w/ White & Brown Streaks VFT Mastic	2,000	SF	2nd Floor Corridors & Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
32	9"x9" Brown w/ White & Dark Brown Speckles VFT	400	SF	Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
33	9"x9" Brown w/ White & Dark Brown Speckles VFT Mastic	400	SF	Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12"x12" White w/ Brown Speckles VFT	64	SF	Room 212 Toilet - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
35	12"x12" White w/ Brown Speckles VFT Mastic	64	SF	Room 212 Toilet - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12"x12" White w/ Gray Speckles VFT	600	SF	Teachers Faculty Room - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
37	12"x12" White w/ Gray Speckles VFT Mastic	600	SF	Teachers Faculty Room - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12"x12" White w/ Gray Speckles VFT	800	SF	Engineer's Hall, Engineer's Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
39	12"x12" White w/ Gray Speckles VFT Mastic	800	SF	Engineer's Hall, Engineer's Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12"x12" White w/ Tan VFT	1,600	SF	Room 205, 207 and Principal's Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
41	12"x12" White w/ Tan VFT Mastic	1,600	SF	Room 205, 207 and Principal's Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12"x12" White w/ Grey Streaks VFT	3,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
43	12"x12" White w/ Grey Streaks VFT Mastic	3,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12"x12" Black w/ White Streaks VFT	100	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
45	12"x12" Black w/ White Streaks VFT Mastic	100	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12"x12" Sand VFT	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
47	12"x12" Sand VFT Mastic	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	12"x12" Red VFT	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
49	12"x12" Red VFT Mastic	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	12"x12" Blue VFT	1,200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
51	12"x12" Blue VFT Mastic	1,200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
52	Textured Blue Linoleum	400	SF	Stairwells, & Breezeway - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
53	Textured Blue Linoleum Mastic	400	SF	Stairwells, & Breezeway - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	Red Linoleum	100	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
55	Red Linoleum Mastic	100	SF	Gym - 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Beige Linoleum	500	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
57	Beige Linoleum Mastic	500	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	Blue Linoleum	200	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
59	Blue Linoleum Mastic	200	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	2'x2' Dot Ceiling Tile	5,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
61	2'x2' Smooth Ceiling Tile	1,000	SF	Kitchen & Lunch Area - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
62	Vinyl Baseboard	1,200	LF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Vinyl Baseboard Mastic	1,200	LF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	Drywall	10,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
65	Drywall Compound	2,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
66	Spray-On Fireproofing Insulation	10,000	SF	Throughout Above Ceilings on Beams - 1997 Addition	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
67	Carpet Mastic	2,000	SF	Main Office Area, Library - 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	12"x12" with Grey Streaks VFT	800	SF	1st, 2nd and 3rd Floor Hall connecting old Building with annex 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
68 A	12"x12" White with Grey Streaks VFT (MASTIC)	800	SF	1st, 2nd and 3rd Floor Hall connecting old	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building with annex 1997										
69	12"x12" Red VFT - 1903 bldg.	24	SF	1st and 2nd Floor Hall connecting old Building with Annex 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
69 A	12"x12" Red VFT & (MASTIC) - 1903 bldg.	24	SF	1st and 2nd Floor Hall connecting old bldg. with Annex 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70	12"x12" Black with White Streaks VFT	6	SF	1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
70 A	12"x12" Black with White Streaks VFT (MASTIC)	6	SF	1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	2'x2' Dot Ceiling Tile - bldg. 1903	400	SF	1st and 2nd Floor Hall connecting old bldg. with Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
72	Canvas Wall Cover	280	SF	Room 212 above wainscot - picture rail back stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	Insulation (NOT USED)			Boiler Breaching and Incinerator Breaching		TSI								
74	Incinerator Gasket	8	LF	Incinerator- between burner and incinerator housing	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
75	Decorative Plaster Trim	1,500	SF	Auditorium and Stage	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
76	Insulation Lining	4	SF	side of incinerator	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
77	Fire Doors	3	EA	Auditorium east exit, 2nd Floor Faculty Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
78	2'x4' Ceiling Tile with Grooves	4,800	SF	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's Office - 1903	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
79	12"x12" Gray Speckled VFT	300	SF	Engineer's Office - 1903 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
79A	12"x12" Gray Speckled VFT Mastic	300	SF	Engineer's Office - 1903 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
80	12"x12" Light Beige w/ Off-White & Tan Speckles VFT	690	SF	3rd Floor Corridor - 1895 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
80A	12"x12" Light Beige w/ Off-White & Tan Speckles VFT Mastic	690	SF	3rd Floor Corridor - 1895 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
81	Carpet mastic	600	SF	Principals office & associated room - 1903 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
82	12"x12" White w/ Specks Floor Tile	750	SF	Room 207	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
82A	12"x12" White w/ Specks Floor Tile Mastic	750	SF	Room 207	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
83	12"x12" Beige w/ Specks Floor Tiles	1,200	SF	3rd Floor South Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
83A	12"x12" Beige w/ Specks Floor Tiles Mastic	1,200	SF	3rd Floor South Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
84	12"x12" White, Red, Black w/ Specks Floor Tile	400	SF	3rd Floor Elevator Vestibule	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
84A	12"x12" White, Red, Black w/ Specks Floor tile Mastic	400	SF	3rd Floor Elevator Vestibule	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
85	Hard Plaster	50,000	SF	Throughout 1895 Building	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
86	Hard Plaster	75,000	SF	Throughout 1903 Addition	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
87	9"x9" Beige Replacement VFT	35	SF	2nd Floor Corridor - 1895 Building	ASSUMED	MISC	N	DIST	15		No	ACBM with the potential for damage	3	MODERATE
87A	9"x9" Beige Replacement VFT Mastic	35	SF	2nd Floor Corridor - 1895 Building	ASSUMED	MISC	N	DIST	15		No	ACBM with the potential for damage	3	MODERATE
G	Mag Block Pipe Insulation	30	LF	South Cold Deck, South Hall Outside Cold Deck - 1903	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
H	MJP E/F/V on Mag Block Pipe Insulation	7	FITTING	South Cold Deck, South Hall Outside Cold Deck - 1903	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
M	MJP E/F/V on Fiberglass Pipe Insulation	36	FITTING	Electrical Room, Engineer's Storage, Engineer's Toilet, Boys Basement Toilet Sprinkler Room & Hall, S. Stair - 1903	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Linne School Unit 24201 Building ID 4490
Address 3221 N Sacramento Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>2/24/2025</u>
Inspector Name <u>Michael Holvay</u>
<u>100-07210</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
05	
06	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
21A	
22	
25	
26	
27	
28	
29	
30	
31	
32	
33	

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
63	
64	
65	
66	
67	
68	
68 A	
69	
69 A	
70	
70 A	
71	
72	
73	
74	
75	
76	
77	
78	
79	
79A	
80	
80A	
81	
82	Previous 3-year has tile & mastic for HA 82, this will now be just HA 82 for the tile, and HA 82A will be this tiles mastic.
82A	Separate HA for the mastic in HA 82 tile
83	Previous 3-year has tile & mastic for HA 83, this will now be just HA 83 for the tile, and HA 83A will be this tiles mastic.

Chicago Public Schools

School Linne School **Unit** 24201 **Building ID** 4490
Address 3221 N Sacramento **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
83A	Separate HA for the mastic in HA82 tile
84	Previous 3-year has tile & mastic for HA 84, this will now be just HA 84 for the tile, and HA 84A will be this tiles mastic.
84A	
85	
86	Good Condition
87	Material Needs Testing & Repair/Replace
87A	Material Needs Testing & Repair/Replacement
G	
H	
M	
O	
Q	
R	
S	
T	
U	
V	
W	
X	

Table II
Management Planner's Review

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
05	1'x1' Ceiling Tile			4th Floor Stage and Assembly Hall - 1903	No ACBM	MISC					
06	Green Linoleum	1,000	SF	Room 212 - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Green Linoleum Mastic	1,000	SF	Room 212 and wardrobe - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Rust Color Linoleum Mastic	2,000	SF	4th Floor Auditorium - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12"x12" Brown w/ White Speckles VFT	500	SF	1st Floor Kitchen 1895 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" Brown w/ Speckles VFT	600	SF	4th Floor Stage - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	9"x9" Dark Brown w/ White & Red Streaks VFT	300	SF	2nd Floor Corridor Border - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9"x9" Gray w/ White Streaks VFT	600	SF	Room 103 Storage - 1903 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Brown w/ White Speckles VFT Mastic	500	SF	1st Floor Kitchen - 1895 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Brown w/ Speckles VFT Mastic	600	SF	4th Floor Stage - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic	300	SF	2nd Floor Corridor Border - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	9"x9" Gray w/ White Streaks VFT Mastic	600	SF	Room 103 storage - 1903 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Drywall Joint Compound			Throughout 1903	No ACBM						
21A	Drywall			Throughout 1903	No ACBM						
22	1'x1' Ceiling Tile Mastic	2,300	SF	4th Floor Stage and Assembly Hall - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Rust Color Linoleum	2,000	SF	4th Floor Auditorium - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Off White w/ Brown Speckles VFT	500	SF	1st Floor Kitchen- 1895 (Basement)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" Off White w/ Brown Speckles VFT Mastic	500	SF	1st Floor Kitchen- 1895 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" Brown w/ Speckles VFT	1,000	SF	Room 211 and Wardrobe - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12"x12" Brown w/ Speckles VFT Mastic	1,000	SF	Room 211 and Wardrobe - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	9"x9" Tan w/ White & Brown Streaks VFT	2,000	SF	2nd Floor Corridors & Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	9"x9" Tan w/ White & Brown Streaks VFT Mastic	2,000	SF	2nd Floor Corridors & Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	9"x9" Brown w/ White & Dark Brown Speckles VFT	400	SF	Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	9"x9" Brown w/ White & Dark Brown Speckles VFT Mastic	400	SF	Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" White w/ Brown Speckles VFT	64	SF	Room 212 Toilet - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12"x12" White w/ Brown Speckles VFT Mastic	64	SF	Room 212 Toilet - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12"x12" White w/ Gray Speckles VFT	600	SF	Teachers Faculty Room - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12"x12" White w/ Gray Speckles VFT Mastic	600	SF	Teachers Faculty Room - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" White w/ Gray Speckles VFT	800	SF	Engineer's Hall, Engineer's Restroom - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12"x12" White w/ Gray Speckles VFT Mastic	800	SF	Engineer's Hall, Engineer's Restroom -	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				1903							
40	12"x12" White w/ Tan VFT	1,600	SF	Room 205, 207 and Principal's Restroom - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12"x12" White w/ Tan VFT Mastic	1,600	SF	Room 205, 207 and Principal's Restroom - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12"x12" White w/ Grey Streaks VFT	3,000	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12"x12" White w/ Grey Streaks VFT Mastic	3,000	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12"x12" Black w/ White Streaks VFT	100	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12"x12" Black w/ White Streaks VFT Mastic	100	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12"x12" Sand VFT	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12"x12" Sand VFT Mastic	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	12"x12" Red VFT	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12"x12" Red VFT Mastic	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12"x12" Blue VFT	1,200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12"x12" Blue VFT Mastic	1,200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Textured Blue Linoleum	400	SF	Stairwells, & Breezeway - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Textured Blue Linoleum Mastic	400	SF	Stairwells, & Breezeway - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Red Linoleum	100	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	Red Linoleum Mastic	100	SF	Gym - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	Beige Linoleum	500	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Beige Linoleum Mastic	500	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	Blue Linoleum	200	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Blue Linoleum Mastic	200	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	2'x2' Dot Ceiling Tile	5,000	SF	Throughout - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	2'x2' Smooth Ceiling Tile	1,000	SF	Kitchen & Lunch Area - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	Vinyl Baseboard	1,200	LF	Throughout - 1997 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
63	Vinyl Baseboard Mastic	1,200	LF	Throughout - 1997 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
64	Drywall	10,000	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	Drywall Compound	2,000	SF	Throughout - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	Spray-On Fireproofing Insulation	10,000	SF	Throughout Above Ceilings on Beams - 1997 Addition	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Carpet Mastic	2,000	SF	Main Office Area, Library - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	12"x12" with Grey Streaks VFT	800	SF	1st, 2nd and 3rd Floor Hall connecting	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				old Building with annex 1997							
68 A	12"x12" White with Grey Streaks VFT (MASTIC)	800	SF	1st, 2nd and 3rd Floor Hall connecting old Building with annex 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	12"x12" Red VFT - 1903 bldg.	24	SF	1st and 2nd Floor Hall connecting old Building with Annex 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69 A	12"x12" Red VFT & (MASTIC) - 1903 bldg.	24	SF	1st and 2nd Floor Hall connecting old bldg. with Annex 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	12"x12" Black with White Streaks VFT	6	SF	1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70 A	12"x12" Black with White Streaks VFT (MASTIC)	6	SF	1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	2'x2' Dot Ceiling Tile - bldg. 1903	400	SF	1st and 2nd Floor Hall connecting old bldg. with Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	Canvas Wall Cover	280	SF	Room 212 above wainscot - picture rail back stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	Insulation (NOT USED)			Boiler Breaching and Incinerator Breaching		TSI					
74	Incinerator Gasket	8	LF	Incinerator- between burner and incinerator housing	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
75	Decorative Plaster Trim	1,500	SF	Auditorium and Stage	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	Insulation Lining	4	SF	side of incinerator	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	Fire Doors	3	EA	Auditorium east exit, 2nd Floor Faculty Restroom	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
78	2'x4' Ceiling Tile with Grooves	4,800	SF	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's Office - 1903	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	12"x12" Gray Speckled VFT	300	SF	Engineer's Office - 1903 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79A	12"x12" Gray Speckled VFT Mastic	300	SF	Engineer's Office - 1903 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
80	12"x12" Light Beige w/ Off-White & Tan Speckles VFT	690	SF	3rd Floor Corridor - 1895 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
80A	12"x12" Light Beige w/ Off-White & Tan Speckles VFT Mastic	690	SF	3rd Floor Corridor - 1895 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81	Carpet mastic	600	SF	Principals office & associated room - 1903 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82	12"x12" White w/ Specks Floor Tile	750	SF	Room 207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
82A	12"x12" White w/ Specks Floor Tile Mastic	750	SF	Room 207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
83	12"x12" Beige w/ Specks Floor Tiles	1,200	SF	3rd Floor South Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
83A	12"x12" Beige w/ Specks Floor Tiles Mastic	1,200	SF	3rd Floor South Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
84	12"x12" White, Red, Black w/ Specks Floor Tile	400	SF	3rd Floor Elevator Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
84A	12"x12" White, Red, Black w/ Specks Floor tile Mastic	400	SF	3rd Floor Elevator Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
85	Hard Plaster	50,000	SF	Throughout 1895 Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
86	Hard Plaster	75,000	SF	Throughout 1903 Addition	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
87	9"x9" Beige Replacement VFT	35	SF	2nd Floor Corridor - 1895 Building	Assumed	MISC	No	15	SF	6 ACBM with the potential for damage	Follow O&M Plan
87A	9"x9" Beige Replacement VFT Mastic	35	SF	2nd Floor Corridor - 1895 Building	Assumed	MISC	No	15	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Mag Block Pipe Insulation	30	LF	South Cold Deck, South Hall Outside Cold Deck - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	MJP E/F/V on Mag Block Pipe Insulation	7	FITTING	South Cold Deck, South Hall Outside Cold Deck - 1903	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
M	MJP E/F/V on Fiberglass Pipe Insulation	36	FITTING	Electrical Room, Engineer's Storage, Engineer's Toilet, Boys Basement Toilet Sprinkler Room & Hall, S. Stair - 1903	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
O	Cardboard Pipe Insulation	73	LF	North Basement (Encapsulated), Electrical Room, Engineer Office - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
Q	MJP E/F/V on Cardboard Pipe Insulation	6	FITTING	North Basement (Encapsulated), Engineer Office - 1903	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
R	2'x4' Off White/Smooth Ceiling Tile			S. Basement, S. Corridor, S. Caged (Kitchen) Area - 1895	No ACBM	MISC					
S	2'x4' White Textured Ceiling Tile			Teachers Faculty Room, S. Basement - 1895	No ACBM	MISC					
T	Canvas Wall Cover	50	SF	Room 311 - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
U	2'x4' Off White/Smooth Ceiling Tile	1,100	SF	North Basement Dance Area - 1903	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
V	2'x4' White Textured Ceiling Tile			Engine/Tank Room, 3rd Floor Boys & Girls Toilets, 4th Floor Stairwells, 3rd Floor Classrooms, Storage Rm behind Stage - 1903	No ACBM						
W	Tank Insulation			Tank/Engine Room - 1903	No ACBM						
X	Canvas Wall Cover (Abated)			2nd Floor Corridor - 1903	Abated	MISC					

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	3/25/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
05	
06	
11	
12	
13	
14	
15	

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
16	
17	
18	
19	
20	
21	
21A	
22	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
68 A	
69	

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
69 A	
70	
70 A	
71	
72	
73	
74	
75	
76	
77	
78	
79	
79A	
80	
80A	
81	
82	
82A	
83	
83A	
84	
84A	
85	
86	
87	
87A	
G	

Chicago Public Schools

School Linne School

Unit 24201

Building ID 4490

Address 3221 N Sacramento

Chicago, IL, 60618

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
H	
M	
O	
Q	
R	
S	
T	
U	
V	
W	
X	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 05

MATERIAL DESCRIPTION: 1'x1' Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 4th Floor Stage and Assembly Hall - 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**

MATERIAL LOCATION: **4th Floor Stage and Assembly Hall - 1903**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	Green Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 212 - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Green Linoleum**

MATERIAL LOCATION: **Room 212 - 1895**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Green Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212 and wardrobe - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **Green Linoleum Mastic**

MATERIAL LOCATION: **Room 212 and wardrobe - 1895**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Rust Color Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor Auditorium - 1903		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Rust Color Linoleum Mastic**

MATERIAL LOCATION: **4th Floor Auditorium - 1903**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor Kitchen 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Speckles VFT**

MATERIAL LOCATION: **1st Floor Kitchen 1895 (Basement)**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

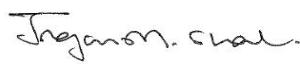

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	4th Floor Stage - 1903		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 14

MATERIAL DESCRIPTION: 12"x12" Brown w/ Speckles VFT

MATERIAL LOCATION: 4th Floor Stage - 1903

MATERIAL QUANTITY: 600 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	9"x9" Dark Brown w/ White & Red Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	2nd Floor Corridor Border - 1895		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **9"x9" Dark Brown w/ White & Red Streaks VFT**

MATERIAL LOCATION: **2nd Floor Corridor Border - 1895**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

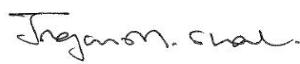

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 103 Storage - 1903 (Basement)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

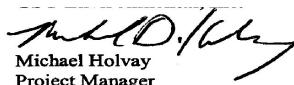
Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **9"x9" Gray w/ White Streaks VFT**

MATERIAL LOCATION: **Room 103 Storage - 1903 (Basement)**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Kitchen - 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Speckles VFT Mastic**

MATERIAL LOCATION: **1st Floor Kitchen - 1895 (Basement)**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor Stage - 1903		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12"x12" Brown w/ Speckles VFT Mastic**

MATERIAL LOCATION: **4th Floor Stage - 1903**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

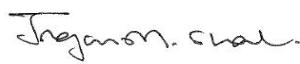

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Corridor Border - 1895		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **9"x9" Dark Brown w/ White & Red Streaks VFT Mastic**

MATERIAL LOCATION: **2nd Floor Corridor Border - 1895**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 103 storage - 1903 (Basement)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **9"x9" Gray w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 103 storage - 1903 (Basement)**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21	
MATERIAL DESCRIPTION:	Drywall Joint Compound	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout 1903**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Michael Holvay
Project Manager

Date: **02/24/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Drywall Joint Compound**

MATERIAL LOCATION: **Throughout 1903**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 21A
MATERIAL DESCRIPTION: Drywall
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **21A**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Throughout 1903**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor Stage and Assembly Hall - 1903		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Mastic**

MATERIAL LOCATION: **4th Floor Stage and Assembly Hall - 1903**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	Rust Color Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	4th Floor Auditorium - 1903		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 25

MATERIAL DESCRIPTION: Rust Color Linoleum

MATERIAL LOCATION: 4th Floor Auditorium - 1903

MATERIAL QUANTITY: 2000 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor Kitchen- 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

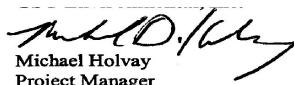
Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Brown Speckles VFT**

MATERIAL LOCATION: **1st Floor Kitchen- 1895 (Basement)**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

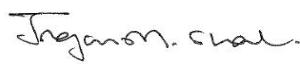

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Brown Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Kitchen- 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Brown Speckles VFT Mastic**

MATERIAL LOCATION: **1st Floor Kitchen- 1895 (Basement)**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 211 and Wardrobe - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12"x12" Brown w/ Speckles VFT**

MATERIAL LOCATION: **Room 211 and Wardrobe - 1895**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 211 and Wardrobe - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

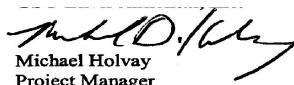
Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **12"x12" Brown w/ Speckles VFT Mastic**

MATERIAL LOCATION: **Room 211 and Wardrobe - 1895**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	9"x9" Tan w/ White & Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	2nd Floor Corridors & Room 311 - 1895		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **9"x9" Tan w/ White & Brown Streaks VFT**

MATERIAL LOCATION: **2nd Floor Corridors & Room 311 - 1895**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	9"x9" Tan w/ White & Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Corridors & Room 311 - 1895		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 31

MATERIAL DESCRIPTION: 9"x9" Tan w/ White & Brown Streaks VFT Mastic

MATERIAL LOCATION: 2nd Floor Corridors & Room 311 - 1895

MATERIAL QUANTITY: 2000 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Dark Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 311 - 1895		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White & Dark Brown Speckles VFT**

MATERIAL LOCATION: **Room 311 - 1895**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Dark Brown Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 311 - 1895		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 33

MATERIAL DESCRIPTION: 9"x9" Brown w/ White & Dark Brown Speckles VFT Mastic

MATERIAL LOCATION: Room 311 - 1895

MATERIAL QUANTITY: 400 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 212 Toilet - 1895		
MATERIAL QUANTITY:	64	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **12"x12" White w/ Brown Speckles VFT**

MATERIAL LOCATION: **Room 212 Toilet - 1895**

MATERIAL QUANTITY: **64** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212 Toilet - 1895		
MATERIAL QUANTITY:	64	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12"x12" White w/ Brown Speckles VFT Mastic**

MATERIAL LOCATION: **Room 212 Toilet - 1895**

MATERIAL QUANTITY: **64** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Teachers Faculty Room - 1895		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12"x12" White w/ Gray Speckles VFT**

MATERIAL LOCATION: **Teachers Faculty Room - 1895**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teachers Faculty Room - 1895		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12"x12" White w/ Gray Speckles VFT Mastic**

MATERIAL LOCATION: **Teachers Faculty Room - 1895**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Engineer's Hall, Engineer's Restroom - 1903		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **12"x12" White w/ Gray Speckles VFT**

MATERIAL LOCATION: **Engineer's Hall, Engineer's Restroom - 1903**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer's Hall, Engineer's Restroom - 1903		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **12"x12" White w/ Gray Speckles VFT Mastic**

MATERIAL LOCATION: **Engineer's Hall, Engineer's Restroom - 1903**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 205, 207 and Principal's Restroom - 1903		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan VFT**

MATERIAL LOCATION: **Room 205, 207 and Principal's Restroom - 1903**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

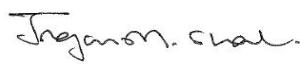

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 205, 207 and Principal's Restroom - 1903		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 41

MATERIAL DESCRIPTION: 12"x12" White w/ Tan VFT Mastic

MATERIAL LOCATION: Room 205, 207 and Principal's Restroom - 1903

MATERIAL QUANTITY: 1600 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **12"x12" White w/ Grey Streaks VFT**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

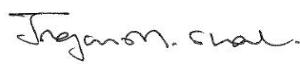

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **12"x12" White w/ Grey Streaks VFT Mastic**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	12"x12" Black w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 44

MATERIAL DESCRIPTION: 12"x12" Black w/ White Streaks VFT

MATERIAL LOCATION: Throughout - 1997 Addition

MATERIAL QUANTITY: 100 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

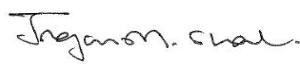

Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12"x12" Black w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **12"x12" Black w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Sand VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12"x12" Sand VFT**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	12"x12" Sand VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12"x12" Sand VFT Mastic**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

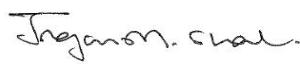

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	12"x12" Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **12"x12" Red VFT**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12"x12" Red VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **12"x12" Red VFT Mastic**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **12"x12" Blue VFT**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12"x12" Blue VFT Mastic**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	Textured Blue Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Stairwells, & Breezeway - 1997 Addition		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **Textured Blue Linoleum**

MATERIAL LOCATION: **Stairwells, & Breezeway - 1997 Addition**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	Textured Blue Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairwells, & Breezeway - 1997 Addition		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **Textured Blue Linoleum Mastic**

MATERIAL LOCATION: **Stairwells, & Breezeway - 1997 Addition**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	Red Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **Red Linoleum**

MATERIAL LOCATION: **Gym - 1997 Addition**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	Red Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1997		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **Red Linoleum Mastic**

MATERIAL LOCATION: **Gym - 1997**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	Beige Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **Beige Linoleum**

MATERIAL LOCATION: **Gym - 1997 Addition**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

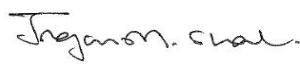

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	Beige Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **Beige Linoleum Mastic**

MATERIAL LOCATION: **Gym - 1997 Addition**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	Blue Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **Blue Linoleum**

MATERIAL LOCATION: **Gym - 1997 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

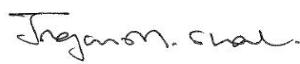

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	Blue Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **Blue Linoleum Mastic**

MATERIAL LOCATION: **Gym - 1997 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	2'x2' Dot Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **2'x2' Dot Ceiling Tile**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	2'x2' Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen & Lunch Area - 1997 Addition		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **2'x2' Smooth Ceiling Tile**

MATERIAL LOCATION: **Kitchen & Lunch Area - 1997 Addition**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **Vinyl Baseboard**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

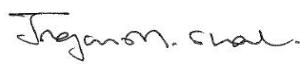

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	65		
MATERIAL DESCRIPTION:	Drywall Compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **Drywall Compound**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	66		
MATERIAL DESCRIPTION:	Spray-On Fireproofing Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Above Ceilings on Beams - 1997 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **Spray-On Fireproofing Insulation**

MATERIAL LOCATION: **Throughout Above Ceilings on Beams - 1997 Addition**

MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office Area, Library - 1997		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Main Office Area, Library - 1997**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	12"x12" with Grey Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd and 3rd Floor Hall connecting old Building with annex 1997		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **12"x12" with Grey Streaks VFT**

MATERIAL LOCATION: **1st, 2nd and 3rd Floor Hall connecting old Building with annex 1997**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68 A		
MATERIAL DESCRIPTION:	12"x12" White with Grey Streaks VFT (MASTIC)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd and 3rd Floor Hall connecting old Building with annex 1997		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **68 A**

MATERIAL DESCRIPTION: **12"x12" White with Grey Streaks VFT (MASTIC)**

MATERIAL LOCATION: **1st, 2nd and 3rd Floor Hall connecting old Building with annex 1997**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

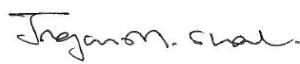

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69		
MATERIAL DESCRIPTION:	12"x12" Red VFT - 1903 bldg.		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st and 2nd Floor Hall connecting old Building with Annex 1997		
MATERIAL QUANTITY:	24	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **69**

MATERIAL DESCRIPTION: **12"x12" Red VFT - 1903 bldg.**

MATERIAL LOCATION: **1st and 2nd Floor Hall connecting old Building with Annex 1997**

MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69 A		
MATERIAL DESCRIPTION:	12"x12" Red VFT & (MASTIC) - 1903 bldg.		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd Floor Hall connecting old bldg. with Annex 1997		
MATERIAL QUANTITY:	24	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **69 A**

MATERIAL DESCRIPTION: **12"x12" Red VFT & (MASTIC) - 1903 bldg.**

MATERIAL LOCATION: **1st and 2nd Floor Hall connecting old bldg. with Annex 1997**

MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70		
MATERIAL DESCRIPTION:	12"x12" Black with White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **12"x12" Black with White Streaks VFT**

MATERIAL LOCATION: **1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

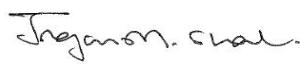

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70 A		
MATERIAL DESCRIPTION:	12"x12" Black with White Streaks VFT (MASTIC)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **70 A**

MATERIAL DESCRIPTION: **12"x12" Black with White Streaks VFT (MASTIC)**

MATERIAL LOCATION: **1st and 2nd Floor Hall connecting old bldg. with Annex 1903 bldg.**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	2'x2' Dot Ceiling Tile - bldg. 1903		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd Floor Hall connecting old bldg. with Annex		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **2'x2' Dot Ceiling Tile - bldg. 1903**

MATERIAL LOCATION: **1st and 2nd Floor Hall connecting old bldg. with Annex**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

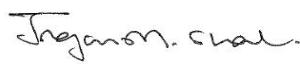

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	72		
MATERIAL DESCRIPTION:	Canvas Wall Cover		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW	MATERIAL UNITS:	SF
MATERIAL LOCATION:	Room 212 above wainscot - picture rail back stage	DAMAGE UNITS:	SF
MATERIAL QUANTITY:	280	COMMENTS:	
DAMAGE QUANTITY:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **72**

MATERIAL DESCRIPTION: **Canvas Wall Cover**

MATERIAL LOCATION: **Room 212
above wainscot - picture rail
back stage**

MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 73
MATERIAL DESCRIPTION: Insulation (NOT USED)
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Boiler Breaching and Incinerator Breaching

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **73**

MATERIAL DESCRIPTION: **Insulation (NOT USED)**

MATERIAL LOCATION: **Boiler Breaching and Incinerator Breaching**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	Incinerator Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Incinerator- between burner and incinerator housing		
MATERIAL QUANTITY:	8	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **74**

MATERIAL DESCRIPTION: **Incinerator Gasket**

MATERIAL LOCATION: **Incinerator- between burner and incinerator housing**

MATERIAL QUANTITY: **8** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	Decorative Plaster Trim		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium and Stage		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **Decorative Plaster Trim**

MATERIAL LOCATION: **Auditorium and Stage**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	Insulation Lining		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	side of incinerator		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **76**

MATERIAL DESCRIPTION: **Insulation Lining**

MATERIAL LOCATION: **side of incinerator**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	Fire Doors		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium east exit, 2nd Floor Faculty Restroom		
MATERIAL QUANTITY:	3	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **77**

MATERIAL DESCRIPTION: **Fire Doors**

MATERIAL LOCATION: **Auditorium east exit,
2nd Floor Faculty Restroom**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	78		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile with Grooves		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's Office - 1903		
MATERIAL QUANTITY:	4800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **78**

MATERIAL DESCRIPTION: **2'x4' Ceiling Tile with Grooves**

MATERIAL LOCATION: **Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's Office - 1903**

MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	79		
MATERIAL DESCRIPTION:	12"x12" Gray Speckled VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Engineer's Office - 1903 Bldg		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **79**

MATERIAL DESCRIPTION: **12"x12" Gray Speckled VFT**

MATERIAL LOCATION: **Engineer's Office - 1903 Bldg**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

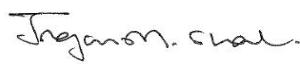

Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	79A		
MATERIAL DESCRIPTION:	12"x12" Gray Speckled VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer's Office - 1903 Bldg		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 79A

MATERIAL DESCRIPTION: 12"x12" Gray Speckled VFT Mastic

MATERIAL LOCATION: Engineer's Office - 1903 Bldg

MATERIAL QUANTITY: 300 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	80		
MATERIAL DESCRIPTION:	12"x12" Light Beige w/ Off-White & Tan Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	3rd Floor Corridor -1895 Bldg.		
MATERIAL QUANTITY:	690	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **80**

MATERIAL DESCRIPTION: **12"x12" Light Beige w/ Off-White & Tan Speckles VFT**

MATERIAL LOCATION: **3rd Floor Corridor -1895 Bldg.**

MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	80A		
MATERIAL DESCRIPTION:	12"x12" Light Beige w/ Off-White & Tan Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Corridor - 1895 Bldg.		
MATERIAL QUANTITY:	690	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **80A**

MATERIAL DESCRIPTION: **12"x12" Light Beige w/ Off-White & Tan Speckles VFT Mastic**

MATERIAL LOCATION: **3rd Floor Corridor - 1895 Bldg.**

MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	81		
MATERIAL DESCRIPTION:	Carpet mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals office & associated room - 1903 Bldg		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 81

MATERIAL DESCRIPTION: Carpet mastic

MATERIAL LOCATION: Principals office & associated room - 1903 Bldg

MATERIAL QUANTITY: 600 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	82		
MATERIAL DESCRIPTION:	12"x12" White w/ Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 207		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF

COMMENTS: Previous 3-year has tile & mastic for HA 82, this will now be just HA 82 for the tile, and HA 82A will be this tiles mastic.

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **82**

MATERIAL DESCRIPTION: **12"x12" White w/ Specks Floor Tile**

MATERIAL LOCATION: **Room 207**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	83		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Specks Floor Tiles		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	3rd Floor South Hallway		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF

COMMENTS: Previous 3-year has tile & mastic for HA 83, this will now be just HA 83 for the tile, and HA 83A will be this tiles mastic.

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **83**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Specks Floor Tiles**

MATERIAL LOCATION: **3rd Floor South Hallway**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	84		
MATERIAL DESCRIPTION:	12"x12" White, Red, Black w/ Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	3rd Floor Elevator Vestibule		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF

COMMENTS: Previous 3-year has tile & mastic for HA 84, this will now be just HA 84 for the tile, and HA 84A will be this tiles mastic.

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: 84

MATERIAL DESCRIPTION: 12"x12" White, Red, Black w/ Specks Floor Tile

MATERIAL LOCATION: 3rd Floor Elevator Vestibule

MATERIAL QUANTITY: 400 MATERIAL UNITS: SF

DAMAGE QUANTITY: 0 DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 03/25/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	South Cold Deck, South Hall Outside Cold Deck - 1903		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**

MATERIAL LOCATION: **South Cold Deck, South Hall Outside Cold Deck - 1903**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	H		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	South Cold Deck, South Hall Outside Cold Deck - 1903		
MATERIAL QUANTITY:	7	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**

MATERIAL LOCATION: **South Cold Deck, South Hall Outside Cold Deck - 1903**

MATERIAL QUANTITY: **7** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Electrical Room, Engineer's Storage, Engineer's Toilet, Boys Basement Toilet Sprinkler Room & Hall, S. Stair - 1903		
MATERIAL QUANTITY:	36	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Electrical Room, Engineer's Storage, Engineer's Toilet, Boys Basement Toilet Sprinkler Room & Hall, S. Stair - 1903**

MATERIAL QUANTITY: **36** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North Basement (Encapsulated), Electrical Room, Engineer Office - 1903		
MATERIAL QUANTITY:	73	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **North Basement (Encapsulated), Electrical Room, Engineer Office - 1903**

MATERIAL QUANTITY: **73** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North Basement (Encapsulated), Engineer Office - 1903		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**

MATERIAL LOCATION: **North Basement (Encapsulated), Engineer Office - 1903**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: R

MATERIAL DESCRIPTION: 2'x4' Off White/Smooth Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: S. Basement, S. Corridor, S. Caged (Kitchen) Area - 1895

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **R**

MATERIAL DESCRIPTION: **2'x4' Off White/Smooth Ceiling Tile**

MATERIAL LOCATION: **S. Basement, S. Corridor, S. Caged (Kitchen) Area - 1895**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: S

MATERIAL DESCRIPTION: 2'x4' White Textured Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Teachers Faculty Room, S. Basement - 1895

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **S**

MATERIAL DESCRIPTION: **2'x4' White Textured Ceiling Tile**

MATERIAL LOCATION: **Teachers Faculty Room, S. Basement - 1895**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	Canvas Wall Cover		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 311 - 1895		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **T**

MATERIAL DESCRIPTION: **Canvas Wall Cover**

MATERIAL LOCATION: **Room 311 - 1895**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	U		
MATERIAL DESCRIPTION:	2'x4' Off White/Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North Basement Dance Area - 1903		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **U**

MATERIAL DESCRIPTION: **2'x4' Off White/Smooth Ceiling Tile**

MATERIAL LOCATION: **North Basement Dance Area - 1903**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: V

MATERIAL DESCRIPTION: 2'x4' White Textured Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engine/Tank Room, 3rd Floor Boys & Girls Toilets, 4th Floor Stairwells, 3rd Floor Classrooms, Storage Rm behind Stage - 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **V**

MATERIAL DESCRIPTION: **2'x4' White Textured Ceiling Tile**

MATERIAL LOCATION: **Engine/Tank Room, 3rd Floor Boys & Girls Toilets, 4th Floor Stairwells, 3rd Floor Classrooms, Storage Rm behind Stage - 1903**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: W

MATERIAL DESCRIPTION: Tank Insulation

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Tank/Engine Room - 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Michael Holvay
Project Manager

Inspector's Signature:

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA: **W**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Tank/Engine Room - 1903**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:

MATERIAL DESCRIPTION: Canvas Wall Cover (Abated)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 2nd Floor Corridor - 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Michael Holvay
Project Manager

Inspector's Signature:

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Linne School	REVIEW DATE:	3/25/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:

MATERIAL DESCRIPTION: **Canvas Wall Cover (Abated)**

MATERIAL LOCATION: **2nd Floor Corridor - 1903**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	87		
MATERIAL DESCRIPTION:	9"x9" Beige Replacement VFT		
MATERIAL LOCATION:	2nd Floor Corridor - 1895 Building		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	15	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:	Material Needs Testing & Repair/Replace		

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **87**

MATERIAL DESCRIPTION: **9"x9" Beige Replacement VFT**

MATERIAL LOCATION: **2nd Floor Corridor - 1895 Building**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	82A				
MATERIAL DESCRIPTION:	12"x12" White w/ Specks Floor Tile Mastic				
MATERIAL LOCATION:	Room 207				
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		
COMMENTS:	Separate HA for the mastic in HA 82 tile				

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **82A**

MATERIAL DESCRIPTION: **12"x12" White w/ Specks Floor Tile Mastic**

MATERIAL LOCATION: **Room 207**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	83A				
MATERIAL DESCRIPTION:	12"x12" Beige w/ Specks Floor Tiles Mastic				
MATERIAL LOCATION:	3rd Floor South Hallway				
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		
COMMENTS:	Separate HA for the mastic in HA82 tile				

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **83A**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Specks Floor Tiles Mastic**

MATERIAL LOCATION: **3rd Floor South Hallway**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	84A				
MATERIAL DESCRIPTION:	12"x12" White, Red, Black w/ Specks Floor tile Mastic				
MATERIAL LOCATION:	3rd Floor Elevator Vestibule				
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **84A**

MATERIAL DESCRIPTION: **12"x12" White, Red, Black w/ Specks Floor tile Mastic**

MATERIAL LOCATION: **3rd Floor Elevator Vestibule**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	87A			
MATERIAL DESCRIPTION:	9"x9" Beige Replacement VFT Mastic			
MATERIAL LOCATION:	2nd Floor Corridor - 1895 Building			
MATERIAL QUANTITY:	35	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	No	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	MODERATE		CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Not Reachable	DAMAGE REASON:		
DAMAGE QUANTITY:	15	DAMAGE REASON:		
		DAMAGE REASON:		
		DAMAGE UNITS:	SF	
COMMENTS:	Material Needs Testing & Repair/Replacement			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **87A**

MATERIAL DESCRIPTION: **9"x9" Beige Replacement VFT Mastic**

MATERIAL LOCATION: **2nd Floor Corridor - 1895 Building**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	86		
MATERIAL DESCRIPTION:	Hard Plaster		
MATERIAL LOCATION:	Throughout 1903 Addition		
MATERIAL QUANTITY:	75000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	SURFACE	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
COMMENTS:	Good Condition		

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **86**

MATERIAL DESCRIPTION: **Hard Plaster**

MATERIAL LOCATION: **Throughout 1903 Addition**

MATERIAL QUANTITY: **75000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **03/25/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUIDLING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Linne School	INSPECTION DATE:	2/24/2025		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	85		
MATERIAL DESCRIPTION:	Hard Plaster		
MATERIAL LOCATION:	Throughout 1895 Building		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	SURFACE	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE		
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 02/24/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUIDLING ID: **4490**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Linne School** REVIEW DATE: **3/25/2025**

ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **85**

MATERIAL DESCRIPTION: **Hard Plaster**

MATERIAL LOCATION: **Throughout 1895 Building**

MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:




Date: **03/25/2025**

APPENDIX B

Inspector and Management Planner Licenses

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2022

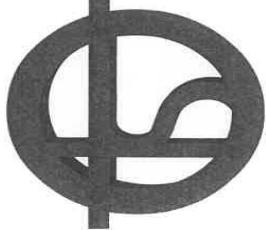

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Michael Holvay

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092152

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Michael Holvay

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/10/2021

Exam Date: 9/10/2021

Expiration Date: 9/10/2022

Certificate Number: BIR2109101950


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, IL

MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/30/

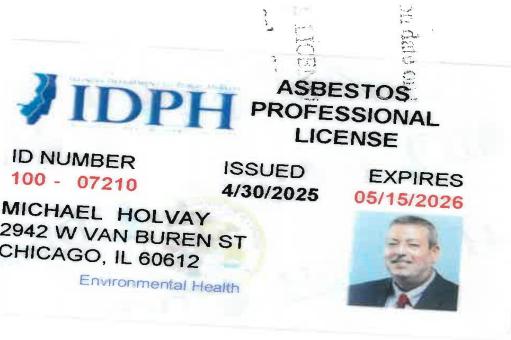

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07210

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07210	ISSUED 4/30/2025	EXPIRES 05/15/2026	INSPECTOR	9/13/2025
MICHAEL HOLVAY 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL	Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	1/11/2026

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois

MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 07210

ISSUED
2/28/2022 EXPIRES
05/15/2023

MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health




2/28/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: **07210**

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

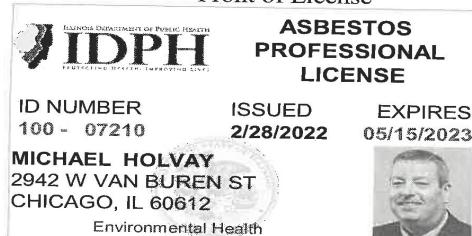

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	9/10/2022
PROJECT MANAGER	1/13/2023
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07210

ISSUED
4/8/2024

EXPIRES
05/15/2025

MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



MICHAEL HOLVAY
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07210

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07210	ISSUED 4/8/2024	INSPECTOR	9/15/2024
MICHAEL HOLVAY 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health	05/15/2025	PROJECT MANAGER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	1/13/2025

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Michael Holvay

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. This course is accredited by the State of Wisconsin, Department of Health Services under ch. DHS 159, Wis. Admin. Code, The Illinois Department of Public Health and The Indiana Department of Environmental Management, under 326 IAC 18. Training was in accordance with requirements listed under EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Location: 12304 75th Street
Kenosha, WI 53142

Certificate Number: BIRWI2409132641

Course Date: 9/13/2024

Exam Date: 9/13/2024

Expiration Date: 9/13/2025



Issue Date: 9/13/2024

Tyler Nicholson, Authorized Signer

Course Credit Hours: BIR WI 4 Hours

A handwritten signature in blue ink, appearing to read 'Tyler Nicholson'.



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07342	ISSUED 6/9/2025	EXPIRES 05/15/2026	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023


Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo

Kathy DeSalvo, Director

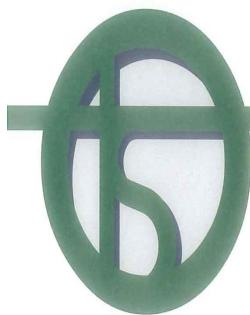

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

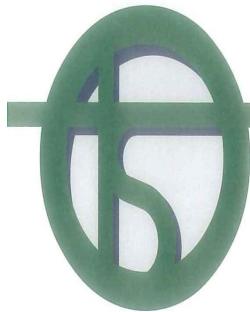

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License



Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/8/2024

EXPIRES
05/15/2025

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

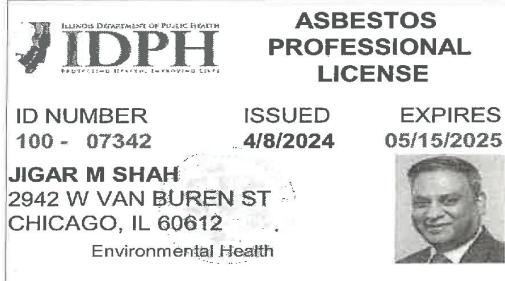

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES
Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2025

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

Kristina Miczek, Training Manager

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed