

ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2385  
SCHOOL NAME: Piccolo Elementary School  
ADDRESS OF SCHOOL: 1040 N. Keeler Avenue  
CITY: Chicago, IL, 60651

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 8/25/2022

**If the address on this form is different than the address of the building, submit a written explanation.**

**SECTION II (Please type or print)**

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 5/8/2025 ENROLLMENT 599  
IDPH INSPECTOR LICENSE NUMBER: 100-18790  
IDPH LICENSED INSPECTOR NAME (Please Print): Allizon Brooks  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

*Richard J. Schleyer* 6/4/2025

Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Piccolo Elementary School**

1040 N. Keeler Avenue  
Chicago, IL, 60651

Unit: 24781  
Building ID: 5210

IDPH ID Number: 14-016-2990-2385

**REPORT DATE:**  
Wednesday, June 04, 2025

**Prepared for:**  
**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**  
**Specialty Consulting, Inc.**

2942 W. Van Buren Street  
Chicago, IL, 60612  
Phone (312) 319-7575  
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

06/04/2025

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299      Unit: 24781      Region: 02      IDPH ID: 14-016-2990-2385

School: Piccolo Elementary School      Building ID: 5210

Address: 1040 N. Keeler Avenue

Chicago, IL, 60651

Building Contact: Hernandez, Jimmie      Contact Phone: 7736982342

Current Building Owners: Chicago Public Schools

Reinspection Date: 5/8/2025

Review Date: 06/04/2025

Inspector: Allizon Brooks

Inspector IDPH License: 100-18790

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,  
Specialty Consulting, Inc.



Jigar Shah  
100-07342

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: June 04, 2025

RE: Piccolo Elementary School, Unit 24781  
1040 N. Keeler Avenue  
Chicago, IL, 60651

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Piccolo Elementary School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Piccolo Elementary School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Piccolo Elementary School      Unit: 24781      Region: 02  
Address: 1040 N. Keeler Avenue      Chicago, IL, 60651  
IDPH ID: 14-016-2990-2385      Building ID: 5210  
Contact: Hernandez, Jimmie      Phone: 7736982342

### 2. Description of Facility

Original Construction: 1919      Additional Construction: 1966  
Total Square Footage: 106755      No of Floors: 3  
Current Occupancy: 599

### 3. LEA Designated Person

Contact: Richard J.Schleyer      Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602

### 4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.  
Contact: Jigar Shah  
Address 2942 W. Van Buren Street  
Phone: (312) 319-7575      Fax: (312) 319-7580

### 5. Inspector

Inspector Name: Allizon Brooks

Inspector IDPH license # 100-18790      Signature:  
Reinspection Date: 5/8/2025      Date: 5/8/2025

### 6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342      Signature:  
Date: 06/04/2025

### 7. Review Date: 06/04/2025

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

*Richard J. Schleyer*  
Signature:      Date: 6/4/2025

Name: Richard J.Schleyer

## **II. EXECUTIVE SUMMARY**

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Piccolo Elementary School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

- A. The following HAs have changed assessment categories for Building 5210:

B. The following new homogenous areas have been identified for Building 5210:

135	12"x12" Beige w/ Brown Streaks VFT
136	12"x12" Beige w/ Brown Streaks VFT Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

061	12"x12" Dark Brown VFT
065	12"x12" Pink VFT
066	12"x12" Pink VFT Mastic
069	12"x12" Blue VFT
070	12"x12" Blue VFT Mastic
071	2'x4' White Ceiling Tile
072	2'x4' White Ceiling Tile
073	Hard Coat Plaster
074	12"x12" White Ceiling Tile
075	12"x12" White VFT - NOT OBSERVED
077	12"x12" White w/ Brown Streaks VFT
079	12"x12" Brown w/ White & Black Streaks VFT
081	12"x12" Beige w/ Brown Streaks VFT
082	12"x12" Beige w/ Brown Streaks VFT Mastic
083	12"x12" Brown Grain VFT
084	12"x12" Brown Grain VFT Mastic
085	12"x12" Light Brown VFT
089	12"x12" Off White VFT
092	12"x12" Off White w/ Beige Streaks VFT Mastic
093	12"x12" White w/ Yellow Streaks VFT
094	12"x12" White w/ Yellow Streaks VFT Mastic (NOT OBSERVED)
098	9"x9" White w/ Black Streaks VFT Mastic (NOT OBSERVED)
099	Gray Fireproofing
1	Spray on insulation above ceiling tiles
104	12"x12" Beige VFT
105	12"x12" Beige VFT Mastic
108	Terrazzo
109	Brown Carpet Adhesive
110	Adobe Mosaic Ceramic Tile Grout
111	Adobe Mosaic Ceramic Tile Adhesive
112	12"x12" Sand Colored Floor Tile
113	12"x12" Sand Colored Floor Tile Adhesive
114	12"x12" Gray Floor Tile
115	12"x12" Gray Floor Tile Adhesive
116	12"x12" White w/Multi-Specks Floor Tile
117	12"x12" White w/Multi-Specks Floor Tile Adhesive
118	12"x12" Blue Floor Tile
119	12"x12" Blue Floor Tile Adhesive
120	Blue Carpet Adhesive
121	Red Terrazzo

122	Mosaic Ceramic Tile Grout
123	Mosaic Ceramic Tile Adhesive
124	12"x12" White Floor Tile w/Tan Specks
125	12"x12" White Floor Tile w/Tan Specks Adhesive
126	12"x12" White Fissured Ceiling Tile
127	12"x12" White Fissured Ceiling Tile Adhesive
128	12" X 12" Tan with white streaks, VFT
129	12" X 12" Tan with white streaks, Mastic
130	Transite hood
131	Transite sink & counterop
132	12"x12" Beige w/ Streaks VFT - 1965 Bldg
133	12"x12" Beige w/Streaks VFT Mastic - 1965 Bldg
134	Carpet Mastic
135	12"x12" Beige w/ Brown Streaks VFT
136	12"x12" Beige w/ Brown Streaks VFT Mastic
2	12"x12" Blue Specks Floor Tile & Mastic
2A	12" x 12" Blue Specks Floor Tile & Mastic
3	12" x 12" Beige specks floor tile & mastic
3A	12" x 12" Beige specks floor tile & mastic

The following areas were deemed to be inaccessible:

082	12"x12" Beige w/ Brown Streaks VFT Mastic
084	12"x12" Brown Grain VFT Mastic
090	12"x12" Off White VFT Mastic
092	12"x12" Off White w/ Beige Streaks VFT Mastic
094	12"x12" White w/ Yellow Streaks VFT Mastic (NOT OBSERVED)
111	Adobe Masaic Ceramic Tile Adhesive
113	12"x12" Sand Colored Floor Tile Adhesive
115	12"x12" Gray Floor Tile Adhesive
117	12"x12" White w/Multi-Specks Floor Tile Adhesive
119	12"x12" Blue Floor Tile Adhesive
120	Blue Carpet Adhesive
123	Mosaic Ceramic Tile Adhesive
125	12"x12" White Floor Tile w/Tan Specks Adhesive
127	12"x12" White Fissured Ceiling Tile Adhesive
133	12"x12" Beige w/Streaks VFT Mastic - 1965 Bldg

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Allizon Brooks, IDPH License # 100-18790. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Piccolo Elementary School Building 5210 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
015	MJP on Aircell Pipe Insulation	15	FITTING	1st, 2nd, & 3rd Floor Janitor Closets, 2nd Floor Boys & Girls Toilets, Crawl Under Auditorium - 1918	CHR	TSI	Y	NONE	0			ACBM with the potential for damage		MODERATE
030	Sink Undercoat (Black)	20	SF	Rooms 214, 314 & 229, 1918 Building 225 and 227 Lab - 1965 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
031	Gray Coating on Sink Basin	4	SF	Kitchen - 1965 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
032	Gray Coating on Sink Basin	100	SF	125 - 1965 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
036	MJP on Fiberglass Pipe Insulation	105	FITTING	N & S Unexcavated Areas, Kitchen, Base Kitchen Store, Locker Room, Shower Room, Base Stairwell - 1965	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
050	MJP on Fiberglass Pipe Insulation	193	FITTING	1st, 2nd, & 3rd Floor Boys & Girls Toilet Chases, 201, 202, 203, 204, 205, 206, 101, 102 - 1918 Bldg. Removed 2 ft and 5 ft in Room 101 and 202, respectively.	CHR	TSI	Y		0		No	ACBM with the potential for damage		MODERATE
051	MJP on Cardboard Pipe Insulation	700	FITTING	1st, 2nd, & 3rd Floor JC's, Auditorium Toilet, Crawl Under Auditorium, Attic - 1918 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
052	Air Cell Pipe Insulation	800	LF	1st, 2nd, & 3rd Floor N&S JC's, 2nd Floor Boys & Girls Toilets, Crawl Under Auditorium - 1918 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
054	Cardboard Pipe Insulation	600	LF	1st, 2nd, & 3rd Floor JC's, Auditorium Toilet, Crawl Under Auditorium, Attic - 1918 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
055	Mortar	500	SF	Air Tunnel, Attic, Washrooms - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
061	12"x12" Dark Brown VFT	950	SF	Room 208 ABATED - 1918 Bldg. 1st Floor Reading Room and Main Office remains.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
062	12"x12" Dark Brown VFT Mastic	950	SF	Room 208 ABATED - 1918 Bldg. 1st Floor Reading Room and Main Office remains.	CHR	MISC	N	NONE	0			ACBM with the potential for damage		LOW
063	9"x9" Green VFT	1,500	SF	1st Floor Store Room - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
064	9"x9" Green VFT Mastic	1,500	SF	1st Floor Store Room - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
065	12"x12" Pink VFT	60,000	SF	Throughout - 1965 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
066	12"x12" Pink VFT Mastic	60,000	SF	Throughout - 1965 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
067	9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile	0	SF	1st Floor Lunchroom - 1965 Bldg. 2500 SF removed in 2012.	CHR	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
068	9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile Mastic	0	SF	1st Floor Lunchroom - 1965 Bldg. 2500 SF removed in 2012.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
069	12"x12" Blue VFT	63,000	SF	Throughout - 1965 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
070	12"x12" Blue VFT Mastic	63,000	SF	Throughout - 1965 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
071	2'x4' White Ceiling Tile	120,000	SF	Throughout - 1965 Bldg.	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
072	2'x4' White Ceiling Tile	5,000	SF	Throughout Hallways - 1918 Bldg.	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
073	Hard Coat Plaster	100,000	SF	Throughout 1918	ASSUMED	SURFACE	N	NONE	0			ACBM with the potential for damage		MODERATE

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
074	12"x12" White Ceiling Tile	2,000	SF	Upper Library (1918 Bldg.)  Removed/replaced but NOT ABATED. Classrooms throughout school were replaced with drop 2' X 4' ceiling tiles EXCEPT Upper Library and Student Dining Area.	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		
075	12"x12" White VFT - NOT OBSERVED	2,500	SF	1st Floor Store Room, Main Office, Reading Room (#208) - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
076	12"x12" White VFT Mastic - NOT OBSERVED	2,500	SF	1st Floor Store Room, Main Office, Reading Room (208) - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
077	12"x12" White w/ Brown Streaks VFT	1,500	SF	1st Fl: Rm 109 (principal's office), Offices #5, #6, #9, #10 & #11, Assistant Principal's Office Area - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
078	12"x12" White w/ Brown Streaks VFT Mastic	1,500	SF	1st Fl: Rm 109, Offices #5, #6, #9, #10 & #11, Assistant Principal's Office Area - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
079	12"x12" Brown w/ White & Black Streaks VFT	630	SF	(Room #204 - Closet Only) & Room #102 (NOT OBSERVED) - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
080	12"x12" Brown w/ White & Black Streaks VFT Mastic	630	SF	Closet Only (Room 204) and room #102 (NOT OBSERVED) - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
081	12"x12" Beige w/ Brown Streaks VFT	500	SF	Rooms 101, 103, 111, 327, 321 - 1918 Bldg. (A total of 1400 SF of tile/mastic were removed from	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Rooms 112 and 210 in 2012.)										
082	12"x12" Beige w/ Brown Streaks VFT Mastic	500	SF	Rooms 101, 103, 111, 327, 321 - 1918 Bldg. (A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
083	12"x12" Brown Grain VFT	750	SF	Room 209 - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
084	12"x12" Brown Grain VFT Mastic	750	SF	Room 209 - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
085	12"x12" Light Brown VFT	1,500	SF	Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
086	12"x12" Light Brown VFT Mastic	1,500	SF	Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
087	9"x9" White VFT (NOT OBSERVED)	0	SF	Room 314 - 1918 Bldg.	CHR	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
088	9"x9" White VFT Mastic (NOT OBSERVED)	0	SF	Room 314 - 1918 Bldg.	CHR	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
089	12"x12" Off White VFT	1,500	SF	Rooms 304 & 305 - 1918 Bldg.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
090	12"x12" Off White VFT Mastic	1,500	SF	Rooms 304 & 305 - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
091	12"x12" Off White w/ Beige Streaks VFT	2,100	SF	Rooms 301, 303, 308, 309 - 1918 Bldg. (500 SF removed from Rm 202 in 2012.)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
092	12"x12" Off White w/ Beige Streaks VFT Mastic	2,100	SF	Rooms 301, 303, 308, 309 - 1918 Bldg. (500 SF removed from Rm 202 in 2012.)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
093	12"x12" White w/ Yellow Streaks VFT	800	SF	1st Floor Dean's Office - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
094	12"x12" White w/ Yellow Streaks VFT Mastic (NOT OBSERVED)	1,800	SF	1st Floor Dean's Office - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
095	12"x12" Peach VFT	900	SF	Room 310 - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
096	12"x12" Peach VFT Mastic	900	SF	Room 310 - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
097	9"x9" White w/ Black Streaks VFT (NOT OBSERVED)	0		Room 205 Wardrobe- 1918 Bldg.	ABATED	MISC			0					
098	9"x9" White w/ Black Streaks VFT Mastic (NOT OBSERVED)	0	SF	Room 205 Wardrobe - 1918 Bldg.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
099	Gray Fireproofing	60,000	SF	Throughout - 1965 Bldg.	ASSUMED	SURFACE	Y	NONE	0			ACBM with the potential for damage		LOW
1	Spray on insulation above ceiling tiles	4,000	SF	above ceiling tiles in Addition 1965	ASSUMED	SURFACE	Y	NONE	0			ACBM with the potential for damage		LOW
100	9"x9" Spotted Brown VFT (Under New VFT)	1,310	SF	Rooms 110, 1st floor storage - 1918 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
101	9"x9" Spotted Brown VFT Mastic (Under New VFT)	1,310	SF	Rooms 110, 1st floor storage - 1918 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
102	9"x9" Beige VFT	759	SF	1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
103	9"x9" Beige VFT Mastic	759	SF	1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
104	12"x12" Beige VFT	750	SF	Room 102; Storage (Room 104) - 1918 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
105	12"x12" Beige VFT Mastic	750	SF	Room 102; Storage (Room 104) - 1918 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
106	9"x9" Tan VFT -(REMOVED 2012)			Lunchroom - 1965 bldg. (3000 SF removed in 2012)	ABATED	MISC								
107	9"x9" Tan VFT Mastic (REMOVED 2012)			Lunchroom - 1965 bldg. (3000 SF removed in 2012)	ABATED	MISC								
108	Terrazo	3,000	SF	1st fl corridor and stair, landings - 1918 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
109	Brown Carpet Adhesive	1,600	SF	Room 306/307 --1918 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
110	Adobe Mosaic Ceramic Tile Grout	2,300	SF	1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
111	Adobe Mosaic Ceramic Tile Adhesive	2,300	SF	1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
112	12"x12" Sand Colored Floor Tile	1,090	SF	1918 Building: Room 205	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
113	12"x12" Sand Colored Floor Tile Adhesive	1,090	SF	1918 Building: Room 205	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
114	12"x12" Gray Floor Tile	930	SF	1918 Building: Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
115	12"x12" Gray Floor Tile Adhesive	930	SF	1918 Building: Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
116	12"x12" White w/Multi-Specks Floor Tile	1,000	SF	1918 Building: Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
117	12"x12" White w/Multi-Specks Floor Tile Adhesive	1,000	SF	1918 Building: Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
118	12"x12" Blue Floor Tile	500	SF	1918 Building: Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
119	12"x12" Blue Floor Tile Adhesive	500	SF	1918 Building: Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
120	Blue Carpet Adhesive	2,000	SF	1918 Building: Assembly Hall NOT OBSERVED. Removed/covered in 2012 with 24" X 24" gray slip-free rubber flooring.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
121	Red Terrazzo	2,850	SF	1965 Addition: 2nd & 3rd Floor Stairways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
122	Mosaic Ceramic Tile Grout	4,170	SF	1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
123	Mosaic Ceramic Tile Adhesive	4,170	SF	1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
124	12"x12" White Floor Tile w/Tan Specks	1,400	SF	1965 Addition: Room 129 & 122	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
125	12"x12" White Floor Tile w/Tan Specks Adhesive	1,400	SF	1965 Addition: Room 129 & 122	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
126	12"x12" White Fissured Ceiling Tile	4,500	SF	1965 Addition: Lunchroom	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
127	12"x12" White Fissured Ceiling Tile Adhesive	4,500	SF	1965 Addition: Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
128	12" X 12" Tan with white streaks, VFT	1,960	SF	Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
129	12" X 12" Tan with white streaks, Mastic	1,960	SF	Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
130	Transite hood	20	SF	Rm 305 Lab Work Room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
131	Transite sink & counterop	215	SF	Lab Work Rooms in 303, 305, 306; Biology Lab in Rm 301.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
132	12"x12" Beige w/ Streaks VFT - 1965 Bldg	9,000	SF	Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
133	12"x12" Beige w/Streaks VFT Mastic - 1965 Bldg	9,000	SF	Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
134	Carpet Mastic	600	SF	Room 228- 1965 addition	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
135	12"x12" Beige w/ Brown Streaks VFT	500	SF	Rooms 321 and 327 - 1965 Addition	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
136	12"x12" Beige w/ Brown Streaks VFT Mastic	500	SF	Rooms 321 and 327 - 1965 Addition	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
2	12"x12" Blue Specks Floor Tile & Mastic	80	SF	Room 110 Toilet	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
2A	12" x12" Blue Specks Floor Tile & Mastic	80	SF	Room 110 Toilet	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
3	12" x 12" Beige specks floor tile & mastic	1,200	SF	Room 203 and 205	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
3A	12" x 12" Beige specks floor tile & mastic	1,200	SF	Room 203 and 205	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

# Chicago Public Schools

School Piccolo Elementary School Unit 24781 Building ID 5210  
Address 1040 N. Keeler Avenue Region 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date 5/8/2025  
Inspector Name Allizon Brooks  
100-18790 5/15/2026  
Inspector's IDPH License Number / Expiration Date

#### Inspector's Comments

HA Number:	Inspector Comments:
015	
030	
031	
032	
036	
050	
051	
052	
054	
055	
061	
062	
063	
064	
065	
066	
067	
068	
069	
070	
071	
072	
073	
074	

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA Number:	Inspector Comments:
075	
076	
077	
078	
079	
080	
081	Tiles were removed from closed wing in BLDG
082	Tiles were removed from a closed wing in BLDG.
083	
084	
085	
086	
087	
088	
089	
090	
091	
092	
093	
094	
095	
096	
097	
098	
099	
1	
100	
101	
102	

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

HA Number:	Inspector Comments:
103	
104	
105	
106	
107	
108	
109	
110	
111	
112	
113	
114	
115	
116	
117	
118	
119	
120	
121	
122	
123	
124	
125	
126	
127	
128	
129	
130	
131	

# Chicago Public Schools

**School** Piccolo Elementary School **Unit** 24781 **Building ID** 5210  
**Address** 1040 N. Keeler Avenue **Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
132	
133	
134	
135	
136	
2	
2A	
3	
3A	

**Table II**  
**Management Planner's Review**

---

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
015	MJP on Aircell Pipe Insulation	15	FITTING	1st, 2nd, & 3rd Floor Janitor Closets, 2nd Floor Boys & Girls Toilets, Crawl Under Auditorium - 1918	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
030	Sink Undercoat (Black)	20	SF	Rooms 214, 314 & 229, 1918 Building 225 and 227 Lab - 1965 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
031	Gray Coating on Sink Basin	4	SF	Kitchen - 1965 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
032	Gray Coating on Sink Basin	100	SF	125 - 1965 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
036	MJP on Fiberglass Pipe Insulation	105	FITTING	N & S Unexcavated Areas, Kitchen, Base Kitchen Store, Locker Room, Shower Room, Base Stairwell - 1965	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
050	MJP on Fiberglass Pipe Insulation	193	FITTING	1st, 2nd, & 3rd Floor Boys & Girls Toilet Chases, 201, 202, 203, 204, 205, 206, 101, 102 - 1918 Bldg. Removed 2 ft and 5 ft in Rooms 101 and 202, respectively.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
051	MJP on Cardboard Pipe Insulation	700	FITTING	1st, 2nd, & 3rd Floor JC's, Auditorium Toilet, Crawl Under Auditorium, Attic - 1918 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
052	Air Cell Pipe Insulation	800	LF	1st, 2nd, & 3rd Floor N&S JC's, 2nd Floor Boys & Girls Toilets, Crawl Under Auditorium - 1918 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
054	Cardboard Pipe Insulation	600	LF	1st, 2nd, & 3rd Floor JC's, Auditorium Toilet, Crawl Under Auditorium, Attic - 1918 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
055	Mortar	500	SF	Air Tunnel, Attic, Washrooms - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
061	12"x12" Dark Brown VFT	950	SF	Room 208 ABATED - 1918 Bldg. 1st Floor Reading Room and Main Office remains.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
062	12"x12" Dark Brown VFT Mastic	950	SF	Room 208 ABATED - 1918 Bldg. 1st Floor Reading Room and Main Office remains.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
063	9"x9" Green VFT	1,500	SF	1st Floor Store Room - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
064	9"x9" Green VFT Mastic	1,500	SF	1st Floor Store Room - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
065	12"x12" Pink VFT	60,000	SF	Throughout - 1965 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
066	12"x12" Pink VFT Mastic	60,000	SF	Throughout - 1965 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
067	9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile	0	SF	1st Floor Lunchroom - 1965 Bldg. 2500 SF removed in 2012.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
068	9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile Mastic	0	SF	1st Floor Lunchroom - 1965 Bldg. 2500 SF removed in 2012.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
069	12"x12" Blue VFT	63,000	SF	Throughout - 1965 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
070	12"x12" Blue VFT Mastic	63,000	SF	Throughout - 1965 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
071	2"x4" White Ceiling Tile	120,000	SF	Throughout - 1965 Bldg.	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
072	2"x4" White Ceiling Tile	5,000	SF	Throughout Hallways - 1918 Bldg.	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
073	Hard Coat Plaster	100,000	SF	Throughout 1918	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
074	12"x12" White Ceiling Tile	2,000	SF	Upper Library (1918 Bldg.)  Removed/replaced but NOT ABATED. Classrooms throughout school were replaced with drop 2' X 4' ceiling tiles EXCEPT Upper Library and Student Dining Area.	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
075	12"x12" White VFT - NOT OBSERVED	2,500	SF	1st Floor Store Room, Main Office, Reading Room (#208) - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
076	12"x12" White VFT Mastic - NOT OBSERVED	2,500	SF	1st Floor Store Room, Main Office, Reading Room (208) - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
077	12"x12" White w/ Brown Streaks VFT	1,500	SF	1st Fl: Rm 109 (principal's office), Offices #5, #6, #9, #10 & #11, Assistant Principal's Office Area - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
078	12"x12" White w/ Brown Streaks VFT Mastic	1,500	SF	1st Fl: Rm 109, Offices #5, #6, #9, #10 & #11, Assistant Principal's Office Area - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
079	12"x12" Brown w/ White & Black Streaks VFT	630	SF	(Room #204 - Closet Only) & Room #102 (NOT OBSERVED) - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
080	12"x12" Brown w/ White & Black Streaks VFT Mastic	630	SF	Closet Only (Room 204) and room #102 (NOT OBSERVED) - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
081	12"x12" Beige w/ Brown Streaks VFT	500	SF	Rooms 101, 103, 111, 327, 321 - 1918 Bldg. (A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
082	12"x12" Beige w/ Brown Streaks VFT Mastic	500	SF	Rooms 101, 103, 111, 327, 321 - 1918 Bldg. (A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
083	12"x12" Brown Grain VFT	750	SF	Room 209 - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
084	12"x12" Brown Grain VFT Mastic	750	SF	Room 209 - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
085	12"x12" Light Brown VFT	1,500	SF	Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
086	12"x12" Light Brown VFT Mastic	1,500	SF	Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
087	9"x9" White VFT (NOT OBSERVED)	0	SF	Room 314 - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
088	9"x9" White VFT Mastic (NOT OBSERVED)	0	SF	Room 314 - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
089	12"x12" Off White VFT	1,500	SF	Rooms 304 & 305 - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
090	12"x12" Off White VFT Mastic	1,500	SF	Rooms 304 & 305 - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
091	12"x12" Off White w/ Beige Streaks VFT	2,100	SF	Rooms 301, 303, 308, 309 - 1918 Bldg. (500 SF removed from Rm 202 in 2012.)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
092	12"x12" Off White w/ Beige Streaks VFT Mastic	2,100	SF	Rooms 301, 303, 308, 309 - 1918 Bldg. (500 SF removed from Rm 202 in 2012)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
093	12"x12" White w/ Yellow Streaks VFT	800	SF	1st Floor Dean's Office - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
094	12"x12" White w/ Yellow Streaks VFT Mastic (NOT OBSERVED)	1,800	SF	1st Floor Dean's Office - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
095	12"x12" Peach VFT	900	SF	Room 310 - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
096	12"x12" Peach VFT Mastic	900	SF	Room 310 - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
097	9"x9" White w/ Black Streaks VFT (NOT OBSERVED)	0		Room 205 Wardrobe - 1918 Bldg.	Abated	MISC		0			
098	9"x9" White w/ Black Streaks VFT Mastic (NOT OBSERVED)	0	SF	Room 205 Wardrobe - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
099	Gray Fireproofing	60,000	SF	Throughout - 1965 Bldg.	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
1	Spray on insulation above ceiling tiles	4,000	SF	above ceiling tiles in Addition 1965	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
100	9"x9" Spotted Brown VFT (Under New VFT)	1,310	SF	Rooms 110, 1st floor storage - 1918 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101	9"x9" Spotted Brown VFT Mastic (Under New VFT)	1,310	SF	Rooms 110, 1st floor storage - 1918 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
102	9"x9" Beige VFT	759	SF	1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
103	9"x9" Beige VFT Mastic	759	SF	1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104	12"x12" Beige VFT	750	SF	Room 102; Storage (Room 104) - 1918 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
105	12"x12" Beige VFT Mastic	750	SF	Room 102; Storage (Room 104) - 1918 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
106	9"x9" Tan VFT -(REMOVED 2012)			Lunchroom - 1965 bldg. (3000 SF removed in 2012)	Abated	MISC					
107	9"x9" Tan VFT Mastic (REMOVED 2012)			Lunchroom - 1965 bldg. (3000 SF removed in 2012)	Abated	MISC					
108	Terrazzo	3,000	SF	1st fl corridor and stair, landings - 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	Brown Carpet Adhesive	1,600	SF	Room 306/307 --1918 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
110	Adobe Mosaic Ceramic Tile Grout	2,300	SF	1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
111	Adobe Mosaic Ceramic Tile Adhesive	2,300	SF	1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
112	12"x12" Sand Colored Floor Tile	1,090	SF	1918 Building: Room 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
113	12"x12" Sand Colored Floor Tile Adhesive	1,090	SF	1918 Building: Room 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
114	12"x12" Gray Floor Tile	930	SF	1918 Building: Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
115	12"x12" Gray Floor Tile Adhesive	930	SF	1918 Building: Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116	12"x12" White w/Multi-Specks Floor Tile	1,000	SF	1918 Building: Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
117	12"x12" White w/Multi-Specks Floor Tile Adhesive	1,000	SF	1918 Building: Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
118	12"x12" Blue Floor Tile	500	SF	1918 Building: Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
119	12"x12" Blue Floor Tile Adhesive	500	SF	1918 Building: Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
120	Blue Carpet Adhesive	2,000	SF	1918 Building: Assembly Hall NOT OBSERVED. Removed/covered in 2012 with 24" X 24" gray slip-free rubber flooring.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
121	Red Terrazzo	2,850	SF	1965 Addition: 2nd & 3rd Floor Stairways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
122	Mosaic Ceramic Tile Grout	4,170	SF	1965 Addition: 1st, 2nd & 3rd Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Girl's & Boy's Washrooms							
123	Mosaic Ceramic Tile Adhesive	4,170	SF	1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
124	12"x12" White Floor Tile w/Tan Specks	1,400	SF	1965 Addition: Room 129 & 122	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
125	12"x12" White Floor Tile w/Tan Specks Adhesive	1,400	SF	1965 Addition: Room 129 & 122	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
126	12"x12" White Fissured Ceiling Tile	4,500	SF	1965 Addition: Lunchroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
127	12"x12" White Fissured Ceiling Tile Adhesive	4,500	SF	1965 Addition: Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
128	12" X 12" Tan with white streaks, VFT	1,960	SF	Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
129	12" X 12" Tan with white streaks, Mastic	1,960	SF	Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
130	Transite hood	20	SF	Rm 305 Lab Work Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
131	Transite sink & counterop	215	SF	Lab Work Rooms in 303, 305, 306; Biology Lab in Rm 301.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
132	12"x12" Beige w/ Streaks VFT - 1965 Bldg	9,000	SF	Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
133	12"x12" Beige w/Streaks VFT Mastic - 1965 Bldg	9,000	SF	Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
134	Carpet Mastic	600	SF	Room 228- 1965 addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
135	12"x12" Beige w/ Brown Streaks VFT	500	SF	Rooms 321 and 327 - 1965 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
136	12"x12" Beige w/ Brown Streaks VFT Mastic	500	SF	Rooms 321 and 327 - 1965 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2	12"x12" Blue Specks Floor Tile & Mastic	80	SF	Room 110 Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2A	12" x12" Blue Specks Floor Tile & Mastic	80	SF	Room 110 Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3	12" x 12" Beige specks floor tile & mastic	1,200	SF	Room 203 and 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3A	12" x 12" Beige specks floor tile & mastic	1,200	SF	Room 203 and 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

*Management Planner's Comments Summarized at the End of the Report*

Review Date	6/4/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
015	
030	
031	
032	
036	
050	
051	
052	
054	
055	
061	
062	
063	

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
064	
065	
066	
067	
068	
069	
070	
071	
072	
073	
074	
075	
076	
077	
078	
079	
080	
081	
082	
083	
084	
085	
086	
087	
088	
089	
090	

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
091	
092	
093	
094	
095	
096	
097	
098	
099	
1	
100	
101	
102	
103	
104	
105	
106	
107	
108	
109	
110	
111	
112	
113	
114	
115	
116	

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
117	
118	
119	
120	
121	
122	
123	
124	
125	
126	
127	
128	
129	
130	
131	
132	
133	
134	
135	
136	
2	
2A	
3	
3A	

# Chicago Public Schools

**School** Piccolo Elementary School

**Unit** 24781

**Building ID** 5210

**Address** 1040 N. Keeler Avenue

Chicago, IL, 60651

**Region** 02

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575      Fax: (312) 319-7580

*Management Planner's Comments Summarized at the End of the Report*

## APPENDIX A

---

### Assessment Sheets, Drawings and Photos

**Chicago Public Schools**

**Specialty Consulting, Inc.**

***2025 AHERA REINSPECTION***

# Chicago Public Schools

Specialty Consulting, Inc.

**2025 AHERA REINSPECTION**

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	AHERA INSPECTOR:	<b>Allizon Brooks</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	INSPECTION DATE:	<b>5/8/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	<b>015</b>		
MATERIAL DESCRIPTION:	<b>MJP on Aircell Pipe Insulation</b>		
HISTORICAL AHERA DAMAGE CATEGORY	<b>6 ACBM with the potential for damage</b>		
HISTORICAL DAMAGE REASON:	<b>Physical Damage</b> <b>Deterioration</b>		
HISTORICAL RESPONSE ACTION:	<b>Follow O&amp;M Plan</b>		
ASBESTOS TYPE:	<b>Chrysotile</b>	FRIABLE:	<b>Yes</b>

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	<b>1st, 2nd, &amp; 3rd Floor Janitor Closets, 2nd Floor Boys &amp; Girls Toilets, Crawl Under Auditorium - 1918</b>		
MATERIAL QUANTITY:	<b>15</b>	MATERIAL UNITS:	<b>FITTING</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>FITTING</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Piccolo Elementary School	REVIEW DATE:	6/4/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

HOMOGENEOUS AREA:	015				
MATERIAL DESCRIPTION:	MJP on Aircell Pipe Insulation				
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Janitor Closets, 2nd Floor Boys & Girls Toilets, Crawl Under Auditorium - 1918				
MATERIAL QUANTITY:	15	MATERIAL UNITS:	FITTING		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	FITTING		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 06/04/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	030		
MATERIAL DESCRIPTION:	Sink Undercoat (Black)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 214, 314 & 229, 1918 Building 225 and 227 Lab - 1965 Building		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **030**

MATERIAL DESCRIPTION: **Sink Undercoat (Black)**

MATERIAL LOCATION: **Rooms 214, 314 & 229, 1918 Building 225 and 227 Lab - 1965 Building**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	031		
MATERIAL DESCRIPTION:	Gray Coating on Sink Basin		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen - 1965 Building		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **031**

MATERIAL DESCRIPTION: **Gray Coating on Sink Basin**

MATERIAL LOCATION: **Kitchen - 1965 Building**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	032		
MATERIAL DESCRIPTION:	Gray Coating on Sink Basin		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	125 - 1965 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **032**

MATERIAL DESCRIPTION: **Gray Coating on Sink Basin**

MATERIAL LOCATION: **125 - 1965 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

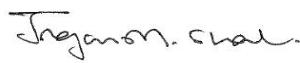

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	036		
MATERIAL DESCRIPTION:	MJP on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **N & S Unexcavated Areas, Kitchen, Base Kitchen Store, Locker Room, Shower Room, Base Stairwell - 1965**

MATERIAL QUANTITY: **105** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: MATERIAL UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Piccolo Elementary School	REVIEW DATE:	6/4/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

HOMOGENEOUS AREA: **036**

MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **N & S Unexcavated Areas, Kitchen, Base Kitchen Store, Locker Room, Shower Room, Base Stairwell - 1965**

MATERIAL QUANTITY: **105** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	050		
MATERIAL DESCRIPTION:	MJP on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 Damaged or significantly damaged friable thermal system insulating ACBM		
HISTORICAL DAMAGE REASON:	Air Erosion/Flow		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Boys & Girls Toliet Chases, 201, 202, 203, 204, 205, 206, 101, 102 - 1918 Bldg.**  
**Removed 2 ft and 5 ft in Rooms 101 and 202, respectively.**

MATERIAL QUANTITY: **193** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: MATERIAL UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24781** BULDING ID: **5210**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Piccolo Elementary School** REVIEW DATE: **6/4/2025**  
ADDRESS: **1040 N. Keeler Avenue** IDPH LICENSE NO: **100-18790**

---

HOMOGENEOUS AREA: **050**  
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**  
MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Boys & Girls Toliet Chases, 201, 202, 203, 204, 205, 206, 101, 102 - 1918 Bldg.  
Removed 2 ft and 5 ft in Rooms 101 and 202, respectively.**  
MATERIAL QUANTITY: **193** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	051		
MATERIAL DESCRIPTION:	MJP on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor JC's, Auditorium Toliet, Crawl Under Auditorium, Attic - 1918 Bldg.		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **051**

MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor JC's, Auditorium Toliet, Crawl Under Auditorium, Attic - 1918 Bldg.**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	052		
MATERIAL DESCRIPTION:	Air Cell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor N&S JC's, 2nd Floor Boys & Girls Toliets, Crawl Under Auditorium - 1918 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA:	<b>052</b>				
MATERIAL DESCRIPTION:	<b>Air Cell Pipe Insulation</b>				
MATERIAL LOCATION:	<b>1st, 2nd, &amp; 3rd Floor N&amp;S JC's, 2nd Floor Boys &amp; Girls Toilets, Crawl Under Auditorium - 1918 Bldg.</b>				
MATERIAL QUANTITY:	<b>800</b>	MATERIAL UNITS:	<b>LF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>LF</b>		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	054		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor JC's, Auditorium Toliet, Crawl Under Auditorium, Attic - 1918 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **054**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor JC's, Auditorium Toliet, Crawl Under Auditorium, Attic - 1918 Bldg.**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	055		
MATERIAL DESCRIPTION:	Mortar		
HISTORICAL AHERA DAMAGE CATEGORY	<b>6 ACBM with the potential for damage</b>		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Air Tunnel, Attic, Washrooms - 1918 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **055**

MATERIAL DESCRIPTION: **Mortar**

MATERIAL LOCATION: **Air Tunnel, Attic, Washrooms - 1918 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	061		
MATERIAL DESCRIPTION:	12"x12" Dark Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 208 ABATED - 1918 Bldg. 1st Floor Reading Room and Main Office remains.		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **061**

MATERIAL DESCRIPTION: **12"x12" Dark Brown VFT**

MATERIAL LOCATION: **Room 208 ABATED - 1918 Bldg.  
1st Floor Reading Room and Main Office remains.**

MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	062		
MATERIAL DESCRIPTION:	12"x12" Dark Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 208 ABATED - 1918 Bldg.  
1st Floor Reading Room and Main Office remains.**

MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **062**

MATERIAL DESCRIPTION: **12"x12" Dark Brown VFT Mastic**

MATERIAL LOCATION: **Room 208 ABATED - 1918 Bldg.  
1st Floor Reading Room and Main Office remains.**

MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	063		
MATERIAL DESCRIPTION:	9"x9" Green VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor Store Room - 1918 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **063**

MATERIAL DESCRIPTION: **9"x9" Green VFT**

MATERIAL LOCATION: **1st Floor Store Room - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	064		
MATERIAL DESCRIPTION:	9"x9" Green VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Store Room - 1918 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **064**

MATERIAL DESCRIPTION: **9"x9" Green VFT Mastic**

MATERIAL LOCATION: **1st Floor Store Room - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	065		
MATERIAL DESCRIPTION:	12"x12" Pink VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1965 Bldg.		
MATERIAL QUANTITY:	60000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **065**

MATERIAL DESCRIPTION: **12"x12" Pink VFT**

MATERIAL LOCATION: **Throughout - 1965 Bldg.**

MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	066		
MATERIAL DESCRIPTION:	12"x12" Pink VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1965 Bldg.		
MATERIAL QUANTITY:	60000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **066**

MATERIAL DESCRIPTION: **12"x12" Pink VFT Mastic**

MATERIAL LOCATION: **Throughout - 1965 Bldg.**

MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	067		
MATERIAL DESCRIPTION:	9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st Floor Lunchroom - 1965 Bldg.  
2500 SF removed in 2012.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **067**

MATERIAL DESCRIPTION: **9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile**

MATERIAL LOCATION: **1st Floor Lunchroom - 1965 Bldg.  
2500 SF removed in 2012.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	068		
MATERIAL DESCRIPTION:	9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Lunchroom - 1965 Bldg.  
2500 SF removed in 2012.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **068**

MATERIAL DESCRIPTION: **9"x9" Green & 9"x9" Beige/Brown Checker Board Patterned Floor Tile Mastic**

MATERIAL LOCATION: **1st Floor Lunchroom - 1965 Bldg.  
2500 SF removed in 2012.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	069		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1965 Bldg.		
MATERIAL QUANTITY:	63000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **069**

MATERIAL DESCRIPTION: **12"x12" Blue VFT**

MATERIAL LOCATION: **Throughout - 1965 Bldg.**

MATERIAL QUANTITY: **63000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	070		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1965 Bldg.		
MATERIAL QUANTITY:	63000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **070**

MATERIAL DESCRIPTION: **12"x12" Blue VFT Mastic**

MATERIAL LOCATION: **Throughout - 1965 Bldg.**

MATERIAL QUANTITY: **63000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

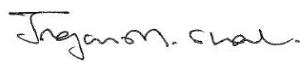

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	071		
MATERIAL DESCRIPTION:	2'x4' White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1965 Bldg.		
MATERIAL QUANTITY:	120000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **071**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**

MATERIAL LOCATION: **Throughout - 1965 Bldg.**

MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	072		
MATERIAL DESCRIPTION:	2'x4' White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout Hallways - 1918 Bldg.		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **072**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**

MATERIAL LOCATION: **Throughout Hallways - 1918 Bldg.**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

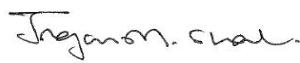

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	073		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout 1918		
MATERIAL QUANTITY:	100000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **073**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout 1918**

MATERIAL QUANTITY: **100000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	074		
MATERIAL DESCRIPTION:	12"x12" White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:	Upper Library (1918 Bldg.)	Removed/replaced but NOT ABATED. Classrooms throughout school were replaced with drop 2' X 4' ceiling tiles EXCEPT Upper Library and Student Dining Area.
--------------------	-------------------------------	---

MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
--------------------	------	-----------------	----

DAMAGE QUANTITY:		DAMAGE UNITS:	SF
------------------	--	---------------	----

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Piccolo Elementary School	REVIEW DATE:	6/4/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

HOMOGENEOUS AREA: **074**

MATERIAL DESCRIPTION: **12"x12" White Ceiling Tile**

MATERIAL LOCATION: **Upper Library  
(1918 Bldg.)**

**Removed/replaced but NOT ABATED. Classrooms throughout school were replaced with drop 2' X 4' ceiling tiles EXCEPT Upper Library and Student Dining Area.**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	075		
MATERIAL DESCRIPTION:	12"x12" White VFT - NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Store Room, Main Office, Reading Room (#208) - 1918 Bldg.		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **075**

MATERIAL DESCRIPTION: **12"x12" White VFT - NOT OBSERVED**

MATERIAL LOCATION: **1st Floor Store Room, Main Office, Reading Room (#208) - 1918 Bldg.**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

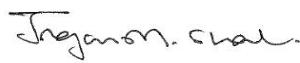

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	076		
MATERIAL DESCRIPTION:	12"x12" White VFT Mastic - NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Store Room, Main Office, Reading Room (208) - 1918 Bldg.		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **076**

MATERIAL DESCRIPTION: **12"x12" White VFT Mastic - NOT OBSERVED**

MATERIAL LOCATION: **1st Floor Store Room, Main Office, Reading Room (208) - 1918 Bldg.**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	077		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st Fl: Rm 109 (principal's office), Offices #5, #6, #9, #10 & #11, Assistant Principal's Office Area - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA:	<b>077</b>				
MATERIAL DESCRIPTION:	<b>12"x12" White w/ Brown Streaks VFT</b>				
MATERIAL LOCATION:	<b>1st Fl: Rm 109 (principal's office), Offices #5, #6, #9, #10 &amp; #11, Assistant Principal's Office Area - 1918 Bldg.</b>				
MATERIAL QUANTITY:	<b>1500</b>	MATERIAL UNITS:	<b>SF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>		

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

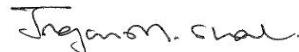

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	078		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Fl: Rm 109, Offices #5, #6, #9, #10 & #11, Assistant Principal's Office Area - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA:	<b>078</b>				
MATERIAL DESCRIPTION:	<b>12"x12" White w/ Brown Streaks VFT Mastic</b>				
MATERIAL LOCATION:	<b>1st Fl: Rm 109, Offices #5, #6, #9, #10 &amp; #11, Assistant Principal's Office Area - 1918 Bldg.</b>				
MATERIAL QUANTITY:	<b>1500</b>	MATERIAL UNITS:	<b>SF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	079		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White & Black Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(Room #204 - Closet Only) & Room #102 (NOT OBSERVED) -1918 Bldg.		
MATERIAL QUANTITY:	630	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24781** BULDING ID: **5210**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Piccolo Elementary School** REVIEW DATE: **6/4/2025**

ADDRESS: **1040 N. Keeler Avenue** IDPH LICENSE NO: **100-18790**

---

HOMOGENEOUS AREA: **079**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White & Black Streaks VFT**

MATERIAL LOCATION: **(Room #204 - Closet Only) & Room #102 (NOT OBSERVED) -1918 Bldg.**

MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	080		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White & Black Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Closet Only (Room 204) and room #102 (NOT OBSERVED) - 1918 Bldg.		
MATERIAL QUANTITY:	630	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **080**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White & Black Streaks VFT Mastic**

MATERIAL LOCATION: **Closet Only (Room 204) and room #102 (NOT OBSERVED) - 1918 Bldg.**

MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	081		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 103, 111, 327, 321 - 1918 Bldg. (A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Tiles were removed from closed wing in BLDG		

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **081**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT**

MATERIAL LOCATION: **Rooms 101, 103, 111, 327, 321 - 1918 Bldg.  
(A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	082		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 103, 111, 327, 321 - 1918 Bldg. (A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Tiles were removed from a closed wing in BLDG.		

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **082**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 101, 103, 111, 327, 321 - 1918 Bldg.  
(A total of 1400 SF of tile/mastic were removed from Rooms 112 and 210 in 2012.)**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	083		
MATERIAL DESCRIPTION:	12"x12" Brown Grain VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 209 - 1918 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **083**

MATERIAL DESCRIPTION: **12"x12" Brown Grain VFT**

MATERIAL LOCATION: **Room 209 - 1918 Bldg.**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	084		
MATERIAL DESCRIPTION:	12"x12" Brown Grain VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 209 - 1918 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **084**

MATERIAL DESCRIPTION: **12"x12" Brown Grain VFT Mastic**

MATERIAL LOCATION: **Room 209 - 1918 Bldg.**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	085		
MATERIAL DESCRIPTION:	12"x12" Light Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **085**

MATERIAL DESCRIPTION: **12"x12" Light Brown VFT**

MATERIAL LOCATION: **Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	086		
MATERIAL DESCRIPTION:	12"x12" Light Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **086**

MATERIAL DESCRIPTION: **12"x12" Light Brown VFT Mastic**

MATERIAL LOCATION: **Rooms 204 (NOT OBSERVED), 304 & 305 - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	087		
MATERIAL DESCRIPTION:	9"x9" White VFT (NOT OBSERVED)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 314 - 1918 Bldg.		
MATERIAL QUANTITY:	0	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **087**

MATERIAL DESCRIPTION: **9"x9" White VFT (NOT OBSERVED)**

MATERIAL LOCATION: **Room 314 - 1918 Bldg.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	088		
MATERIAL DESCRIPTION:	9"x9" White VFT Mastic (NOT OBSERVED)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 314 - 1918 Bldg.		
MATERIAL QUANTITY:	0	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **088**

MATERIAL DESCRIPTION: **9"x9" White VFT Mastic (NOT OBSERVED)**

MATERIAL LOCATION: **Room 314 - 1918 Bldg.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	089		
MATERIAL DESCRIPTION:	12"x12" Off White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 304 & 305 - 1918 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **089**

MATERIAL DESCRIPTION: **12"x12" Off White VFT**

MATERIAL LOCATION: **Rooms 304 & 305 - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	090		
MATERIAL DESCRIPTION:	12"x12" Off White VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 304 & 305 - 1918 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **090**

MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**

MATERIAL LOCATION: **Rooms 304 & 305 - 1918 Bldg.**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	091		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Beige Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rooms 301, 303, 308, 309 - 1918 Bldg.  
(500 SF removed from Rm 202 in 2012. )**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Piccolo Elementary School	REVIEW DATE:	6/4/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

HOMOGENEOUS AREA: **091**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Beige Streaks VFT**

MATERIAL LOCATION: **Rooms 301, 303, 308, 309 - 1918 Bldg.  
(500 SF removed from Rm 202 in 2012. )**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	092		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Beige Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 301, 303, 308, 309 - 1918 Bldg.  
(500 SF removed from Rm 202 in 2012)**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **092**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Beige Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 301, 303, 308, 309 - 1918 Bldg.  
(500 SF removed from Rm 202 in 2012)**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	093		
MATERIAL DESCRIPTION:	12"x12" White w/ Yellow Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor Dean's Office - 1918 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **093**

MATERIAL DESCRIPTION: **12"x12" White w/ Yellow Streaks VFT**

MATERIAL LOCATION: **1st Floor Dean's Office - 1918 Bldg.**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	094		
MATERIAL DESCRIPTION:	12"x12" White w/ Yellow Streaks VFT Mastic (NOT OBSERVED)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Dean's Office - 1918 Bldg.		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **094**

MATERIAL DESCRIPTION: **12"x12" White w/ Yellow Streaks VFT Mastic (NOT OBSERVED)**

MATERIAL LOCATION: **1st Floor Dean's Office - 1918 Bldg.**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	095		
MATERIAL DESCRIPTION:	12"x12" Peach VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 310 - 1918 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **095**

MATERIAL DESCRIPTION: **12"x12" Peach VFT**

MATERIAL LOCATION: **Room 310 - 1918 Bldg.**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

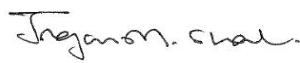

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	096		
MATERIAL DESCRIPTION:	12"x12" Peach VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 310 - 1918 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **096**

MATERIAL DESCRIPTION: **12"x12" Peach VFT Mastic**

MATERIAL LOCATION: **Room 310 - 1918 Bldg.**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

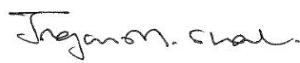

Date: **06/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	097		
MATERIAL DESCRIPTION:	9"x9" White w/ Black Streaks VFT (NOT OBSERVED)		
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 205 Wardrobe- 1918 Bldg.

MATERIAL QUANTITY: 0 MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **097**

MATERIAL DESCRIPTION: **9"x9" White w/ Black Streaks VFT (NOT OBSERVED)**

MATERIAL LOCATION: **Room 205 Wardrobe- 1918 Bldg.**

MATERIAL QUANTITY: **0** MATERIAL UNITS:

DAMAGE QUANTITY: **0** DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	098		
MATERIAL DESCRIPTION:	9"x9" White w/ Black Streaks VFT Mastic (NOT OBSERVED)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 205 Wardrobe - 1918 Bldg.		
MATERIAL QUANTITY:	0	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **098**

MATERIAL DESCRIPTION: **9"x9" White w/ Black Streaks VFT Mastic (NOT OBSERVED)**

MATERIAL LOCATION: **Room 205 Wardrobe - 1918 Bldg.**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	099		
MATERIAL DESCRIPTION:	Gray Fireproofing		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1965 Bldg.		
MATERIAL QUANTITY:	60000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **099**

MATERIAL DESCRIPTION: **Gray Fireproofing**

MATERIAL LOCATION: **Throughout - 1965 Bldg.**

MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	1		
MATERIAL DESCRIPTION:	Spray on insulation above ceiling tiles		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	above ceiling tiles in Addition 1965		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **Spray on insulation above ceiling tiles**

MATERIAL LOCATION: **above ceiling tiles in Addition 1965**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	100		
MATERIAL DESCRIPTION:	9"x9" Spotted Brown VFT (Under New VFT)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 110, 1st floor storage - 1918 Bldg		
MATERIAL QUANTITY:	1310	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **100**

MATERIAL DESCRIPTION: **9"x9" Spotted Brown VFT (Under New VFT)**

MATERIAL LOCATION: **Rooms 110, 1st floor storage - 1918 Bldg**

MATERIAL QUANTITY: **1310** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101		
MATERIAL DESCRIPTION:	9"x9" Spotted Brown VFT Mastic (Under New VFT)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 110, 1st floor storage - 1918 Bldg		
MATERIAL QUANTITY:	1310	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **9"x9" Spotted Brown VFT Mastic (Under New VFT)**

MATERIAL LOCATION: **Rooms 110, 1st floor storage - 1918 Bldg**

MATERIAL QUANTITY: **1310** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102		
MATERIAL DESCRIPTION:	9"x9" Beige VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	<b>1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.</b>		
MATERIAL QUANTITY:	<b>759</b>	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **102**

MATERIAL DESCRIPTION: **9"x9" Beige VFT**

MATERIAL LOCATION: **1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.**

MATERIAL QUANTITY: **759** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103		
MATERIAL DESCRIPTION:	9"x9" Beige VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.		
MATERIAL QUANTITY:	759	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **103**

MATERIAL DESCRIPTION: **9"x9" Beige VFT Mastic**

MATERIAL LOCATION: **1st Floor Store Room and 303 MDF Closet, 3rd Floor Janitors Closet - 1918 Bldg.**

MATERIAL QUANTITY: **759** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104		
MATERIAL DESCRIPTION:	12"x12" Beige VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 102; Storage (Room 104) - 1918 Bldg		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **104**

MATERIAL DESCRIPTION: **12"x12" Beige VFT**

MATERIAL LOCATION: **Room 102; Storage (Room 104) - 1918 Bldg**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	105		
MATERIAL DESCRIPTION:	12"x12" Beige VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 102; Storage (Room 104) - 1918 Bldg		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **105**

MATERIAL DESCRIPTION: **12"x12" Beige VFT Mastic**

MATERIAL LOCATION: **Room 102; Storage (Room 104) - 1918 Bldg**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	AHERA INSPECTOR:	<b>Allizon Brooks</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>		INSPECTION DATE:	<b>5/8/2025</b>	
ADDRESS:	<b>1040 N. Keeler Avenue</b>		IDPH LICENSE NO:	<b>100-18790</b>	

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **9"x9" Tan VFT -(REMOVED 2012)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION: **Follow O&M Plan**

ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Lunchroom - 1965 bldg.  
(3000 SF removed in 2012)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: **05/08/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Piccolo Elementary School	REVIEW DATE:	6/4/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

HOMOGENEOUS AREA: 106

MATERIAL DESCRIPTION: 9"x9" Tan VFT -(REMOVED 2012)

MATERIAL LOCATION: Lunchroom - 1965 bldg.  
(3000 SF removed in 2012)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 06/04/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107	
MATERIAL DESCRIPTION:	9"x9" Tan VFT Mastic (REMOVED 2012)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Abated	FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Lunchroom - 1965 bldg.  
(3000 SF removed in 2012)

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Piccolo Elementary School	REVIEW DATE:	6/4/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **9"x9" Tan VFT Mastic (REMOVED 2012)**

MATERIAL LOCATION: **Lunchroom - 1965 bldg.  
(3000 SF removed in 2012)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	108		
MATERIAL DESCRIPTION:	Terrazo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st fl corridor and stair, landings - 1918 Bldg.		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **108**

MATERIAL DESCRIPTION: **Terrazo**

MATERIAL LOCATION: **1st fl corridor and stair, landings - 1918 Bldg.**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109		
MATERIAL DESCRIPTION:	Brown Carpet Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 306/307 --1918 Building		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **109**

MATERIAL DESCRIPTION: **Brown Carpet Adhesive**

MATERIAL LOCATION: **Room 306/307 --1918 Building**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	110		
MATERIAL DESCRIPTION:	Adobe Mosaic Ceramic Tile Grout		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **110**

MATERIAL DESCRIPTION: **Adobe Mosaic Ceramic Tile Grout**

MATERIAL LOCATION: **1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111		
MATERIAL DESCRIPTION:	Adobe Mosaic Ceramic Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **111**

MATERIAL DESCRIPTION: **Adobe Mosaic Ceramic Tile Adhesive**

MATERIAL LOCATION: **1918 Building: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	112		
MATERIAL DESCRIPTION:	12"x12" Sand Colored Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1918 Building: Room 205		
MATERIAL QUANTITY:	1090	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **112**

MATERIAL DESCRIPTION: **12"x12" Sand Colored Floor Tile**

MATERIAL LOCATION: **1918 Building: Room 205**

MATERIAL QUANTITY: **1090** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	113		
MATERIAL DESCRIPTION:	12"x12" Sand Colored Floor Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: Room 205		
MATERIAL QUANTITY:	1090	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **113**

MATERIAL DESCRIPTION: **12"x12" Sand Colored Floor Tile Adhesive**

MATERIAL LOCATION: **1918 Building: Room 205**

MATERIAL QUANTITY: **1090** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

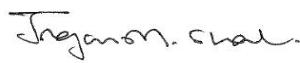

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	114		
MATERIAL DESCRIPTION:	12"x12" Gray Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1918 Building: Room 202		
MATERIAL QUANTITY:	930	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **114**

MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile**

MATERIAL LOCATION: **1918 Building: Room 202**

MATERIAL QUANTITY: **930** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	115		
MATERIAL DESCRIPTION:	12"x12" Gray Floor Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: Room 202		
MATERIAL QUANTITY:	930	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **115**

MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile Adhesive**

MATERIAL LOCATION: **1918 Building: Room 202**

MATERIAL QUANTITY: **930** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116		
MATERIAL DESCRIPTION:	12"x12" White w/Multi-Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	<b>1918 Building: Room 110</b>		
MATERIAL QUANTITY:	<b>1000</b>	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **116**

MATERIAL DESCRIPTION: **12"x12" White w/Multi-Specks Floor Tile**

MATERIAL LOCATION: **1918 Building: Room 110**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	117		
MATERIAL DESCRIPTION:	12"x12" White w/Multi-Specks Floor Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: Room 110		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **117**

MATERIAL DESCRIPTION: **12"x12" White w/Multi-Specks Floor Tile Adhesive**

MATERIAL LOCATION: **1918 Building: Room 110**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	118		
MATERIAL DESCRIPTION:	12"x12" Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1918 Building: Room 110		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **118**

MATERIAL DESCRIPTION: **12"x12" Blue Floor Tile**

MATERIAL LOCATION: **1918 Building: Room 110**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	119		
MATERIAL DESCRIPTION:	12"x12" Blue Floor Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: Room 110		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **119**

MATERIAL DESCRIPTION: **12"x12" Blue Floor Tile Adhesive**

MATERIAL LOCATION: **1918 Building: Room 110**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:

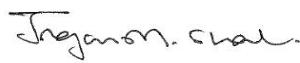

Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	120		
MATERIAL DESCRIPTION:	Blue Carpet Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1918 Building: Assembly Hall NOT OBSERVED. Removed/covered in 2012 with 24" X 24" gray slip-free rubber flooring.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA:	<b>120</b>		
MATERIAL DESCRIPTION:	<b>Blue Carpet Adhesive</b>		
MATERIAL LOCATION:	<b>1918 Building: Assembly Hall</b> <b>NOT OBSERVED. Removed/covered in 2012 with 24" X 24" gray slip-free rubber flooring.</b>		
MATERIAL QUANTITY:	<b>2000</b>	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	121		
MATERIAL DESCRIPTION:	Red Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1965 Addition: 2nd & 3rd Floor Stairways		
MATERIAL QUANTITY:	2850	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **121**

MATERIAL DESCRIPTION: **Red Terrazzo**

MATERIAL LOCATION: **1965 Addition: 2nd & 3rd Floor Stairways**

MATERIAL QUANTITY: **2850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	122		
MATERIAL DESCRIPTION:	Mosaic Ceramic Tile Grout		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms		
MATERIAL QUANTITY:	4170	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **122**

MATERIAL DESCRIPTION: **Mosaic Ceramic Tile Grout**

MATERIAL LOCATION: **1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms**

MATERIAL QUANTITY: **4170** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	123		
MATERIAL DESCRIPTION:	Mosaic Ceramic Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms		
MATERIAL QUANTITY:	4170	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **123**

MATERIAL DESCRIPTION: **Mosaic Ceramic Tile Adhesive**

MATERIAL LOCATION: **1965 Addition: 1st, 2nd & 3rd Floor Girl's & Boy's Washrooms**

MATERIAL QUANTITY: **4170** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	124		
MATERIAL DESCRIPTION:	12"x12" White Floor Tile w/Tan Specks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	<b>1965 Addition: Room 129 &amp; 122</b>		
MATERIAL QUANTITY:	<b>1400</b>	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **124**

MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Tan Specks**

MATERIAL LOCATION: **1965 Addition: Room 129 & 122**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	125		
MATERIAL DESCRIPTION:	12"x12" White Floor Tile w/Tan Specks Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1965 Addition: Room 129 & 122		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **125**

MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Tan Specks Adhesive**

MATERIAL LOCATION: **1965 Addition: Room 129 & 122**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	126		
MATERIAL DESCRIPTION:	12"x12" White Fissured Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1965 Addition: Lunchroom		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **126**

MATERIAL DESCRIPTION: **12"x12" White Fissured Ceiling Tile**

MATERIAL LOCATION: **1965 Addition: Lunchroom**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	127		
MATERIAL DESCRIPTION:	12"x12" White Fissured Ceiling Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1965 Addition: Lunchroom		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **127**

MATERIAL DESCRIPTION: **12"x12" White Fissured Ceiling Tile Adhesive**

MATERIAL LOCATION: **1965 Addition: Lunchroom**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	128		
MATERIAL DESCRIPTION:	12" X 12" Tan with white streaks, VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.		
MATERIAL QUANTITY:	1960	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA:	<b>128</b>				
MATERIAL DESCRIPTION:	<b>12" X 12" Tan with white streaks, VFT</b>				
MATERIAL LOCATION:	<b>Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.</b>				
MATERIAL QUANTITY:	<b>1960</b>	MATERIAL UNITS:	<b>SF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	129		
MATERIAL DESCRIPTION:	12" X 12" Tan with white streaks, Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.**

MATERIAL QUANTITY: **1960** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA:	<b>129</b>				
MATERIAL DESCRIPTION:	<b>12" X 12" Tan with white streaks, Mastic</b>				
MATERIAL LOCATION:	<b>Vault Main Office (60 SF); Main Office Reception Area (1200 SF); Rm 104 (700 SF). All in 1918 Bldg.</b>				
MATERIAL QUANTITY:	<b>1960</b>	MATERIAL UNITS:	<b>SF</b>		
DAMAGE QUANTITY:	<b>0</b>	DAMAGE UNITS:	<b>SF</b>		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	130		
MATERIAL DESCRIPTION:	Transite hood		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rm 305 Lab Work Room		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **130**

MATERIAL DESCRIPTION: **Transite hood**

MATERIAL LOCATION: **Rm 305 Lab Work Room**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	131		
MATERIAL DESCRIPTION:	Transite sink & counterop		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lab Work Rooms in 303, 305, 306; Biology Lab in Rm 301.		
MATERIAL QUANTITY:	215	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **131**

MATERIAL DESCRIPTION: **Transite sink & counterop**

MATERIAL LOCATION: **Lab Work Rooms in 303, 305, 306; Biology Lab in Rm 301.**

MATERIAL QUANTITY: **215** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	132		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Streaks VFT - 1965 Bldg		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom		
MATERIAL QUANTITY:	9000	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **132**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Streaks VFT - 1965 Bldg**

MATERIAL LOCATION: **Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom**

MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	133		
MATERIAL DESCRIPTION:	12"x12" Beige w/Streaks VFT Mastic - 1965 Bldg		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom		
MATERIAL QUANTITY:	9000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **133**

MATERIAL DESCRIPTION: **12"x12" Beige w/Streaks VFT Mastic - 1965 Bldg**

MATERIAL LOCATION: **Rooms 124, 126, 213, 214, 215, 218, 222, 224, Lunchroom**

MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	134		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 228- 1965 addition		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **134**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Room 228- 1965 addition**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	2		
MATERIAL DESCRIPTION:	12"x12" Blue Specks Floor Tile & Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 110 Toilet		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUILDING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **12"x12" Blue Specks Floor Tile & Mastic**

MATERIAL LOCATION: **Room 110 Toilet**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	2A		
MATERIAL DESCRIPTION:	12" x12" Blue Specks Floor Tile & Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 110 Toilet		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **2A**

MATERIAL DESCRIPTION: **12" x12" Blue Specks Floor Tile & Mastic**

MATERIAL LOCATION: **Room 110 Toilet**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	3		
MATERIAL DESCRIPTION:	12" x 12" Beige specks floor tile & mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	<b>Room 203 and 205</b>		
MATERIAL QUANTITY:	<b>1200</b>	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: **05/08/2025**

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **3**

MATERIAL DESCRIPTION: **12" x 12" Beige specks floor tile & mastic**

MATERIAL LOCATION: **Room 203 and 205**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24781	BUIDLING ID:	5210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Piccolo Elementary School	INSPECTION DATE:	5/8/2025		
ADDRESS:	1040 N. Keeler Avenue	IDPH LICENSE NO:	100-18790		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	3A		
MATERIAL DESCRIPTION:	12" x 12" Beige specks floor tile & mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 203 and 205		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: \_\_\_\_\_ Date: 05/08/2025

# Chicago Public Schools

## Specialty Consulting, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24781</b>	BUIDLING ID:	<b>5210</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Jigar Shah</b>		
SCHOOL NAME:	<b>Piccolo Elementary School</b>	REVIEW DATE:	<b>6/4/2025</b>		
ADDRESS:	<b>1040 N. Keeler Avenue</b>	IDPH LICENSE NO:	<b>100-18790</b>		

---

HOMOGENEOUS AREA: **3A**

MATERIAL DESCRIPTION: **12" x 12" Beige specks floor tile & mastic**

MATERIAL LOCATION: **Room 203 and 205**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24781** BUIDLING ID: **5210**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Allizon Brooks**  
SCHOOL NAME: **Piccolo Elementary School** INSPECTION DATE: **5/8/2025**  
ADDRESS: **1040 N. Keeler Avenue** IDPH LICENSE NO: **100-18790**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **135**  
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT**  
MATERIAL LOCATION: **Rooms 321 and 327 - 1965 Addition**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:

Date: **05/08/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24781** BUIDLING ID: **5210**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Piccolo Elementary School** REVIEW DATE: **6/4/2025**

ADDRESS: **1040 N. Keeler Avenue** IDPH LICENSE NO: **100-18790**

HOMOGENEOUS AREA: **135**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT**

MATERIAL LOCATION: **Rooms 321 and 327 - 1965 Addition**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/04/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24781** BUIDLING ID: **5210**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Allizon Brooks**  
SCHOOL NAME: **Piccolo Elementary School** INSPECTION DATE: **5/8/2025**  
ADDRESS: **1040 N. Keeler Avenue** IDPH LICENSE NO: **100-18790**

---

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **136**  
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT Mastic**  
MATERIAL LOCATION: **Rooms 321 and 327 - 1965 Addition**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach** DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:

Date: **05/08/2025**

# Chicago Public Schools

Specialty Consulting, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24781** BUIDLING ID: **5210**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Piccolo Elementary School** REVIEW DATE: **6/4/2025**

ADDRESS: **1040 N. Keeler Avenue** IDPH LICENSE NO: **100-18790**

HOMOGENEOUS AREA: **136**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 321 and 327 - 1965 Addition**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

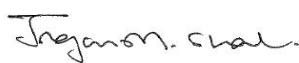

Date: **06/04/2025**

## APPENDIX B

---

### Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS  
PROFESSIONAL  
LICENSE

ID NUMBER  
100 - 18790

ISSUED  
4/5/2024

EXPIRES  
05/15/2025

ALLIZON L BROOKS  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

Environmental Health



ALLIZON L BROOKS  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

4/5/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18790

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License


ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18790	ISSUED 4/5/2024	EXPIRES 05/15/2025	INSPECTOR	1/27/2025
ALLIZON L BROOKS 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL	<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	6/12/2024

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

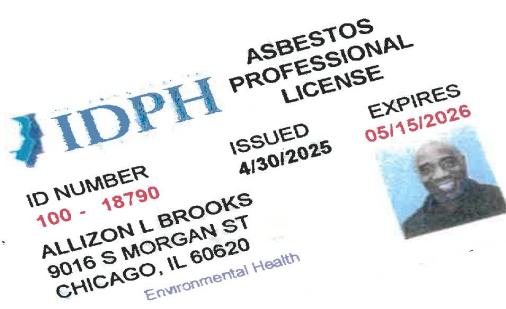

ENDORSEMENTS	TC EXPIRES
INSPECTOR	1/4/2026
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	6/1/2025
<b>Alteration of this license shall result in legal action</b>	
This license issued under authority of the State of Illinois	
Department of Public Health	
This license is valid only when accompanied by a valid	
training course certificate.	

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that ALLIZON L. BROOKS  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • [www.public-health-safety.com](http://www.public-health-safety.com)

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR02

Certificate Number:

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

A handwritten signature in black ink that appears to read "Nicholas J. Peneff".



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER <b>100 - 07342</b>	ISSUED <b>6/9/2025</b>	EXPIRES <b>05/15/2026</b>	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	


If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH, IMPROVING LIVES  
*Nationally Accredited by PHAB*

7233 S. Adams Street | Willowbrook, IL 60527  
(630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2023

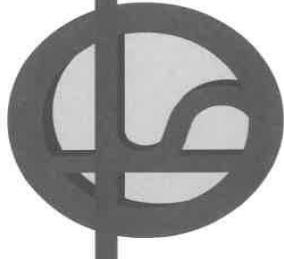

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

*Kathy DeSalvo*

Kathy DeSalvo, Director



# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

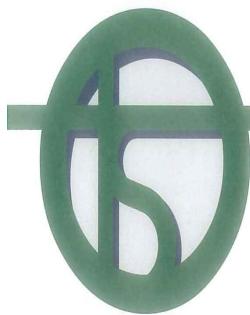

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS  
PROFESSIONAL  
LICENSE

ID NUMBER  
100 - 07342

ISSUED  
4/1/2022

EXPIRES  
05/15/2023

JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License



Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS  
PROFESSIONAL  
LICENSE

ID NUMBER  
100 - 07342

ISSUED  
4/8/2024

EXPIRES  
05/15/2025

JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH  
2942 W VAN BUREN ST  
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

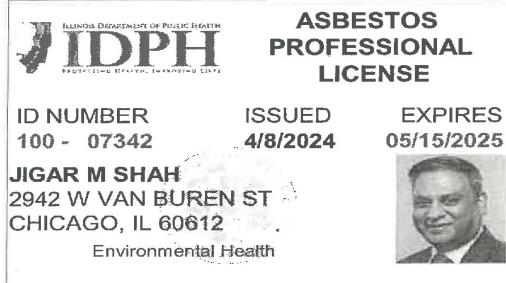

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<b>Alteration of this license shall result in legal action</b>	
This license issued under authority of the State of Illinois	
Department of Public Health	
This license is valid only when accompanied by a valid	
training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH. IMPROVING LIVES

*Nationally Accredited by PHAB*



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2024

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2025

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

---

Kristina Miczek, Training Manager

## APPENDIX C

---

### **Laboratory Accreditations**

## APPENDIX D

---

### Laboratory Results

## APPENDIX E

---

### Chain of Custody Forms

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>	Loc	Localized
	Dist	Distributed