

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-3525
SCHOOL NAME: Stock School
ADDRESS OF SCHOOL: 7507 W Birchwood Avenue
CITY: Chicago, IL, 60648

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 6/21/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 1/17/2025 ENROLLMENT 599
IDPH INSPECTOR LICENSE NUMBER: 100-18350
IDPH LICENSED INSPECTOR NAME (Please Print): Joseph Hennigan
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 2/18/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Stock School

7507 W Birchwood Avenue
Chicago, IL, 60648

Unit: 24781
Building ID: 5770

IDPH ID Number: 14-016-2990-3525

REPORT DATE:
Tuesday, February 18, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street
Chicago, IL, 60612
Phone (312) 319-7575
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

02/18/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 30081 Region: 01 IDPH ID: 14-016-2990-3525

School: Stock School Building ID: 5770

Address: 7507 W Birchwood Avenue

Chicago, IL, 60648

Building Contact: Hennmueller, Mark Contact Phone: 7737096346

Current Building Owners: Chicago Public Schools

Reinspection Date: 1/17/2025

Review Date: 02/18/2025

Inspector: Joseph Hennigan

Inspector IDPH License: 100-18350

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: February 18, 2025

RE: Stock School, Unit 24781
7507 W Birchwood Avenue
Chicago, IL, 60648

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Stock School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Stock School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J. Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074.

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Stock School Unit: 30081 Region: 01
Address: 7507 W Birchwood Avenue Chicago, IL, 60648
IDPH ID: 14-016-2990-3525 Building ID: 5770
Contact: Hemmueller, Mark Phone: 7737096346

2. Description of Facility

Original Construction: 1999 Additional Construction:
Total Square Footage: 1005 No of Floors: 1
Current Occupancy: 599

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Joseph Hennigan



Signature:
Date: 1/17/2025

Inspector IDPH license # 100-18350
Reinspection Date: 1/17/2025

6. Management Planner

Management Planner Name: Jigar Shah



Signature:
Date: 02/18/2025


Management Planner IDPH license # 100-07342

7. Review Date: 02/18/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

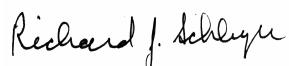

Richard J. Schleyer

Date: 2/18/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Stock School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5770:

35	12"x12" Off White w/ Beige and Gray Streaks VFT
39A	12"x12" Rust w/White Specks VFT Mastic
47	2'x2' Smooth Ceiling Tile
A	Cardboard Pipe Insulation
D	MJP E/F/V on Fiberglass Pipe Insulation
E	Aircell Pipe Insulation

B. The following new homogenous areas have been identified for Building 5770:

- 52 Terrazzo Flooring
- 53 12"x12" white w/ gray streaks VFT
- 53A 12"x12" white w/ gray streaks VFT Mastic
- 54 Spray on Sink Undercoating - Gray
- 55 Sprayed on Sink Overcoating - Black
- 56 Sprayed on Sink Undercoating - White
- 57 Sprayed on Sink Undercoating - Black
- 58 12"x12" Light Blue with White Gray Specks Replacement VFT
- 58A 12"x12" Light Blue with White Gray Specks Replacement VFT Mastic
- 59 Replacement Ceiling Tiles 1'x1' white w/ dots and pinholes
- 59A Replacement Ceiling tiles for HA-44 and HA-44A, 1'x1' white w/ dots and pinholes
- 60 12"x12" Gray w/ white streaks VFT (replacing HA-50 and HA-51)
- 60A 12"x12" Gray w/ white streaks VFT Mastic - Replacing HA-50/51

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Acoustical Plaster
14	Drywall
15	Baseboard
16	Baseboard Mastic
19	12"x12" Blue VFT
31	12"x12" White VFT
32	12"x12" White VFT Mastic
35	12"x12" Off White w/ Beige and Gray Streaks VFT
35A	12"x12" Off White w/ Beige and Gray Streaks VFT Mastic
36	Acoustical Ceiling with Grooves
37	Drywall System
38	12"x12" Tan w/White Specks VFT
38A	12"x12" Tan w/White Specks VFT Mastic
39	12"x12" Rust w/White Specks VFT
39A	12"x12" Rust w/White Specks VFT Mastic
40	12"x12" Red VFT
40A	12"x12" Red VFT Mastic
41	Carpet Mastic
42	2'x2' Smooth Ceiling Tile
43	2'x4' Ceiling Tle
44	1'x1' Ceiling Tile
44A	1'x1' Ceiling Tile Mastic Pucks
45	12"x12" Pink w/White & Brown Specks VFT
45A	12"x12" Pink w/White & Brown specks VFT Mastic
46	12"x12" Rust w/White Specks VFT
46A	12"x12" Rust w/White Specks VFT Mastic
47	2'x2' Smooth Ceiling Tile
48	12"x12" Beige w/ Mixed Specs VFT
49	12"x12" Beige w/ Mixed Specs VFT Mastic
50	12"x12" Light Blue w/ Specs VFT
51	12"x12" Light Blue w/ Specs VFT Mastic
52	Terrazzo Flooring
53	12"x12" white w/ gray streaks VFT
53A	12"x12" white w/ gray streaks VFT Mastic
54	Spray on Sink Undercoating - Gray
55	Sprayed on Sink Overcoating - Black
56	Sprayed on Sink Undercoating - White
57	Sprayed on Sink Undercoating - Black
58	12"x12" Light Blue with White Gray Specks Replacement VFT
58A	12"x12" Light Blue with White Gray Specks

59	Replacement VFT Mastic Replacement Ceiling Tiles 1'x1' white w/ dots and pinholes
59A	Replacement Ceiling tiles for HA-44 and HA-44A, 1'x1' white w/ dots and pinholes
60	12"x12" Gray w/ white streaks VFT (replacing HA- 50 and HA-51)
60A	12"x12" Gray w/ white streaks VFT Mastic - Replacing HA-50/51
I	Mud Boiler Gaskets

The following areas were deemed to be inaccessible:

53A	12"x12" white w/ gray streaks VFT Mastic
-----	--

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Joseph Hennigan, IDPH License # 100-18350. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Stock School Building 5770 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Acoustical Plaster	1,500	SF	Rooms 109, 111, 112/114 All Purpose Room, Corridor -1960 bldg	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
05	12"x12" Tan w/ Brown and White Streaks VFT	1,800	SF	Kitchen, Kitchen Storage, Rooms 108, 100, 101, Corridor Outside Kitchen - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06	9"x9" Tan VFT	2,500	SF	Rooms 103, 105, Corridor - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07	12"x12" Tan w/Brown & White Streaks VFT Mastic	1,800	SF	Kitchen, Kitchen Storage, Rooms 100, 108, 101, Corridor Outside Kitchen - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	9"x9" Tan VFT Mastic	2,500	SF	Rooms 103, 105, Corridor - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	12"x12" Tan VFT	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
11	12"x12" Tan VFT Mastic	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Drywall	600	SF	Throughout - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Baseboard	30	LF	Engineer Office - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Baseboard Mastic	30	LF	Engineer Office - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12"x12" Blue VFT	1,400	SF	Room 104, Public Office Storage - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	12"x12" Blue VFT Mastic	1,400	SF	Room 104, Public Office Storage - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Blue VFT	1,600	SF	Rooms 109 (NOT)	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				OBSERVED) & 111 - 1960 Addition								potential for damage		
20	12"x12" Blue VFT Mastic	1,600	SF	Rooms 109 & 111 - 1960 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	9"x9" Brown VFT	50	SF	Hallway outside Room 105 - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
22	9"x9" Brown VFT Mastic	50	SF	Hallway outside Room 105 - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" White w/Tan Specs VFT	1,800	SF	Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
24	12"x12" White w/Tan Specs VFT Mastic	1,800	SF	Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12"x12" Beige (White w/Tan specs) VFT	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
26	12"x12" Beige (White w/Tan specs) VFT Mastic	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12"x12" Gray VFT (ABATED)			Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)	ABATED	MISC								
28	12"x12" Gray VFT Mastic (ABATED)			Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)	ABATED	MISC								
29	9"x9" Gray w/ Green VFT	2,000	SF	Rooms 102 and 106 - 1955 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
30	9"x9" Gray w/ Green VFT Mastic	2,000	SF	Rooms 102 and 106	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				- 1955 Building								potential for damage		
31	12"x12" White VFT	120	SF	Room 112 Storage - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
32	12"x12" White VFT Mastic	120	SF	Room 112 Storage - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	MJP E/F/V on Fiberglass Pipe Insulation	55	FITTING	Crawlspac, Teachers Toilet Pipe Chase - 1960 Addition	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
34	2x4' Ceiling tiles (Removed)			Rooms 109 & 111 - 1960 Addition (Removed)	ABATED	MISC								
35	12"x12" Off White w/ Beige and Gray Streaks VFT	1,000	SF	Mobile Unit	ASSUMED	MISC	N	DIST	100		Yes	ACBM with the potential for damage	3	LOW
35A	12"x12" Off White w/ Beige and Gray Streaks VFT Mastic	1,000	SF	Mobile Unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	Acoustical Ceiling with Grooves	1,000	SF	Mobile Unit	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
37	Drywall System	2,000	SF	Mobile Unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12"x12" Tan w/White Specks VFT	160	SF	Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
38A	12"x12" Tan w/White Specks VFT Mastic	160	SF	Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12"x12" Rust w/White Specks VFT	200	SF	Toilets in Rooms 103 (NOT OBSERVED), 104, 105, 106, 102, JC next to Room 101 - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
39A	12"x12" Rust w/White Specks VFT Mastic	200	SF	Toilets in Rooms 102,103 (NOT OBSERVED), 104, 105, 106, JC next to Room 101 - 1955 Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
40	12"x12" Red VFT	600	SF	Main Office - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
40A	12"x12" Red VFT Mastic	600	SF	Main Office - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	Carpet Mastic	500	SF	Principals Office - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	2'x2' Smooth Ceiling Tile	180	SF	Toilets in Rooms 102, 103, 104, 105, 106 - 1955 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
43	2'x4' Ceiling Tile	500	SF	Room 100 - 1955 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
44	1'x1' Ceiling Tile	9,500	SF	Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
44A	1'x1' Ceiling Tile Mastic Pucks	9,500	SF	Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12"x12" Pink w/White & Brown Specks VFT	40	SF	Toilet next to Gym 112/114 - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
45A	12"x12" Pink w/White & Brown specks VFT Mastic	40	SF	Toilet next to Gym 112/114 - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12"x12" Rust w/White Specks VFT	200	SF	Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
46A	12"x12" Rust w/White Specks VFT Mastic	200	SF	Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	2'x2' Smooth Ceiling Tile	150	SF	Room 109 (NOT OBSERVED) & 111 Toilets. Toilet next to gym 112/114, Toilet by Teachers Lounge - 1960 Addition	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
48	12"x12" Beige w/ Mixed Specs VFT	2,000	SF	Rooms 103 and 105	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				- 1955 Building								potential for damage		
49	12"x12" Beige w/ Mixed Specs VFT Mastic	2,000	SF	Rooms 103 and 105 - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	12"x12" Light Blue w/ Specs VFT	1,046	SF	Rooms 109 and 111 - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
51	12"x12" Light Blue w/ Specs VFT Mastic	1,046	SF	Rooms 109 and 111 - 1960 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	Terrazzo Flooring	40	SF	Vestibule @ South Entry Doorway	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
53	12"x12" white w/ gray streaks VFT	30	SF	Rooms 102, 106 - 1955 building	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
53A	12"x12" white w/ gray streaks VFT Mastic	30	SF	Rooms 102, 106 - 1955	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
54	Spray on Sink Undercoating - Gray	20	SF	Rooms 108, 101 - 1955 building	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
55	Sprayed on Sink Overcoating - Black	40	SF	1955 Building - 102, 103, 104, 105, and principal's office	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
56	Sprayed on Sink Undercoating - White	10	SF	1955 Building - 106	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
57	Sprayed on Sink Undercoating - Black	20	SF	1960 building - 109 and 111	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
58	12"x12" Light Blue with White Gray Specks Replacement VFT	150	SF	1960 Addition Building - Room 111	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
58A	12"x12" Light Blue with White Gray Specks Replacement VFT Mastic	150	SF	1960 Addition Building - Room 111	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
59	Replacement Ceiling Tiles 1'x1' white w/ dots and pinholes	103	SF	1955 - 103, 105, 102	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
59A	Replacement Ceiling tiles for HA-44 and HA-44A, 1'x1' white w/ dots and pinholes	103	SF	1955 - 103, 105, 102	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
60	12"x12" Gray w/ white streaks VFT (replacing HA-50 and HA-51)	4	SF	1960 - room 111	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
60A	12"x12" Gray w/ white streaks VFT Mastic - Replacing HA-50/51	4	SF	1960 - room 111	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A	Cardboard Pipe Insulation	20	LF	Boiler Room, Crawlspace - 1955 Building	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage	2	LOW
B	MJP E/F/V on Cardboard Pipe Insulation	5	FITTING	Boiler Room, Crawlspace - 1955 Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
D	MJP E/F/V on Fiberglass Pipe Insulation	10	FITTING	Boiler Room, Crawlspace - 1955	CHR	TSI	Y	LOC	0		Yes	ACBM with the potential for damage	5	LOW

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building										
E	Aircell Pipe Insulation	30	LF	Boiler Room, Crawlspace - 1955 Building	CHR	TSI	Y	LOC	0		Yes	ACBM with the potential for damage	5	LOW
F	MJP E/F/V on Aircell Pipe Insulation	5	FITTING	Boiler Room, Crawlspace - 1955 Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage	5	MODERATE
I	Mud Boiler Gaskets	10	LF	Boiler Room - 1955 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
J	Mud Packing	2	SF	Boiler Room - 1955 Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage	5	LOW

Chicago Public Schools

School Stock School Unit 30081 Building ID 5770
Address 7507 W Birchwood Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>1/17/2025</u>
Inspector Name <u>Joseph Hennigan</u>
<u>100-18350</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
05	
06	
07	
08	
10	
11	
14	
15	
16	
17	
18	
19	(NOT OBSERVED in 109)
20	NOT OBSERVED in 109
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
31	
32	
33	
34	
35	Cracks in VFT Throughout Mobile Unit
35A	
36	
37	
38	
38A	
39	
39A	NOT OBSERVED in 103
40	
40A	
41	
42	
43	
44	
44A	
45	
45A	
46	
46A	
47	Removed From 109 (-30SF)
48	
49	
50	
51	
52	

Chicago Public Schools

School Stock School **Unit** 30081 **Building ID** 5770
Address 7507 W Birchwood Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
53	Damaged tiles (9x9) were replaced w/ this new HA and Cut to fit
53A	See HA-53 , damaged tiles replaced
54	
55	
56	
57	
58	
58A	
59	
59A	Replaced HA-44 and HA-44A
60	New Replacement Tiles for HA-50/51
60A	Replacement tiles for HA-50/51
A	
B	
D	Repaired
E	Repaired
F	Repaired
I	
J	Repaired

Table II
Management Planner's Review

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Acoustical Plaster	1,500	SF	Rooms 109, 111, 112/114 All Purpose Room, Corridor -1960 bldg	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" Tan w/ Brown and White Streaks VFT	1,800	SF	Kitchen, Kitchen Storage, Rooms 108, 100, 101, Corridor Outside Kitchen - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	9"x9" Tan VFT	2,500	SF	Rooms 103, 105, Corridor - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Tan w/Brown & White Streaks VFT Mastic	1,800	SF	Kitchen, Kitchen Storage, Rooms 100, 108, 101, Corridor Outside Kitchen - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	9"x9" Tan VFT Mastic	2,500	SF	Rooms 103, 105, Corridor - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12"x12" Tan VFT	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12"x12" Tan VFT Mastic	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Drywall	600	SF	Throughout - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Baseboard	30	LF	Engineer Office - 1955 Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
16	Baseboard Mastic	30	LF	Engineer Office - 1955 Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Blue VFT	1,400	SF	Room 104, Public Office Storage - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Blue VFT Mastic	1,400	SF	Room 104, Public Office Storage - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Blue VFT	1,600	SF	Rooms 109 (NOT OBSERVED) & 111 - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Blue VFT Mastic	1,600	SF	Rooms 109 & 111 - 1960 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	9"x9" Brown VFT	50	SF	Hallway outside Room 105 - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	9"x9" Brown VFT Mastic	50	SF	Hallway outside Room 105 - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" White w/Tan Specs VFT	1,800	SF	Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" White w/Tan Specs VFT Mastic	1,800	SF	Kitchen, Kitchen Storage, Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Outside Kitchen, Rooms 100, 101, 108 - 1955 Building							
25	12"x12" Beige (White w/Tan specs) VFT	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Beige (White w/Tan specs) VFT Mastic	2,200	SF	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" Gray VFT (ABATED)			Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)	Abated	MISC					
28	12"x12" Gray VFT Mastic (ABATED)			Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)	Abated	MISC					
29	9"x9" Gray w/ Green VFT	2,000	SF	Rooms 102 and 106 - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	9"x9" Gray w/ Green VFT Mastic	2,000	SF	Rooms 102 and 106 - 1955 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"x12" White VFT	120	SF	Room 112 Storage - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12"x12" White VFT Mastic	120	SF	Room 112 Storage - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	MJP E/F/V on Fiberglass Pipe Insulation	55	FITTING	Crawlspace, Teachers Toilet Pipe Chase - 1960 Addition	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
34	2'x4' Ceiling tiles (Removed)			Rooms 109 & 111 - 1960 Addition (Removed)	Abated	MISC					
35	12"x12" Off White w/ Beige and Gray Streaks VFT	1,000	SF	Mobile Unit	Assumed	MISC	No	100	SF	6 ACBM with the potential for damage	Follow O&M Plan
35A	12"x12" Off White w/ Beige and Gray Streaks VFT Mastic	1,000	SF	Mobile Unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Acoustical Ceiling with Grooves	1,000	SF	Mobile Unit	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Drywall System	2,000	SF	Mobile Unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" Tan w/White Specks VFT	160	SF	Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38A	12"x12" Tan w/White Specks VFT Mastic	160	SF	Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12"x12" Rust w/White Specks VFT	200	SF	Toilets in Rooms 103 (NOT OBSERVED), 104, 105, 106, 102, JC next to Room 101 - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	12"x12" Rust w/White Specks VFT Mastic	200	SF	Toilets in Rooms 102,103 (NOT OBSERVED), 104, 105, 106, JC next to	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Room 101 - 1955 Building							
40	12"x12" Red VFT	600	SF	Main Office - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	12"x12" Red VFT Mastic	600	SF	Main Office - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Carpet Mastic	500	SF	Principals Office - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	2'x2' Smooth Ceiling Tile	180	SF	Toilets in Rooms 102, 103, 104, 105, 106 - 1955 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	2'x4' Ceiling Tile	500	SF	Room 100 - 1955 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	1'x1' Ceiling Tile	9,500	SF	Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44A	1'x1' Ceiling Tile Mastic Pucks	9,500	SF	Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12"x12" Pink w/White & Brown Specks VFT	40	SF	Toilet next to Gym 112/114 - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45A	12"x12" Pink w/White & Brown specks VFT Mastic	40	SF	Toilet next to Gym 112/114 - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12"x12" Rust w/White Specks VFT	200	SF	Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46A	12"x12" Rust w/White Specks VFT Mastic	200	SF	Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	2'x2' Smooth Ceiling Tile	150	SF	Room 109 (NOT OBSERVED) & 111 Toilets, Toilet next to gym 112/114, Toilet by Teachers Lounge - 1960 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	12"x12" Beige w/ Mixed Specs VFT	2,000	SF	Rooms 103 and 105 - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12"x12" Beige w/ Mixed Specs VFT Mastic	2,000	SF	Rooms 103 and 105 - 1955 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12"x12" Light Blue w/ Specs VFT	1,046	SF	Rooms 109 and 111 - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12"x12" Light Blue w/ Specs VFT Mastic	1,046	SF	Rooms 109 and 111 - 1960 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Terrazzo Flooring	40	SF	Vestibule @ South Entry Doorway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12"x12" white w/ gray streaks VFT	30	SF	Rooms 102, 106 - 1955 building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53A	12"x12" white w/ gray streaks VFT Mastic	30	SF	Rooms 102, 106 - 1955	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Spray on Sink Undercoating - Gray	20	SF	Rooms 108, 101 - 1955 building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	Sprayed on Sink Overcoating - Black	40	SF	1955 Building - 102, 103, 104, 105, and	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				principal's office							
56	Sprayed on Sink Undercoating - White	10	SF	1955 Building - 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Sprayed on Sink Undercoating - Black	20	SF	1960 building - 109 and 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12"x12" Light Blue with White Gray Specks Replacement VFT	150	SF	1960 Addition Building - Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58A	12"x12" Light Blue with White Gray Specks Replacement VFT Mastic	150	SF	1960 Addition Building - Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Replacement Ceiling Tiles 1x1' white w/ dots and pinholes	103	SF	1955 - 103, 105, 102	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59A	Replacement Ceiling tiles for HA-44 and HA-44A, 1x1' white w/ dots and pinholes	103	SF	1955 - 103, 105, 102	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12"x12" Gray w/ white streaks VFT (replacing HA-50 and HA-51)	4	SF	1960 - room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60A	12"x12" Gray w/ white streaks VFT Mastic - Replacing HA-50/51	4	SF	1960 - room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Cardboard Pipe Insulation	20	LF	Boiler Room, Crawlspace - 1955 Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
B	MJP E/F/V on Cardboard Pipe Insulation	5	FITTING	Boiler Room, Crawlspace - 1955 Building	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
D	MJP E/F/V on Fiberglass Pipe Insulation	10	FITTING	Boiler Room, Crawlspace - 1955 Building	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	30	LF	Boiler Room, Crawlspace - 1955 Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
F	MJP E/F/V on Aircell Pipe Insulation	5	FITTING	Boiler Room, Crawlspace - 1955 Building	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
I	Mud Boiler Gaskets	10	LF	Boiler Room - 1955 Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
J	Mud Packing	2	SF	Boiler Room - 1955 Building	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	2/18/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
05	
06	
07	
08	
10	
11	
14	
15	
16	
17	
18	
19	

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
35A	
36	
37	
38	
38A	
39	
39A	
40	
40A	
41	
42	

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
43	
44	
44A	
45	
45A	
46	
46A	
47	
48	
49	
50	
51	
52	
53	
53A	
54	
55	
56	
57	
58	
58A	
59	
59A	
60	
60A	
A	
B	

Chicago Public Schools

School Stock School

Unit 30081

Building ID 5770

Address 7507 W Birchwood Avenue

Chicago, IL, 60648

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
D	
E	
F	
I	
J	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	Acoustical Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 109, 111, 112/114 All Purpose Room, Corridor -1960 bldg		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **Acoustical Plaster**

MATERIAL LOCATION: **Rooms 109, 111, 112/114 All Purpose Room, Corridor -1960 bldg**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Brown and White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Kitchen, Kitchen Storage, Rooms 108, 100, 101, Corridor Outside Kitchen - 1955 Building		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown and White Streaks VFT**

MATERIAL LOCATION: **Kitchen, Kitchen Storage, Rooms 108, 100, 101, Corridor Outside Kitchen - 1955 Building**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	9"x9" Tan VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 103, 105, Corridor - 1955 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **9"x9" Tan VFT**

MATERIAL LOCATION: **Rooms 103, 105, Corridor - 1955 Building**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	12"x12" Tan w/Brown & White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen, Kitchen Storage, Rooms 100, 108, 101, Corridor Outside Kitchen - 1955 Building		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **12"x12" Tan w/Brown & White Streaks VFT Mastic**

MATERIAL LOCATION: **Kitchen, Kitchen Storage, Rooms 100, 108, 101, Corridor Outside Kitchen - 1955 Building**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	9"x9" Tan VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103, 105, Corridor - 1955 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **9"x9" Tan VFT Mastic**

MATERIAL LOCATION: **Rooms 103, 105, Corridor - 1955 Building**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	12"x12" Tan VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition		
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **12"x12" Tan VFT**

MATERIAL LOCATION: **NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12"x12" Tan VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition		
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12"x12" Tan VFT Mastic**

MATERIAL LOCATION: **NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room - 1960 Addition**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1955 Building		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Throughout - 1955 Building**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer Office - 1955 Building		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Baseboard**

MATERIAL LOCATION: **Engineer Office - 1955 Building**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer Office - 1955 Building		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Baseboard Mastic**

MATERIAL LOCATION: **Engineer Office - 1955 Building**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 104, Public Office Storage - 1955 Building		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **12"x12" Blue VFT**

MATERIAL LOCATION: **Room 104, Public Office Storage - 1955 Building**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 104, Public Office Storage - 1955 Building		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12"x12" Blue VFT Mastic**

MATERIAL LOCATION: **Room 104, Public Office Storage - 1955 Building**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 109 (NOT OBSERVED) & 111 - 1960 Addition		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	(NOT OBSERVED in 109)		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **12"x12" Blue VFT**

MATERIAL LOCATION: **Rooms 109 (NOT OBSERVED) & 111 - 1960 Addition**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

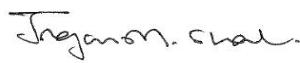

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 109 & 111 - 1960 Addition		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	NOT OBSERVED in 109		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **12"x12" Blue VFT Mastic**

MATERIAL LOCATION: **Rooms 109 & 111 - 1960 Addition**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	9"x9" Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Hallway outside Room 105 - 1955 Building		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **9"x9" Brown VFT**

MATERIAL LOCATION: **Hallway outside Room 105 - 1955 Building**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

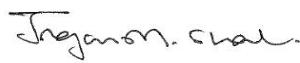

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	9"x9" Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hallway outside Room 105 - 1955 Building		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **9"x9" Brown VFT Mastic**

MATERIAL LOCATION: **Hallway outside Room 105 - 1955 Building**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	12"x12" White w/Tan Specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12"x12" White w/Tan Specs VFT**

MATERIAL LOCATION: **Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12"x12" White w/Tan Specs VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12"x12" White w/Tan Specs VFT Mastic**

MATERIAL LOCATION: **Kitchen, Kitchen Storage, Corridor Outside Kitchen, Rooms 100, 101, 108 - 1955 Building**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

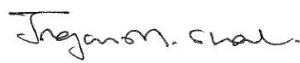

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12"x12" Beige (White w/Tan specs) VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12"x12" Beige (White w/Tan specs) VFT**

MATERIAL LOCATION: **NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Beige (White w/Tan specs) VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12"x12" Beige (White w/Tan specs) VFT Mastic**

MATERIAL LOCATION: **NW Vestibule, Corridor, 114/112 All Purpose Room, Teachers Break Room & Toilet - 1960 Addition**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12"x12" Gray VFT (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12"x12" Gray VFT (ABATED)**

MATERIAL LOCATION: **Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	12"x12" Gray VFT Mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12"x12" Gray VFT Mastic (ABATED)**

MATERIAL LOCATION: **Engineer Office, Corridor outside Kitchen - 1955 Building (ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

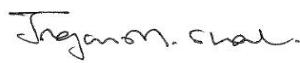

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	9"x9" Gray w/ Green VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 102 and 106 - 1955 Building		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **9"x9" Gray w/ Green VFT**

MATERIAL LOCATION: **Rooms 102 and 106 - 1955 Building**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	9"x9" Gray w/ Green VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 102 and 106 - 1955 Building		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **9"x9" Gray w/ Green VFT Mastic**

MATERIAL LOCATION: **Rooms 102 and 106 - 1955 Building**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12"x12" White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 112 Storage - 1960 Addition		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12"x12" White VFT**

MATERIAL LOCATION: **Room 112 Storage - 1960 Addition**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	12"x12" White VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112 Storage - 1960 Addition		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**

MATERIAL LOCATION: **Room 112 Storage - 1960 Addition**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawlspace, Teachers Toilet Pipe Chase - 1960 Addition		
MATERIAL QUANTITY:	55	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Crawlspace, Teachers Toilet Pipe Chase - 1960 Addition**

MATERIAL QUANTITY: **55** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	2'x4' Ceiling tiles (Removed)		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 109 & 111 - 1960 Addition (Removed)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **2'x4' Ceiling tiles (Removed)**

MATERIAL LOCATION: **Rooms 109 & 111 - 1960 Addition (Removed)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

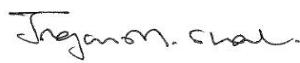

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Beige and Gray Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Mobile Unit		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Cracks in VFT Throughout Mobile Unit		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Beige and Gray Streaks VFT**

MATERIAL LOCATION: **Mobile Unit**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35A		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Beige and Gray Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Mobile Unit		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **35A**

MATERIAL DESCRIPTION: **12"x12" Off White w/ Beige and Gray Streaks VFT Mastic**

MATERIAL LOCATION: **Mobile Unit**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	Acoustical Ceiling with Grooves		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Mobile Unit		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **Acoustical Ceiling with Grooves**

MATERIAL LOCATION: **Mobile Unit**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	Drywall System		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Mobile Unit		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Drywall System**

MATERIAL LOCATION: **Mobile Unit**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

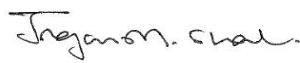

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" Tan w/White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building		
MATERIAL QUANTITY:	160	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **12"x12" Tan w/White Specks VFT**

MATERIAL LOCATION: **Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building**

MATERIAL QUANTITY: **160** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38A		
MATERIAL DESCRIPTION:	12"x12" Tan w/White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building		
MATERIAL QUANTITY:	160	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **38A**

MATERIAL DESCRIPTION: **12"x12" Tan w/White Specks VFT Mastic**

MATERIAL LOCATION: **Eng. Office, Corridor by Kitchen, Corridor outside Room 101 - 1955 Building**

MATERIAL QUANTITY: **160** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12"x12" Rust w/White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Toilets in Rooms 103 (NOT OBSERVED), 104, 105, 106, 102, JC next to Room 101 - 1955 Building**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **12"x12" Rust w/White Specks VFT**

MATERIAL LOCATION: **Toilets in Rooms 103 (NOT OBSERVED), 104, 105, 106, 102, JC next to Room 101 - 1955 Building**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39A		
MATERIAL DESCRIPTION:	12"x12" Rust w/White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Toilets in Rooms 102,103 (NOT OBSERVED), 104, 105, 106, JC next to Room 101 - 1955 Building		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	NOT OBSERVED in 103		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **39A**

MATERIAL DESCRIPTION: **12"x12" Rust w/White Specks VFT Mastic**

MATERIAL LOCATION: **Toilets in Rooms 102,103 (NOT OBSERVED), 104, 105, 106, JC next to Room 101 - 1955 Building**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12"x12" Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Main Office - 1955 Building		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **12"x12" Red VFT**

MATERIAL LOCATION: **Main Office - 1955 Building**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40A		
MATERIAL DESCRIPTION:	12"x12" Red VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office - 1955 Building		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **40A**

MATERIAL DESCRIPTION: **12"x12" Red VFT Mastic**

MATERIAL LOCATION: **Main Office - 1955 Building**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals Office - 1955 Building		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Principals Office - 1955 Building**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

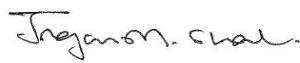

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	2'x2' Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Toilets in Rooms 102, 103, 104, 105, 106 - 1955 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **2'x2' Smooth Ceiling Tile**

MATERIAL LOCATION: **Toilets in Rooms 102, 103, 104, 105, 106 - 1955 Building**

MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 100 - 1955 Building		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**

MATERIAL LOCATION: **Room 100 - 1955 Building**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

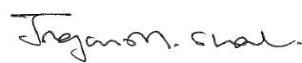

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building		
MATERIAL QUANTITY:	9500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**

MATERIAL LOCATION: **Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building**

MATERIAL QUANTITY: **9500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44A		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile Mastic Pucks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building		
MATERIAL QUANTITY:	9500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **44A**

MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Mastic Pucks**

MATERIAL LOCATION: **Rooms 102, 103, 104, 105, 106, 108, Main office, Principals office, Corridor - 1955 Building**

MATERIAL QUANTITY: **9500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12"x12" Pink w/White & Brown Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Toilet next to Gym 112/114 - 1960 Addition		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **12"x12" Pink w/White & Brown Specks VFT**

MATERIAL LOCATION: **Toilet next to Gym 112/114 - 1960 Addition**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45A		
MATERIAL DESCRIPTION:	12"x12" Pink w/White & Brown specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Toilet next to Gym 112/114 - 1960 Addition		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **45A**

MATERIAL DESCRIPTION: **12"x12" Pink w/White & Brown specks VFT Mastic**

MATERIAL LOCATION: **Toilet next to Gym 112/114 - 1960 Addition**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Rust w/White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12"x12" Rust w/White Specks VFT**

MATERIAL LOCATION: **Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46A		
MATERIAL DESCRIPTION:	12"x12" Rust w/White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **46A**

MATERIAL DESCRIPTION: **12"x12" Rust w/White Specks VFT Mastic**

MATERIAL LOCATION: **Room 109 Toilet, Room 111 Toilet, Toilet next to Teachers Lounge - 1960 Addition**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	2'x2' Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 109 (NOT OBSERVED) & 111 Toilets, Toilet next to gym 112/114, Toilet by Teachers Lounge - 1960 Addition		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Removed From 109 (-30SF)		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **2'x2' Smooth Ceiling Tile**

MATERIAL LOCATION: **Room 109 (NOT OBSERVED) & 111 Toilets, Toilet next to gym 112/114, Toilet by Teachers Lounge - 1960 Addition**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Mixed Specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 103 and 105 - 1955 Building		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Mixed Specs VFT**

MATERIAL LOCATION: **Rooms 103 and 105 - 1955 Building**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Mixed Specs VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103 and 105 - 1955 Building		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Mixed Specs VFT Mastic**

MATERIAL LOCATION: **Rooms 103 and 105 - 1955 Building**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	12"x12" Light Blue w/ Specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 109 and 111 - 1960 Addition		
MATERIAL QUANTITY:	1046	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **12"x12" Light Blue w/ Specs VFT**

MATERIAL LOCATION: **Rooms 109 and 111 - 1960 Addition**

MATERIAL QUANTITY: **1046** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

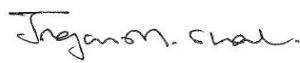

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Light Blue w/ Specs VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 109 and 111 - 1960 Addition		
MATERIAL QUANTITY:	1046	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12"x12" Light Blue w/ Specs VFT Mastic**

MATERIAL LOCATION: **Rooms 109 and 111 - 1960 Addition**

MATERIAL QUANTITY: **1046** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

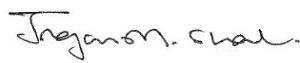

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	A		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Delamination Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Crawlspace - 1955 Building		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**

MATERIAL LOCATION: **Boiler Room, Crawlspace - 1955 Building**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	B		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Crawlspace - 1955 Building		
MATERIAL QUANTITY:	5	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Boiler Room, Crawlspace - 1955 Building**

MATERIAL QUANTITY: **5** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

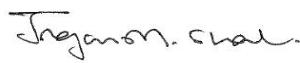

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Crawlspace - 1955 Building		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:	Repaired		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Boiler Room, Crawlspace - 1955 Building**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Crawlspace - 1955 Building		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:	Repaired		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Boiler Room, Crawlspace - 1955 Building**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

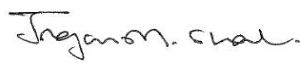

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Boiler Room, Crawlspace - 1955 Building		
MATERIAL QUANTITY:	5	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:	Repaired		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**

MATERIAL LOCATION: **Boiler Room, Crawlspace - 1955 Building**

MATERIAL QUANTITY: **5** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	I		
MATERIAL DESCRIPTION:	Mud Boiler Gaskets		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room - 1955 Building		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Mud Boiler Gaskets**

MATERIAL LOCATION: **Boiler Room - 1955 Building**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

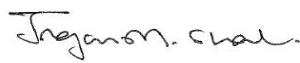

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	J		
MATERIAL DESCRIPTION:	Mud Packing		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room - 1955 Building		
MATERIAL QUANTITY:	2	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Repaired		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUILDING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Mud Packing**

MATERIAL LOCATION: **Boiler Room - 1955 Building**

MATERIAL QUANTITY: **2** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	Sprayed on Sink Overcoating - Black		
MATERIAL LOCATION:	1955 Building - 102, 103, 104, 105, and principal's office		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **Sprayed on Sink Overcoating - Black**

MATERIAL LOCATION: **1955 Building - 102, 103, 104, 105, and principal's office**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	59A			
MATERIAL DESCRIPTION:	Replacement Ceiling tiles for HA-44 and HA-44A, 1'x1' white w/ dots and pinholes			
MATERIAL LOCATION:	1955 - 103, 105, 102			
MATERIAL QUANTITY:	103	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	LOW	CONDITION:		
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Within Reach	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
		DAMAGE REASON:		
COMMENTS:	Replaced HA-44 and HA-44A			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **30081** BUIDLING ID: **5770**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Stock School** REVIEW DATE: **2/18/2025**

ADDRESS: **7507 W Birchwood Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **59A**

MATERIAL DESCRIPTION: **Replacement Ceiling tiles for HA-44 and HA-44A, 1'x1' white w/ dots and pinholes**

MATERIAL LOCATION: **1955 - 103, 105, 102**

MATERIAL QUANTITY: **103** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	53A				
MATERIAL DESCRIPTION:	12"x12" white w/ gray streaks VFT Mastic				
MATERIAL LOCATION:	Rooms 102, 106 -1955				
MATERIAL QUANTITY:	30	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Not Reachable	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
		DAMAGE REASON:			
COMMENTS:	See HA-53 , damaged tiles replaced				

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **53A**

MATERIAL DESCRIPTION: **12"x12" white w/ gray streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 102, 106 -1955**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	Spray on Sink Undercoating - Gray		
MATERIAL LOCATION:	Rooms 108, 101 - 1955 building		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **Spray on Sink Undercoating - Gray**

MATERIAL LOCATION: **Rooms 108, 101 - 1955 building**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	Sprayed on Sink Undercoating - White		
MATERIAL LOCATION:	1955 Building - 106		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **Sprayed on Sink Undercoating - White**

MATERIAL LOCATION: **1955 Building - 106**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	12"x12" Light Blue with White Gray Specks Replacement VFT		
MATERIAL LOCATION:	1960 Addition Building - Room 111		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **12"x12" Light Blue with White Gray Specks Replacement VFT**

MATERIAL LOCATION: **1960 Addition Building - Room 111**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	12"x12" white w/ gray streaks VFT		
MATERIAL LOCATION:	Rooms 102, 106 - 1955 building		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:
Damaged tiles (9x9) were replaced w/ this new HA and Cut to fit

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **30081** BUIDLING ID: **5770**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Stock School** REVIEW DATE: **2/18/2025**

ADDRESS: **7507 W Birchwood Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12"x12" white w/ gray streaks VFT**

MATERIAL LOCATION: **Rooms 102, 106 - 1955 building**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **30081** BUIDLING ID: **5770**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Stock School** INSPECTION DATE: **1/17/2025**
ADDRESS: **7507 W Birchwood Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **58A**
MATERIAL DESCRIPTION: **12"x12" Light Blue with White Gray Specks Replacement VFT Mastic**
MATERIAL LOCATION: **1960 Addition Building - Room 111**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **58A**

MATERIAL DESCRIPTION: **12"x12" Light Blue with White Gray Specks Replacement VFT Mastic**

MATERIAL LOCATION: **1960 Addition Building - Room 111**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	12"x12" Gray w/ white streaks VFT (replacing HA-50 and HA-51)		
MATERIAL LOCATION:	1960 - room 111		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:	New Replacement Tiles for HA-50/51		

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **12"x12" Gray w/ white streaks VFT (replacing HA-50 and HA-51)**

MATERIAL LOCATION: **1960 - room 111**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **30081** BUIDLING ID: **5770**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Stock School** INSPECTION DATE: **1/17/2025**
ADDRESS: **7507 W Birchwood Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **Terrazzo Flooring**
MATERIAL LOCATION: **Vestibule @ South Entry Doorway**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **01/17/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **Terrazzo Flooring**

MATERIAL LOCATION: **Vestibule @ South Entry Doorway**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	Sprayed on Sink Undercoating - Black		
MATERIAL LOCATION:	1960 building - 109 and 111		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **30081** BUIDLING ID: **5770**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Stock School** REVIEW DATE: **2/18/2025**

ADDRESS: **7507 W Birchwood Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **Sprayed on Sink Undercoating - Black**

MATERIAL LOCATION: **1960 building - 109 and 111**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	Replacement Ceiling Tiles 1'x1' white w/ dots and pinholes		
MATERIAL LOCATION:	1955 - 103, 105, 102		
MATERIAL QUANTITY:	103	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **Replacement Ceiling Tiles 1'x1' white w/ dots and pinholes**

MATERIAL LOCATION: **1955 - 103, 105, 102**

MATERIAL QUANTITY: **103** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:

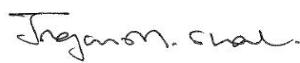

Date: **02/18/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Stock School	INSPECTION DATE:	1/17/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	60A				
MATERIAL DESCRIPTION:	12"x12" Gray w/ white streaks VFT Mastic - Replacing HA-50/51				
MATERIAL LOCATION:	1960 - room 111				
MATERIAL QUANTITY:	4	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:	Replacement tiles for HA-50/51				

Inspector's Signature:



Date: 01/17/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	30081	BUIDLING ID:	5770
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Stock School	REVIEW DATE:	2/18/2025		
ADDRESS:	7507 W Birchwood Avenue	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **60A**

MATERIAL DESCRIPTION: **12"x12" Gray w/ white streaks VFT Mastic - Replacing HA-50/51**

MATERIAL LOCATION: **1960 - room 111**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **02/18/2025**

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/28/2023 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/28/2023

Course Dates:

01/28/2024

Expires:

2301BIR23

Certificate Number:

N Penef *APD*
Director of Training

Nicholas J. Penef

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/5/2024

IDPH
ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 18350

ISSUED
4/5/2024

EXPIRES
05/15/2025

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: **18350**

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18350	ISSUED 4/5/2024	EXPIRES 05/15/2025	INSPECTOR	1/27/2025
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/13/2025
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that HENNIGAN JOSEPH
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR08

Certificate Number:

Director of Training

Nicholas J. Peneff
Doctor of Public Health


Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/15/2022

Course Dates:

01/15/2023

Expires:

2201BIR11

Certificate Number:

A handwritten signature in black ink that reads "Nicholas J. Peneff" followed by "EPA".

Phone: 312-491-0081

Director of Training

Nicholas J. Peneff

Doctor of Public Health

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 18350

ISSUED
2/28/2022

EXPIRES
05/15/2023

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: **18350**

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18350	ISSUED 2/28/2022	EXPIRES 05/15/2023	INSPECTOR	1/15/2023
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612			PROJECT MANAGER	1/22/2023
			AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES


Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, IL

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/30/20

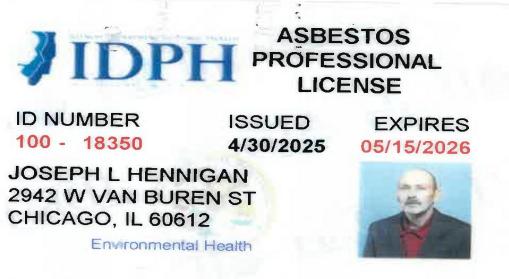


ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

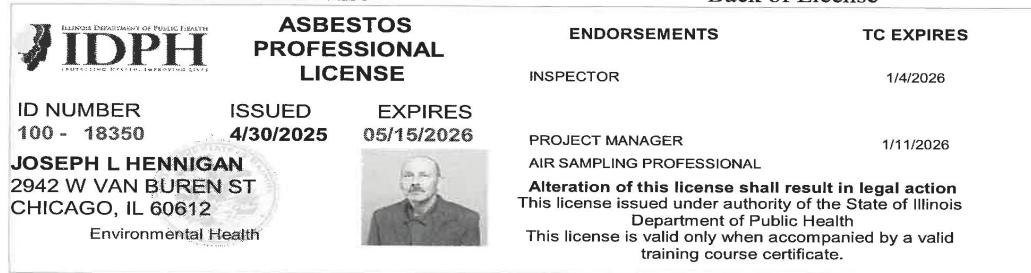

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07342	ISSUED 6/9/2025	EXPIRES 05/15/2026	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	


If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023

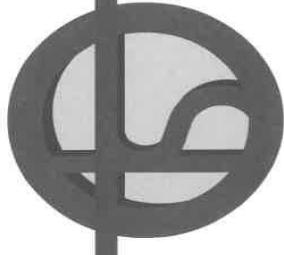

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023


Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo

Kathy DeSalvo, Director

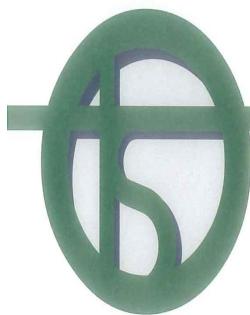

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

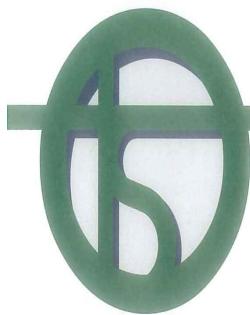

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License



Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/8/2024

EXPIRES
05/15/2025

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

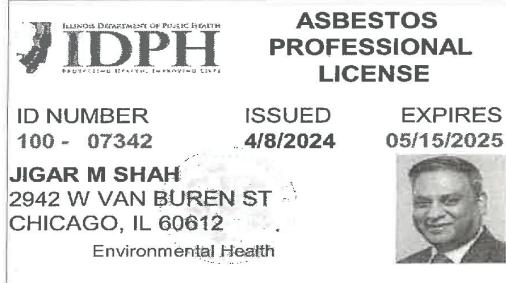

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES

Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2025

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

Kristina Miczek, Training Manager

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed