

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2200  
SCHOOL NAME: Peck School PreK  
ADDRESS OF SCHOOL: 4026 W 59th St.  
CITY: Chicago, IL, 60629

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 10/13/2022

**If the address on this form is different than the address of the building, submit a written explanation.**

**SECTION II (Please type or print)**

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 5/8/2025 ENROLLMENT 672

IDPH INSPECTOR LICENSE NUMBER: 100-20974

IDPH LICENSED INSPECTOR NAME (Please Print): Anthony Porfilio

IDPH MP LICENSE NUMBER: \_\_\_\_\_

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): \_\_\_\_\_

DESIGNATED PERSON (Please Print): \_\_\_\_\_ PHONE: \_\_\_\_\_

**SECTION III**

**PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.**

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Peck School PreK**

4026 W 59th St.  
Chicago, IL, 60629

Unit: 24871  
Building ID: 5340 PreK

IDPH ID Number: 14-016-2990-2200

**REPORT DATE:**

**Prepared for:**  
**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**  
**TEM Environmental, Inc.**

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299      Unit: 24871      Region: 05      IDPH ID: 14-016-2990-2200

School: Peck School PreK      Building ID: 5340 PreK

Address: 4026 W 59th St.

Chicago, IL, 60629

Building Contact: Hett, Daniel      Contact Phone: 7737107820

Current Building Owners: Chicago Public Schools

Reinspection Date: 5/8/2025

Review Date:

Inspector: Anthony Porfilio

Inspector IDPH License: 100-20974

Management Planner:

Management Planner IDPH License:

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date:

RE: Peck School PreK, Unit 24871  
4026 W 59th St.  
Chicago, IL, 60629

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Peck School PreK , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Peck School PreK, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact , the designated Local Education Authority's Designated Person at .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Peck School PreK      Unit: 24871      Region: 05  
Address: 4026 W 59th St.      Chicago, IL, 60629  
IDPH ID: 14-016-2990-2200      Building ID: 5340 PreK  
Contact: Hett, Daniel      Phone: 7737107820

### 2. Description of Facility

Original Construction: 2002      Additional Construction:  
Total Square Footage: 6000      No of Floors: 1  
Current Occupancy: 672

### 3. LEA Designated Person

Contact:      Phone:  
Address: 42 West Madison Street  
Chicago, IL 60602

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Phone: 630-790-0880      Fax: 630-790-0882

### 5. Inspector

Inspector Name: Anthony Porfilio

Inspector IDPH license # 100-20974  
Reinspection Date: 5/8/2025



Signature:  
Date: 5/8/2025

### 6. Management Planner

Management Planner Name:

Management Planner IDPH license #

Signature:  
Date:

### 7. Review Date:

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Name:

---

Unit : 24871

Peck School PreK

Building: 5340 PreK

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Peck School PreK. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5340 PreK:

7	Drywall
8	Drywall Joint Compound
9	2'x4' Plain White Ceiling Tile
NEW	Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 5340 PreK:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile
2	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile Mastic
3	2'x4' Pebble Ceiling Tile
4	White Vinyl Baseboard
5	White Vinyl Baseboard Adhesive
6	Metal Pan Ceiling Above 2X4 Ceiling
7	Drywall
8	Drywall Joint Compound
9	2'x4' Plain White Ceiling Tile
NEW	Newly Installed Suspect ACM

The following areas were deemed to be inaccessible:

2	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile Mastic
5	White Vinyl Baseboard Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Anthony Porfilio, IDPH License # 100-20974. The Management Plan was updated by , IDPH License # . Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Peck School PreK Building 5340 PreK Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

**School** Peck School PreK **Unit** 24871 **Building ID** 5340 PreK  
**Address** 4026 W 59th St. **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile	1,200	SF	Throughout Building	ASSUMED	MISC	N	LOC	3		No	ACBM with the potential for damage		LOW
2	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile Mastic	1,200	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3	2'x4' Pebble Ceiling Tile	1,200	SF	Front Half of Space	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
4	White Vinyl Baseboard	600	LF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5	White Vinyl Baseboard Adhesive	600	LF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
6	Metal Pan Ceiling Above 2X4 Ceiling	1,200	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
7	Drywall	20,000	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
8	Drywall Joint Compound	20,000	SF	Throughout Building	ASSUMED	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
9	2'x4' Plain White Ceiling Tile	2,000	SF	Back Half South Areas	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKNO WN			Yes	ACBM with the potential for damage		

# Chicago Public Schools

School Peck School PreK Unit 24871 Building ID 5340 PreK  
Address 4026 W 59th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <u>5/8/2025</u>
Inspector Name <u>Anthony Porfilio</u>
<u>100-20974</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

#### Inspector's Comments

HA Number:	Inspector Comments:
1	
2	
3	
4	
5	
6	
7	
8	
9	
NEW	

**Table II**  
**Management Planner's Review**

---

# Chicago Public Schools

**School** Peck School PreK

**Unit** 24871

**Building ID** 5340 PreK

**Address** 4026 W 59th St.

Chicago, IL, 60629

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile	1,200	SF	Throughout Building	Assumed	MISC	No	3	SF	6 ACBM with the potential for damage	
2	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile Mastic	1,200	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
3	2'x4' Pebble Ceiling Tile	1,200	SF	Front Half of Space	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	
4	White Vinyl Baseboard	600	LF	Throughout Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
5	White Vinyl Baseboard Adhesive	600	LF	Throughout Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
6	Metal Pan Ceiling Above 2X4 Ceiling	1,200	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
7	Drywall	20,000	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
8	Drywall Joint Compound	20,000	SF	Throughout Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	
9	2'x4' Plain White Ceiling Tile	2,000	SF	Back Half South Areas	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC				6 ACBM with the potential for damage	

# Chicago Public Schools

**School** Peck School PreK

**Unit** 24871

**Building ID** 5340 PreK

**Address** 4026 W 59th St.

Chicago, IL, 60629

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

***Management Planner's Comments Summarized at the End of the Report***

Review Date	
Manager Planner Name	
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
2	
3	
4	
5	
6	
7	
8	
9	
NEW	

## APPENDIX A

---

### Assessment Sheets, Drawings and Photos

**Chicago Public Schools**

**TEM Environmental, Inc.**

***2025 AHERA REINSPECTION***

# Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	1		
MATERIAL DESCRIPTION:	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BUIDLING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **3** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	2		
MATERIAL DESCRIPTION:	12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24871</b>	BUILDING ID:	<b>5340 PreK</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:			
SCHOOL NAME:	<b>Peck School PreK</b>	REVIEW DATE:			
ADDRESS:	<b>4026 W 59th St.</b>	IDPH LICENSE NO:	<b>100-20974</b>		

---

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **12x12 White w/Blue, Red & Yellow Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	3		
MATERIAL DESCRIPTION:	2'x4' Pebble Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Front Half of Space		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24871</b>	BUILDING ID:	<b>5340 PreK</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:			
SCHOOL NAME:	<b>Peck School PreK</b>	REVIEW DATE:			
ADDRESS:	<b>4026 W 59th St.</b>	IDPH LICENSE NO:	<b>100-20974</b>		

---

HOMOGENEOUS AREA: **3**

MATERIAL DESCRIPTION: **2'x4' Pebble Ceiling Tile**

MATERIAL LOCATION: **Front Half of Space**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	4		
MATERIAL DESCRIPTION:	White Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BULDING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **4**

MATERIAL DESCRIPTION: **White Vinyl Baseboard**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	5		
MATERIAL DESCRIPTION:	White Vinyl Baseboard Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BULDING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **5**

MATERIAL DESCRIPTION: **White Vinyl Baseboard Adhesive**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	6		
MATERIAL DESCRIPTION:	Metal Pan Ceiling Above 2X4 Ceiling		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BULDING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **6**

MATERIAL DESCRIPTION: **Metal Pan Ceiling Above 2X4 Ceiling**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	7		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	<b>6 ACBM with the potential for damage</b>		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BULDING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	8		
MATERIAL DESCRIPTION:	Drywall Joint Compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Building		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>24871</b>	BUILDING ID:	<b>5340 PreK</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:			
SCHOOL NAME:	<b>Peck School PreK</b>	REVIEW DATE:			
ADDRESS:	<b>4026 W 59th St.</b>	IDPH LICENSE NO:	<b>100-20974</b>		

---

HOMOGENEOUS AREA: **8**

MATERIAL DESCRIPTION: **Drywall Joint Compound**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	9		
MATERIAL DESCRIPTION:	2'x4' Plain White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Back Half South Areas		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/08/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BULDING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **2'x4' Plain White Ceiling Tile**

MATERIAL LOCATION: **Back Half South Areas**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24871	BUIDLING ID:	5340 PreK
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Anthony Porfilio		
SCHOOL NAME:	Peck School PreK	INSPECTION DATE:	5/8/2025		
ADDRESS:	4026 W 59th St.	IDPH LICENSE NO:	100-20974		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	NEW		
MATERIAL DESCRIPTION:	Newly Installed Suspect ACM		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/08/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24871** BUIDLING ID: **5340 PreK**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:  
SCHOOL NAME: **Peck School PreK** REVIEW DATE:  
ADDRESS: **4026 W 59th St.** IDPH LICENSE NO: **100-20974**

---

HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: \_\_\_\_\_

**Chicago Public Schools**

**TEM Environmental, Inc.**

***2025 AHERA REINSPECTION***

## APPENDIX B


---

### Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield

**ANTHONY M PORFILIO**  
2942 W. VAN BUREN ST.  
CHICAGO, IL 60612

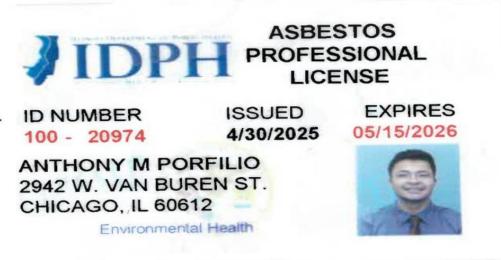

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 20974

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License


ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 20974	ISSUED 4/30/2025	EXPIRES 05/15/2026	INSPECTOR 1/4/2026
<b>ANTHONY M PÓRFILIO</b> 2942 W. VAN BUREN ST. CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL <b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	1/11/2026

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

PROTECTING HEALTH, IMPROVING LIVES

*Nationally Accredited by PHAB*

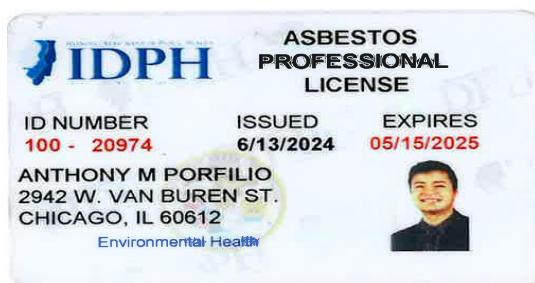

ENDORSEMENTS

INSPECTOR

TC EXPIRES

1/27/2025

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

1/13/2025

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

# CERTIFICATE OF ACHIEVEMENT

## ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that ANTHONY PORFILIO  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • [www.public-health-safety.com](http://www.public-health-safety.com)

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR11

Certificate Number:

Director of Training

Nicholas J. Peneff  
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

A handwritten signature in black ink, appearing to read 'Nicholas J. Peneff, DO

## APPENDIX C

---

### **Laboratory Accreditations**

## APPENDIX D

---

### Laboratory Results

## APPENDIX E

---

### Chain of Custody Forms

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>	Loc	Localized
	Dist	Distributed