

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0001
SCHOOL NAME: Amundsen High School
ADDRESS OF SCHOOL: 5110 N. Damen
CITY: Chicago, IL, 60625

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 7/14/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 3/13/2025 ENROLLMENT 1428
IDPH INSPECTOR LICENSE NUMBER: 100-18790
IDPH LICENSED INSPECTOR NAME (Please Print): Allizon Brooks
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 3/28/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Amundsen High School

5110 N. Damen
Chicago, IL, 60625

Unit: 46031
Building ID: 1210

IDPH ID Number: 14-016-2990-0001

REPORT DATE:
Friday, March 28, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street
Chicago, IL, 60612
Phone (312) 319-7575
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

03/28/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46031 Region: 01 IDPH ID: 14-016-2990-0001

School: Amundsen High School Building ID: 1210

Address: 5110 N. Damen

Chicago, IL, 60625

Building Contact: Vaughn, Jeffrey Contact Phone: 7737095138

Current Building Owners: Chicago Public Schools

Reinspection Date: 3/13/2025

Review Date: 03/28/2025

Inspector: Allizon Brooks

Inspector IDPH License: 100-18790

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 28, 2025

RE: Amundsen High School, Unit 46031
5110 N. Damen
Chicago, IL, 60625

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Amundsen High School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Amundsen High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J. Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074.

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Amundsen High School Unit: 46031 Region: 01
Address: 5110 N. Damen Chicago, IL, 60625
IDPH ID: 14-016-2990-0001 Building ID: 1210
Contact: Vaughn, Jeffrey Phone: 7737095138

2. Description of Facility

Original Construction: 1930 Additional Construction:
Total Square Footage: 218950 No of Floors: 4
Current Occupancy: 1428

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Allizon Brooks

Inspector IDPH license # 100-18790 Signature:
Reinspection Date: 3/13/2025 Date: 3/13/2025

6. Management Planner

Management Planner Name: Jigar Shah


Management Planner IDPH license # 100-07342 Signature:
Date: 03/28/2025

7. Review Date: 03/28/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

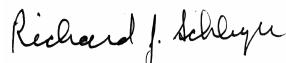

Date: 3/28/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Amundsen High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

- A. The following HAs have changed assessment categories for Building 1210:

B. The following new homogenous areas have been identified for Building 1210:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

102	12"x12" Light blue w/ gray specks VFT
102A	12"x12" Light blue w/ gray specks VFT MASTIC
103	2'x2' Ceiling tiles w/ dots
104	12"x12" Black with white specks VFT
104A	12"x12" Black with white specks VFT MASTIC
105	12"x12" Light brown with brown and tan streaks VFT
105A	12"x12" Light brown with brown and tan streaks VFT MASTIC
106	2'x4' Ceiling Tile
107B	Linoleum - White
107C	Linoleum - Tan
107D	Linoleum - Gray w/ Black Spots
107E	Linoleum Mastic - White/Tan/Gray with Black
108	2'x4' ceiling tiles
109	12"x12" Off white w/ light gray & gray specs VFT NOT OBSERVED
109A	12"x12" Off white w/ light gray & gray specs VFT Mastic NOT OBSERVED
111	Fire door NOT OBSERVED
112	Terrazzo
113	Black lab table tops
114	2' x 2' White Ceiling Tile
115	Drywall System
116	24" x 24" White VFT
116A	24" x 24" Blue VFT
116B	24" x 24" Gray VFT
116C	24" x 24" Black VFT
116D	24" x 24" VFT Mastic for HA 116, 116A, 116B, 116C
16	12" x 12" Black VFT
16A	12" x 12" Black VFT Mastic
19	12" x 12" White w/Beige VFT
23	12" x 12" Gray VFT
32	12" x 12" Red w/ Red Streaks VFT
32A	12" x 12" Red with red streaks VFT MASTIC
36	12" x 12" Brown w/Grey VFT
37	12" x 12" Red VFT
37A	12" x 12" Red VFT Mastic
40	2' x 2' Dot/Wave Ceiling Tile
43	Terrazzo
46	12"x12" Black with white streaks VFT

46 A	12"x12" Black with white streaks VFT MASTIC
48	12"x12" Sand VFT
48 A	12"x12" Sand VFT MASTIC
9	Lab Table Tops
M	12" x 12" White VFT (Not Observed)
O	12" x 12" Brown & White VFT
Q	12" x 12" Brown & White VFT
R	12" x 12" Brown, White & Beige VFT
S	Terrazzo Red & White
T	12" x 12" Speckled Beige & White VFT
U	12" x 12" Gray & Black VFT
V	Terrazzo (Red, White & Black)
W	12" x 12" Beige VFT
X	12" x 12" Grey & Black VFT
Y	12" x 12" Black & Red VFT
Z	Terrazzo (Red & White)
ZZ	12"x12" Beige with Speckles VFT

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Allizon Brooks, IDPH License # 100-18790. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Amundsen High School Building 1210 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
07	9" x 9" White VFT ABATED			Room 222 ABATED	ABATED	MISC								
08	12" x 12" Tan VFT (Not Observed)	325	SF	Room 128 (Not Observed)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
101	2' x 2' Ceiling Tile w/ dots Glue pucks	1,000	SF	Boy's Gym	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
102	12"x12" Light blue w/ gray specks VFT	260	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
102A	12"x12" Light blue w/ gray specks VFT MASTIC	260	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
103	2'x2' Ceiling tiles w/ dots	8,000	SF	Boys' Gymnasium	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
104	12"x12" Black with white specks VFT	500	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
104A	12"x12" Black with white specks VFT MASTIC	500	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
105	12"x12" Light brown with brown and tan streaks VFT	250	SF	Room 303, 3rd floor MDF room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
105A	12"x12" Light brown with brown and tan streaks VFT MASTIC	250	SF	Room 303, 3rd floor MDF room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
106	2'x4' Ceiling Tile	1,200	SF	Health center made up of room 307 & boys and girls toilets on the 3rd fl	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
107	Salmon linoleum ABATED			Health center made up of rm 307 & girls toilets on 3rd fl. ABATED	ABATED	MISC								
107A	Salmon linoleum MASTIC ABATED			Health center made up of rm 307 & Girls toilets on the 3rd fl. ABATED	ABATED	MISC								
107B	Linoleum - White	3,748	SF	Rooms 322, 317, 318, 215	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
107C	Linoleum - Tan	6,000	SF	307 Health Center, 317 Lab, 217 Lab, Offices & Vault, 215	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
107D	Linoleum - Gray w/ Black Spots	1,300	SF	Room 221 and Power Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
107E	Linoleum Mastic - White/Tan/Gray with Black	11,000	SF	Rooms 322, 317, 318, 215, 307 Health Center, 207, 215, 221 & Power Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
108	2'x4' ceiling tiles	4,000	SF	Rooms 321, 322, 324	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
109	12"x12" Off white w/ light gray & gray specs VFT NOT OBSERVED	100	SF	Darkroom NOT OBSERVED	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
109A	12"x12" Off white w/ light gray & gray specs VFT Mastic NOT OBSERVED	100	SF	Darkroom NOT OBSERVED	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12" x 12" Tan VFT Mastic (Not Observed)	325	SF	Room 128 - (Not Observed)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
110	9"x9" Light brown VFT ABATED			Room 308 & closet next to the dark room ABATED	ABATED	MISC								
110A	9"x9" Light brown VFT MASTIC ABATED			Room 308 & closet next to dark room ABATED	ABATED	MISC								
111	Fire door NOT OBSERVED	2	EA	Stage entrance, projector rm. NOT OBSERVED	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
112	Terrazzo	23,000	SF	1st, 2nd, and 3rd fl. corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
113	Black lab table tops	154	EA	Rooms 315, 318, 322, 209, 215, 217, 221	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
114	2' x 2' White Ceiling Tile	15,000	SF	Rooms 122 A & B, Asst. Principal's Office, 124, 126, 128 & A thru F Offices, 109, 114, 117 & A, B, C, 104	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
115	Drywall System	30,000	SF	Elevator Hallway, Basement Office & Power Room; Rooms 122 A & B & Main Offices, 124, 126, 128 & A thru F Offices; Men's/Women's, Boy's/Girl's, Unisex Bathrooms & Locker Rooms; Health Center 307 & Offices; Stairwell Corridor #3, Rooms 108, 109 and 113	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
116	24" x 24" White VFT	2,500	SF	Rooms 109, 104 &	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				(abated)										
24A	9" x 9" Green VFT Mastic (abated)			Engineers Office (abated)	ABATED	MISC								
25	9" x 9" Dark Brown VFT	20	SF	Room 209 Vault	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
25A	9" x 9" Dark Brown VFT Mastic	20	SF	Room 209 Vault	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	9" x 9" Light Brown VFT - ABATED			Rooms 308, 306 & 201 - ABATED	ABATED	MISC								
26A	9" x 9" Light Brown VFT Mastic - ABATED			Rooms 308, 306 & 201 - ABATED	ABATED	MISC								
27	9" x 9" Red VFT - ABATED			1st, 2nd, and 3rd floor corridors - ABATED	ABATED	MISC								
27A	9" x 9" Red VFT Mastic - ABATED			1st, 2nd, and 3rd floor corridors - ABATED	ABATED	MISC								
30	12" x 12" Off-White VFT			Room 328	ABATED	MISC								
30A	12" x 12" Off-White VFT Mastic			Room 328	ABATED	MISC								
31	9" x 9" Brown VFT - ABATED			Engineers Bathroom - ABATED	ABATED	MISC								
31A	9" x 9" Brown VFT Mastic - ABATED			Engineers Bathroom - ABATED	ABATED	MISC								
32	12" x 12" Red w/ Red Streaks VFT	100	SF	Room 230	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
32A	12" x 12" Red with red streaks VFT MASTIC	100	SF	Room 230	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	9" x 9" Black VFT			1st, 2nd, 3rd Floor Corridors	ABATED	MISC								
33A	9" x 9" Black VFT Mastic			1st, 2nd, 3rd Floor Corridors	ABATED	MISC								
34	12" x 12" Brown VFT (ABATED)			Room 317 (ABATED)	ABATED	MISC								
34A	12" x 12" Brown VFT Mastic (ABATED)			Room 317 (ABATED)	ABATED	MISC								
35	12" x 12" White VFT (ABATED)			Rooms 112, 114 Library (ABATED)	ABATED	MISC								
35A	12" x 12" White VFT Mastic (ABATED)			Rooms 112, 114 Library (ABATED)	ABATED	MISC								
36	12" x 12" Brown w/Grey VFT	900	SF	Rooms 129, 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36A	12" x 12" Brown w/Grey VFT Mastic	900	SF	Rooms 129, 229	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12" x 12" Red VFT	40	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
48	12"x12" Sand VFT	150	SF	Room 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
48 A	12"x12" Sand VFT MASTIC	150	SF	Room 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
9	Lab Table Tops	40	EA	Rooms 317-24 and 321-16, 322-24, 318-24, 315-24	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
F	Aircell Pipe Insulation	350	LF	Basement Fan & Engine Room, Basement Air Tunnel, south, 2nd Floor Open Hatch inside Kitchen Locker Room.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
G	MJP E/F/V on Aircell Pipe Insulation	15	FITTING	Basement Fan & Engine Room, Basement Air Tunnel South	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
HA-100	12"x12" White VFT ABATED			First floor Library ABATED	ABATED	MISC								
HA-100A	12"x12" White VFT Mastic - ABATED			First floor Library - Abated	ABATED	MISC								
K	MJP E/F/V on Fiberglass Pipe Insulation NOT OBSERVED	50	FITTING	Rooms 121, 221, 218 NOT OBSERVED	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
L	12" x 12" Brown with White Specks VFT (Abated)			Room 222 (Abated)	ABATED	MISC								
M	12" x 12" White VFT (Not Observed)	1,200	SF	Health Room (307) (Not Observed)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
O	12" x 12" Brown & White VFT	1,020	SF	Room 308	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
Q	12" x 12" Brown & White VFT	36	SF	Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
R	12" x 12" Brown, White & Beige VFT	1,020	SF	Room 306	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
S	Terrazzo Red & White	500	SF	3rd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
T	12" x 12" Speckled Beige & White VFT	40	SF	Engineer's Bathroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
U	12" x 12" Gray & Black VFT	5,000	SF	Rooms 217, 221, 222, 317, 318, Rooms 321 & 322 (Not Observed)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
V	Terrazzo (Red, White & Black)	500	SF	Corridor 2nd Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
W	12" x 12" Beige VFT	120	SF	Room 305 Storage, Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
X	12" x 12" Grey & Black VFT	5,960	SF	Rooms 217, 221, 222, 317, 318, Rooms 321 & 322 (Not Observed)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
Y	12" x 12" Black & Red VFT	100	SF	Room 230	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
Z	Terrazzo (Red & White)	300	SF	Corridor 1st Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
ZZ	12"x12" Beige with Speckles VFT	400	SF	Room 322, Room 323	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Amundsen High School Unit 46031 Building ID 1210
Address 5110 N. Damen Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>3/13/2025</u>
Inspector Name <u>Allizon Brooks</u>
<u>100-18790</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
07	
08	
101	
102	
102A	
103	
104	
104A	
105	
105A	
106	
107	
107A	
107B	
107C	
107D	
107E	
108	
109	
109A	
11	
110	
110A	
111	

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
112	
113	
114	
115	
116	
116A	
116B	
116C	
116D	
12	
13	
14	
15	
16	
16A	
17	
19	
19A	
20	
22A	
23	
23A	
24	
24A	
25	
25A	
26	
26A	
27	

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
27A	
30	
30A	
31	
31A	
32	
32A	
33	
33A	
34	
34A	
35	
35A	
36	
36A	
37	
37A	
38	
38A	
39	
39A	
40	
41	
41A	
42	
43	
44	
44 A	
45	

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
45 A	
46	
46 A	
47	
48	
48 A	
9	
F	
G	
HA-100	
HA-100A	
K	
L	
M	
O	
Q	
R	
S	
T	
U	
V	
W	
X	
Y	
Z	
ZZ	

Chicago Public Schools

School Amundsen High School **Unit** 46031 **Building ID** 1210
Address 5110 N. Damen **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Table II
Management Planner's Review

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
07	9" x 9" White VFT ABATED			Room 222 ABATED	Abated	MISC					
08	12" x 12" Tan VFT (Not Observed)	325	SF	Room 128 (Not Observed)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101	2' x 2' Ceiling Tile w/ dots Glue pucks	1,000	SF	Boy's Gym	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
102	12"x12" Light blue w/ gray specks VFT	260	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
102A	12"x12" Light blue w/ gray specks VFT MASTIC	260	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
103	2'x2' Ceiling tiles w/ dots	8,000	SF	Boys' Gymnasium	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104	12"x12" Black with white specks VFT	500	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104A	12"x12" Black with white specks VFT MASTIC	500	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
105	12"x12" Light brown with brown and tan streaks VFT	250	SF	Room 303, 3rd floor MDF room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
105A	12"x12" Light brown with brown and tan streaks VFT MASTIC	250	SF	Room 303, 3rd floor MDF room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
106	2'x4' Ceiling Tile	1,200	SF	Health center made up of room 307 & boys and girls toilets on the 3rd fl	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107	Salmon linoleum ABATED			Health center made up of rm 307 & girls toilets on 3rd fl. ABATED	Abated	MISC					
107A	Salmon linoleum MASTIC ABATED			Health center made up of rm 307 & Girls toilets on the 3rd fl. ABATED	Abated	MISC					
107B	Linoleum - White	3,748	SF	Rooms 322, 317, 318, 215	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107C	Linoleum - Tan	6,000	SF	307 Health Center, 317 Lab, 217 Lab, Offices & Vault, 215	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107D	Linoleum - Gray w/ Black Spots	1,300	SF	Room 221 and Power Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107E	Linoleum Mastic - White/Tan/Gray with Black	11,000	SF	Rooms 322, 317, 318, 215, 307 Health Center, 207, 215, 221 & Power Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
108	2'x4' ceiling tiles	4,000	SF	Rooms 321, 322, 324	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	12"x12" Off white w/ light gray & gray specs VFT NOT OBSERVED	100	SF	Darkroom NOT OBSERVED	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109A	12"x12" Off white w/ light gray & gray specs VFT Mastic NOT OBSERVED	100	SF	Darkroom NOT OBSERVED	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12" x 12" Tan VFT Mastic (Not Observed)	325	SF	Room 128 - (Not Observed)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
110	9"x9" Light brown VFT ABATED			Room 308 & closet next to the dark room ABATED	Abated	MISC					
110A	9"x9" Light brown VFT MASTIC ABATED			Room 308 & closet next to dark room	Abated	MISC					

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				ABATED							
111	Fire door NOT OBSERVED	2	EA	Stage entrance, projector rm. NOT OBSERVED	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
112	Terrazzo	23,000	SF	1st, 2nd, and 3rd fl. corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
113	Black lab table tops	154	EA	Rooms 315, 318, 322, 209, 215, 217, 221	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
114	2' x 2' White Ceiling Tile	15,000	SF	Rooms 122 A & B, Asst. Principal's Office, 124, 126, 128 & A thru F Offices, 109, 114, 117 & A, B, C, 104	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
115	Drywall System	30,000	SF	Elevator Hallway, Basement Office & Power Room; Rooms 122 A & B & Main Offices, 124, 126, 128 & A thru F Offices; Men's/Women's, Boy's, Girl's, Unisex Bathrooms & Locker Rooms; Health Center 307 & Offices; Stairwell Corridor #3, Rooms 108, 109 and 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116	24" x 24" White VFT	2,500	SF	Rooms 109, 104 & A, B, C, 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116A	24" x 24" Blue VFT	1,200	SF	Room 104 & A, B & C Staff Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116B	24" x 24" Gray VFT	400	SF	Room 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116C	24" x 24" Black VFT	400	SF	Room 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116D	24" x 24" VFT Mastic for HA 116, 116A, 116B, 116C	4,500	SF	Room 117, 109, 104 A, B & C	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	9" x 9" White VFT Mastic - ABATED			Room 222 - ABATED	Abated	MISC					
13	Hard Coat Plaster			Throughout	No ACBM	SURFACE					
14	Sculptured Plaster			Auditorium and Auditorium Foyer	No ACBM	SURFACE					
15	2' x 4' Ceiling Tile			Club room B, Library, rooms 112, 117, 118, 124, 126, 221, 226, 328	No ACBM	MISC					
16	12" x 12" Black VFT	4,300	SF	Auditorium, Girls and Boys Locker Room Entrances, Book Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A	12" x 12" Black VFT Mastic	4,300	SF	Auditorium, Girls and Boys Locker Room Entrances, Book Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	1' x 1' Rough Ceiling Tile			Club room A, College Faculty	No ACBM	MISC					
19	12" x 12" White w/Beige VFT	4,600	SF	Room 117, (library- not observed)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A	12" x 12" White w/Beige VFT Mastic	4,600	SF	Room 117, (library- not observed)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	1' x 1' White Acoustic Ceiling Tile			Lunch room, Band room, Music room, Study room, Girls Gym	No ACBM	MISC					

Chicago Public Schools

School Amundsen High School
Address 5110 N. Damen

Unit 46031
Chicago, IL, 60625

Building ID 1210
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
22A	6" x 12" Acoustical Tile			Library, Auditorium	No ACBM	MISC					
23	12" x 12" Gray VFT	2,900	SF	Clubroom A & B, College Faculty, Main Office & 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	12" x 12" Grey VFT Mastic	2,900	SF	Clubroom A & B, College Faculty, Main Office & 117	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	9" x 9" Green VFT (abated)			Engineers Office (abated)	Abated	MISC					
24A	9" x 9" Green VFT Mastic (abated)			Engineers Office (abated)	Abated	MISC					
25	9" x 9" Dark Brown VFT	20	SF	Room 209 Vault	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	9" x 9" Dark Brown VFT Mastic	20	SF	Room 209 Vault	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	9" x 9" Light Brown VFT - ABATED			Rooms 308, 306 & 201 - ABATED	Abated	MISC					
26A	9" x 9" Light Brown VFT Mastic - ABATED			Rooms 308, 306 & 201 - ABATED	Abated	MISC					
27	9" x 9" Red VFT - ABATED			1st, 2nd, and 3rd floor corridors - ABATED	Abated	MISC					
27A	9" x 9" Red VFT Mastic - ABATED			1st, 2nd, and 3rd floor corridors - ABATED	Abated	MISC					
30	12" x 12" Off-White VFT			Room 328	Abated	MISC					
30A	12" x 12" Off-White VFT Mastic			Room 328	Abated	MISC					
31	9" x 9" Brown VFT - ABATED			Engineers Bathroom - ABATED	Abated	MISC					
31A	9" x 9" Brown VFT Mastic - ABATED			Engineers Bathroom - ABATED	Abated	MISC					
32	12" x 12" Red w/ Red Streaks VFT	100	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32A	12" x 12" Red with red streaks VFT MASTIC	100	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	9" x 9" Black VFT			1st, 2nd, 3rd Floor Corridors	Abated	MISC					
33A	9" x 9" Black VFT Mastic			1st, 2nd, 3rd Floor Corridors	Abated	MISC					
34	12" x 12" Brown VFT (ABATED)			Room 317 (ABATED)	Abated	MISC					
34A	12" x 12" Brown VFT Mastic (ABATED)			Room 317 (ABATED)	Abated	MISC					
35	12" x 12" White VFT (ABATED)			Rooms 112, 114 Library (ABATED)	Abated	MISC					
35A	12" x 12" White VFT Mastic (ABATED)			Rooms 112, 114 Library (ABATED)	Abated	MISC					
36	12" x 12" Brown w/Grey VFT	900	SF	Rooms 129, 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36A	12" x 12" Brown w/Grey VFT Mastic	900	SF	Rooms 129, 229	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12" x 12" Red VFT	40	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37A	12" x 12" Red VFT Mastic	40	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	9" x 9" Red w/ White VFT - ABATED			Engineers Office (ABATED)	Abated	MISC					
38A	9" x 9" Red w/ White VFT Mastic - ABATED			Engineers Office (ABATED)	Abated	MISC					
39	2' x 2' Blue VFT ABATED			Weight Rooms ABATED	Abated	MISC					
39A	2' x 2' Blue VFT Mastic ABATED			Weight Rooms ABATED	Abated	MISC					

Chicago Public Schools

School Amundsen High School
Address 5110 N. Damen

Unit 46031
Chicago, IL, 60625

Building ID 1210
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
40	2' x 2' Dot/Wave Ceiling Tile	1,100	SF	Room 230	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Salmon Linoleum (ABATED)			Rooms 217, 221, 317, 318, 321, 322, 327 (ABATED)	Abated	MISC					
41A	Salmon Linoleum Mastic (ABATED)			Rooms 217, 221, 317, 318, 322, 321 and 327(ABATED)	Abated	MISC					
42	Carpet Mastic ABATED			Main Office, Room 325 & 109 ABATED	Abated	MISC					
43	Terrazzo	5,000	SF	Entryways, Stairs, Lunch Room, Serving Area, Kitchen, 1st & 2nd & 3rd floor corridors, Auditorium vestibule and stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12"x12" Light Tan with Specks VFT ABATED			1st floor corridors ABATED	Abated	MISC					
44 A	12"x12" Light tan with specks MASTIC -ABATED			1st floor corridors ABATED	Abated	MISC					
45	12"x12" Dark red VFT - ABATED			1st floor corridors ABATED	Abated	MISC					
45 A	12"x12" Dark red VFT MASTIC - ABATED			1st floor corridors ABATED	Abated	MISC					
46	12"x12" Black with white streaks VFT	200	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46 A	12"x12" Black with white streaks VFT MASTIC	200	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12"x12" Red with red streaks VFT - ABATED			Room 230 - ABATED	Abated	MISC					
48	12"x12" Sand VFT	150	SF	Room 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48 A	12"x12" Sand VFT MASTIC	150	SF	Room 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
9	Lab Table Tops	40	EA	Rooms 317-24 and 321-16, 322-24, 318-24, 315-24	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
F	Aircell Pipe Insulation	350	LF	Basement Fan & Engine Room, Basement Air Tunnel, south, 2nd Floor Open Hatch inside Kitchen Locker Room.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
G	MJP E/F/V on Aircell Pipe Insulation	15	FITTING	Basement Fan & Engine Room, Basement Air Tunnel South	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
HA-100	12"x12" White VFT ABATED			First floor Library ABATED	Abated	MISC					
HA-100A	12"x12" White VFT Mastic - ABATED			First floor Library - Abated	Abated	MISC					
K	MJP E/F/V on Fiberglass Pipe Insulation NOT OBSERVED	50	FITTING	Rooms 121, 221, 218 NOT OBSERVED	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
L	12" x 12" Brown with White Specks VFT (Abated)			Room 222 (Abated)	Abated	MISC					
M	12" x 12" White VFT (Not Observed)	1,200	SF	Health Room (307) (Not Observed)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O	12" x 12" Brown & White VFT	1,020	SF	Room 308	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Q	12" x 12" Brown & White VFT	36	SF	Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
R	12" x 12" Brown, White & Beige VFT	1,020	SF	Room 306	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
S	Terrazzo Red & White	500	SF	3rd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
T	12" x 12" Speckled Beige & White VFT	40	SF	Engineer's Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
U	12" x 12" Gray & Black VFT	5,000	SF	Rooms 217, 221, 222, 317, 318. Rooms 321 & 322 (Not Observed)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
V	Terrazzo (Red, White & Black)	500	SF	Corridor 2nd Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
W	12" x 12" Beige VFT	120	SF	Room 305 Storage, Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
X	12" x 12" Grey & Black VFT	5,960	SF	Rooms 217, 221, 222, 317, 318. Rooms 321 & 322 (Not Observed)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Y	12" x 12" Black & Red VFT	100	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Z	Terrazzo (Red & White)	300	SF	Corridor 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
ZZ	12"x12" Beige with Speckles VFT	400	SF	Room 322, Room 323	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	3/28/2025
Manager Planner Name	Jigar Shah
100-07342	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
07	
08	
101	
102	
102A	
103	
104	
104A	
105	
105A	
106	
107	
107A	
107B	
107C	
107D	
107E	
108	
109	
109A	
11	
110	
110A	
111	

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
112	
113	
114	
115	
116	
116A	
116B	
116C	
116D	
12	
13	
14	
15	
16	
16A	
17	
19	
19A	
20	
22A	
23	
23A	
24	
24A	
25	
25A	
26	

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
26A	
27	
27A	
30	
30A	
31	
31A	
32	
32A	
33	
33A	
34	
34A	
35	
35A	
36	
36A	
37	
37A	
38	
38A	
39	
39A	
40	
41	
41A	
42	

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
43	
44	
44 A	
45	
45 A	
46	
46 A	
47	
48	
48 A	
9	
F	
G	
HA-100	
HA-100A	
K	
L	
M	
O	
Q	
R	
S	
T	
U	
V	
W	
X	

Chicago Public Schools

School Amundsen High School

Unit 46031

Building ID 1210

Address 5110 N. Damen

Chicago, IL, 60625

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
Y	
Z	
ZZ	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **9" x 9" White VFT ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 222 ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **9" x 9" White VFT ABATED**

MATERIAL LOCATION: **Room 222 ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

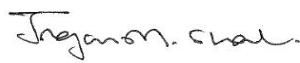

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	12" x 12" Tan VFT (Not Observed)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 128 (Not Observed)		
MATERIAL QUANTITY:	325	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **12" x 12" Tan VFT (Not Observed)**

MATERIAL LOCATION: **Room 128 (Not Observed)**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101		
MATERIAL DESCRIPTION:	2' x 2' Ceiling Tile w/ dots Glue pucks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boy's Gym		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile w/ dots Glue pucks**

MATERIAL LOCATION: **Boy's Gym**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102		
MATERIAL DESCRIPTION:	12"x12" Light blue w/ gray specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	260	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **102**

MATERIAL DESCRIPTION: **12"x12" Light blue w/ gray specks VFT**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **260** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102A		
MATERIAL DESCRIPTION:	12"x12" Light blue w/ gray specks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	260	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **102A**

MATERIAL DESCRIPTION: **12"x12" Light blue w/ gray specks VFT MASTIC**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **260** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103		
MATERIAL DESCRIPTION:	2'x2' Ceiling tiles w/ dots		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys' Gymnasium		
MATERIAL QUANTITY:	8000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **103**

MATERIAL DESCRIPTION: **2'x2' Ceiling tiles w/ dots**

MATERIAL LOCATION: **Boys' Gymnasium**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

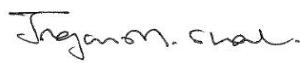

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104		
MATERIAL DESCRIPTION:	12"x12" Black with white specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **104**

MATERIAL DESCRIPTION: **12"x12" Black with white specks VFT**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104A		
MATERIAL DESCRIPTION:	12"x12" Black with white specks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **104A**

MATERIAL DESCRIPTION: **12"x12" Black with white specks VFT MASTIC**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	105		
MATERIAL DESCRIPTION:	12"x12" Light brown with brown and tan streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 303, 3rd floor MDF room		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **105**

MATERIAL DESCRIPTION: **12"x12" Light brown with brown and tan streaks VFT**

MATERIAL LOCATION: **Room 303, 3rd floor MDF room**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	105A		
MATERIAL DESCRIPTION:	12"x12" Light brown with brown and tan streaks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 303, 3rd floor MDF room		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **105A**

MATERIAL DESCRIPTION: **12"x12" Light brown with brown and tan streaks VFT MASTIC**

MATERIAL LOCATION: **Room 303, 3rd floor MDF room**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

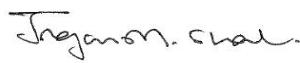

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	106		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Health center made up of room 307 & boys and girls toilets on the 3rd fl		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46031** BULDING ID: **1210**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**

SCHOOL NAME: **Amundsen High School** REVIEW DATE: **3/28/2025**

ADDRESS: **5110 N. Damen** IDPH LICENSE NO: **100-18790**

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**

MATERIAL LOCATION: **Health center made up of room 307 & boys and girls toilets on the 3rd fl**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **Salmon linoleum ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Health center made up of rm 307 & girls toilets on 3rd fl.
ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **Salmon linoleum ABATED**

MATERIAL LOCATION: **Health center made up of rm 307 & girls toilets on 3rd fl.
ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107A**

MATERIAL DESCRIPTION: **Salmon linoleum MASTIC ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Health center made up of rm 307 & Girls toilets on the 3rd fl.
ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107A**

MATERIAL DESCRIPTION: **Salmon linoleum MASTIC ABATED**

MATERIAL LOCATION: **Health center made up of rm 307 & Girls toilets on the 3rd fl.
ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107B		
MATERIAL DESCRIPTION:	Linoleum - White		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 322, 317, 318, 215		
MATERIAL QUANTITY:	3748	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107B**

MATERIAL DESCRIPTION: **Linoleum - White**

MATERIAL LOCATION: **Rooms 322, 317, 318, 215**

MATERIAL QUANTITY: **3748** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107C		
MATERIAL DESCRIPTION:	Linoleum - Tan		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	307 Health Center, 317 Lab, 217 Lab, Offices & Vault, 215		
MATERIAL QUANTITY:	6000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107C**

MATERIAL DESCRIPTION: **Linoleum - Tan**

MATERIAL LOCATION: **307 Health Center, 317 Lab, 217 Lab, Offices & Vault, 215**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107D		
MATERIAL DESCRIPTION:	Linoleum - Gray w/ Black Spots		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 221 and Power Closet		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107D**

MATERIAL DESCRIPTION: **Linoleum - Gray w/ Black Spots**

MATERIAL LOCATION: **Room 221 and Power Closet**

MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107E		
MATERIAL DESCRIPTION:	Linoleum Mastic - White/Tan/Gray with Black		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 322, 317, 318, 215, 307 Health Center, 207, 215, 221 & Power Closet		
MATERIAL QUANTITY:	11000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107E**

MATERIAL DESCRIPTION: **Linoleum Mastic - White/Tan/Gray with Black**

MATERIAL LOCATION: **Rooms 322, 317, 318, 215, 307 Health Center, 207, 215, 221 & Power Closet**

MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	108		
MATERIAL DESCRIPTION:	2'x4' ceiling tiles		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 321, 322, 324		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **108**

MATERIAL DESCRIPTION: **2'x4' ceiling tiles**

MATERIAL LOCATION: **Rooms 321, 322, 324**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109		
MATERIAL DESCRIPTION:	12"x12" Off white w/ light gray & gray specs VFT NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Darkroom NOT OBSERVED		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **109**

MATERIAL DESCRIPTION: **12"x12" Off white w/ light gray & gray specs VFT NOT OBSERVED**

MATERIAL LOCATION: **Darkroom NOT OBSERVED**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109A		
MATERIAL DESCRIPTION:	12"x12" Off white w/ light gray & gray specs VFT Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Darkroom NOT OBSERVED**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **109A**

MATERIAL DESCRIPTION: **12"x12" Off white w/ light gray & gray specs VFT Mastic NOT OBSERVED**

MATERIAL LOCATION: **Darkroom NOT OBSERVED**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12" x 12" Tan VFT Mastic (Not Observed)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 128 - (Not Observed)		
MATERIAL QUANTITY:	325	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12" x 12" Tan VFT Mastic (Not Observed)**

MATERIAL LOCATION: **Room 128 - (Not Observed)**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110**

MATERIAL DESCRIPTION: **9"x9" Light brown VFT ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 308 & closet next to the dark room**
ABATED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **110**

MATERIAL DESCRIPTION: **9"x9" Light brown VFT ABATED**

MATERIAL LOCATION: **Room 308 & closet next to the dark room
ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110A**

MATERIAL DESCRIPTION: **9"x9" Light brown VFT MASTIC ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 308 & closet next to dark room**
ABATED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **110A**

MATERIAL DESCRIPTION: **9"x9" Light brown VFT MASTIC ABATED**

MATERIAL LOCATION: **Room 308 & closet next to dark room
ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111		
MATERIAL DESCRIPTION:	Fire door NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stage entrance, projector rm. NOT OBSERVED		
MATERIAL QUANTITY:	2	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **111**

MATERIAL DESCRIPTION: **Fire door NOT OBSERVED**

MATERIAL LOCATION: **Stage entrance, projector rm. NOT OBSERVED**

MATERIAL QUANTITY: **2** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	112		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, and 3rd fl. corridors		
MATERIAL QUANTITY:	23000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **112**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **1st, 2nd, and 3rd fl. corridors**

MATERIAL QUANTITY: **23000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	113		
MATERIAL DESCRIPTION:	Black lab table tops		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 315, 318, 322, 209, 215, 217, 221		
MATERIAL QUANTITY:	154	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **113**

MATERIAL DESCRIPTION: **Black lab table tops**

MATERIAL LOCATION: **Rooms 315, 318, 322, 209, 215, 217, 221**

MATERIAL QUANTITY: **154** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	114		
MATERIAL DESCRIPTION:	2' x 2' White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 122 A & B, Asst. Principal's Office, 124, 126, 128 & A thru F Offices, 109, 114, 117 & A, B, C, 104**

MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA:	114				
MATERIAL DESCRIPTION:	2' x 2' White Ceiling Tile				
MATERIAL LOCATION:	Rooms 122 A & B, Asst. Principal's Office, 124, 126, 128 & A thru F Offices, 109, 114, 117 & A, B, C, 104				
MATERIAL QUANTITY:	15000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	115		
MATERIAL DESCRIPTION:	Drywall System		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Elevator Hallway, Basement Office & Power Room; Rooms 122 A & B & Main Offices, 124, 126, 128 & A thru F Offices; Men's Women's, Boy's, Girl's, Unisex Bathrooms & Locker Rooms; Health Center 307 & Offices; Stairwell Corridor #3, Rooms 108, 109 and 113**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA:	115				
MATERIAL DESCRIPTION:	Drywall System				
MATERIAL LOCATION:	Elevator Hallway, Basement Office & Power Room; Rooms 122 A & B & Main Offices, 124, 126, 128 & A thru F Offices; Men's Women's, Boy's, Girl's, Unisex Bathrooms & Locker Rooms; Health Center 307 & Offices; Stairwell Corridor #3, Rooms 108, 109 and 113				
MATERIAL QUANTITY:	30000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: *Jigar Shah* Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116		
MATERIAL DESCRIPTION:	24" x 24" White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 109, 104 & A, B, C, 117		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **116**

MATERIAL DESCRIPTION: **24" x 24" White VFT**

MATERIAL LOCATION: **Rooms 109, 104 & A, B, C, 117**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116A		
MATERIAL DESCRIPTION:	24" x 24" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 104 & A, B & C Staff Offices		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **116A**

MATERIAL DESCRIPTION: **24" x 24" Blue VFT**

MATERIAL LOCATION: **Room 104 & A, B & C Staff Offices**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116B		
MATERIAL DESCRIPTION:	24" x 24" Gray VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 117		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **116B**

MATERIAL DESCRIPTION: **24" x 24" Gray VFT**

MATERIAL LOCATION: **Room 117**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

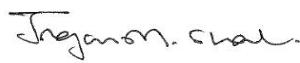

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116C		
MATERIAL DESCRIPTION:	24" x 24" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 117		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **116C**

MATERIAL DESCRIPTION: **24" x 24" Black VFT**

MATERIAL LOCATION: **Room 117**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116D		
MATERIAL DESCRIPTION:	24" x 24" VFT Mastic for HA 116, 116A, 116B, 116C		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 117, 109, 104 A, B &C		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **116D**

MATERIAL DESCRIPTION: **24" x 24" VFT Mastic for HA 116, 116A, 116B, 116C**

MATERIAL LOCATION: **Room 117, 109, 104 A, B &C**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **9" x 9" White VFT Mastic - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 222 - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **9" x 9" White VFT Mastic - ABATED**

MATERIAL LOCATION: **Room 222 - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Sculptured Plaster**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium and Auditorium Foyer**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Sculptured Plaster**

MATERIAL LOCATION: **Auditorium and Auditorium Foyer**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 15

MATERIAL DESCRIPTION: 2' x 4' Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Club room B, Library, rooms 112,117, 118, 124, 126, 221, 226, 328

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile**

MATERIAL LOCATION: **Club room B, Library, rooms 112,117, 118, 124, 126, 221, 226, 328**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

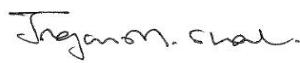

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	12" x 12" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Auditorium, Girls and Boys Locker Room Entrances, Book Room		
MATERIAL QUANTITY:	4300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **12" x 12" Black VFT**

MATERIAL LOCATION: **Auditorium, Girls and Boys Locker Room Entrances, Book Room**

MATERIAL QUANTITY: **4300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16A		
MATERIAL DESCRIPTION:	12" x 12" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium, Girls and Boys Locker Room Entrances, Book Room		
MATERIAL QUANTITY:	4300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **16A**

MATERIAL DESCRIPTION: **12" x 12" Black VFT Mastic**

MATERIAL LOCATION: **Auditorium, Girls and Boys Locker Room Entrances, Book Room**

MATERIAL QUANTITY: **4300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **1' x 1' Rough Ceiling Tile**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Club room A, College Faculty**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **1' x 1' Rough Ceiling Tile**

MATERIAL LOCATION: **Club room A, College Faculty**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 117, (library- not observed)		
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **12" x 12" White w/Beige VFT**

MATERIAL LOCATION: **Room 117, (library- not observed)**

MATERIAL QUANTITY: **4600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

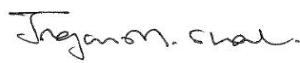

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19A		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 117, (library- not observed)		
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **19A**

MATERIAL DESCRIPTION: **12" x 12" White w/Beige VFT Mastic**

MATERIAL LOCATION: **Room 117, (library- not observed)**

MATERIAL QUANTITY: **4600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 20

MATERIAL DESCRIPTION: 1' x 1' White Acoustic Ceiling Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Lunch room, Band room, Music room, Study room, Girls Gym

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **1' x 1' White Acoustic Ceiling Tile**

MATERIAL LOCATION: **Lunch room, Band room, Music room, Study room, Girls Gym**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 22A

MATERIAL DESCRIPTION: 6" x 12" Acoustical Tile

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Library, Auditorium

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **22A**

MATERIAL DESCRIPTION: **6" x 12" Acoustical Tile**

MATERIAL LOCATION: **Library, Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	12" x 12" Gray VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Clubroom A & B, College Faculty, Main Office & 117		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12" x 12" Gray VFT**

MATERIAL LOCATION: **Clubroom A & B, College Faculty, Main Office & 117**

MATERIAL QUANTITY: **2900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

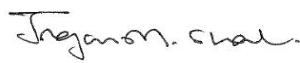

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23A		
MATERIAL DESCRIPTION:	12" x 12" Grey VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Clubroom A & B, College Faculty, Main Office & 117		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **23A**

MATERIAL DESCRIPTION: **12" x 12" Grey VFT Mastic**

MATERIAL LOCATION: **Clubroom A & B, College Faculty, Main Office & 117**

MATERIAL QUANTITY: **2900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **9" x 9" Green VFT (abated)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Office (abated)**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **9" x 9" Green VFT (abated)**

MATERIAL LOCATION: **Engineers Office (abated)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24A**

MATERIAL DESCRIPTION: **9" x 9" Green VFT Mastic (abated)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Office (abated)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **24A**

MATERIAL DESCRIPTION: **9" x 9" Green VFT Mastic (abated)**

MATERIAL LOCATION: **Engineers Office (abated)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	9" x 9" Dark Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 209 Vault		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown VFT**

MATERIAL LOCATION: **Room 209 Vault**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25A		
MATERIAL DESCRIPTION:	9" x 9" Dark Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 209 Vault		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **25A**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown VFT Mastic**

MATERIAL LOCATION: **Room 209 Vault**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **9" x 9" Light Brown VFT - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 308, 306 & 201 - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **9" x 9" Light Brown VFT - ABATED**

MATERIAL LOCATION: **Rooms 308, 306 & 201 - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26A**

MATERIAL DESCRIPTION: **9" x 9" Light Brown VFT Mastic - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 308, 306 & 201 - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **26A**

MATERIAL DESCRIPTION: **9" x 9" Light Brown VFT Mastic - ABATED**

MATERIAL LOCATION: **Rooms 308, 306 & 201 - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **9" x 9" Red VFT - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, and 3rd floor corridors - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **9" x 9" Red VFT - ABATED**

MATERIAL LOCATION: **1st, 2nd, and 3rd floor corridors - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

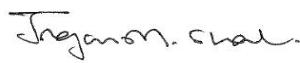

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27A**

MATERIAL DESCRIPTION: **9" x 9" Red VFT Mastic - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, and 3rd floor corridors - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **27A**

MATERIAL DESCRIPTION: **9" x 9" Red VFT Mastic - ABATED**

MATERIAL LOCATION: **1st, 2nd, and 3rd floor corridors - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12" x 12" Off-White VFT**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 328**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12" x 12" Off-White VFT**

MATERIAL LOCATION: **Room 328**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30A**

MATERIAL DESCRIPTION: **12" x 12" Off-White VFT Mastic**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 328**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **30A**

MATERIAL DESCRIPTION: **12" x 12" Off-White VFT Mastic**

MATERIAL LOCATION: **Room 328**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

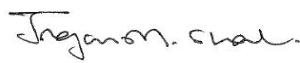

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **9" x 9" Brown VFT - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Bathroom - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **9" x 9" Brown VFT - ABATED**

MATERIAL LOCATION: **Engineers Bathroom - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

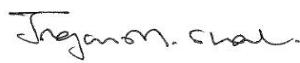

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31A**

MATERIAL DESCRIPTION: **9" x 9" Brown VFT Mastic - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Bathroom - ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **31A**

MATERIAL DESCRIPTION: **9" x 9" Brown VFT Mastic - ABATED**

MATERIAL LOCATION: **Engineers Bathroom - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	12" x 12" Red w/ Red Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12" x 12" Red w/ Red Streaks VFT**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32A		
MATERIAL DESCRIPTION:	12" x 12" Red with red streaks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **32A**

MATERIAL DESCRIPTION: **12" x 12" Red with red streaks VFT MASTIC**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **9" x 9" Black VFT**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **9" x 9" Black VFT**

MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33A**

MATERIAL DESCRIPTION: **9" x 9" Black VFT Mastic**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **33A**

MATERIAL DESCRIPTION: **9" x 9" Black VFT Mastic**

MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 34
MATERIAL DESCRIPTION: 12" x 12" Brown VFT (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 317 (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **12" x 12" Brown VFT (ABATED)**

MATERIAL LOCATION: **Room 317 (ABATED)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 34A

MATERIAL DESCRIPTION: 12" x 12" Brown VFT Mastic (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 317 (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **34A**

MATERIAL DESCRIPTION: **12" x 12" Brown VFT Mastic (ABATED)**

MATERIAL LOCATION: **Room 317 (ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 35
MATERIAL DESCRIPTION: 12" x 12" White VFT (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112, 114 Library (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12" x 12" White VFT (ABATED)**

MATERIAL LOCATION: **Rooms 112, 114 Library (ABATED)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 35A

MATERIAL DESCRIPTION: 12" x 12" White VFT Mastic (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112, 114 Library (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **35A**

MATERIAL DESCRIPTION: **12" x 12" White VFT Mastic (ABATED)**

MATERIAL LOCATION: **Rooms 112, 114 Library (ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12" x 12" Brown w/Grey VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 129, 229		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12" x 12" Brown w/Grey VFT**

MATERIAL LOCATION: **Rooms 129, 229**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36A		
MATERIAL DESCRIPTION:	12" x 12" Brown w/Grey VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 129, 229		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **36A**

MATERIAL DESCRIPTION: **12" x 12" Brown w/Grey VFT Mastic**

MATERIAL LOCATION: **Rooms 129, 229**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12" x 12" Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12" x 12" Red VFT**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

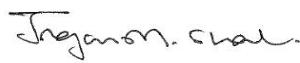

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37A		
MATERIAL DESCRIPTION:	12" x 12" Red VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **37A**

MATERIAL DESCRIPTION: **12" x 12" Red VFT Mastic**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **9" x 9" Red w/ White VFT - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Office (ABATED)**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **9" x 9" Red w/ White VFT - ABATED**

MATERIAL LOCATION: **Engineers Office (ABATED)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 38A

MATERIAL DESCRIPTION: 9" x 9" Red w/ White VFT Mastic - ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engineers Office (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **38A**

MATERIAL DESCRIPTION: **9" x 9" Red w/ White VFT Mastic - ABATED**

MATERIAL LOCATION: **Engineers Office (ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **2' x 2' Blue VFT ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Weight Rooms ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **2' x 2' Blue VFT ABATED**

MATERIAL LOCATION: **Weight Rooms ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**

MATERIAL DESCRIPTION: **2' x 2' Blue VFT Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Weight Rooms ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **39A**

MATERIAL DESCRIPTION: **2' x 2' Blue VFT Mastic ABATED**

MATERIAL LOCATION: **Weight Rooms ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	2' x 2' Dot/Wave Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **2' x 2' Dot/Wave Ceiling Tile**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 41

MATERIAL DESCRIPTION: Salmon Linoleum (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 217, 221, 317, 318, 321, 322, 327 (ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Salmon Linoleum (ABATED)**

MATERIAL LOCATION: **Rooms 217, 221, 317, 318, 321, 322, 327 (ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 41A

MATERIAL DESCRIPTION: Salmon Linoleum Mastic (ABATED)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 217, 221, 317, 318, 322, 321 and 327(ABATED)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **41A**

MATERIAL DESCRIPTION: **Salmon Linoleum Mastic (ABATED)**

MATERIAL LOCATION: **Rooms 217, 221, 317, 318, 322, 321 and 327(ABATED)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

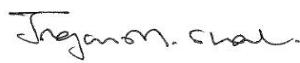

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Carpet Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office, Room 325 & 109 ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Carpet Mastic ABATED**

MATERIAL LOCATION: **Main Office, Room 325 & 109 ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

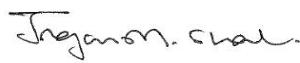

Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Entryways, Stairs, Lunch Room, Serving Area, Kitchen, 1st & 2nd & 3rd floor corridors, Auditorium vestibule and stairs		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **Entryways, Stairs, Lunch Room, Serving Area, Kitchen, 1st & 2nd & 3rd floor corridors, Auditorium vestibule and stairs**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **12"x12" Light Tan with Specks VFT ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **12"x12" Light Tan with Specks VFT ABATED**

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44 A**

MATERIAL DESCRIPTION: **12"x12" Light tan with specks MASTIC -ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **44 A**

MATERIAL DESCRIPTION: **12"x12" Light tan with specks MASTIC -ABATED**

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School		INSPECTION DATE:	3/13/2025	
ADDRESS:	5110 N. Damen		IDPH LICENSE NO:	100-18790	

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **12"x12" Dark red VFt - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **12"x12" Dark red VFT - ABATED**

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45 A**

MATERIAL DESCRIPTION: **12"x12" Dark red VFT MASTIC - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **45 A**

MATERIAL DESCRIPTION: **12"x12" Dark red VFT MASTIC - ABATED**

MATERIAL LOCATION: **1st floor corridors ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Black with white streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12"x12" Black with white streaks VFT**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46 A		
MATERIAL DESCRIPTION:	12"x12" Black with white streaks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **46 A**

MATERIAL DESCRIPTION: **12"x12" Black with white streaks VFT MASTIC**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12"x12" Red with red streaks VFT - ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 230 - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12"x12" Red with red streaks VFT - ABATED**

MATERIAL LOCATION: **Room 230 - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	12"x12" Sand VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 303		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **12"x12" Sand VFT**

MATERIAL LOCATION: **Room 303**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48 A		
MATERIAL DESCRIPTION:	12"x12" Sand VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 303		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **48 A**

MATERIAL DESCRIPTION: **12"x12" Sand VFT MASTIC**

MATERIAL LOCATION: **Room 303**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	9		
MATERIAL DESCRIPTION:	Lab Table Tops		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 317-24 and 321-16, 322-24, 318-24, 315-24		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **Lab Table Tops**

MATERIAL LOCATION: **Rooms 317-24 and 321-16, 322-24, 318-24, 315-24**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allison Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 Damaged or significantly damaged friable thermal system insulating ACBM		
HISTORICAL DAMAGE REASON:	Delamination Deterioration		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Basement Fan & Engine Room, Basement Air Tunnel, south, 2nd Floor Open Hatch inside Kitchen Locker Room.**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement Fan & Engine Room, Basement Air Tunnel, south, 2nd Floor Open Hatch inside Kitchen Locker Room.**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allison Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 Damaged or significantly damaged friable thermal system insulating ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Basement Fan & Engine Room, Basement Air Tunnel South		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:	DAMAGE UNITS: FITTING		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**

MATERIAL LOCATION: **Basement Fan & Engine Room, Basement Air Tunnel South**

MATERIAL QUANTITY: **15** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-100**

MATERIAL DESCRIPTION: **12"x12" White VFT ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **First floor Library ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-100**

MATERIAL DESCRIPTION: **12"x12" White VFT ABATED**

MATERIAL LOCATION: **First floor Library ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: HA-100A

MATERIAL DESCRIPTION: 12"x12" White VFT Mastic - ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: First floor Library - Abated

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-100A**

MATERIAL DESCRIPTION: **12"x12" White VFT Mastic - ABATED**

MATERIAL LOCATION: **First floor Library - Abated**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	K		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 121, 221, 218 NOT OBSERVED		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature:

Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation NOT OBSERVED**

MATERIAL LOCATION: **Rooms 121, 221, 218 NOT OBSERVED**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **12" x 12" Brown with White Specks VFT (Abated)**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 222 (Abated)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **12" x 12" Brown with White Specks VFT (Abated)**

MATERIAL LOCATION: **Room 222 (Abated)**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	12" x 12" White VFT (Not Observed)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Health Room (307) (Not Observed)		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **12" x 12" White VFT (Not Observed)**

MATERIAL LOCATION: **Health Room (307) (Not Observed)**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	0		
MATERIAL DESCRIPTION:	12" x 12" Brown & White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 308		
MATERIAL QUANTITY:	1020	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **12" x 12" Brown & White VFT**

MATERIAL LOCATION: **Room 308**

MATERIAL QUANTITY: **1020** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	12" x 12" Brown & White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 201		
MATERIAL QUANTITY:	36	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **12" x 12" Brown & White VFT**

MATERIAL LOCATION: **Room 201**

MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	R		
MATERIAL DESCRIPTION:	12" x 12" Brown, White & Beige VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 306		
MATERIAL QUANTITY:	1020	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **R**

MATERIAL DESCRIPTION: **12" x 12" Brown, White & Beige VFT**

MATERIAL LOCATION: **Room 306**

MATERIAL QUANTITY: **1020** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	S		
MATERIAL DESCRIPTION:	Terrazzo Red & White		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	3rd Floor Corridor		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **S**

MATERIAL DESCRIPTION: **Terrazzo Red & White**

MATERIAL LOCATION: **3rd Floor Corridor**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	12" x 12" Speckled Beige & White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Engineer's Bathroom		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature: _____ Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **T**

MATERIAL DESCRIPTION: **12" x 12" Speckled Beige & White VFT**

MATERIAL LOCATION: **Engineer's Bathroom**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	U		
MATERIAL DESCRIPTION:	12" x 12" Gray & Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 217, 221, 222, 317, 318. Rooms 321 & 322 (Not Observed)		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **U**

MATERIAL DESCRIPTION: **12" x 12" Gray & Black VFT**

MATERIAL LOCATION: **Rooms 217, 221, 222, 317, 318. Rooms 321 & 322 (Not Observed)**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	V		
MATERIAL DESCRIPTION:	Terrazzo (Red, White & Black)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Corridor 2nd Floor		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **V**

MATERIAL DESCRIPTION: **Terrazzo (Red, White & Black)**

MATERIAL LOCATION: **Corridor 2nd Floor**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	W		
MATERIAL DESCRIPTION:	12" x 12" Beige VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 305 Storage, Engineer's Office		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **W**

MATERIAL DESCRIPTION: **12" x 12" Beige VFT**

MATERIAL LOCATION: **Room 305 Storage, Engineer's Office**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	X		
MATERIAL DESCRIPTION:	12" x 12" Grey & Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 217, 221, 222, 317, 318. Rooms 321 & 322 (Not Observed)		
MATERIAL QUANTITY:	5960	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **X**

MATERIAL DESCRIPTION: **12" x 12" Grey & Black VFT**

MATERIAL LOCATION: **Rooms 217, 221, 222, 317, 318. Rooms 321 & 322 (Not Observed)**

MATERIAL QUANTITY: **5960** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Y		
MATERIAL DESCRIPTION:	12" x 12" Black & Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **Y**

MATERIAL DESCRIPTION: **12" x 12" Black & Red VFT**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUIDLING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Z		
MATERIAL DESCRIPTION:	Terrazzo (Red & White)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Corridor 1st Floor		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature: _____ Date: 03/13/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **Z**

MATERIAL DESCRIPTION: **Terrazzo (Red & White)**

MATERIAL LOCATION: **Corridor 1st Floor**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Amundsen High School	INSPECTION DATE:	3/13/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	ZZ		
MATERIAL DESCRIPTION:	12"x12" Beige with Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 322, Room 323		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:

Date: **03/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46031	BUILDING ID:	1210
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Amundsen High School	REVIEW DATE:	3/28/2025		
ADDRESS:	5110 N. Damen	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **ZZ**

MATERIAL DESCRIPTION: **12"x12" Beige with Speckles VFT**

MATERIAL LOCATION: **Room 322, Room 323**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **03/28/2025**

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 18790

ISSUED
4/5/2024

EXPIRES
05/15/2025

ALLIZON L BROOKS
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ALLIZON L BROOKS
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/5/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18790

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License


Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18790	ISSUED 4/5/2024	EXPIRES 05/15/2025	INSPECTOR	1/27/2025
ALLIZON L BROOKS 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	6/12/2024
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

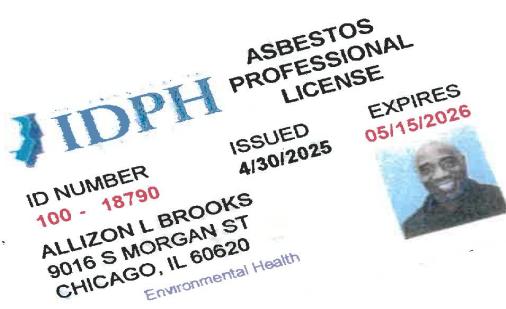

ENDORSEMENTS	TC EXPIRES
INSPECTOR	1/4/2026
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	6/1/2025
Alteration of this license shall result in legal action	
This license issued under authority of the State of Illinois	
Department of Public Health	
This license is valid only when accompanied by a valid	
training course certificate.	

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that ALLIZON L. BROOKS
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR02

Certificate Number:

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

A handwritten signature in black ink that appears to read "Nicholas J. Peneff".



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

6/9/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07342	ISSUED 6/9/2025	EXPIRES 05/15/2026	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/7/2026 1/27/2026 3/7/2026 4/7/2026
JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo

Kathy DeSalvo, Director



Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022


Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director

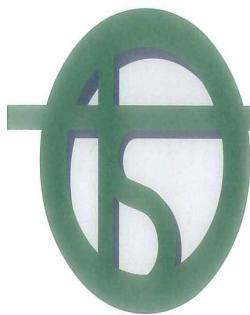

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License



Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/9/2023
PROJECT DESIGNER	3/24/2023
MANAGEMENT PLANNER	3/9/2023
PROJECT MANAGER	3/2/2023
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 07342

ISSUED
4/8/2024

EXPIRES
05/15/2025

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612


4/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

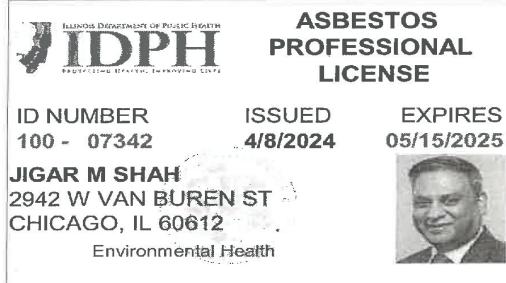

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	3/8/2025
PROJECT DESIGNER	3/7/2025
MANAGEMENT PLANNER	3/8/2025
PROJECT MANAGER	3/25/2024
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES

Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/8/2024

Exam Date: 3/8/2024

Expiration Date: 3/8/2025

Certificate Number: MPR2403081126

Course Credit Hours: MPR 4 Hours

A handwritten signature in black ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2025

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 3/7/2025

Exam Date: 3/7/2025

Expiration Date: 3/7/2026

Certificate Number: MPR2503070948

Course Credit Hours: MPR 4 Hours

Kristina Miczek, Training Manager

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed