

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0036
SCHOOL NAME: Schurz High School
ADDRESS OF SCHOOL: 3601 N. Milwaukee Ave.
CITY: Chicago, IL, 60641

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 9/16/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/14/2025 ENROLLMENT 1010
IDPH INSPECTOR LICENSE NUMBER: 100-18790
IDPH LICENSED INSPECTOR NAME (Please Print): Allizon Brooks
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

 5/13/2025
Richard J. Schleyer
Signature of Designated Person Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Schurz High School

3601 N. Milwaukee Ave.
Chicago, IL, 60641

Unit: 46281
Building ID: 1530

IDPH ID Number: 14-016-2990-0036

REPORT DATE:
Tuesday, May 13, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
Specialty Consulting, Inc.

2942 W. Van Buren Street
Chicago, IL, 60612
Phone (312) 319-7575
Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

05/13/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46281 Region: 01 IDPH ID: 14-016-2990-0036

School: Schurz High School Building ID: 1530

Address: 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Building Contact: Degante, Joaquin Contact Phone: 7737097140

Current Building Owners: Chicago Public Schools

Reinspection Date: 4/14/2025

Review Date: 05/13/2025

Inspector: Allizon Brooks

Inspector IDPH License: 100-18790

Management Planner: Arturo Saenz

Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: May 13, 2025

RE: Schurz High School, Unit 46281
3601 N. Milwaukee Ave.
Chicago, IL, 60641

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Schurz High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Schurz High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Schurz High School Unit: 46281 Region: 01
Address: 3601 N. Milwaukee Ave. Chicago, IL, 60641
IDPH ID: 14-016-2990-0036 Building ID: 1530
Contact: Degante, Joaquin Phone: 7737097140

2. Description of Facility

Original Construction: 1910 Additional Construction:
Total Square Footage: 455800 No of Floors: 5
Current Occupancy: 1010

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: Allizon Brooks

Inspector IDPH license # 100-18790 Signature:
Reinspection Date: 4/14/2025 Date: 4/14/2025



Signature:
Date: 05/13/2025

6. Management Planner

Management Planner Name: Arturo Saenz

Management Planner IDPH license # 100-04019



Signature:
Date: 05/13/2025

7. Review Date: 05/13/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

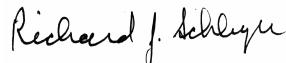

Date: 5/13/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Schurz High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1530:

02

9"x9" Brown w/ White Specks VFT

B. The following new homogenous areas have been identified for Building 1530:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

03	Tan w/ Brown Swirls Linoleum
06	Tan w/ Brown Swirls Linoleum Mastic
1009	Boiler #1 (small) Insulation
103	MJP E/F/V on Fiberglass Pipe Insulation
104	Green Linoleum
105	Green Linoleum Mastic
107	12" x 12" Gray w/ White SpeckS VFT
108	12" x 12" Gray w/ White SpeckS VFT Mastic
109	12" x 12" Orange Cork VFT
110	12" x 12" Orange Cork VFT Mastic
111	Carpet Mastic
112	Carpet Adhesive
113	12" x 12" Powder-Blue w/White and Blue Streaks VFT
113M	12" x 12" Powder-Blue w/White and Blue Streaks VFT Mastic
114	12" x 12" Tan w/ white specs VFT & Mastic
115	Carpet Mastic
116	Lab Black Counter Tops
117	Lab Black Table Tops
118	12" x 12" Tan w/ Large White Striations VFT
118A	12" x 12" Tan w/ Large White Striations VFT Mastic
119	12" x 12" Light blue w/ gray & white specs VFT
119A	12" x 12" Light blue w/ gray & white specs VFT Mastic
120	12" x 12" White w/ Tan Streaks VFT
120A	12" x 12" White w/ Tan Streaks VFT Mastic
121	12" x 12" White w/ Green & Gray Streaks VFT
121 A	12" x 12" White w/ Green & Gray Streaks VFT Mastic
122	12" x 12" Tan w/ white Streaks VFT
122A	12" x 12" Tan w/ White Streaks VFT Mastic
123	Tan Linoleum w/ white & black streaks
123A	Tan Linoleum w/ white & black streaks Mastic
124	12" x 12" Tan with Specks Floor Tile
125	12" x 12" Tan with Specks Floor Tile Mastic
126	12" x 12" Brown w/ Specks VFT
127	12" x 12" Brown w/ Specks VFT Mastic
128	12" x 12" Light Brown w/ Gray Specks VFT
129	12" x 12" Light Brown w/ Gray Specks VFT Mastic
130	12" x 12" Off White VFT

130M	12" x 12" Off White VFT Mastic
25	12"x12" Beige w/ Brown & White Streaks VFT
26	12"x12" Beige w/ Brown & White Streaks VFT Mastic
29	12"x12" Gray w/ White Streaks VFT
30	12"x12" Gray w/ White Streaks VFT Mastic
48	Brown Linoleum Mastic
49	12"x12" White w/ Blue Speckles VFT
50	12"x12" White w/ Blue Speckles VFT Mastic
51	12"x12" Beige w/ Dark Brown Speckles VFT
52	12"x12" Beige w/ Dark Brown Speckles VFT Mastic
53	12"x12" White w/ Tan Spots VFT
54	12"x12" White w/ Tan Spots VFT Mastic
64	9"x9" Beige w/ Brown & White Streaks VFT Mastic
67	12"x12" Tan w/ Tan Specks VFT
68	12"x12" Tan w/ Tan Specks VFT Mastic
73	12"x12" Gray w/ Gray & Black Specks VFT
74	12"x12" Gray w/ Gray & Black Specks VFT Mastic
75	12"x12" Blue w/ White Streaks VFT
76	12"x12" Blue w/ White Streaks VFT Mastic
99	Lab Counter Top
GG	MJP E/F/V on Aircell Pipe Insulation
HA-1000	2' x 4' White Ceiling Tiles with Random Fissures & Holes
HA-1001	2' x 4' White plain ceiling tile
HA-1002	1' x 1' White ceiling tile w/ random holes
HA-1003	Glue for 1' x 1' White ceiling tile with random holes
HA-1004	2' x 2' White plain ceiling tile
HA-1005	1' x 1' White CT with large holes
HA-1006	Glue for 1' x 1' White CT with large holes
HA-1007	1' x 1' White CT with random fissures
HA-1008	Glue for 1' x 1' White CT with random fissures
HA-1010	12"x12" Yellow VFT NOT OBSERVED
HA-1010m	Adhesive for 12"x12" Yellow VFT NOT OBSERVED
II	Cardboard Pipe Insulation (Paper-Wrap Pipe Insulation)

The following areas were deemed to be inaccessible:

04 12"x12" Tan w/ White Streaks VFT Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not

conducted to avoid damage.

This reinspection was conducted by Allizon Brooks, IDPH License # 100-18790. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 3/3/2023

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Schurz High School Building 1530 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Bldg.										
102	Undetermined Size & Color VFT Mastic			Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.	NO_ACBM									
103	MJP E/F/V on Fiberglass Pipe Insulation	100	FITTING	1st Floor Men's Faculty Toliet, 2nd & 3rd Floor Girls Toliet (chases) - 1908 Bldg.	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
104	Green Linoleum	1,600	SF	Room 320, 369, Prep Room, Storage Room - 1923 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
105	Green Linoleum Mastic	400	SF	Room 320, 369, Prep Room, Storage Room - 1923 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
106	2' x 2' Ceiling Tile			Room 320, 369, Prep Room, Storage Room - 1923 Bldg.	NO_ACBM									
107	12" x 12" Gray w/ White SpeckS VFT	1,400	SF	Room 216 - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
108	12" x 12" Gray w/ White SpeckS VFT Mastic	1,400	SF	Room 216 - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
109	12" x 12" Orange Cork VFT	4,500	SF	Library - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
11	12"x12" Tan w/ White Streaks VFT	18,061	SF	Throughout - 1923 Bldg. (See Hatching Maps)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
110	12" x 12" Orange Cork VFT Mastic	4,500	SF	Library - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
111	Carpet Mastic	4,500	SF	Library - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
112	Carpet Adhesive	4,934	SF	Main Office, Nurse Office 128, 125A, 114, 110, 115, Teacher/Staff Room, 376	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
113	12" x 12" Powder-Blue w/White and Blue Streaks VFT	2,000	SF	Room 309 -1915 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
113M	12" x 12" Powder-Blue w/White and Blue Streaks VFT Mastic	2,000	SF	Room 309 -1915 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
114	12" x 12" Tan w/ white specs VFT & Mastic	700	SF	Room 205	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
115	Carpet Mastic	2,600	SF	Rooms 110, 128, 111, 119, 300	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
116	Lab Black Counter Tops	2,000	SF	Rooms 315, 313, 219, 215, 213, 223, 225, 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
117	Lab Black Table Tops	2,000	SF	Rooms 315, 313, 219, 215, 213, 223, 225, 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
118	12" x 12" Tan w/ Large White Striations VFT	21,000	SF	Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
118A	12" x 12" Tan w/ Large White Striations VFT Mastic	21,000	SF	Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
119	12" x 12" Light blue w/ gray & white specs VFT	4,000	SF	Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
119A	12" x 12" Light blue w/ gray & white specs VFT Mastic	4,000	SF	Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12"x12" Tan w/ White Streaks VFT Mastic	18,061	SF	Throughout - 1923 Bldg. (See Hatching Maps)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
120	12" x 12" White w/ Tan Streaks VFT	4,000	SF	Rooms 311, 336, 338, 334, 129, 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
120A	12" x 12" White w/ Tan Streaks VFT Mastic	4,000	SF	Rooms 311, 336, 338, 334, 129, 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
121	12" x 12" White w/ Green & Gray Streaks VFT	2,200	SF	Rooms 312, 314	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
121 A	12" x 12" White w/ Green & Gray Streaks VFT Mastic	2,200	SF	Rooms 312, 314	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
122	12" x 12" Tan w/ white Streaks VFT	700	SF	Room 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
122A	12" x 12" Tan w/ White Streaks VFT Mastic	700	SF	Room 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
123	Tan Linoleum w/ white & black streaks	700	SF	Room 315	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
123A	Tan Linoleum w/ white & black streaks Mastic	700	SF	Room 315	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
124	12" x 12" Tan with Specks Floor Tile	4,600	SF	Cafeteria, Serving Area, Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
125	12" x 12" Tan with Specks Floor Tile Mastic	4,600	SF	Cafeteria, Serving Area, Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
126	12" x 12" Brown w/ Specks VFT	300	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
127	12" x 12" Brown w/ Specks VFT Mastic	300	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, and 5th Floors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
128	12" x 12" Light Brown w/ Gray Specks VFT	600	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
129	12" x 12" Light Brown w Gray Specks VFT Mastic	600	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	9"x9" Cocoa w/ White & Brown Streaks VFT	7,260	SF	Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
130	12" x 12" Off White VFT	1,200	SF	Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
130M	12" x 12" Off White VFT Mastic	1,200	SF	Room 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	9"x9" Cocoa w/ White & Brown Streaks VFT Mastic	7,260	SF	Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Brown Linoleum			Gymnasium Office - 1915 Bldg.	NO_ACBM									
16	Brown Linoleum Mastic			Gymnasium Office - 1915 Bldg.	NO_ACBM									
17	12"x12" White w/ Light Brown Streaks VFT	1,000	SF	Room 309 - 1915 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	12"x12" White w/ Light Brown Streaks VFT Mastic	1,000	SF	Room 309 - 1915 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	9"x9" Red w/ Black & White Specks VFT	340	SF	Room 301 - 1915 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
39	9"x9" Pine Green w/ White Streaks VFT ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
40	9"x9" Pine Green w/ White Streaks VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
41	9"x9" White w/ Pine Green Streaks VFT ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
42	9"x9" White w/ Pine Green Streaks VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
43	9"x9" Forest Green VFT ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
44	9"x9" Forest Green VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
45	9"x9" Gray w/ White Streaks VFT ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
46	9"x9" Gray w/ White Streaks VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	ABATED	MISC								
47	Brown Linoleum	504	SF	Teacher's Rest Area & Room 376 - 1923 Bldg. NOT OBSERVED	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
48	Brown Linoleum Mastic	504	SF	Teacher's Rest Area & Room 376 - 1923 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	12"x12" White w/ Blue Speckles VFT	900	SF	Room 110 - 1923 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
50	12"x12" White w/ Blue Speckles VFT Mastic	900	SF	Room 110 - 1923 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	12"x12" Beige w/ Dark Brown Speckles VFT	1,800	SF	Engineer's Office, Room 342 - 1923 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
52	12"x12" Beige w/ Dark Brown Speckles VFT Mastic	1,800	SF	Engineer's Office, Room 342 - 1923 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12"x12" White w/ Tan Spots VFT	1,800	SF	Rooms 334, 336, 338, 340 - 1923 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
54	12"x12" White w/ Tan Spots VFT Mastic	1,800	SF	Rooms 334, 336, 338, 340 - 1923 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12"x12" Gray w/ White & Brown Spots VFT	1,100	SF	Rooms 212, 340, 315 - 1923 Bldg	CHR	MISC	N	DIST	300		No	ACBM with the potential for damage	3	MODERATE
56	12"x12" Gray w/ White & Brown Spots VFT Mastic	1,100	SF	Rooms 212, 340, 315 - 1923 Bldg	CHR	MISC	N	DIST	300		No	ACBM with the potential for damage	3	LOW
57	9"x9" Gray VFT	750	SF	Room 128 - 1923	CHR	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Bldg. NOT OBSERVED								potential for damage		
58	9"x9" Gray VFT Mastic	750	SF	Room 128 - 1923 Bldg. NOT OBSERVED	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	12"x12" Brown w/ White Specks VFT	4,900	SF	1st Floor through 4th Floor Corridors - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
60	12"x12" Brown w/ White Specks VFT Mastic	4,900	SF	1st Floor through 4th Floor Corridors - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	12"x12" White w/ Gray Streaks VFT	2,500	SF	Main Office, Room 315, Room 117 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
62	12"x12" White w/ Gray Streaks VFT Mastic	2,500	SF	Main Office, Room 315, Room 117 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	9"x9" Beige w/ Brown & White Streaks VFT	350	SF	Room 316 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
64	9"x9" Beige w/ Brown & White Streaks VFT Mastic	350	SF	Room 316 - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	12"x12" White w/ Tan Specks VFT			Room 312 - 1908 Bldg. NOT OBSERVED	NO_ACBM						No			
66	12"x12" White w/ Tan Specks VFT Mastic			Room 312 - 1908 Bldg. NOT OBSERVED	NO_ACBM						No			
67	12"x12" Tan w/ Tan Specks VFT	900	SF	Room 322 - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
68	12"x12" Tan w/ Tan Specks VFT Mastic	900	SF	Room 322 - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	9"x9" Green w/ White Streaks VFT	500	SF	Room 114 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
70	9"x9" Green w/ White Streaks VFT Mastic	500	SF	Room 114 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	9"x9" Black w/ White Streaks VFT	1,300	SF	Room 114 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
72	9"x9" Black w/ White Streaks VFT Mastic	1,300	SF	Room 114 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	12"x12" Gray w/ Gray & Black Specks VFT	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
74	12"x12" Gray w/ Gray & Black Specks VFT Mastic	600	SF	Room 114 - 1908 Bldg. NOT	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				OBSERVED										
75	12"x12" Blue w/ White Streaks VFT	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
76	12"x12" Blue w/ White Streaks VFT Mastic	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
77	9"x9" Brown w/ White & Red Streaks VFT	650	SF	Room 018 & Hallway -1908 Bldg.	CHR	MISC	N	DIST	150		No	ACBM with the potential for damage	3	LOW
78	9"x9" Brown w/ White & Red Streaks VFT Mastic	650	SF	Room 018 & Hallway - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
79	9"x9" Tan w/ Brown & White Streaks VFT	650	SF	Room 018 & Hallway - 1908 Bldg.	CHR	MISC	N	DIST	150		No	ACBM with the potential for damage	3	LOW
80	9"x9" Tan w/ Brown & White Streaks VFT Mastic	650	SF	Room 018 & Hallway - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
81	9"x9" Gray w/ White Swirls VFT	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
82	9"x9" Gray w/ White Swirls VFT Mastic	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
83	9"x9" White w/ Black Swirls VFT	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
84	9"x9" White w/ Black Swirls VFT Mastic	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
85	12"x24" Gray w/ Black & White Swirls VFT	200	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
86	12"x24" Gray w/ Black & White Swirls VFT Mastic	200	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
87	Stair Tread Tile Yellow w/ Gold Specks VFT	35	SF	Library (Underneath Carpet, HA # 111, #	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				109 & # 110) - 1908 Bldg.										
88	Stair Tread Tile Yellow w/ Gold Specks VFT Mastic	35	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
89	Stair Tread Tile Gray w/ White Marble VFT	20	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
90	Stair Tread Tile Gray w/ White Marble VFT Mastic	20	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
91	12"x12" Tan w/ Red & Black Streaks VFT	120	SF	Room 115 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
92	12"x12" Tan w/ Red & Black Streaks VFT Mastic	120	SF	Room 115 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
93	9"x9" Gray w/ Black & White Streaks VFT	120	SF	Room 115 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
94	9"x9" Gray w/ Black & White Streaks VFT Mastic	120	SF	Room 115 - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
95	9"x9" Dark Green w/ White Streaks VFT	500	SF	Rooms 121, 121A - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
96	9"x9" Dark Green w/ White Streaks VFT Mastic	500	SF	Rooms 121, 121A - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
97	Tan Spotted Linoleum	400	SF	Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
98	Tan Spotted Linoleum Mastic	400	SF	Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
99	Lab Counter Top	100	SF	Room 319 - 1908 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
AA	Air Cell Pipe Insulation	14	LF	3rd Floor Janitor's Closet By Room 301- 1915	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
BB	MJP E/F/V on Air Cell Pipe Insulation	6	FITTING	3rd Floor Janitor's Closet By Room 301 - 1915; 1st Floor Girls Toilet Added in 2010	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
CC	MJP E/F/V on Fiberglass Pipe Insulation	20	FITTING	First Floor Girl's Toilet, First Floor Corridor - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
DD	MJP E/F/V on Mag Block Pipe Insulation	1	FITTING	Janitor's Closet By Room 301 - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Boiler Gasket	20	LF	Boiler Room - 1923 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
EE	Mag Block Pipe Insulation	14	LF	Janitor's Closet By Room 301 - 1915 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	Boiler Gasket	20	LF	Boiler Room - 1923 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FF	Aircell Pipe Insulation	10	LF	Incinerator Room - 1923 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
GG	MJP E/F/V on Aircell Pipe Insulation	7	FITTING	Incinerator Room - 1923 Bldg.	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1000	2' x 4' White Ceiling Tiles with Random Fissures & Holes	20,000	SF	Throughout	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1001	2' x 4' White plain ceiling tile	960	SF	Teachers' Lunch Room	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1002	1' x 1' White ceiling tile w/ random holes	1,500	SF	Students' Lunch Room	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1003	Glue for 1' x 1' White ceiling tile with random holes	1,500	SF	Students' Lunch Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1004	2' x 2' White plain ceiling tile	1,500	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1005	1' x 1' White CT with large holes	150	SF	Kitchen Manager Office	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1006	Glue for 1' x 1' White CT with large holes	150	SF	Kitchen Manager Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1007	1' x 1' White CT with random fissures	1,680	SF	Room 300 on ceiling and walls	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-1008	Glue for 1' x 1' White CT with random fissures	1,680	SF	Room 300 on ceiling and walls	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1010	12"x12" Yellow VFT NOT OBSERVED				ASSUMED	MISC								
HA-1010m	Adhesive for 12"x12" Yellow VFT NOT OBSERVED				ASSUMED	MISC								
HA-1011	Transite	30	SF	1st floor girl's restroom privacy wall	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
HH	MJP E/F/V on Fiberglass Pipe Insulation	142	FITTING	Locker Room, 1st Floor Boy's Toilet,	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Hot & Cold Deck, & Wood Shop Area - 1923 Bldg.; Rooms 219, 315, 319 under Classroom Sinks (12 LF); 2nd Floor Girls washroom (5 LF); 3rd Floor Girls Washroom (5 LF).										
II	Cardboard Pipe Insulation (Paper-Wrap Pipe Insulation)	38	LF	Electrical Room Across from Stairway # 4 - 1908 Bldg.	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
JJ	MJP E/F/V on Cardboard Pipe Insulation (Paperwrap Pipe Insulation)	10	FITTING	Electrical Room Across from Stairway # 4 - 1908 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schurz High School Unit 46281 Building ID 1530
Address 3601 N. Milwaukee Ave. Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>4/14/2025</u>
Inspector Name <u>Allizon Brooks</u>
<u>100-18790</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	Damage located in Rooms 123/125, 303, 317, 4th Floor Corridor outside Room 420 and 424-
03	
04	
05	
06	
07	
08	
09	
10	
100	
1009	
101	
102	
103	
104	
105	
106	
107	
108	
109	
11	
110	

Chicago Public Schools

School Schurz High School Unit 46281 Building ID 1530
Address 3601 N. Milwaukee Ave. Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
111	
112	
113	
113M	
114	
115	
116	
117	
118	
118A	
119	
119A	
12	
120	
120A	
121	
121 A	
122	
122A	
123	
123A	
124	
125	
126	
127	
128	
129	
13	
130	

Chicago Public Schools

School Schurz High School Unit 46281 Building ID 1530
Address 3601 N. Milwaukee Ave. Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
130M	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	

Chicago Public Schools

School Schurz High School Unit 46281 Building ID 1530
Address 3601 N. Milwaukee Ave. Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	

Chicago Public Schools

School Schurz High School Unit 46281 Building ID 1530
Address 3601 N. Milwaukee Ave. Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
90	
91	
92	
93	
94	
95	
96	
97	
98	
99	

Chicago Public Schools

School Schurz High School Unit 46281 Building ID 1530
Address 3601 N. Milwaukee Ave. Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
AA	
BB	
CC	
DD	
E	
EE	
F	
FF	
GG	
HA-1000	
HA-1001	
HA-1002	
HA-1003	
HA-1004	
HA-1005	
HA-1006	
HA-1007	
HA-1008	
HA-1010	
HA-1010m	
HA-1011	
HH	
II	
JJ	

Chicago Public Schools

School Schurz High School **Unit** 46281 **Building ID** 1530
Address 3601 N. Milwaukee Ave. **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Table II
Management Planner's Review

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	12"x12" Tan w/ White Streaks VFT	32,604	SF	Throughout - 1908 (See Hatching Maps); Corridor at Rm 112	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	9"x9" Brown w/ White Specks VFT	2,400	SF	Rooms 123/125, 213, 217, 219, 303, 313, 317, 320, 321, 4th Floor Corridor outside Room 420 and 424- 1908 Bldg.	Chrysotile	MISC	No	50	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	Tan w/ Brown Swirls Linoleum	2,400	SF	5th Fl Band Rm - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12"x12" Tan w/ White Streaks VFT Mastic	32,604	SF	Throughout - 1908 (See Hatching Maps)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	9"x9" Brown w/ White Specks VFT Mastic	2,400	SF	Rooms 123/125, 213, 217, 219, 303, 313, 317, 320, 321, 4th Floor Corridor outside Room 420 and 424- 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	Tan w/ Brown Swirls Linoleum Mastic	2,400	SF	5th Fl Band Rm - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Tan w/ White Streaks VFT	5,665	SF	Room 305, 1st through 3rd Fl Corridor, 3rd Fl Girls Toilet - 1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Tan w/ White Streaks VFT Mastic	5,665	SF	Room 305, 1st through 3rd Fl Corridor, 3rd Fl Girls Toilet - 1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	9"x9" Green w/ White Specks VFT	340	SF	Room 301 - 1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	9"x9" Green w/ White Specks VFT Mastic	340	SF	Room 301 - 1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
100	Textured Plaster			Auditorium - 1923 Bldg.	No ACBM						
1009	Boiler #1 (small) Insulation	350	SF	Boiler Room	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101	Undetermined Size & Color VFT			Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.	No ACBM						
102	Undetermined Size & Color VFT Mastic			Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.	No ACBM						
103	MJP E/F/V on Fiberglass Pipe Insulation	100	FITTING	1st Floor Men's Faculty Toliet, 2nd & 3rd Floor Girls Toliet (chases) - 1908 Bldg.	Assumed	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
104	Green Linoleum	1,600	SF	Room 320, 369, Prep Room, Storage Room - 1923 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
105	Green Linoleum Mastic	400	SF	Room 320, 369, Prep Room, Storage Room - 1923 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
106	2' x 2' Ceiling Tile			Room 320, 369, Prep Room, Storage Room - 1923 Bldg.	No ACBM						
107	12" x 12" Gray w/ White SpeckS VFT	1,400	SF	Room 216 - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
108	12" x 12" Gray w/ White SpeckS VFT Mastic	1,400	SF	Room 216 - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	12" x 12" Orange Cork VFT	4,500	SF	Library - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
11	12"x12" Tan w/ White Streaks VFT	18,061	SF	Throughout - 1923 Bldg. (See Hatching Maps)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
110	12" x 12" Orange Cork VFT Mastic	4,500	SF	Library - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
111	Carpet Mastic	4,500	SF	Library - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
112	Carpet Adhesive	4,934	SF	Main Office, Nurse Office 128, 125A, 114, 110, 115, Teacher/Staff Room, 376	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
113	12" x 12" Powder-Blue w/White and Blue Streaks VFT	2,000	SF	Room 309 -1915 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
113M	12" x 12" Powder-Blue w/White and Blue Streaks VFT Mastic	2,000	SF	Room 309 -1915 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
114	12" x 12" Tan w/ white specs VFT & Mastic	700	SF	Room 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
115	Carpet Mastic	2,600	SF	Rooms 110, 128, 111, 119, 300	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116	Lab Black Counter Tops	2,000	SF	Rooms 315, 313, 219, 215, 213, 223, 225, 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
117	Lab Black Table Tops	2,000	SF	Rooms 315, 313, 219, 215, 213, 223, 225, 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
118	12" x 12" Tan w/ Large White Striations VFT	21,000	SF	Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
118A	12" x 12" Tan w/ Large White Striations VFT Mastic	21,000	SF	Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
119	12" x 12" Light blue w/ gray & white specs VFT	4,000	SF	Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
119A	12" x 12" Light blue w/ gray & white specs VFT Mastic	4,000	SF	Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12"x12" Tan w/ White Streaks VFT Mastic	18,061	SF	Throughout - 1923 Bldg. (See Hatching Maps)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
120	12" x 12" White w/ Tan Streaks VFT	4,000	SF	Rooms 311, 336, 338, 334, 129, 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
120A	12" x 12" White w/ Tan Streaks VFT Mastic	4,000	SF	Rooms 311, 336, 338, 334, 129, 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
121	12" x 12" White w/ Green & Gray Streaks VFT	2,200	SF	Rooms 312, 314	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
121 A	12" x 12" White w/ Green & Gray Streaks VFT Mastic	2,200	SF	Rooms 312, 314	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
122	12" x 12" Tan w/ white Streaks VFT	700	SF	Room 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
122A	12" x 12" Tan w/ White Streaks VFT Mastic	700	SF	Room 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
123	Tan Linoleum w/ white & black streaks	700	SF	Room 315	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
123A	Tan Linoleum w/ white & black streaks Mastic	700	SF	Room 315	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
124	12" x 12" Tan with Specks Floor Tile	4,600	SF	Cafeteria, Serving Area, Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
125	12" x 12" Tan with Specks Floor Tile Mastic	4,600	SF	Cafeteria, Serving Area, Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
126	12" x 12" Brown w/ Specks VFT	300	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
127	12" x 12" Brown w/ Specks VFT Mastic	300	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, and 5th Floors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
128	12" x 12" Light Brown w/ Gray Specks VFT	600	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
129	12" x 12" Light Brown w/ Gray Specks VFT Mastic	600	SF	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	9"x9" Cocoa w/ White & Brown Streaks VFT	7,260	SF	Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
130	12" x 12" Off White VFT	1,200	SF	Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
130M	12" x 12" Off White VFT Mastic	1,200	SF	Room 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	9"x9" Cocoa w/ White & Brown Streaks VFT Mastic	7,260	SF	Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Brown Linoleum			Gymnasium Office - 1915 Bldg.	No ACBM						
16	Brown Linoleum Mastic			Gymnasium Office - 1915 Bldg.	No ACBM						
17	12"x12" White w/ Light Brown Streaks VFT	1,000	SF	Room 309 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" White w/ Light Brown Streaks VFT Mastic	1,000	SF	Room 309 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	9"x9" Red w/ Black & White Specks VFT	340	SF	Room 301 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	9"x9" Red w/ Black & White Specks VFT Mastic	340	SF	Room 301 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	9"x9" Brown w/ Black & White Streaks VFT	20	SF	Room 301 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	9"x9" Brown w/ White & Black Streaks VFT Mastic	20	SF	Room 301 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	24" x 6" Black VFT	70	SF	Room 301 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	24" x 6" Black VFT Mastic	70	SF	Room 301 - 1915 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" Beige w/ Brown & White Streaks VFT	750	SF	Room 308 - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Beige w/ Brown & White Streaks VFT Mastic	750	SF	Room 308 - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
27	12"x12" Brown w/ White Specks VFT	1,150	SF	1st, 2nd, & 3rd Floor Corridors - 1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" Brown w/ White Specks VFT Mastic	1,150	SF	1st, 2nd, & 3rd Floor Corridors - 1915 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12"x12" Gray w/ White Streaks VFT	1,600	SF	Gymnasium/205 - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12"x12" Gray w/ White Streaks VFT Mastic	1,600	SF	Gymnasium/205 - 1915 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"x12" Beige w/ White & Orange Streaks VFT	1,810	SF	Room 310 and 341 - 1923 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12"x12" Beige w/ White & Orange Streaks VFT Mastic	1,810	SF	Room 310 and 341 - 1923 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	9"x9" Cocoa w/ White & Brown Short Streaks VFT	3,324	SF	3rd Floor Hallway - 1923 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	9"x9" Cocoa w/ White & Brown Short Streaks VFT Mastic	3,324	SF	3rd Floor Hallway - 1923 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12"x12" Cocoa w/ White & Brown Long Streaks VFT	924	SF	Room 253 - 1923 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12"x12" Cocoa w/ White & Brown Long Streaks VFT Mastic	924	SF	Room 253 - 1923 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12"x12" Gray w/ White & Gray Streaks VFT ABATED			Teachers Room Next to Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
38	12"x12" Gray w/ White & Gray Streaks VFT Mastic ABATED			Teachers Room Next to Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
39	9"x9" Pine Green w/ White Streaks VFT ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
40	9"x9" Pine Green w/ White Streaks VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
41	9"x9" White w/ Pine Green Streaks VFT ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
42	9"x9" White w/ Pine Green Streaks VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
43	9"x9" Forest Green VFT ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
44	9"x9" Forest Green VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
45	9"x9" Gray w/ White Streaks VFT ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
46	9"x9" Gray w/ White Streaks VFT Mastic ABATED			Cafeteria - 1923 Bldg. ABATED	Abated	MISC					
47	Brown Linoleum	504	SF	Teacher's Rest Area & Room 376 - 1923 Bldg. NOT OBSERVED	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	Brown Linoleum Mastic	504	SF	Teacher's Rest Area & Room 376 - 1923 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12"x12" White w/ Blue Speckles VFT	900	SF	Room 110 - 1923 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12"x12" White w/ Blue Speckles VFT Mastic	900	SF	Room 110 - 1923 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
51	12"x12" Beige w/ Dark Brown Speckles VFT	1,800	SF	Engineer's Office, Room 342 - 1923 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	12"x12" Beige w/ Dark Brown Speckles VFT Mastic	1,800	SF	Engineer's Office, Room 342 - 1923	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12"x12" White w/ Tan Spots VFT	1,800	SF	Rooms 334, 336, 338, 340 - 1923 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12"x12" White w/ Tan Spots VFT Mastic	1,800	SF	Rooms 334, 336, 338, 340 - 1923 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12"x12" Gray w/ White & Brown Spots VFT	1,100	SF	Rooms 212, 340, 315 - 1923 Bldg	Chrysotile	MISC	No	300	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	12"x12" Gray w/ White & Brown Spots VFT Mastic	1,100	SF	Rooms 212, 340, 315 - 1923 Bldg	Chrysotile	MISC	No	300	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	9"x9" Gray VFT	750	SF	Room 128 - 1923 Bldg. NOT OBSERVED	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	9"x9" Gray VFT Mastic	750	SF	Room 128 - 1923 Bldg. NOT OBSERVED	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	12"x12" Brown w/ White Specks VFT	4,900	SF	1st Floor through 4th Floor Corridors - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12"x12" Brown w/ White Specks VFT Mastic	4,900	SF	1st Floor through 4th Floor Corridors - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12"x12" White w/ Gray Streaks VFT	2,500	SF	Main Office, Room 315, Room 117 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12"x12" White w/ Gray Streaks VFT Mastic	2,500	SF	Main Office, Room 315, Room 117 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	9"x9" Beige w/ Brown & White Streaks VFT	350	SF	Room 316 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	9"x9" Beige w/ Brown & White Streaks VFT Mastic	350	SF	Room 316 - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	12"x12" White w/ Tan Specks VFT			Room 312 - 1908 Bldg. NOT OBSERVED	No ACBM						
66	12"x12" White w/ Tan Specks VFT Mastic			Room 312 - 1908 Bldg. NOT OBSERVED	No ACBM						
67	12"x12" Tan w/ Tan Specks VFT	900	SF	Room 322 - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	12"x12" Tan w/ Tan Specks VFT Mastic	900	SF	Room 322 - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	9"x9" Green w/ White Streaks VFT	500	SF	Room 114 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	9"x9" Green w/ White Streaks VFT Mastic	500	SF	Room 114 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	9"x9" Black w/ White Streaks VFT	1,300	SF	Room 114 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	9"x9" Black w/ White Streaks VFT Mastic	1,300	SF	Room 114 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	12"x12" Gray w/ Gray & Black Specks VFT	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
74	12"x12" Gray w/ Gray & Black Specks VFT Mastic	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
75	12"x12" Blue w/ White Streaks VFT	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	12"x12" Blue w/ White Streaks VFT Mastic	600	SF	Room 114 - 1908 Bldg. NOT OBSERVED	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	9"x9" Brown w/ White & Red Streaks VFT	650	SF	Room 018 & Hallway -1908 Bldg.	Chrysotile	MISC	No	150	SF	6 ACBM with the potential for damage	Follow O&M Plan
78	9"x9" Brown w/ White & Red Streaks VFT Mastic	650	SF	Room 018 & Hallway - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	9"x9" Tan w/ Brown & White Streaks VFT	650	SF	Room 018 & Hallway - 1908 Bldg.	Chrysotile	MISC	No	150	SF	6 ACBM with the potential for damage	Follow O&M Plan
80	9"x9" Tan w/ Brown & White Streaks VFT Mastic	650	SF	Room 018 & Hallway - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81	9"x9" Gray w/ White Swirls VFT	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82	9"x9" Gray w/ White Swirls VFT Mastic	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
83	9"x9" White w/ Black Swirls VFT	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
84	9"x9" White w/ Black Swirls VFT Mastic	1,900	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
85	12"x24" Gray w/ Black & White Swirls VFT	200	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
86	12"x24" Gray w/ Black & White Swirls VFT Mastic	200	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
87	Stair Tread Tile Yellow w/ Gold Specks VFT	35	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
88	Stair Tread Tile Yellow w/ Gold Specks VFT Mastic	35	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
89	Stair Tread Tile Gray w/ White Marble VFT	20	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
90	Stair Tread Tile Gray w/ White Marble VFT Mastic	20	SF	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91	12"x12" Tan w/ Red & Black Streaks VFT	120	SF	Room 115 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
92	12"x12" Tan w/ Red & Black Streaks VFT Mastic	120	SF	Room 115 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
93	9"x9" Gray w/ Black & White Streaks VFT	120	SF	Room 115 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
94	9"x9" Gray w/ Black & White Streaks VFT Mastic	120	SF	Room 115 - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
95	9"x9" Dark Green w/ White Streaks VFT	500	SF	Rooms 121, 121A - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
96	9"x9" Dark Green w/ White Streaks VFT Mastic	500	SF	Rooms 121, 121A - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
97	Tan Spotted Linoleum	400	SF	Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
98	Tan Spotted Linoleum Mastic	400	SF	Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
99	Lab Counter Top	100	SF	Room 319 - 1908 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
AA	Air Cell Pipe Insulation	14	LF	3rd Floor Janitor's Closet By Room 301- 1915	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
BB	MJP E/F/V on Air Cell Pipe Insulation	6	FITTING	3rd Floor Janitor's Closet By Room 301 - 1915; 1st Floor Girls Toilet Added in 2010	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
CC	MJP E/F/V on Fiberglass Pipe Insulation	20	FITTING	First Floor Girl's Toilet, First Floor Corridor - 1915 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
DD	MJP E/F/V on Mag Block Pipe Insulation	1	FITTING	Janitor's Closet By Room 301 - 1915 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
E	Boiler Gasket	20	LF	Boiler Room - 1923 Bldg.	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
EE	Mag Block Pipe Insulation	14	LF	Janitor's Closet By Room 301 - 1915 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
F	Boiler Gasket	20	LF	Boiler Room - 1923 Bldg.	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
FF	Aircell Pipe Insulation	10	LF	Incinerator Room - 1923 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
GG	MJP E/F/V on Aircell Pipe Insulation	7	FITTING	Incinerator Room - 1923 Bldg.	Assumed	MISC	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
HA-1000	2' x 4' White Ceiling Tiles with Random Fissures & Holes	20,000	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1001	2' x 4' White plain ceiling tile	960	SF	Teachers' Lunch Room	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1002	1' x 1' White ceiling tile w/ random holes	1,500	SF	Students' Lunch Room	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1003	Glue for 1' x 1' White ceiling tile with random holes	1,500	SF	Students' Lunch Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1004	2' x 2' White plain ceiling tile	1,500	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1005	1' x 1' White CT with large holes	150	SF	Kitchen Manager Office	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1006	Glue for 1' x 1' White CT with large holes	150	SF	Kitchen Manager Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1007	1' x 1' White CT with random fissures	1,680	SF	Room 300 on ceiling and walls	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-1008	Glue for 1' x 1' White CT with random fissures	1,680	SF	Room 300 on ceiling and walls	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
HA-1010	12"x12" Yellow VFT NOT OBSERVED				Assumed	MISC					
HA-1010m	Adhesive for 12"x12" Yellow VFT NOT OBSERVED				Assumed	MISC					
HA-1011	Transite	30	SF	1st floor girl's restroom privacy wall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HH	MJP E/F/V on Fiberglass Pipe Insulation	142	FITTING	Locker Room, 1st Floor Boy's Toilet, Hot & Cold Deck, & Wood Shop Area - 1923 Bldg.; Rooms 219, 315, 319 under Classroom Sinks (12 LF); 2nd Floor Girls washroom (5 LF); 3rd Floor Girls Washroom (5 LF).	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
II	Cardboard Pipe Insulation (Paper-Wrap Pipe Insulation)	38	LF	Electrical Room Across from Stairway # 4 - 1908 Bldg.	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
JJ	MJP E/F/V on Cardboard Pipe Insulation (Paperwrap Pipe Insulation)	10	FITTING	Electrical Room Across from Stairway # 4 - 1908 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	5/13/2025
Manager Planner Name	Arturo Saenz
100-04019	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
100	
1009	
101	
102	
103	
104	
105	
106	
107	
108	
109	
11	

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
110	
111	
112	
113	
113M	
114	
115	
116	
117	
118	
118A	
119	
119A	
12	
120	
120A	
121	
121 A	
122	
122A	
123	
123A	
124	
125	
126	
127	
128	

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
129	
13	
130	
130M	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
90	

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
91	
92	
93	
94	
95	
96	
97	
98	
99	
AA	
BB	
CC	
DD	
E	
EE	
F	
FF	
GG	
HA-1000	
HA-1001	
HA-1002	
HA-1003	
HA-1004	
HA-1005	
HA-1006	
HA-1007	
HA-1008	

Chicago Public Schools

School Schurz High School

Unit 46281

Building ID 1530

Address 3601 N. Milwaukee Ave.

Chicago, IL, 60641

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
HA-1010	
HA-1010m	
HA-1011	
HH	
II	
JJ	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	12"x12" Tan w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Physical Damage		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1908 (See Hatching Maps); Corridor at Rm 112		
MATERIAL QUANTITY:	32604	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **12"x12" Tan w/ White Streaks VFT**

MATERIAL LOCATION: **Throughout - 1908 (See Hatching Maps); Corridor at Rm 112**

MATERIAL QUANTITY: **32604** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 123/125, 213, 217, 219, 303, 313, 317, 320, 321, 4th Floor Corridor outside Room 420 and 424- 1908 Bldg.		
MATERIAL QUANTITY:	2400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Damage located in Rooms 123/125, 303, 317, 4th Floor Corridor outside Room 420 and 424-		

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White Specks VFT**

MATERIAL LOCATION: **Rooms 123/125, 213, 217, 219, 303, 313, 317, 320, 321, 4th Floor Corridor outside Room 420 and 424- 1908 Bldg.**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	Tan w/ Brown Swirls Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	5th Fl Band Rm - 1908 Bldg.		
MATERIAL QUANTITY:	2400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **Tan w/ Brown Swirls Linoleum**

MATERIAL LOCATION: **5th Fl Band Rm - 1908 Bldg.**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12"x12" Tan w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1908 (See Hatching Maps)		
MATERIAL QUANTITY:	32604	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **12"x12" Tan w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Throughout - 1908 (See Hatching Maps)**

MATERIAL QUANTITY: **32604** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 123/125, 213, 217, 219, 303, 313, 317, 320, 321, 4th Floor Corridor outside Room 420 and 424- 1908 Bldg.**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White Specks VFT Mastic**

MATERIAL LOCATION: **Rooms 123/125, 213, 217, 219, 303, 313, 317, 320, 321, 4th Floor Corridor outside Room 420 and 424- 1908 Bldg.**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	Tan w/ Brown Swirls Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	5th Fl Band Rm - 1908 Bldg.		
MATERIAL QUANTITY:	2400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Tan w/ Brown Swirls Linoleum Mastic**

MATERIAL LOCATION: **5th Fl Band Rm - 1908 Bldg.**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	12"x12" Tan w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 305, 1st through 3rd Fl Corridor, 3rd Fl Girls Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	5665	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **12"x12" Tan w/ White Streaks VFT**

MATERIAL LOCATION: **Room 305, 1st through 3rd Fl Corridor, 3rd Fl Girls Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **5665** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	12"x12" Tan w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 305, 1st through 3rd Fl Corridor, 3rd Fl Girls Toilet - 1915 Bldg.		
MATERIAL QUANTITY:	5665	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **12"x12" Tan w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 305, 1st through 3rd Fl Corridor, 3rd Fl Girls Toilet - 1915 Bldg.**

MATERIAL QUANTITY: **5665** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	9"x9" Green w/ White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 301 - 1915 Bldg.		
MATERIAL QUANTITY:	340	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **9"x9" Green w/ White Specks VFT**

MATERIAL LOCATION: **Room 301 - 1915 Bldg.**

MATERIAL QUANTITY: **340** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	9"x9" Green w/ White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 301 - 1915 Bldg.		
MATERIAL QUANTITY:	340	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **9"x9" Green w/ White Specks VFT Mastic**

MATERIAL LOCATION: **Room 301 - 1915 Bldg.**

MATERIAL QUANTITY: **340** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	100	
MATERIAL DESCRIPTION:	Textured Plaster	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Auditorium - 1923 Bldg.

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **100**

MATERIAL DESCRIPTION: **Textured Plaster**

MATERIAL LOCATION: **Auditorium - 1923 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	1009		
MATERIAL DESCRIPTION:	Boiler #1 (small) Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **1009**

MATERIAL DESCRIPTION: **Boiler #1 (small) Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101	
MATERIAL DESCRIPTION:	Undetermined Size & Color VFT	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **Undetermined Size & Color VFT**

MATERIAL LOCATION: **Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102	
MATERIAL DESCRIPTION:	Undetermined Size & Color VFT Mastic	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **102**

MATERIAL DESCRIPTION: **Undetermined Size & Color VFT Mastic**

MATERIAL LOCATION: **Fourth Floor Corridor (Underneath HA # 59 & 60) - 1908 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Men's Faculty Toliet, 2nd & 3rd Floor Girls Toliet (chases) - 1908 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **103**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **1st Floor Men's Faculty Toliet, 2nd & 3rd Floor Girls Toliet (chases) - 1908 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104		
MATERIAL DESCRIPTION:	Green Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 320, 369, Prep Room, Storage Room - 1923 Bldg.		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **104**

MATERIAL DESCRIPTION: **Green Linoleum**

MATERIAL LOCATION: **Room 320, 369, Prep Room, Storage Room - 1923 Bldg.**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	105		
MATERIAL DESCRIPTION:	Green Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 320, 369, Prep Room, Storage Room - 1923 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **105**

MATERIAL DESCRIPTION: **Green Linoleum Mastic**

MATERIAL LOCATION: **Room 320, 369, Prep Room, Storage Room - 1923 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 320, 369, Prep Room, Storage Room - 1923 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile**

MATERIAL LOCATION: **Room 320, 369, Prep Room, Storage Room - 1923 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107		
MATERIAL DESCRIPTION:	12" x 12" Gray w/ White SpeckS VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 216 - 1908 Bldg.		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **12" x 12" Gray w/ White SpeckS VFT**

MATERIAL LOCATION: **Room 216 - 1908 Bldg.**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	108		
MATERIAL DESCRIPTION:	12" x 12" Gray w/ White SpeckS VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 216 - 1908 Bldg.		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **108**

MATERIAL DESCRIPTION: **12" x 12" Gray w/ White SpeckS VFT Mastic**

MATERIAL LOCATION: **Room 216 - 1908 Bldg.**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109		
MATERIAL DESCRIPTION:	12" x 12" Orange Cork VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Library - 1908 Bldg.		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **109**

MATERIAL DESCRIPTION: **12" x 12" Orange Cork VFT**

MATERIAL LOCATION: **Library - 1908 Bldg.**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12"x12" Tan w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1923 Bldg. (See Hatching Maps)		
MATERIAL QUANTITY:	18061	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **12"x12" Tan w/ White Streaks VFT**

MATERIAL LOCATION: **Throughout - 1923 Bldg. (See Hatching Maps)**

MATERIAL QUANTITY: **18061** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	110		
MATERIAL DESCRIPTION:	12" x 12" Orange Cork VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library - 1908 Bldg.		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **110**

MATERIAL DESCRIPTION: **12" x 12" Orange Cork VFT Mastic**

MATERIAL LOCATION: **Library - 1908 Bldg.**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library - 1908 Bldg.		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **111**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Library - 1908 Bldg.**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	112		
MATERIAL DESCRIPTION:	Carpet Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Nurse Office 128, 125A, 114, 110, 115, Teacher/Staff Room, 376		
MATERIAL QUANTITY:	4934	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **112**

MATERIAL DESCRIPTION: **Carpet Adhesive**

MATERIAL LOCATION: **Main Office, Nurse Office 128, 125A, 114, 110, 115, Teacher/Staff Room, 376**

MATERIAL QUANTITY: **4934** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	113		
MATERIAL DESCRIPTION:	12" x 12" Powder-Blue w/White and Blue Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 309 -1915 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **113**

MATERIAL DESCRIPTION: **12" x 12" Powder-Blue w/White and Blue Streaks VFT**

MATERIAL LOCATION: **Room 309 -1915 Addition**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	113M		
MATERIAL DESCRIPTION:	12" x 12" Powder-Blue w/White and Blue Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 309 -1915 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **113M**

MATERIAL DESCRIPTION: **12" x 12" Powder-Blue w/White and Blue Streaks VFT Mastic**

MATERIAL LOCATION: **Room 309 -1915 Addition**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	114		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ white specs VFT & Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 205		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **114**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ white specs VFT & Mastic**

MATERIAL LOCATION: **Room 205**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	115		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 110, 128, 111, 119, 300		
MATERIAL QUANTITY:	2600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **115**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Rooms 110, 128, 111, 119, 300**

MATERIAL QUANTITY: **2600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116		
MATERIAL DESCRIPTION:	Lab Black Counter Tops		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 315, 313, 219, 215, 213, 223, 225, 229		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **116**

MATERIAL DESCRIPTION: **Lab Black Counter Tops**

MATERIAL LOCATION: **Rooms 315, 313, 219, 215, 213, 223, 225, 229**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	117		
MATERIAL DESCRIPTION:	Lab Black Table Tops		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 315, 313, 219, 215, 213, 223, 225, 229		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **117**

MATERIAL DESCRIPTION: **Lab Black Table Tops**

MATERIAL LOCATION: **Rooms 315, 313, 219, 215, 213, 223, 225, 229**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	118		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ Large White Striations VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108		
MATERIAL QUANTITY:	21000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **118**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ Large White Striations VFT**

MATERIAL LOCATION: **Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108**

MATERIAL QUANTITY: **21000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	118A		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ Large White Striations VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108**

MATERIAL QUANTITY: **21000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **118A**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ Large White Striations VFT Mastic**

MATERIAL LOCATION: **Rooms 220, 305, 308, 310, 320, 321, 322, 332, 353, 355, 361, 358, 364, 368, 377, 379, 381, 324, 351, 363, 372, 374, 376, 327, 221, 125, 105 & 108**

MATERIAL QUANTITY: **21000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	119		
MATERIAL DESCRIPTION:	12" x 12" Light blue w/ gray & white specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **119**

MATERIAL DESCRIPTION: **12" x 12" Light blue w/ gray & white specs VFT**

MATERIAL LOCATION: **Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	119A		
MATERIAL DESCRIPTION:	12" x 12" Light blue w/ gray & white specs VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **119A**

MATERIAL DESCRIPTION: **12" x 12" Light blue w/ gray & white specs VFT Mastic**

MATERIAL LOCATION: **Rooms 219, 217, 213, 123, 122, 323, 229, 227, 223, 225, 309 & 371**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	12"x12" Tan w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1923 Bldg. (See Hatching Maps)		
MATERIAL QUANTITY:	18061	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **12"x12" Tan w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Throughout - 1923 Bldg. (See Hatching Maps)**

MATERIAL QUANTITY: **18061** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	120		
MATERIAL DESCRIPTION:	12" x 12" White w/ Tan Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 311, 336, 338, 334, 129, 131		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **120**

MATERIAL DESCRIPTION: **12" x 12" White w/ Tan Streaks VFT**

MATERIAL LOCATION: **Rooms 311, 336, 338, 334, 129, 131**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	120A		
MATERIAL DESCRIPTION:	12" x 12" White w/ Tan Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 311, 336, 338, 334, 129, 131		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **120A**

MATERIAL DESCRIPTION: **12" x 12" White w/ Tan Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 311, 336, 338, 334, 129, 131**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	121		
MATERIAL DESCRIPTION:	12" x 12" White w/ Green & Gray Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 312, 314		
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **121**

MATERIAL DESCRIPTION: **12" x 12" White w/ Green & Gray Streaks VFT**

MATERIAL LOCATION: **Rooms 312, 314**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	121 A		
MATERIAL DESCRIPTION:	12" x 12" White w/ Green & Gray Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 312, 314		
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **121 A**

MATERIAL DESCRIPTION: **12" x 12" White w/ Green & Gray Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 312, 314**

MATERIAL QUANTITY: **2200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	122		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ white Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 116		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **122**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ white Streaks VFT**

MATERIAL LOCATION: **Room 116**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	122A		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 116		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **122A**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 116**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	123		
MATERIAL DESCRIPTION:	Tan Linoleum w/ white & black streaks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 315		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **123**

MATERIAL DESCRIPTION: **Tan Linoleum w/ white & black streaks**

MATERIAL LOCATION: **Room 315**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	123A		
MATERIAL DESCRIPTION:	Tan Linoleum w/ white & black streaks Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 315		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **123A**

MATERIAL DESCRIPTION: **Tan Linoleum w/ white & black streaks Mastic**

MATERIAL LOCATION: **Room 315**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	124		
MATERIAL DESCRIPTION:	12" x 12" Tan with Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Cafeteria, Serving Area, Teachers' Lounge		
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **124**

MATERIAL DESCRIPTION: **12" x 12" Tan with Specks Floor Tile**

MATERIAL LOCATION: **Cafeteria, Serving Area, Teachers' Lounge**

MATERIAL QUANTITY: **4600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	125		
MATERIAL DESCRIPTION:	12" x 12" Tan with Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Cafeteria, Serving Area, Teachers' Lounge		
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **125**

MATERIAL DESCRIPTION: **12" x 12" Tan with Specks Floor Tile Mastic**

MATERIAL LOCATION: **Cafeteria, Serving Area, Teachers' Lounge**

MATERIAL QUANTITY: **4600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	126		
MATERIAL DESCRIPTION:	12" x 12" Brown w/ Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **126**

MATERIAL DESCRIPTION: **12" x 12" Brown w/ Specks VFT**

MATERIAL LOCATION: **Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	127		
MATERIAL DESCRIPTION:	12" x 12" Brown w/ Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator Lobbies on 1st, 2nd, 3rd, 4th, and 5th Floors		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **127**

MATERIAL DESCRIPTION: **12" x 12" Brown w/ Specks VFT Mastic**

MATERIAL LOCATION: **Elevator Lobbies on 1st, 2nd, 3rd, 4th, and 5th Floors**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	128		
MATERIAL DESCRIPTION:	12" x 12" Light Brown w/ Gray Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **128**

MATERIAL DESCRIPTION: **12" x 12" Light Brown w/ Gray Specks VFT**

MATERIAL LOCATION: **Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	129		
MATERIAL DESCRIPTION:	12" x 12" Light Brown w Gray Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **129**

MATERIAL DESCRIPTION: **12" x 12" Light Brown w Gray Specks VFT Mastic**

MATERIAL LOCATION: **Elevator Lobbies on 1st, 2nd, 3rd, 4th, ad 5th Floors**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	9"x9" Cocoa w/ White & Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg		
MATERIAL QUANTITY:	7260	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **9"x9" Cocoa w/ White & Brown Streaks VFT**

MATERIAL LOCATION: **Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg**

MATERIAL QUANTITY: **7260** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	130		
MATERIAL DESCRIPTION:	12" x 12" Off White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 111		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **130**

MATERIAL DESCRIPTION: **12" x 12" Off White VFT**

MATERIAL LOCATION: **Room 111**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	130M		
MATERIAL DESCRIPTION:	12" x 12" Off White VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 111		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **130M**

MATERIAL DESCRIPTION: **12" x 12" Off White VFT Mastic**

MATERIAL LOCATION: **Room 111**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	9"x9" Cocoa w/ White & Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg		
MATERIAL QUANTITY:	7260	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **9"x9" Cocoa w/ White & Brown Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 223, 225, 227, 359, 365, 367, 371 - 1923 Bldg**

MATERIAL QUANTITY: **7260** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Brown Linoleum**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gymnasium Office - 1915 Bldg.**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Brown Linoleum**

MATERIAL LOCATION: **Gymnasium Office - 1915 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Brown Linoleum Mastic**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gymnasium Office - 1915 Bldg.**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Brown Linoleum Mastic**

MATERIAL LOCATION: **Gymnasium Office - 1915 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" White w/ Light Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 309 - 1915 Bldg		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown Streaks VFT**

MATERIAL LOCATION: **Room 309 - 1915 Bldg**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" White w/ Light Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 309 - 1915 Bldg		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12"x12" White w/ Light Brown Streaks VFT Mastic**

MATERIAL LOCATION: **Room 309 - 1915 Bldg**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	9"x9" Red w/ Black & White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 301 - 1915 Bldg		
MATERIAL QUANTITY:	340	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **9"x9" Red w/ Black & White Specks VFT**

MATERIAL LOCATION: **Room 301 - 1915 Bldg**

MATERIAL QUANTITY: **340** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	9"x9" Red w/ Black & White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 301 - 1915 Bldg		
MATERIAL QUANTITY:	340	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **9"x9" Red w/ Black & White Specks VFT Mastic**

MATERIAL LOCATION: **Room 301 - 1915 Bldg**

MATERIAL QUANTITY: **340** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Black Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 301 - 1915 Bldg		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White & Black Streaks VFT**

MATERIAL LOCATION: **Room 301 - 1915 Bldg**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Black Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 301 - 1915 Bldg		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White & Black Streaks VFT Mastic**

MATERIAL LOCATION: **Room 301 - 1915 Bldg**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	24" x 6" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 301 - 1915 Bldg		
MATERIAL QUANTITY:	70	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **24" x 6" Black VFT**

MATERIAL LOCATION: **Room 301 - 1915 Bldg**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	24" x 6" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 301 - 1915 Bldg		
MATERIAL QUANTITY:	70	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **24" x 6" Black VFT Mastic**

MATERIAL LOCATION: **Room 301 - 1915 Bldg**

MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown & White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 308 - 1915 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown & White Streaks VFT**

MATERIAL LOCATION: **Room 308 - 1915 Bldg.**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown & White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 308 - 1915 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown & White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 308 - 1915 Bldg.**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Physical Damage		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1915 Bldg.		
MATERIAL QUANTITY:	1150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Specks VFT**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridors - 1915 Bldg.**

MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1915 Bldg.		
MATERIAL QUANTITY:	1150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Specks VFT Mastic**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridors - 1915 Bldg.**

MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gymnasium/205 - 1915 Bldg.		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **12"x12" Gray w/ White Streaks VFT**

MATERIAL LOCATION: **Gymnasium/205 - 1915 Bldg.**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gymnasium/205 - 1915 Bldg.		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12"x12" Gray w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Gymnasium/205 - 1915 Bldg.**

MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12"x12" Beige w/ White & Orange Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 310 and 341 - 1923 Bldg.		
MATERIAL QUANTITY:	1810	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12"x12" Beige w/ White & Orange Streaks VFT**

MATERIAL LOCATION: **Room 310 and 341 - 1923 Bldg.**

MATERIAL QUANTITY: **1810** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	12"x12" Beige w/ White & Orange Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 310 and 341 - 1923 Bldg.		
MATERIAL QUANTITY:	1810	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12"x12" Beige w/ White & Orange Streaks VFT Mastic**

MATERIAL LOCATION: **Room 310 and 341 - 1923 Bldg.**

MATERIAL QUANTITY: **1810** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	9"x9" Cocoa w/ White & Brown Short Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	3rd Floor Hallway - 1923 Bldg.		
MATERIAL QUANTITY:	3324	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **9"x9" Cocoa w/ White & Brown Short Streaks VFT**

MATERIAL LOCATION: **3rd Floor Hallway - 1923 Bldg.**

MATERIAL QUANTITY: **3324** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	9"x9" Cocoa w/ White & Brown Short Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Hallway - 1923 Bldg.		
MATERIAL QUANTITY:	3324	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **9"x9" Cocoa w/ White & Brown Short Streaks VFT Mastic**

MATERIAL LOCATION: **3rd Floor Hallway - 1923 Bldg.**

MATERIAL QUANTITY: **3324** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12"x12" Cocoa w/ White & Brown Long Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 253 - 1923 Bldg.		
MATERIAL QUANTITY:	924	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12"x12" Cocoa w/ White & Brown Long Streaks VFT**

MATERIAL LOCATION: **Room 253 - 1923 Bldg.**

MATERIAL QUANTITY: **924** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12"x12" Cocoa w/ White & Brown Long Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 253 - 1923 Bldg.		
MATERIAL QUANTITY:	924	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12"x12" Cocoa w/ White & Brown Long Streaks VFT Mastic**

MATERIAL LOCATION: **Room 253 - 1923 Bldg.**

MATERIAL QUANTITY: **924** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Gray Streaks VFT ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Teachers Room Next to Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12"x12" Gray w/ White & Gray Streaks VFT ABATED**

MATERIAL LOCATION: **Teachers Room Next to Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Gray Streaks VFT Mastic ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Teachers Room Next to Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **12"x12" Gray w/ White & Gray Streaks VFT Mastic ABATED**

MATERIAL LOCATION: **Teachers Room Next to Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	9"x9" Pine Green w/ White Streaks VFT ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **9"x9" Pine Green w/ White Streaks VFT ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	9"x9" Pine Green w/ White Streaks VFT Mastic ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **9"x9" Pine Green w/ White Streaks VFT Mastic ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	9"x9" White w/ Pine Green Streaks VFT ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **9"x9" White w/ Pine Green Streaks VFT ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	9"x9" White w/ Pine Green Streaks VFT Mastic ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **9"x9" White w/ Pine Green Streaks VFT Mastic ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	9"x9" Forest Green VFT ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **9"x9" Forest Green VFT ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	9"x9" Forest Green VFT Mastic ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **9"x9" Forest Green VFT Mastic ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **9"x9" Gray w/ White Streaks VFT ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT Mastic ABATED		
HISTORICAL AHERA DAMAGE CATEGORY	Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Cafeteria - 1923 Bldg. ABATED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **9"x9" Gray w/ White Streaks VFT Mastic ABATED**

MATERIAL LOCATION: **Cafeteria - 1923 Bldg. ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	Brown Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Teacher's Rest Area & Room 376 - 1923 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	504	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **Brown Linoleum**

MATERIAL LOCATION: **Teacher's Rest Area & Room 376 - 1923 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **504** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	Brown Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teacher's Rest Area & Room 376 - 1923 Bldg.		
MATERIAL QUANTITY:	504	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Brown Linoleum Mastic**

MATERIAL LOCATION: **Teacher's Rest Area & Room 376 - 1923 Bldg.**

MATERIAL QUANTITY: **504** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12"x12" White w/ Blue Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 110 - 1923 Bldg		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **12"x12" White w/ Blue Speckles VFT**

MATERIAL LOCATION: **Room 110 - 1923 Bldg**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	12"x12" White w/ Blue Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 110 - 1923 Bldg		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **12"x12" White w/ Blue Speckles VFT Mastic**

MATERIAL LOCATION: **Room 110 - 1923 Bldg**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Dark Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Engineer's Office, Room 342 - 1923 Bldg.		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Dark Brown Speckles VFT**

MATERIAL LOCATION: **Engineer's Office, Room 342 - 1923 Bldg.**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Dark Brown Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer's Office, Room 342 - 1923 Bldg.		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12"x12" Beige w/ Dark Brown Speckles VFT Mastic**

MATERIAL LOCATION: **Engineer's Office, Room 342 - 1923 Bldg.**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 334, 336, 338, 340 - 1923 Bldg		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan Spots VFT**

MATERIAL LOCATION: **Rooms 334, 336, 338, 340 - 1923 Bldg**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 334, 336, 338, 340 - 1923 Bldg		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan Spots VFT Mastic**

MATERIAL LOCATION: **Rooms 334, 336, 338, 340 - 1923 Bldg**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Brown Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 212, 340, 315 - 1923 Bldg		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **12"x12" Gray w/ White & Brown Spots VFT**

MATERIAL LOCATION: **Rooms 212, 340, 315 - 1923 Bldg**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **300** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Brown Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 212, 340, 315 - 1923 Bldg		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **12"x12" Gray w/ White & Brown Spots VFT Mastic**

MATERIAL LOCATION: **Rooms 212, 340, 315 - 1923 Bldg**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **300** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	9"x9" Gray VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 128 - 1923 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **9"x9" Gray VFT**

MATERIAL LOCATION: **Room 128 - 1923 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	9"x9" Gray VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 128 - 1923 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **9"x9" Gray VFT Mastic**

MATERIAL LOCATION: **Room 128 - 1923 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor through 4th Floor Corridors - 1908 Bldg.		
MATERIAL QUANTITY:	4900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Specks VFT**

MATERIAL LOCATION: **1st Floor through 4th Floor Corridors - 1908 Bldg.**

MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor through 4th Floor Corridors - 1908 Bldg.		
MATERIAL QUANTITY:	4900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **12"x12" Brown w/ White Specks VFT Mastic**

MATERIAL LOCATION: **1st Floor through 4th Floor Corridors - 1908 Bldg.**

MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Main Office, Room 315, Room 117 - 1908 Bldg.		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT**

MATERIAL LOCATION: **Main Office, Room 315, Room 117 - 1908 Bldg.**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Room 315, Room 117 - 1908 Bldg.		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**

MATERIAL LOCATION: **Main Office, Room 315, Room 117 - 1908 Bldg.**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	9'x9" Beige w/ Brown & White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 316 - 1908 Bldg.		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **9'x9" Beige w/ Brown & White Streaks VFT**

MATERIAL LOCATION: **Room 316 - 1908 Bldg.**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	9"x9" Beige w/ Brown & White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 316 - 1908 Bldg.		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **9"x9" Beige w/ Brown & White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 316 - 1908 Bldg.**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 312 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT**

MATERIAL LOCATION: **Room 312 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 312 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**

MATERIAL LOCATION: **Room 312 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Tan Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 322 - 1908 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Tan Specks VFT**

MATERIAL LOCATION: **Room 322 - 1908 Bldg.**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Tan Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 322 - 1908 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Tan Specks VFT Mastic**

MATERIAL LOCATION: **Room 322 - 1908 Bldg.**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69		
MATERIAL DESCRIPTION:	9"x9" Green w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 114 - 1908 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **69**

MATERIAL DESCRIPTION: **9"x9" Green w/ White Streaks VFT**

MATERIAL LOCATION: **Room 114 - 1908 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70		
MATERIAL DESCRIPTION:	9"x9" Green w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 114 - 1908 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **9"x9" Green w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 114 - 1908 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	9"x9" Black w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 114 - 1908 Bldg.		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **9"x9" Black w/ White Streaks VFT**

MATERIAL LOCATION: **Room 114 - 1908 Bldg.**

MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	72		
MATERIAL DESCRIPTION:	9"x9" Black w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 114 - 1908 Bldg.		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **72**

MATERIAL DESCRIPTION: **9"x9" Black w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 114 - 1908 Bldg.**

MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	73		
MATERIAL DESCRIPTION:	12"x12" Gray w/ Gray & Black Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 114 - 1908 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **73**

MATERIAL DESCRIPTION: **12"x12" Gray w/ Gray & Black Specks VFT**

MATERIAL LOCATION: **Room 114 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	12"x12" Gray w/ Gray & Black Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 114 - 1908 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **74**

MATERIAL DESCRIPTION: **12"x12" Gray w/ Gray & Black Specks VFT Mastic**

MATERIAL LOCATION: **Room 114 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	12"x12" Blue w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 114 - 1908 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **12"x12" Blue w/ White Streaks VFT**

MATERIAL LOCATION: **Room 114 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	12"x12" Blue w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 114 - 1908 Bldg. NOT OBSERVED		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **76**

MATERIAL DESCRIPTION: **12"x12" Blue w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 114 - 1908 Bldg. NOT OBSERVED**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Red Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 6. ACBM with the potential for damage

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 018 & Hallway -1908 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **77**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White & Red Streaks VFT**

MATERIAL LOCATION: **Room 018 & Hallway -1908 Bldg.**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **150** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	78		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Red Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 018 & Hallway - 1908 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **78**

MATERIAL DESCRIPTION: **9"x9" Brown w/ White & Red Streaks VFT Mastic**

MATERIAL LOCATION: **Room 018 & Hallway - 1908 Bldg.**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	79		
MATERIAL DESCRIPTION:	9"x9" Tan w/ Brown & White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 018 & Hallway - 1908 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **79**

MATERIAL DESCRIPTION: **9"x9" Tan w/ Brown & White Streaks VFT**

MATERIAL LOCATION: **Room 018 & Hallway - 1908 Bldg.**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **150** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	80		
MATERIAL DESCRIPTION:	9"x9" Tan w/ Brown & White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 018 & Hallway - 1908 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **80**

MATERIAL DESCRIPTION: **9"x9" Tan w/ Brown & White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 018 & Hallway - 1908 Bldg.**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	81		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Swirls VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **9"x9" Gray w/ White Swirls VFT**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	82		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Swirls VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **82**

MATERIAL DESCRIPTION: **9"x9" Gray w/ White Swirls VFT Mastic**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	83		
MATERIAL DESCRIPTION:	9"x9" White w/ Black Swirls VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **83**

MATERIAL DESCRIPTION: **9"x9" White w/ Black Swirls VFT**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	84		
MATERIAL DESCRIPTION:	9"x9" White w/ Black Swirls VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **84**

MATERIAL DESCRIPTION: **9"x9" White w/ Black Swirls VFT Mastic**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	85		
MATERIAL DESCRIPTION:	12"x24" Gray w/ Black & White Swirls VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **85**

MATERIAL DESCRIPTION: **12"x24" Gray w/ Black & White Swirls VFT**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	86		
MATERIAL DESCRIPTION:	12"x24" Gray w/ Black & White Swirls VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **86**

MATERIAL DESCRIPTION: **12"x24" Gray w/ Black & White Swirls VFT Mastic**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	87		
MATERIAL DESCRIPTION:	Stair Tread Tile Yellow w/ Gold Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **87**

MATERIAL DESCRIPTION: **Stair Tread Tile Yellow w/ Gold Specks VFT**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	88		
MATERIAL DESCRIPTION:	Stair Tread Tile Yellow w/ Gold Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110)- 1908 Bldg.		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **88**

MATERIAL DESCRIPTION: **Stair Tread Tile Yellow w/ Gold Specks VFT Mastic**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110)- 1908 Bldg.**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	89		
MATERIAL DESCRIPTION:	Stair Tread Tile Gray w/ White Marble VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **89**

MATERIAL DESCRIPTION: **Stair Tread Tile Gray w/ White Marble VFT**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	90		
MATERIAL DESCRIPTION:	Stair Tread Tile Gray w/ White Marble VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **90**

MATERIAL DESCRIPTION: **Stair Tread Tile Gray w/ White Marble VFT Mastic**

MATERIAL LOCATION: **Library (Underneath Carpet, HA # 111, # 109 & # 110) - 1908 Bldg.**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	91		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Red & Black Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 115 - 1908 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **91**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Red & Black Streaks VFT**

MATERIAL LOCATION: **Room 115 - 1908 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	92		
MATERIAL DESCRIPTION:	12"x12" Tan w/ Red & Black Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 115 - 1908 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **92**

MATERIAL DESCRIPTION: **12"x12" Tan w/ Red & Black Streaks VFT Mastic**

MATERIAL LOCATION: **Room 115 - 1908 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	93		
MATERIAL DESCRIPTION:	9"x9" Gray w/ Black & White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 115 - 1908 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **93**

MATERIAL DESCRIPTION: **9"x9" Gray w/ Black & White Streaks VFT**

MATERIAL LOCATION: **Room 115 - 1908 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	94		
MATERIAL DESCRIPTION:	9"x9" Gray w/ Black & White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 115 - 1908 Bldg.		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **94**

MATERIAL DESCRIPTION: **9"x9" Gray w/ Black & White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 115 - 1908 Bldg.**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	95		
MATERIAL DESCRIPTION:	9"x9" Dark Green w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 121, 121A - 1908 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **95**

MATERIAL DESCRIPTION: **9"x9" Dark Green w/ White Streaks VFT**

MATERIAL LOCATION: **Rooms 121, 121A - 1908 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	96		
MATERIAL DESCRIPTION:	9"x9" Dark Green w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 121, 121A - 1908 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **96**

MATERIAL DESCRIPTION: **9"x9" Dark Green w/ White Streaks VFT Mastic**

MATERIAL LOCATION: **Rooms 121, 121A - 1908 Bldg.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	97		
MATERIAL DESCRIPTION:	Tan Spotted Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **97**

MATERIAL DESCRIPTION: **Tan Spotted Linoleum**

MATERIAL LOCATION: **Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	98		
MATERIAL DESCRIPTION:	Tan Spotted Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **98**

MATERIAL DESCRIPTION: **Tan Spotted Linoleum Mastic**

MATERIAL LOCATION: **Third Floor Men's and Women's Teachers Toilet - 1908 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	99		
MATERIAL DESCRIPTION:	Lab Counter Top		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 319 - 1908 Bldg.		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **99**

MATERIAL DESCRIPTION: **Lab Counter Top**

MATERIAL LOCATION: **Room 319 - 1908 Bldg.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	AA		
MATERIAL DESCRIPTION:	Air Cell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Janitor's Closet By Room 301- 1915		
MATERIAL QUANTITY:	14	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **AA**

MATERIAL DESCRIPTION: **Air Cell Pipe Insulation**

MATERIAL LOCATION: **3rd Floor Janitor's Closet By Room 301- 1915**

MATERIAL QUANTITY: **14** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	BB		
MATERIAL DESCRIPTION:	MJP E/F/V on Air Cell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Janitor's Closet By Room 301 - 1915; 1st Floor Girls Toilet Added in 2010		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **BB**

MATERIAL DESCRIPTION: **MJP E/F/V on Air Cell Pipe Insulation**

MATERIAL LOCATION: **3rd Floor Janitor's Closet By Room 301 - 1915; 1st Floor Girls Toilet Added in 2010**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	CC		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First Floor Girl's Toilet, First Floor Corridor - 1915 Bldg.		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **CC**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **First Floor Girl's Toilet, First Floor Corridor - 1915 Bldg.**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	DD		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Janitor's Closet By Room 301 - 1915 Bldg.		
MATERIAL QUANTITY:	1	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **DD**

MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**

MATERIAL LOCATION: **Janitor's Closet By Room 301 - 1915 Bldg.**

MATERIAL QUANTITY: **1** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	Boiler Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room - 1923 Bldg.		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Boiler Gasket**

MATERIAL LOCATION: **Boiler Room - 1923 Bldg.**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	EE		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Janitor's Closet By Room 301 - 1915 Bldg.		
MATERIAL QUANTITY:	14	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **EE**

MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**

MATERIAL LOCATION: **Janitor's Closet By Room 301 - 1915 Bldg.**

MATERIAL QUANTITY: **14** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	Boiler Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room - 1923 Bldg.		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **Boiler Gasket**

MATERIAL LOCATION: **Boiler Room - 1923 Bldg.**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FF		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Incinerator Room - 1923 Bldg.		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **FF**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **Incinerator Room - 1923 Bldg.**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	GG		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Incinerator Room - 1923 Bldg.		
MATERIAL QUANTITY:	7	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **GG**

MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**

MATERIAL LOCATION: **Incinerator Room - 1923 Bldg.**

MATERIAL QUANTITY: **7** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1000		
MATERIAL DESCRIPTION:	2' x 4' White Ceiling Tiles with Random Fissures & Holes		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1000**

MATERIAL DESCRIPTION: **2' x 4' White Ceiling Tiles with Random Fissures & Holes**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1001		
MATERIAL DESCRIPTION:	2' x 4' White plain ceiling tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teachers' Lunch Room		
MATERIAL QUANTITY:	960	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1001**

MATERIAL DESCRIPTION: **2' x 4' White plain ceiling tile**

MATERIAL LOCATION: **Teachers' Lunch Room**

MATERIAL QUANTITY: **960** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1002		
MATERIAL DESCRIPTION:	1' x 1' White ceiling tile w/ random holes		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Students' Lunch Room		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1002**

MATERIAL DESCRIPTION: **1' x 1' White ceiling tile w/ random holes**

MATERIAL LOCATION: **Students' Lunch Room**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1003		
MATERIAL DESCRIPTION:	Glue for 1' x 1' White ceiling tile with random holes		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Students' Lunch Room		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1003**

MATERIAL DESCRIPTION: **Glue for 1' x 1' White ceiling tile with random holes**

MATERIAL LOCATION: **Students' Lunch Room**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1004		
MATERIAL DESCRIPTION:	2' x 2' White plain ceiling tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1004**

MATERIAL DESCRIPTION: **2' x 2' White plain ceiling tile**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1005		
MATERIAL DESCRIPTION:	1' x 1' White CT with large holes		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen Manager Office		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1005**

MATERIAL DESCRIPTION: **1' x 1' White CT with large holes**

MATERIAL LOCATION: **Kitchen Manager Office**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1006		
MATERIAL DESCRIPTION:	Glue for 1' x 1' White CT with large holes		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen Manager Office		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1006**

MATERIAL DESCRIPTION: **Glue for 1' x 1' White CT with large holes**

MATERIAL LOCATION: **Kitchen Manager Office**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1007		
MATERIAL DESCRIPTION:	1' x 1' White CT with random fissures		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 300 on ceiling and walls		
MATERIAL QUANTITY:	1680	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1007**

MATERIAL DESCRIPTION: **1' x 1' White CT with random fissures**

MATERIAL LOCATION: **Room 300 on ceiling and walls**

MATERIAL QUANTITY: **1680** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1008		
MATERIAL DESCRIPTION:	Glue for 1' x 1' White CT with random fissures		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 300 on ceiling and walls		
MATERIAL QUANTITY:	1680	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1008**

MATERIAL DESCRIPTION: **Glue for 1' x 1' White CT with random fissures**

MATERIAL LOCATION: **Room 300 on ceiling and walls**

MATERIAL QUANTITY: **1680** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: HA-1010
MATERIAL DESCRIPTION: 12"x12" Yellow VFT NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1010**

MATERIAL DESCRIPTION: **12"x12" Yellow VFT NOT OBSERVED**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1010m		
MATERIAL DESCRIPTION:	Adhesive for 12"x12" Yellow VFT NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1010m**

MATERIAL DESCRIPTION: **Adhesive for 12"x12" Yellow VFT NOT OBSERVED**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-1011		
MATERIAL DESCRIPTION:	Transite		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st floor girl's restroom privacy wall		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HA-1011**

MATERIAL DESCRIPTION: **Transite**

MATERIAL LOCATION: **1st floor girl's restroom privacy wall**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HH		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Locker Room, 1st Floor Boy's Toilet, Hot & Cold Deck, & Wood Shop Area - 1923 Bldg.; Rooms 219, 315, 319 under Classroom Sinks (12 LF); 2nd Floor Girls washroom (5 LF); 3rd Floor Girls Washroom (5 LF).**

MATERIAL QUANTITY: **142** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: MATERIAL UNITS: **FITTING**

COMMENTS:

Inspector's Signature: _____ Date: **04/14/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **HH**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Locker Room, 1st Floor Boy's Toilet, Hot & Cold Deck, & Wood Shop Area - 1923 Bldg.; Rooms 219, 315, 319 under Classroom Sinks (12 LF); 2nd Floor Girls washroom (5 LF); 3rd Floor Girls Washroom (5 LF).**

MATERIAL QUANTITY: **142** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	II		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation (Paper-Wrap Pipe Insulation)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Electrical Room Across from Stairway # 4 - 1908 Bldg.		
MATERIAL QUANTITY:	38	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUILDING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **II**

MATERIAL DESCRIPTION: **Cardboard Pipe Insulation (Paper-Wrap Pipe Insulation)**

MATERIAL LOCATION: **Electrical Room Across from Stairway # 4 - 1908 Bldg.**

MATERIAL QUANTITY: **38** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Allizon Brooks		
SCHOOL NAME:	Schurz High School	INSPECTION DATE:	4/14/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	JJ		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation (Paperwrap Pipe Insulation)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Electrical Room Across from Stairway # 4 - 1908 Bldg.		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:		DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 04/14/2025

Chicago Public Schools

Specialty Consulting, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	46281	BUIDLING ID:	1530
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Schurz High School	REVIEW DATE:	5/13/2025		
ADDRESS:	3601 N. Milwaukee Ave.	IDPH LICENSE NO:	100-18790		

HOMOGENEOUS AREA: **JJ**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation (Paperwrap Pipe Insulation)**

MATERIAL LOCATION: **Electrical Room Across from Stairway # 4 - 1908 Bldg.**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/13/2025**

Chicago Public Schools

Specialty Consulting, Inc.

2025 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 18790

ISSUED
4/5/2024

EXPIRES
05/15/2025

ALLIZON L BROOKS
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ALLIZON L BROOKS
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/5/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18790

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License


Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18790	ISSUED 4/5/2024	EXPIRES 05/15/2025	INSPECTOR	1/27/2025
ALLIZON L BROOKS 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	6/12/2024
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

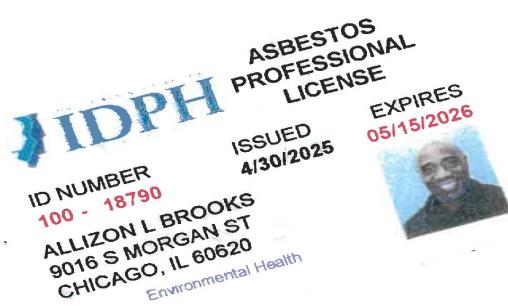

ENDORSEMENTS	TC EXPIRES
INSPECTOR	1/4/2026
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	6/1/2025
Alteration of this license shall result in legal action	
This license issued under authority of the State of Illinois	
Department of Public Health	
This license is valid only when accompanied by a valid	
training course certificate.	

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that ALLIZON L. BROOKS
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/04/2025 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

01/04/2025

Course Dates:

01/04/2026

Expires:

2501BIR02

Certificate Number:

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

A handwritten signature in black ink that appears to read "Nicholas J. Peneff".



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: BIR2111012562

Kathy DeSalvo
Kathy DeSalvo, Director



Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012583

Kathy DeSalvo
Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

7/8/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 04019	ISSUED 7/8/2024	EXPIRES 05/15/2025	INSPECTOR	5/6/2025
ARTURO SAENZ 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			MANAGEMENT PLANNER	5/6/2025
			AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 5/6/2024

Exam Date: 5/6/2024

Expiration Date: 5/6/2025


Certificate Number: MPR2405061823

Course Credit Hours: MPR 8 Hours

Kristina Miczek, Training Manager



525-535 West Jefferson Street • Springfield, Illinois

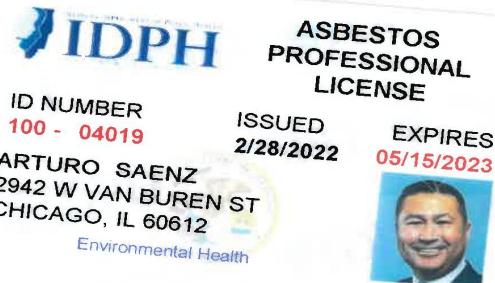

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612


2/28/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

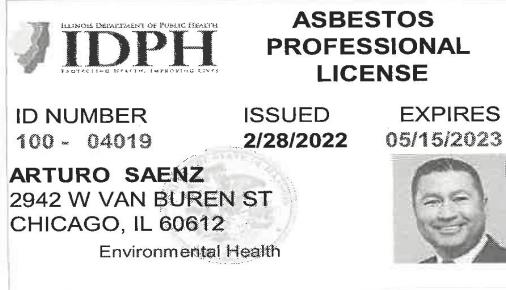

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	11/1/2022
MANAGEMENT PLANNER	11/1/2022
AIR SAMPLING PROFESSIONAL	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Ill

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/30/2026



ASBESTOS
PROFESSIONAL
LICENSE

ID NUMBER
100 - 04019

ISSUED
4/30/2025

EXPIRES
05/15/2026

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health




ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

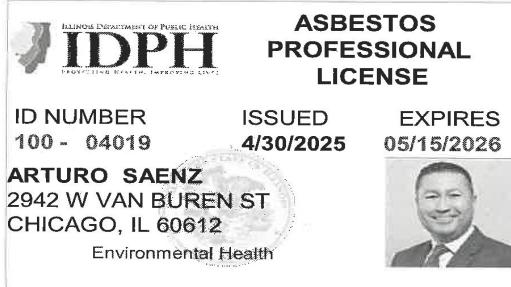

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	5/6/2025
MANAGEMENT PLANNER	4/2/2026
AIR SAMPLING PROFESSIONAL	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

**Reliable
Environmental
Solutions, Inc. R E S**

This is to certify that **Arturo Saenz**

*has on 4/2/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*


Course Date: April 2, 2025

COURSE LENGTH: 4 HOURS

Examination Date: April 2, 2025

Expiration Date: April 2, 2026

Certificate Number: MPR/0560

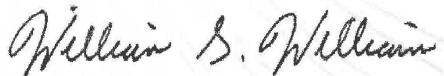

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed