

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0019
SCHOOL NAME: Hirsch High School
ADDRESS OF SCHOOL: 7740 S. Ingleside
CITY: Chicago, IL, 60619

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 7/22/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/9/2025 ENROLLMENT 89
IDPH INSPECTOR LICENSE NUMBER: 100-11070
IDPH LICENSED INSPECTOR NAME (Please Print): Mallory Jones
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 6/5/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Hirsch High School

7740 S. Ingleside
Chicago, IL, 60619

Unit: 47031
Building ID: 1380

IDPH ID Number: 14-016-2990-0019

REPORT DATE:
Thursday, June 05, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
TEM Environmental, Inc.

174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone 630-790-0880
Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

06/03/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 47031 Region: 05 IDPH ID: 14-016-2990-0019

School: Hirsch High School Building ID: 1380

Address: 7740 S. Ingleside

Chicago, IL, 60619

Building Contact: Mulchrone, Thomas Contact Phone: 3126052633

Current Building Owners: Chicago Public Schools

Reinspection Date: 5/9/2025

Review Date: 06/03/2025

Inspector: Mallory Jones

Inspector IDPH License: 100-11070

Management Planner: Daniel Juneau

Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: June 05, 2025

RE: Hirsch High School, Unit 47031
7740 S. Ingleside
Chicago, IL, 60619

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Hirsch High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Hirsch High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Hirsch High School Unit: 47031 Region: 05
Address: 7740 S. Ingleside Chicago, IL, 60619
IDPH ID: 14-016-2990-0019 Building ID: 1380
Contact: Mulchrone, Thomas Phone: 3126052633

2. Description of Facility

Original Construction: 1926 Additional Construction:
Total Square Footage: 217770 No of Floors: 3
Current Occupancy: 89

3. LEA Designated Person


Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Phone: 630-790-0880 Fax: 630-790-0882

5. Inspector

Inspector Name: Mallory Jones

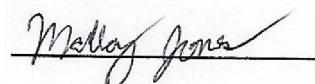

Signature:
Date: 5/9/2025

6. Management Planner

Management Planner Name: Daniel Juneau




Signature:
Date: 06/03/2025

7. Review Date: 06/03/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

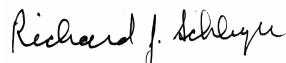
Signature:

Date: 6/5/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Hirsch High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1380:

20	12"x12" Grey Vinyl Floor Tile
20M	12"x12" Grey Vinyl Floor Tile Mastic
25	12"x12" White Vinyl Floor Tile
25M	Mastic associated w/12"x12" White Vinyl Floor Tile
26	12"x12" Beige Floor Tile
26M	Mastic associated w/12"x12" Beige Floor Tile
NEW	Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 1380:

25	12"x12" White Vinyl Floor Tile
25M	Mastic associated w/12"x12" White Vinyl Floor Tile
26	12"x12" Beige Floor Tile
26M	Mastic associated w/12"x12" Beige Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02C	12x12 Tan Vinyl Floor Tile
10	Duct Vibration Sleeve
104	Transite Lab tables
105	Transite Panels
106	Gray Linoleum
107	Beige Linoleum Mastic NOT OBSERVED
108	Transite Countertop
109	Transite Chalkboards
16A	Gray Linoleum w/Blue Streaks
17A	Gray Linoleum Mastic
20	12"x12" Grey Vinyl Floor Tile
20M	12"x12" Grey Vinyl Floor Tile Mastic
22	Pipe Fittings
24A	White w/Tan Streaks Flooring
24B	White w/Tan Streaks Flooring Mastic
25	12"x12" White Vinyl Floor Tile
25M	Mastic associated w/12"x12" White Vinyl Floor Tile
26	12"x12" Beige Floor Tile
26M	Mastic associated w/12"x12" Beige Floor Tile
HA-100	2'x4' White Ceiling Tile
HA-101	1'x1' White Ceiling Tile
HA-102	12"x12" White Ceiling Tile Glue
HA-103	Spray-applied Ceiling Coating
N	Boiler Door Insulation
NEW	Newly Installed Suspect ACM
O	12x12 Off-White w/Streaks Vinyl Floor Tile
O-1	12x12 Off-White w/Streaks Floor Tile Mastic
P	12x12 White w/Black Streaks Vinyl Floor Tile
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic
Q	12x12 Light Pink (Beige) Vinyl Floor Tile
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic

The following areas were deemed to be inaccessible:

10	Duct Vibration Sleeve
107	Beige Linoleum Mastic NOT OBSERVED
14A	9x9 Brown Vinyl Floor Tile Mastic
14B	9x9 Tan Vinyl Floor Tile Mastic
15C	12x12 Tan Vinyl Floor Tile Mastic

15D	12x12 Light Grey Floor Tile Mastic
15E	12x12 Light Green Vinyl Floor Tile Mastic
17A	Gray Linoleum Mastic
24B	White w/Tan Streaks Flooring Mastic
HA-102	12"x12" White Ceiling Tile Glue
M	Boiler Gasket
N	Boiler Door Insulation
O-1	12x12 Off-White w/Streaks Floor Tile Mastic
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Mallory Jones, IDPH License # 100-11070. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 12/30/2022
3/27/2023

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Hirsch High School Building 1380 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Hirsch High School **Unit** 47031 **Building ID** 1380
Address 7740 S. Ingleside **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01A	9x9 Brown w/Streaks Vinyl Floor Tile	3,140	SF	Room 328's Vault and Room 227, 1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01B	9x9 Tan Vinyl Floor Tile	2,320	SF	1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02A	12x12 Light Olive Green Vinyl Floor Tile	2,489	SF	Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02B	12x12 Brown Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02C	12x12 Tan Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02D	12x12 Light Gray Vinyl Floor Tile	5,715	SF	Main Office, Library Office, Room 320, 321, 220, 130, PE Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02E	12x12 Dark Green Vinyl Floor Tile	1,220	SF	Rooms 211, 137	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Duct Vibration Sleeve	15	SF	Band Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
104	Transite Lab tables	25	SF	Room 322, 326, 322 Office, 328	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
105	Transite Panels	30	SF	Room 322 Fume Hood	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
106	Gray Linoleum	1,266	SF	Room 321	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
107	Beige Linoleum Mastic NOT OBSERVED	1,266	SF	Room 321	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
108	Transite Countertop	177	SF	Rooms 322, 326 & 328	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
109	Transite Chalkboards	2,000	SF	1st, 2nd & 3rd Floor Classrooms	ASSUMED	MISC	N	DIST	23		No	ACBM with the potential for damage	3	LOW
12	Firewall	12,000	SF	Assembly Hall	CHR	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
14A	9x9 Brown Vinyl Floor Tile Mastic	2,190	SF	Room 328's Vault	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Hirsch High School **Unit** 47031 **Building ID** 1380
Address 7740 S. Ingleside **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				and Room 227, 1st Floor Corridor								potential for damage		
14B	9x9 Tan Vinyl Floor Tile Mastic	2,320	SF	1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15A	12x12 Light Olive Vinyl Floor Tile Mastic ABATED			Kitchen, 315, 221, 211, 235, 206, 127	ABATED	MISC								
15B	12x12 Brown Vinyl Floor Tile Mastic	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15C	12x12 Tan Vinyl Floor Tile Mastic	14,725	SF	2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15D	12x12 Light Grey Floor Tile Mastic	5,715	SF	Main Office, Library Office, Rooms 320, 321, 220, 130	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15E	12x12 Light Green Vinyl Floor Tile Mastic	1,250	SF	Rooms 211, 137	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16A	Gray Linoleum w/Blue Streaks	5,705	SF	Rooms 222 & 225	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17A	Gray Linoleum Mastic	5,705	SF	Rooms 222 & 225	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12"x12" Grey Vinyl Floor Tile	660	SF	Room 321	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
20M	12"x12" Grey Vinyl Floor Tile Mastic	660	SF	Room 321	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
22	Pipe Fittings	25	LF	Warm Air Tunnel and Unfinished Crawlspace	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
23	Plaster			1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area	NO_ACBM	SURFACE								
24A	White w/Tan Streaks Flooring	1,700	SF	Rooms 221, 211, 235, 206, 127, 322	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24B	White w/Tan Streaks Flooring Mastic	1,700	SF	Room 322, 221, 211, 235, 206, 127	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12"x12" White Vinyl Floor Tile	2,100	SF	Rooms 126, 223 & 235	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hirsch High School **Unit** 47031 **Building ID** 1380
Address 7740 S. Ingleside **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
25M	Mastic associated w/12"x12" White Vinyl Floor Tile	2,100	SF	Rooms 126, 223 & 235	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
26	12"x12" Beige Floor Tile	2,100	SF	Rooms 124, 206 & 207	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
26M	Mastic associated w/12"x12" Beige Floor Tile	2,100	SF	Rooms 124, 206 & 207	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
CM-1	Green Carpet Mastic NOT OBSERVED			Room 230	NO_ACBM	MISC								
CM-2	Blue Carpet Mastic			Rooms 109, 128, 204	NO_ACBM	MISC								
CM-3	Red Carpet Mastic			Social Room, Room 131	NO_ACBM	MISC								
HA-100	2'x4' White Ceiling Tile	150,000	SF	Hallways and Classrooms	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACM or friable suspect ACM		LOW
HA-101	1'x1' White Ceiling Tile	3,000	SF	Kitchen	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACM or friable suspect ACM		LOW
HA-102	12"x12" White Ceiling Tile Glue	3,000	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-103	Spray-applied Ceiling Coating	7,000	SF	Pool	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACM or friable suspect ACM		LOW
M	Boiler Gasket	140	LF	Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACM or friable suspect ACM		LOW
N	Boiler Door Insulation	250	SF	Boiler Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKWN	0		Yes	ACBM with the potential for damage		
O	12x12 Off-White w/Streaks Vinyl Floor Tile	3,560	SF	Rooms 321, 322, 325 & 326	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
O-1	12x12 Off-White w/Streaks Floor Tile Mastic	3,560	SF	Rooms 321, 322, 325, 326	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
P	12x12 White w/Black Streaks Vinyl Floor Tile	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
P-1	12x12 White w/Black Streaks Vinyl Floor Tile Mastic	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hirsch High School **Unit** 47031 **Building ID** 1380
Address 7740 S. Ingleside **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
Q	12x12 Light Pink (Beige) Vinyl Floor Tile	750	SF	Room 128/Counselor's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic	750	SF	Room 128 (Counselor's Office)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380
Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>5/9/2025</u>
Inspector Name <u>Mallory Jones</u>
<u>100-11070</u> <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01A	
01B	
02A	2025- Room 221 Has Brown carpet (tile might be underneath)
02B	2025- Material Abated from Rooms 124 & 207 Winter of 2022. Room 207 has hardwood floor
02C	2025- Room 122 has Grey & Blue carpet.
02D	
02E	
10	
104	
105	
106	
107	2025- Not Observed
108	
109	Damage is located in Rooms 132, 211, 233 & 236
12	
14A	
14B	
15A	
15B	2025- Material Abated from Room 124 & 207 Winter 2023
15C	
15D	
15E	
16A	

Chicago Public Schools

School Hirsch High School Unit 47031 Building ID 1380
Address 7740 S. Ingleside Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
17A	
20	
20M	
22	
23	
24A	
24B	
25	
25M	
26	
26M	
CM-1	Not Observed 2025
CM-2	
CM-3	
HA-100	
HA-101	
HA-102	
HA-103	
M	
N	
NEW	
O	
O-1	
P	
P-1	
Q	
Q-1	

Chicago Public Schools

School Hirsch High School **Unit** 47031 **Building ID** 1380
Address 7740 S. Ingleside **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive
Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Table II
Management Planner's Review

Chicago Public Schools

School Hirsch High School

Unit 47031

Building ID 1380

Address 7740 S. Ingleside

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	9x9 Brown w/Streaks Vinyl Floor Tile	3,140	SF	Room 328's Vault and Room 227, 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01B	9x9 Tan Vinyl Floor Tile	2,320	SF	1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02A	12x12 Light Olive Green Vinyl Floor Tile	2,489	SF	Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02B	12x12 Brown Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02C	12x12 Tan Vinyl Floor Tile	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02D	12x12 Light Gray Vinyl Floor Tile	5,715	SF	Main Office, Library Office, Room 320, 321, 220, 130, PE Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02E	12x12 Dark Green Vinyl Floor Tile	1,220	SF	Rooms 211, 137	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Duct Vibration Sleeve	15	SF	Band Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
104	Transite Lab tables	25	SF	Room 322, 326, 322 Office, 328	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
105	Transite Panels	30	SF	Room 322 Fume Hood	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
106	Gray Linoleum	1,266	SF	Room 321	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107	Beige Linoleum Mastic NOT OBSERVED	1,266	SF	Room 321	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
108	Transite Countertop	177	SF	Rooms 322, 326 & 328	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	Transite Chalkboards	2,000	SF	1st, 2nd & 3rd Floor Classrooms	Assumed	MISC	No	23	SF	6 ACBM with the potential for damage	Repair
12	Firewall	12,000	SF	Assembly Hall	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
14A	9x9 Brown Vinyl Floor Tile Mastic	2,190	SF	Room 328's Vault and Room 227, 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14B	9x9 Tan Vinyl Floor Tile Mastic	2,320	SF	1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	12x12 Light Olive Vinyl Floor Tile Mastic ABATED			Kitchen, 315, 221, 211, 235, 206, 127	Abated	MISC					
15B	12x12 Brown Vinyl Floor Tile Mastic	14,725	SF	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15C	12x12 Tan Vinyl Floor Tile Mastic	14,725	SF	2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15D	12x12 Light Grey Floor Tile Mastic	5,715	SF	Main Office, Library Office, Rooms 320, 321, 220, 130	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15E	12x12 Light Green Vinyl Floor Tile Mastic	1,250	SF	Rooms 211, 137	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Hirsch High School

Unit 47031

Building ID 1380

Address 7740 S. Ingleside

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
16A	Gray Linoleum w/Blue Streaks	5,705	SF	Rooms 222 & 225	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17A	Gray Linoleum Mastic	5,705	SF	Rooms 222 & 225	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Grey Vinyl Floor Tile	660	SF	Room 321	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20M	12"x12" Grey Vinyl Floor Tile Mastic	660	SF	Room 321	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Pipe Fittings	25	LF	Warm Air Tunnel and Unfinished Crawlspace	Assumed	MISC	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
23	Plaster			1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area	No ACBM	SURFACE					
24A	White w/Tan Streaks Flooring	1,700	SF	Rooms 221, 211, 235, 206, 127, 322	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24B	White w/Tan Streaks Flooring Mastic	1,700	SF	Room 322, 221, 211, 235, 206, 127	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" White Vinyl Floor Tile	2,100	SF	Rooms 126, 223 & 235	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25M	Mastic associated w/12"x12" White Vinyl Floor Tile	2,100	SF	Rooms 126, 223 & 235	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Beige Floor Tile	2,100	SF	Rooms 124, 206 & 207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26M	Mastic associated w/12"x12" Beige Floor Tile	2,100	SF	Rooms 124, 206 & 207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-1	Green Carpet Mastic NOT OBSERVED			Room 230	No ACBM	MISC					
CM-2	Blue Carpet Mastic			Rooms 109, 128, 204	No ACBM	MISC					
CM-3	Red Carpet Mastic			Social Room, Room 131	No ACBM	MISC					
HA-100	2'x4' White Ceiling Tile	150,000	SF	Hallways and Classrooms	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-101	1'x1' White Ceiling Tile	3,000	SF	Kitchen	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-102	12"x12" White Ceiling Tile Glue	3,000	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-103	Spray-applied Ceiling Coating	7,000	SF	Pool	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
M	Boiler Gasket	140	LF	Boiler Room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
N	Boiler Door Insulation	250	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC		0		6 ACBM with the potential for damage	Follow O&M Plan
O	12x12 Off-White w/Streaks Vinyl Floor Tile	3,560	SF	Rooms 321, 322, 325 & 326	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O-1	12x12 Off-White w/Streaks Floor Tile Mastic	3,560	SF	Rooms 321, 322, 325, 326	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P	12x12 White w/Black Streaks Vinyl Floor Tile	9,300	SF	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P-1	12x12 White w/Black Streaks Vinyl Floor Tile	9,300	SF	Rooms 210, 209, 206, 235, 232, 234,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Hirsch High School

Unit 47031

Building ID 1380

Address 7740 S. Ingleside

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Mastic			237, 236, 141, 230, 227, 223							
Q	12x12 Light Pink (Beige) Vinyl Floor Tile	750	SF	Room 128/Counselor's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Q-1	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic	750	SF	Room 128 (Counselor's Office)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Review Date	6/3/2025
Manager Planner Name	Daniel Juneau

HA Number	Management Comments
01A	

Chicago Public Schools

School Hirsch High School

Unit 47031

Building ID 1380

Address 7740 S. Ingleside

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

100-03613	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
01B	
02A	
02B	
02C	
02D	
02E	
10	
104	
105	
106	
107	
108	
109	Repair response action is selective to Rooms 132, 211, 233 & 236 Only
12	
14A	
14B	
15A	
15B	
15C	
15D	
15E	
16A	
17A	
20	
20M	
22	
23	

Management Planner's Comments Summarized at the End of the Report

Chicago Public Schools

School Hirsch High School

Unit 47031

Building ID 1380

Address 7740 S. Ingleside

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
24A	
24B	
25	
25M	
26	
26M	
CM-1	
CM-2	
CM-3	
HA-100	
HA-101	
HA-102	
HA-103	
M	
N	
NEW	
O	
O-1	
P	
P-1	
Q	
Q-1	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01A		
MATERIAL DESCRIPTION:	9x9 Brown w/Streaks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 328's Vault and Room 227, 1st Floor Corridor		
MATERIAL QUANTITY:	3140	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **01A**

MATERIAL DESCRIPTION: **9x9 Brown w/Streaks Vinyl Floor Tile**

MATERIAL LOCATION: **Room 328's Vault and Room 227, 1st Floor Corridor**

MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01B		
MATERIAL DESCRIPTION:	9x9 Tan Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Corridor		
MATERIAL QUANTITY:	2320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **01B**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY: **2320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02A		
MATERIAL DESCRIPTION:	12x12 Light Olive Green Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105		
MATERIAL QUANTITY:	2489	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	2025- Room 221 Has Brown carpet (tile might be underneath)		

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **02A**

MATERIAL DESCRIPTION: **12x12 Light Olive Green Vinyl Floor Tile**

MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127, 205, 231, 233, 105**

MATERIAL QUANTITY: **2489** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUILDING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02B		
MATERIAL DESCRIPTION:	12x12 Brown Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS: **2025- Material Abated from Rooms 124 & 207 Winter of 2022. Room 207 has hardwood floor**

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **02B**

MATERIAL DESCRIPTION: **12x12 Brown Vinyl Floor Tile**

MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**

MATERIAL QUANTITY: **14725**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02C		
MATERIAL DESCRIPTION:	12x12 Tan Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS: **2025- Room 122 has Grey & Blue carpet.**

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **02C**

MATERIAL DESCRIPTION: **12x12 Tan Vinyl Floor Tile**

MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213 & 123**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02D		
MATERIAL DESCRIPTION:	12x12 Light Gray Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Library Office, Room 320, 321, 220, 130, PE Office		
MATERIAL QUANTITY:	5715	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **02D**

MATERIAL DESCRIPTION: **12x12 Light Gray Vinyl Floor Tile**

MATERIAL LOCATION: **Main Office, Library Office, Room 320, 321, 220, 130, PE Office**

MATERIAL QUANTITY: **5715** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02E		
MATERIAL DESCRIPTION:	12x12 Dark Green Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 211, 137		
MATERIAL QUANTITY:	1220	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **02E**

MATERIAL DESCRIPTION: **12x12 Dark Green Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 211, 137**

MATERIAL QUANTITY: **1220** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Duct Vibration Sleeve		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Band Room		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Duct Vibration Sleeve**

MATERIAL LOCATION: **Band Room**

MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104		
MATERIAL DESCRIPTION:	Transite Lab tables		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 322, 326, 322 Office, 328		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **104**

MATERIAL DESCRIPTION: **Transite Lab tables**

MATERIAL LOCATION: **Room 322, 326, 322 Office, 328**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	105		
MATERIAL DESCRIPTION:	Transite Panels		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 322 Fume Hood		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

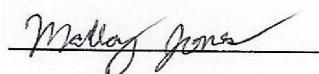

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **105**

MATERIAL DESCRIPTION: **Transite Panels**

MATERIAL LOCATION: **Room 322 Fume Hood**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	106		
MATERIAL DESCRIPTION:	Gray Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 321		
MATERIAL QUANTITY:	1266	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

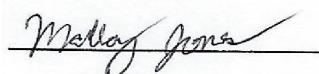

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **Gray Linoleum**

MATERIAL LOCATION: **Room 321**

MATERIAL QUANTITY: **1266** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107		
MATERIAL DESCRIPTION:	Beige Linoleum Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 321		
MATERIAL QUANTITY:	1266	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	2025- Not Observed		

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUILDING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **Beige Linoleum Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 321**

MATERIAL QUANTITY: **1266** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	108		
MATERIAL DESCRIPTION:	Transite Countertop		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 322, 326 & 328		
MATERIAL QUANTITY:	177	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **108**

MATERIAL DESCRIPTION: **Transite Countertop**

MATERIAL LOCATION: **Rooms 322, 326 & 328**

MATERIAL QUANTITY: **177** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109		
MATERIAL DESCRIPTION:	Transite Chalkboards		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Assumed	FRIABLE:	No


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Classrooms		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Damage is located in Rooms 132, 211, 233 & 236		

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **109**

MATERIAL DESCRIPTION: **Transite Chalkboards**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Classrooms**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **23** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair response action is selective to Rooms 132, 211, 233 & 236 Only

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Firewall		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Assembly Hall		
MATERIAL QUANTITY:	12000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUILDING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Firewall**

MATERIAL LOCATION: **Assembly Hall**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14A		
MATERIAL DESCRIPTION:	9x9 Brown Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 328's Vault and Room 227, 1st Floor Corridor		
MATERIAL QUANTITY:	2190	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

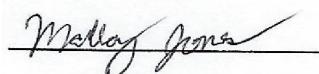

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **14A**

MATERIAL DESCRIPTION: **9x9 Brown Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 328's Vault and Room 227, 1st Floor Corridor**

MATERIAL QUANTITY: **2190** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14B		
MATERIAL DESCRIPTION:	9x9 Tan Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Corridor		
MATERIAL QUANTITY:	2320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

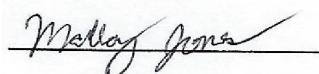

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **14B**

MATERIAL DESCRIPTION: **9x9 Tan Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY: **2320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUILDING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**

MATERIAL DESCRIPTION: **12x12 Light Olive Vinyl Floor Tile Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:


DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: 

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **15A**

MATERIAL DESCRIPTION: **12x12 Light Olive Vinyl Floor Tile Mastic ABATED**

MATERIAL LOCATION: **Kitchen, 315, 221, 211, 235, 206, 127**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUILDING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15B		
MATERIAL DESCRIPTION:	12x12 Brown Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A		
MATERIAL QUANTITY:	14725	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	2025- Material Abated from Room 124 & 207 Winter 2023		

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **15B**

MATERIAL DESCRIPTION: **12x12 Brown Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **2nd, 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 106/106A**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15C		
MATERIAL DESCRIPTION:	12x12 Tan Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **15C**

MATERIAL DESCRIPTION: **12x12 Tan Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **2nd & 3rd Floor Hall, 236, 237, 234, 217, 215, 229, 210, 209, 207, 205, 110, 122, 124, 125, 135, 139, 141, 213, 123**

MATERIAL QUANTITY: **14725** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15D		
MATERIAL DESCRIPTION:	12x12 Light Grey Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Library Office, Rooms 320, 321, 220, 130		
MATERIAL QUANTITY:	5715	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:

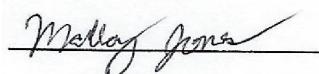

Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **15D**

MATERIAL DESCRIPTION: **12x12 Light Grey Floor Tile Mastic**

MATERIAL LOCATION: **Main Office, Library Office, Rooms 320, 321, 220, 130**

MATERIAL QUANTITY: **5715** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15E		
MATERIAL DESCRIPTION:	12x12 Light Green Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 211, 137		
MATERIAL QUANTITY:	1250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

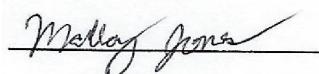

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **15E**

MATERIAL DESCRIPTION: **12x12 Light Green Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 211, 137**

MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16A		
MATERIAL DESCRIPTION:	Gray Linoleum w/Blue Streaks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 222 & 225		
MATERIAL QUANTITY:	5705	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

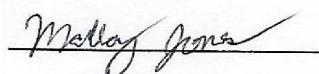

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **16A**

MATERIAL DESCRIPTION: **Gray Linoleum w/Blue Streaks**

MATERIAL LOCATION: **Rooms 222 & 225**

MATERIAL QUANTITY: **5705** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17A		
MATERIAL DESCRIPTION:	Gray Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 222 & 225		
MATERIAL QUANTITY:	5705	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

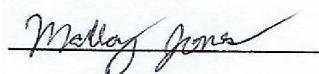

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **17A**

MATERIAL DESCRIPTION: **Gray Linoleum Mastic**

MATERIAL LOCATION: **Rooms 222 & 225**

MATERIAL QUANTITY: **5705** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12"x12" Grey Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 321		
MATERIAL QUANTITY:	660	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **12"x12" Grey Vinyl Floor Tile**

MATERIAL LOCATION: **Room 321**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20M		
MATERIAL DESCRIPTION:	12"x12" Grey Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 321		
MATERIAL QUANTITY:	660	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **20M**

MATERIAL DESCRIPTION: **12"x12" Grey Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 321**

MATERIAL QUANTITY: **660** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	Pipe Fittings		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Warm Air Tunnel and Unfinished Crawlspace		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:

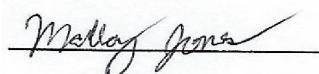

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUILDING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Pipe Fittings**

MATERIAL LOCATION: **Warm Air Tunnel and Unfinished Crawlspace**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: 

Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 23
MATERIAL DESCRIPTION: Plaster
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: 1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **1st, 2nd & 3rd Floors Throughout, Vestibule 12 Stairwell Area**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24A		
MATERIAL DESCRIPTION:	White w/Tan Streaks Flooring		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 221, 211, 235, 206, 127, 322		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **24A**

MATERIAL DESCRIPTION: **White w/Tan Streaks Flooring**

MATERIAL LOCATION: **Rooms 221, 211, 235, 206, 127, 322**

MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24B		
MATERIAL DESCRIPTION:	White w/Tan Streaks Flooring Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 322, 221, 211, 235, 206, 127		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **24B**

MATERIAL DESCRIPTION: **White w/Tan Streaks Flooring Mastic**

MATERIAL LOCATION: **Room 322, 221, 211, 235, 206, 127**

MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: CM-1

MATERIAL DESCRIPTION: Green Carpet Mastic NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: Room 230

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed 2025

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **CM-1**

MATERIAL DESCRIPTION: **Green Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: CM-2

MATERIAL DESCRIPTION: Blue Carpet Mastic

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: Rooms 109, 128, 204

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **CM-2**

MATERIAL DESCRIPTION: **Blue Carpet Mastic**

MATERIAL LOCATION: **Rooms 109, 128, 204**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: CM-3

MATERIAL DESCRIPTION: Red Carpet Mastic

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: No ACBM FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: Social Room, Room 131

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **CM-3**

MATERIAL DESCRIPTION: **Red Carpet Mastic**

MATERIAL LOCATION: **Social Room, Room 131**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-100		
MATERIAL DESCRIPTION:	2'x4' White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hallways and Classrooms		
MATERIAL QUANTITY:	150000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

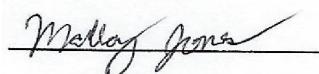

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **HA-100**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**

MATERIAL LOCATION: **Hallways and Classrooms**

MATERIAL QUANTITY: **150000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-101		
MATERIAL DESCRIPTION:	1'x1' White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

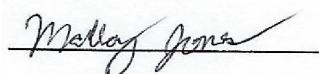

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **HA-101**

MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-102		
MATERIAL DESCRIPTION:	12"x12" White Ceiling Tile Glue		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

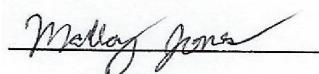

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **HA-102**

MATERIAL DESCRIPTION: **12"x12" White Ceiling Tile Glue**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-103		
MATERIAL DESCRIPTION:	Spray-applied Ceiling Coating		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Pool		
MATERIAL QUANTITY:	7000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

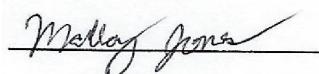

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **HA-103**

MATERIAL DESCRIPTION: **Spray-applied Ceiling Coating**

MATERIAL LOCATION: **Pool**

MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	Boiler Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room		
MATERIAL QUANTITY:	140	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:

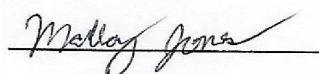

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **Boiler Gasket**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **140** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	Boiler Door Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

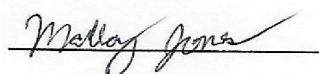

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **Boiler Door Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	NEW		
MATERIAL DESCRIPTION:	Newly Installed Suspect ACM		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/09/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	12x12 Off-White w/Streaks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 321, 322, 325 & 326		
MATERIAL QUANTITY:	3560	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

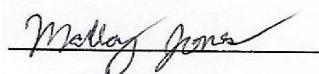

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **12x12 Off-White w/Streaks Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 321, 322, 325 & 326**

MATERIAL QUANTITY: **3560** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	0-1		
MATERIAL DESCRIPTION:	12x12 Off-White w/Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 321, 322, 325, 326		
MATERIAL QUANTITY:	3560	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

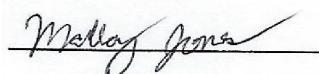

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **O-1**

MATERIAL DESCRIPTION: **12x12 Off-White w/Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 321, 322, 325, 326**

MATERIAL QUANTITY: **3560** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	12x12 White w/Black Streaks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223		
MATERIAL QUANTITY:	9300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

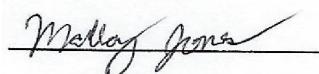

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **12x12 White w/Black Streaks Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223**

MATERIAL QUANTITY: **9300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P-1		
MATERIAL DESCRIPTION:	12x12 White w/Black Streaks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223		
MATERIAL QUANTITY:	9300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

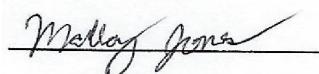

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **P-1**

MATERIAL DESCRIPTION: **12x12 White w/Black Streaks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 210, 209, 206, 235, 232, 234, 237, 236, 141, 230, 227, 223**

MATERIAL QUANTITY: **9300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	12x12 Light Pink (Beige) Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 128/Counsellor's Office		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

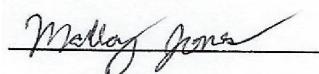

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **12x12 Light Pink (Beige) Vinyl Floor Tile**

MATERIAL LOCATION: **Room 128/Counsellor's Office**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q-1		
MATERIAL DESCRIPTION:	12x12 Light Pink (Beige) Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 128 (Counselor's Office)		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:

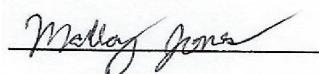

Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Hirsch High School	REVIEW DATE:	6/3/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

HOMOGENEOUS AREA: **Q-1**

MATERIAL DESCRIPTION: **12x12 Light Pink (Beige) Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 128 (Counselor's Office)**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	25			
MATERIAL DESCRIPTION:	12"x12" White Vinyl Floor Tile			
MATERIAL LOCATION:	Rooms 126, 223 & 235			
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF	
MATERIAL CATEGORY:	MISC	FRIABLE:	No	
ASBESTOS TYPE:	Assumed			
DISTURBANCE POTENTIAL:	LOW	CONDITION:		
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage			
ACCESSIBILITY:	Within Reach	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
DAMAGE QUANTITY:	0	DAMAGE REASON:		
COMMENTS:				

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Hirsch High School** REVIEW DATE: **6/3/2025**

ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12"x12" White Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 126, 223 & 235**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	25M				
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" White Vinyl Floor Tile				
MATERIAL LOCATION:	Rooms 126, 223 & 235				
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Hirsch High School** REVIEW DATE: **6/3/2025**

ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **25M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" White Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 126, 223 & 235**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Beige Floor Tile		
MATERIAL LOCATION:	Rooms 124, 206 & 207		
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Hirsch High School** REVIEW DATE: **6/3/2025**

ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile**

MATERIAL LOCATION: **Rooms 124, 206 & 207**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47031	BUIDLING ID:	1380
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mallory Jones		
SCHOOL NAME:	Hirsch High School	INSPECTION DATE:	5/9/2025		
ADDRESS:	7740 S. Ingleside	IDPH LICENSE NO:	100-11070		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	26M				
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" Beige Floor Tile				
MATERIAL LOCATION:	Rooms 124, 206 & 207				
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 05/09/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47031** BUIDLING ID: **1380**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Hirsch High School** REVIEW DATE: **6/3/2025**

ADDRESS: **7740 S. Ingleside** IDPH LICENSE NO: **100-11070**

HOMOGENEOUS AREA: **26M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Beige Floor Tile**

MATERIAL LOCATION: **Rooms 124, 206 & 207**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/03/2025**

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

MALLORY JONES
524 HOMELAND ROAD
MATTESON, IL 60443

3/16/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11070

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11070	ISSUED 3/16/2022	EXPIRES 05/15/2023	SUPERVISOR/WORKER 3/9/2023
MALLORY JONES 524 HOMELAND ROAD MATTESON, IL 60443 Environmental Health		PROJECT MANAGER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	6/5/2022

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MALLORY JONES
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/09/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

03/09/2022

Course Dates:

03/09/2023

Expires:

2203BIR06

Certificate Number:

Director of Training

Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

MALLORY JONES
524 HOMELAND ROAD
MATTESON, IL 60443

3/23/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11070

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

Front of License		Back of License	
 ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS SUPERVISOR/WORKER INSPECTOR	TC EXPIRES 5/31/2024 3/9/2025
ID NUMBER 100 - 11070	ISSUED 3/23/2024	EXPIRES 05/15/2025	PROJECT MANAGER AIR SAMPLING PROFESSIONAL
MALLORY JONES 524 HOMELAND ROAD MATTESON, IL 60443 Environmental Health		Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

MALLORY JONES
524 HOMELAND ROAD
MATTESON, IL 60443

3/7/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11070

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11070	ISSUED 3/7/2025	EXPIRES 05/15/2026	SUPERVISOR/WORKER INSPECTOR	5/29/2025 3/9/2025
MALLORY JONES 524 HOMELAND ROAD MATTESON, IL 60443 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	5/29/2025
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MALLORY L. JONES has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the examination on 03/19/2025 with a minimum score of 70% or better. Training was in accordance with U.S.E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

Course Dates: 03/19/2025
Expires: 03/19/2026
Certificate Number: 2503BIR04

Phone: 312-491-0081

Director of Training
Nicholas J. Penef
Doctor of Public Health

FORM # A-010B

A handwritten signature in black ink that appears to read "Nicholas J. Penef".



TEM ENVIRONMENTAL, INC.
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 03613

ISSUED
3/1/2022

EXPIRES
05/15/2023

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

INSPECTOR

TC EXPIRES

11/19/2022

MANAGEMENT PLANNER

11/19/2022

PROJECT MANAGER

11/1/2022

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2021

Exam Date: 11/19/2021

Expiration Date: 11/19/2022

Certificate Number: BIR2111192805

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2021

Exam Date: 11/19/2021

Expiration Date: 11/19/2022

Certificate Number: MPR2111192816

A handwritten signature in black ink that reads 'Kathy DeSalvo'.

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

4/3/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 03613

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

Front of License		Back of License	
	ASBESTOS PROFESSIONAL LICENSE	ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 03613	ISSUED 4/3/2024	EXPIRES 05/15/2025	INSPECTOR 11/3/2024
DANIEL J JUNEAU 1408 OAKWOOD AVENUE DES PLAINES, IL 60016 Environmental Health			MANAGEMENT PLANNER 11/3/2024 PROJECT MANAGER 11/7/2024 AIR SAMPLING PROFESSIONAL
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

5/8/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 03613

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License


Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 03613	ISSUED 5/8/2025	EXPIRES 05/15/2026	INSPECTOR	11/1/2025
DANIEL J JUNEAU 1408 OAKWOOD AVENUE DES PLAINES, IL 60016 Environmental Health			MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	11/1/2025 11/13/2025
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

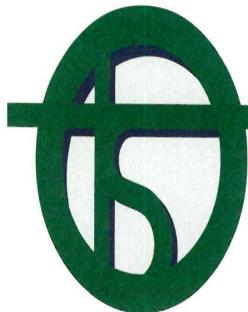

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/12/2022

Exam Date: 12/12/2022

Expiration Date: 12/12/2023

Certificate Number: MPR2212123967

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113645



Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2024

Exam Date: 11/1/2024

Expiration Date: 11/1/2025

Certificate Number: BIR2411013089

Course Credit Hours: BIR 4 Hours

A handwritten signature in blue ink that appears to read "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | www.otssafety.com

2024

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2024

Exam Date: 11/1/2024

Expiration Date: 11/1/2025

Certificate Number: MPR2411013107

Course Credit Hours: MPR 4 Hours

A handwritten signature in blue ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed