

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0016
SCHOOL NAME: Harlan Academy High School
ADDRESS OF SCHOOL: 9652 S. Michigan
CITY: Chicago, IL, 60628

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 8/19/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/28/2025 ENROLLMENT 174
IDPH INSPECTOR LICENSE NUMBER: 100-02950
IDPH LICENSED INSPECTOR NAME (Please Print): Keith Clough
IDPH MP LICENSE NUMBER: 100-01784
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Steven Geneser

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 6/13/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Harlan Academy High School

9652 S. Michigan
Chicago, IL, 60628

Unit: 51021
Building ID: 1350

IDPH ID Number: 14-016-2990-0016

REPORT DATE:
Friday, June 13, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
TEM Environmental, Inc.

174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone 630-790-0880
Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

06/12/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 51021 Region: 06 IDPH ID: 14-016-2990-0016

School: Harlan Academy High School Building ID: 1350

Address: 9652 S. Michigan

Chicago, IL, 60628

Building Contact: Verdi, Noel Contact Phone: 3123307847

Current Building Owners: Chicago Public Schools


Reinspection Date: 5/28/2025

Review Date: 06/12/2025

Inspector: Keith Clough Inspector IDPH License: 100-02950
Management Planner: Steven Geneser Management Planner IDPH License: 100-01784

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

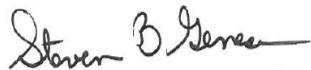

Steven Geneser
100-01784

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: June 13, 2025

RE: Harlan Academy High School, Unit 51021
9652 S. Michigan
Chicago, IL, 60628

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Harlan Academy High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Harlan Academy High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Harlan Academy High School
Address: 9652 S. Michigan IDPH ID: 14-016-2990-0016
Contact: Verdi, Noel

Unit: 51021 Chicago, IL, 60628
Building ID: 1350
Phone: 3123307847

Region: 06

2. Description of Facility

Original Construction: 1957
Total Square Footage: 152196
Current Occupancy: 174

Additional Construction: 1968
No of Floors: 2

3. LEA Designated Person

Contact: Richard J.Schleyer
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 251-7074

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Phone: 630-790-0880

Fax: 630-790-0882

5. Inspector

Inspector Name: Keith Clough

Inspector IDPH license # 100-02950
Reinspection Date: 5/28/2025




Signature:
Date: 5/28/2025

6. Management Planner

Management Planner Name: Steven Geneser

Management Planner IDPH license # 100-01784




Signature:
Date: 06/12/2025

7. Review Date: 06/12/2025

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 6/13/2025

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Harlan Academy High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1350:

81	12"x12" Grey & Brown Floor Tile
81M	Mastic associated w/12"x12" Grey & Brown Floor Tile
82	12"x12" Light Blue Floor Tile
82M	Mastic associated w/12"x12" Light Blue Floor Tile
NEW	Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 1350:

81	12"x12" Grey & Brown Floor Tile
81M	Mastic associated w/12"x12" Grey & Brown Floor Tile
82	12"x12" Light Blue Floor Tile
82M	Mastic associated w/12"x12" Light Blue Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02	Hard Plaster
03	1'x1' Ceiling Tile
04C	12x12 Multicolor Dark Beige Floor Tile
04J	12x12 Taupe w/Brown & White Specks Floor Tile
04K	12x12 Multicolor Cream Floor Tile
07E	12x12 Cream w/Brown Specks Floor Tile Mastic
07G	Mastic -12x12 Beige w/Brown & White Streaks Floor Tile
07H	12x12 Crème w/Tan & White Streaks Floor Tile Mastic
08	1x1 Ceiling Tile Mastic
09	Drywall (Gypsum Board)
10	1x2 Ceiling Tile REMOVED
11A	Gray Baseboard
11B	Black Baseboard
11C	Cream Baseboard
12A	Gray Baseboard Mastic
12B	Black Baseboard Mastic
12C	Cream Baseboard Mastic
13	Yellow Sheet Goods Mastic
13A	Light Grey Linoleum
13C	Black with Gray Linoleum
14A	Light Grey Linoleum Mastic
14C	Black with Gray Linoleum Mastic
15A	Blue Carpet Mastic
15B	Burgundy Carpet Mastic
15P	12x12 Black w/Maroon Checkerboard Vinyl Floor Tile
16	Wood Panel Mastic REMOVED
18	2x4 Ceiling Tile
19	Drywall
25	12x12 Dark Blue Floor Tile
25C	12x12 Tan w/Streaks Vinyl Floor Tile
25D	12x12 Tan w/Streaks Vinyl Floor Tile Mastic
25M	12x12 Dark Blue Floor Tile Mastic
26	12x12 White w/Beige Streaks Floor Tile
26M	12x12 White w/ Beige Streaks Floor Tile Mastic
27	12x12 Brown and White Floor Tile
27M	12x12 Brown and White Floor Tile Mastic
28	2'x4' White Fissured Ceiling Tiles
29	12x12 Red Floor Tile (Duplicate- HA61)
30	12x12 Red Floor Tile Mastic (Duplicate- HA61M)

31	12x12 Blue Floor Tile (Duplicate- HA60)
32	12x12 Blue Floor Tile Mastic (Duplicate- HA60M)
33	12x12 White Floor Tile (Duplicate HA62)
34	12x12 White Floor Tile Mastic (Duplicate- HA62M)
35	12x12 Dark Blue Floor Tile
36	12x12 Dark Blue Floor Tile Mastic
37	12x12 Sky Blue Floor Tile
38	12x12 Sky Blue Floor Tile Mastic
39	22"x22" White Floor Tile
40	22"x22" White Floor Tile Mastic
41	22"x22" Light Blue Floor tile
42	22"x22" Light Blue Floor Tile Mastic
43	22"x22" Dark Blue Floor Tile
44	22"x22" Dark Blue Floor Tile Mastic
45	22"x22" Orange Floor Tile
46	22"x22" Orange Floor Tile Mastic
47	2'x2' Ceiling Tile
48	12"x12" H Blue Mix Speckled Vinyl Floor Tile
48M	12"x12" H Blue Mix Speckled Vinyl Floor Tile Mastic
49	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile
49M	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile Mastic
50	2'x4' Grooved Ceiling Tile
51	12x12 Cream w/Beige Specks Vinyl Floor Tile
51M	12x12 Cream w/Beige Specks Vinyl Floor Tile Mastic
52	12x12 Tan w/Cream Specks Vinyl Floor Tile
52M	12x12 Tan w/Cream Specks Mastic
53	Blue Baseboard Mastic
54	12x12 Brown Mixed Speckled Vinyl Floor Tile
54M	12x12 Brown Mixed Speckled Vinyl Floor Tile Mastic
55	12x12 Baby Blue Vinyl Floor Tile
55M	12x12 Baby Blue Vinyl Floor Tile Mastic
56	2'x4' Ceiling Tile
58	Lab Counter Tops Vinyl Floor Tile
59	Fume Hoods
60	12x12 Teal Mix Speckled Vinyl Floor Tile
60A	Linoleum Mastic
60M	12x12 Teal Mix Speckled Vinyl Floor Tile Mastic
61	12x12 Salmon (Pink) Mix Speckled Vinyl Floor Tile
61M	12x12 Salmon (Pink) Vinyl Floor Tile Mastic
62	12x12 White w/Green Specks Vinyl Floor Tile
62M	12x12 White w/Green Specks Vinyl Floor Tile Mastic
63	12x12 H Gray Mixed Speckled Vinyl Floor Tile
63M	12x12 H Gray Mixed Speckled Vinyl Floor Tile

	Mastic
64	Orange Linoleum
64M	Orange Linoleum Mastic
65	White Linoleum
65M	White Linoleum Mastic
66	Blue Linoleum
66M	Blue Linoleum Mastic
67	12x12 Beige Mixed Speckled Vinyl Floor Tile
67M	12x12 Beige Mixed Speckled Vinyl Floor Tile Mastic
68	12x12 White w/Black Specks Vinyl Floor Tile
68M	12x12 White w/Black Specks Vinyl Floor Tile Mastic
70M	9x9 Grey Vinyl Floor Tile Mastic
71	12"x12" Blue Mottled Vinyl Floor Tile
72	12"x12" Blue Mottled Vinyl Floor Tile Mastic
73	12"x12" White w/Brown Specks Vinyl Floor Tile
74	12"x12" White w/Brown Specks Vinyl Floor Tile Mastic
75	12"x12" Royal Blue Mottled Vinyl Floor Tile
76	12"x12" Royal Blue Mottled Vinyl Floor Tile Mastic
77	2'x2' Gray w/White Specks Vinyl Floor Tile
78	2'x2' Gray w/White Specks Vinyl Floor Tile Mastic
79	2'x2' Blue w/Tan Specks Vinyl Floor Tile
80	2'x2' Blue w/Tan Specks Vinyl Floor Tile Mastic
81	12"x12" Grey & Brown Floor Tile
81M	Mastic associated w/12"x12" Grey & Brown Floor Tile
82	12"x12" Light Blue Floor Tile
82M	Mastic associated w/12"x12" Light Blue Floor Tile
E	Insulation in Fire Rated Doors
G	MJV on Fiberglass Pipe Insulation
H	Vibration Collars
HA-100	2'x4' Plain White Ceiling Tile
HA-101	2'x4' White Ceiling Tile w/Grooves and Pinholes
HA-103	2'x4' White Ceiling Tile w/Random Fissures
HA-104	2'x4' White Ceiling Tile with Regular Holes
HA-105	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile
HA-105M	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile Mastic
HA-106	12"x12" Off-White w/Beige Specks Floor Tile
HA-106/107m	12"x12" Off-White and Brown Floor Tile Mastic
HA-107	12"X12" Brown with Specks Floor Tile
HA-108	Red Carpet Adhesive
HA-109	Gray Carpet Adhesive
HA-110	4" Black Baseboard

HA-110M	4" Black Baseboard Adhesive
HA-111	Hard Joint Mudded Fittings on Fiberglass Insulated Pipe
I	12x12 Light Blue Floor Tile (Duplicate of HA 37)
J	12x12 Dark Blue Floor Tile (Duplicate of HA 35)
M	12x12 Light Blue Floor Tile Mastic (Duplicate of HA 38)
N	12x12 Dark Blue Floor Tile Mastic (Duplicate of HA 36)
NEW	Newly Installed Suspect ACM
O	1x1 Slotted Acoustical Ceiling Tile
P	1x1 Slotted Acoustical Ceiling Tile Adhesive

The following areas were deemed to be inaccessible:

06B	9x9 Beige w/Brown Streaks Floor Tile Mastic
07A	12x12 Various Shades of Beige Floor Tile Mastic NOT OBSERVED
07C	12x12 Multicolor Dark Beige Floor Tile Mastic
07J	12x12 Taupe w/Brown & White Specks Floor Tile Mastic
08	1x1 Ceiling Tile Mastic
12A	Gray Baseboard Mastic
12B	Black Baseboard Mastic
12C	Cream Baseboard Mastic
13	Yellow Sheet Goods Mastic
14A	Light Grey Linoleum Mastic
14C	Black with Gray Linoleum Mastic
15A	Blue Carpet Mastic
15B	Burgundy Carpet Mastic
18	2x4 Ceiling Tile
25D	12x12 Tan w/Streaks Vinyl Floor Tile Mastic
25M	12x12 Dark Blue Floor Tile Mastic
26M	12x12 White w/ Beige Streaks Floor Tile Mastic
27M	12x12 Brown and White Floor Tile Mastic
36	12x12 Dark Blue Floor Tile Mastic
38	12x12 Sky Blue Floor Tile Mastic
40	22"x22" White Floor Tile Mastic
42	22"x22" Light Blue Floor Tile Mastic
44	22"x22" Dark Blue Floor Tile Mastic
46	22"x22" Orange Floor Tile Mastic
48M	12"x12" H Blue Mix Speckled Vinyl Floor Tile Mastic
49M	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile Mastic
51M	12x12 Cream w/Beige Specks Vinyl Floor Tile

	Mastic
52M	12x12 Tan w/Cream Specks Mastic
53	Blue Baseboard Mastic
54M	12x12 Brown Mixed Speckled Vinyl Floor Tile Mastic
55M	12x12 Baby Blue Vinyl Floor Tile Mastic
56	2'x4' Ceiling Tile
60A	Linoleum Mastic
60M	12x12 Teal Mix Speckled Vinyl Floor Tile Mastic
61M	12x12 Salmon (Pink) Vinyl Floor Tile Mastic
62M	12x12 White w/Green Specks Vinyl Floor Tile Mastic
63M	12x12 H Gray Mixed Speckled Vinyl Floor Tile Mastic
64M	Orange Linoleum Mastic
65M	White Linoleum Mastic
66M	Blue Linoleum Mastic
67M	12x12 Beige Mixed Speckled Vinyl Floor Tile Mastic
68M	12x12 White w/Black Specks Vinyl Floor Tile Mastic
69M	9x9 Peach Vinyl Floor Tile Mastic
70M	9x9 Grey Vinyl Floor Tile Mastic
72	12"x12" Blue Mottled Vinyl Floor Tile Mastic
74	12"x12" White w/Brown Specks Vinyl Floor Tile Mastic
76	12"x12" Royal Blue Mottled Vinyl Floor Tile Mastic
78	2'x2' Gray w/White Specks Vinyl Floor Tile Mastic
80	2'x2' Blue w/Tan Specks Vinyl Floor Tile Mastic
HA-105M	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile Mastic
HA-106/107m	12"x12" Off-White and Brown Floor Tile Mastic
HA-108	Red Carpet Adhesive
HA-109	Gray Carpet Adhesive
HA-110M	4" Black Baseboard Adhesive
O	1x1 Slotted Acoustical Ceiling Tile
P	1x1 Slotted Acoustical Ceiling Tile Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Keith Clough, IDPH License # 100-02950. The Management Plan was updated by Steven Geneser, IDPH License # 100-01784. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 4/26/2023
 1/3/2025

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Harlan Academy High School Building 1350 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Acoustical Ceiling Plaster	9,000	SF	Auditorium	CHR	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
02	Hard Plaster	108,000	SF	Throughout Facility	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
03	1'x1' Ceiling Tile	120,000	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
04A	12x12 Various Shades of Beige Floor Tile ABATED			1st Floor West Exit & Corridor, SW Exits, NE Corridor & Men's Washroom (1st Floor), Swimming Pool Corridor	ABATED	MISC								LOW
04B	12x12 Various Shades of Tan Floor Tile ABATED			Corridor outside Room 134, Water Fountain, outside Room 124 & 126 patchwork	ABATED	MISC								LOW
04C	12x12 Multicolor Dark Beige Floor Tile	1,920	SF	Rooms 220 and 222	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04D	12x12 Light Blue Floor Tile ABATED			Room 134	ABATED	MISC								
04E	12x12 Cream w/Brown Specks Floor Tile	7,120	SF	Rooms 115A, 116, 117, 117B, 119, 124, 126, 133, 134, 135, 138A, 139, 210, 211, 213, 217, 218A, Girls Locker Room Office.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04F	12x12 Grey (Dark Tan) w/White Streaks Floor Tile REMOVED			2nd Floor Corridor	CHR	MISC								
04G	12x12 Beige w/Brown & White Streaks Floor Tile	16,000	SF	Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies' Restroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04H	12x12 Crème w/Tan & White Streaks Floor Tile	7,050	SF	Faculty Dining Room & Cafeteria, Ladies' Restroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04I	12x12 Beige w/White Specks Floor Tile ABATED			1st Floor SE Exit	ABATED	MISC								
04J	12x12 Taupe w/Brown & White Specks Floor Tile	216	SF	Room 212	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04K	12x12 Multicolor Cream Floor Tile	2,108	SF	Rooms 220 and 222	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05A	9x9 Tan w/White Streaks Vinyl Floor Tile	4,560	SF	Rooms 224, 229, 230, 242, 216, 121, 123 and Office Vault	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05B	9x9 Beige w/Brown Streaks Floor Tile	1,500	SF	Rooms 135 and 136	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06A	9x9 Tan w/White Streaks Floor Tile Mastic	3,500	SF	Rooms 230, 229, 230, 242, 216, 121, 123, 224, Office Vault	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06B	9x9 Beige w/Brown Streaks Floor Tile Mastic	1,000	SF	Rooms 135 and 136	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07A	12x12 Various Shades of Beige Floor Tile Mastic NOT OBSERVED	2,081	SF	1st Floor West Exit & Corridor, SW Exits, NE Corridor & 1st Floor Men's Washroom, Swimming Pool Corridor	CHR	MISC								
07B	12x12 Various Shades of Tan Floor Tile Mastic NOT OBSERVED			Corridor Outside Room 134, Water Fountain, Outside Room 124 & 126 Patchwork	CHR	MISC								
07C	12x12 Multicolor Dark Beige Floor Tile Mastic	1,920	SF	Rooms 220 and 222	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07D	12x12 Light Blue Floor Tile Mastic ABATED			Room 134	ABATED	MISC								
07E	12x12 Cream w/Brown Specks Floor Tile Mastic	7,120	SF	Rooms 115A, 117, 117B, 119, 133, 135, 138A, 139, 210, 211, 213, 218A and Girls' Locker Room Office.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07F	12x12 Grey (Dark Tan) w/White Streaks Floor Tile Mastic ABATED			2nd Floor Corridor	ABATED	MISC								
07G	Mastic -12x12 Beige w/Brown & White Streaks Floor Tile	17,020	SF	Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07H	12x12 Crème w/Tan & White Streaks Floor Tile Mastic	7,050	SF	Faculty Dining Room & Cafeteria,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Ladies' Restroom										
07I	12x12 Beige w/White Specks Floor Tile Mastic ABATED			1st Floor SE Exit	ABATED	MISC								
07J	12x12 Taupe w/Brown & White Specks Floor Tile Mastic	216	SF	Room 212	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07K	12x12 Multicolor Cream Mastic Floor Tile	2,108	SF	Rooms 220 and 222	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	1x1 Ceiling Tile Mastic	120,000	SF	1st & 2nd Floor Corridors & Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	Drywall (Gypsum Board)	120,000	SF	Above 1x1 Ceiling Tile	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	1x2 Ceiling Tile REMOVED			Boys' Gym	ASSUMED	MISC								
11A	Gray Baseboard	195	LF	Room 109 & 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11B	Black Baseboard	680	LF	Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11C	Cream Baseboard	142	LF	Rooms 106 and 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12A	Gray Baseboard Mastic	195	LF	Room 109 & 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12B	Black Baseboard Mastic	680	LF	Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12C	Cream Baseboard Mastic	142	LF	Rooms 106 and 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Yellow Sheet Goods Mastic	208	SF	Counter Tops, Rooms 109, 103, 105	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13A	Light Grey Linoleum	3,300	SF	Room 109 and 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13C	Black with Gray Linoleum	840	SF	Rooms 106 & 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14A	Light Grey Linoleum Mastic	3,300	SF	Rooms 109 & 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14C	Black with Gray Linoleum Mastic	840	SF	Rooms 106 & 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15A	Blue Carpet Mastic	4,800	SF	Attendance Office & Surrounding Offices, Assistant Principal's Office, Corridor,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Offices D, E, F, H; Main Office, Principal's Office, Girls' Locker Room Office, Room 131										
15B	Burgundy Carpet Mastic	80	SF	Boys' Locker Room and Coach's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15P	12x12 Black w/Maroon Checkerboard Vinyl Floor Tile	1,390	SF	Room 217 Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Wood Panel Mastic REMOVED			Room 124	ASSUMED	MISC								
17	Interior Window Glazing ABATED			Throughout 1st & 2nd Floor	ABATED	MISC								
17A	Interior Window Glazing ABATED			Throughout 1st & 2nd Floor	ABATED	MISC								
18	2x4 Ceiling Tile	840	SF	Room 108	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
19	Drywall	400	SF	Room 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Transite Countertops ABATED			Room 108	ABATED	MISC								
25	12x12 Dark Blue Floor Tile	4,960	SF	Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25C	12x12 Tan w/Streaks Vinyl Floor Tile	700	SF	Room 215	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25D	12x12 Tan w/Streaks Vinyl Floor Tile Mastic	700	SF	Room 215	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25M	12x12 Dark Blue Floor Tile Mastic	4,960	SF	Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12x12 White w/Beige Streaks Floor Tile	12,000	SF	Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, Lunchroom and Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26M	12x12 White w/ Beige Streaks Floor Tile Mastic	12,000	SF	Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, and Library, and lunchroom										
27	12x12 Brown and White Floor Tile	1,500	SF	Hallway in Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27M	12x12 Brown and White Floor Tile Mastic	1,500	SF	Hallway in Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	2'x4' White Fissured Ceiling Tiles	5,000	SF	Hallway and Classrooms Throughout Modular Building	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
29	12x12 Red Floor Tile (Duplicate- HA61)			Rooms 112	ASSUMED	MISC								
30	12x12 Red Floor Tile Mastic (Duplicate- HA61M)			Rooms 112	ASSUMED	MISC								
31	12x12 Blue Floor Tile (Duplicate- HA60)			Rooms 112	ASSUMED	MISC								
32	12x12 Blue Floor Tile Mastic (Duplicate- HA60M)			Rooms 112	ASSUMED	MISC								
33	12x12 White Floor Tile (Duplicate HA62)			Rooms 112	ASSUMED	MISC								
34	12x12 White Floor Tile Mastic (Duplicate- HA62M)			Rooms 112 and 114	ASSUMED	MISC								
35	12x12 Dark Blue Floor Tile	12,000	SF	Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12x12 Dark Blue Floor Tile Mastic	12,000	SF	Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12x12 Sky Blue Floor Tile	10,500	SF	Corridors and Room 138A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12x12 Sky Blue Floor Tile Mastic	10,500	SF	Corridors and Room 138A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	22"x22" White Floor Tile	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	22"x22" White Floor Tile Mastic	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	22"x22" Light Blue Floor tile	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	22"x22" Light Blue Floor Tile Mastic	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	22"x22" Dark Blue Floor Tile	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
44	22"x22" Dark Blue Floor Tile Mastic	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	22"x22" Orange Floor Tile	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	22"x22" Orange Floor Tile Mastic	5,000	SF	Main Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	2'x2' Ceiling Tile	5,000	SF	Main Hall	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
48	12"x12" H Blue Mix Speckled Vinyl Floor Tile	3,300	SF	Annex Building-Throughout Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48M	12"x12" H Blue Mix Speckled Vinyl Floor Tile Mastic	3,300	SF	Annex Building-Throughout Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile	3,300	SF	Annex- Throughout Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49M	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile Mastic	3,300	SF	Annex- Throughout Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	2'x4' Grooved Ceiling Tile	5,000	SF	Throughout Annex	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
51	12x12 Cream w/Beige Specks Vinyl Floor Tile	800	SF	Annex- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51M	12x12 Cream w/Beige Specks Vinyl Floor Tile Mastic	800	SF	Annex- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	12x12 Tan w/Cream Specks Vinyl Floor Tile	800	SF	Annex- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52M	12x12 Tan w/Cream Specks Mastic	800	SF	Annex- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	Blue Baseboard Mastic	1,000	SF	Annex- Throughout Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12x12 Brown Mixed Speckled Vinyl Floor Tile	200	SF	Boys & Girls Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54M	12x12 Brown Mixed Speckled Vinyl Floor Tile Mastic	200	SF	Boys & Girls' Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12x12 Baby Blue Vinyl Floor Tile	500	SF	Room 138	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55M	12x12 Baby Blue Vinyl Floor Tile Mastic	500	SF	Room 138	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	2'x4' Ceiling Tile	560	SF	Rooms 137 and 138	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
57	Tan Linoleum ABATED			Room 104	ABATED	MISC								
57M	Tan Linoleum Mastic ABATED			Room 104	ABATED	MISC								
58	Lab Counter Tops Vinyl Floor Tile	2,000	SF	Rooms 104, 106, 107, 109, 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	Fume Hoods	40	SF	Room 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	12x12 Teal Mix Speckled Vinyl Floor Tile	200	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60A	Linoleum Mastic	800	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60M	12x12 Teal Mix Speckled Vinyl Floor Tile Mastic	200	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	12x12 Salmon (Pink) Mix Speckled Vinyl Floor Tile	200	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61M	12x12 Salmon (Pink) Vinyl Floor Tile Mastic	200	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	12x12 White w/Green Specks Vinyl Floor Tile	200	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62M	12x12 White w/Green Specks Vinyl Floor Tile Mastic	200	SF	Room 112	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	12x12 H Gray Mixed Speckled Vinyl Floor Tile	600	SF	Rooms 113 & 118	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63M	12x12 H Gray Mixed Speckled Vinyl Floor Tile Mastic	600	SF	Rooms 113 & 118	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	Orange Linoleum	300	SF	Rooms 114, 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64M	Orange Linoleum Mastic	300	SF	Rooms 114, 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	White Linoleum	1,320	SF	Rooms 107, 114 & 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65M	White Linoleum Mastic	1,320	SF	Rooms 107, 114 & 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
66	Blue Linoleum	300	SF	Rooms 114 & 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
66M	Blue Linoleum Mastic	300	SF	Rooms 114 & 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	12x12 Beige Mixed Speckled Vinyl Floor Tile	2,000	SF	Rooms 204, 206, 239, Kitchen & Locker Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67M	12x12 Beige Mixed Speckled Vinyl Floor Tile Mastic	2,000	SF	Rooms 204, 206, 239, Kitchen & Locker Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	12x12 White w/Black Specks Vinyl Floor Tile	160	SF	Elevator Vestibule & Engineering	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Office										
68M	12x12 White w/Black Specks Vinyl Floor Tile Mastic	160	SF	Elevator Vestibule & Engineering Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	9x9 Peach Vinyl Floor Tile	566	SF	Room 120	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69M	9x9 Peach Vinyl Floor Tile Mastic	566	SF	Room 120	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70	9x9 Grey Vinyl Floor Tile	284	SF	Room 120	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70M	9x9 Grey Vinyl Floor Tile Mastic	284	SF	Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	12"x12" Blue Mottled Vinyl Floor Tile	600	SF	Room 120 & 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
72	12"x12" Blue Mottled Vinyl Floor Tile Mastic	600	SF	Rooms 120 & 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	12"x12" White w/Brown Specks Vinyl Floor Tile	900	SF	Rooms 120 & 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
74	12"x12" White w/Brown Specks Vinyl Floor Tile Mastic	900	SF	Rooms 120 & 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
75	12"x12" Royal Blue Mottled Vinyl Floor Tile	600	SF	Rooms 120 & 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
76	12"x12" Royal Blue Mottled Vinyl Floor Tile Mastic	600	SF	Rooms 120 & 131	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
77	2'x2' Gray w/White Specks Vinyl Floor Tile	700	SF	Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
78	2'x2' Gray w/White Specks Vinyl Floor Tile Mastic	700	SF	Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
79	2'x2' Blue w/Tan Specks Vinyl Floor Tile	235	SF	Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
80	2'x2' Blue w/Tan Specks Vinyl Floor Tile Mastic	235	SF	Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
81	12"x12" Grey & Brown Floor Tile	573	SF	Room 121	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
81M	Mastic associated w/12"x12" Grey & Brown Floor Tile	573	SF	Room 121	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
82	12"x12" Light Blue Floor Tile	619	SF	Room 230	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
82M	Mastic associated w/12"x12" Light Blue Floor Tile	619	SF	Room 230	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
E	Insulation in Fire Rated Doors	240	SF	At Fire Stops Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	MJV on Fiberglass Pipe Insulation	698	LF	Throughout Basement Crawl	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Space								suspect ACBM		
H	Vibration Collars	5	SF	Basement Boiler Room	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-100	2'x4' Plain White Ceiling Tile	150	SF	1st Floor Boys' Restroom	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-101	2'x4' White Ceiling Tile w/Grooves and Pinholes	7,000	SF	Classrooms	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-102	Acoustical "Pop Corn" Plaster	9,000	SF	Auditorium	CHR	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-103	2'x4' White Ceiling Tile w/Random Fissures	1,800	SF	Classroom, Corridor, Men's Room	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-104	2'x4' White Ceiling Tile with Regular Holes	200	SF	Ladies Room	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
HA-105	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile	400	SF	Restrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-105M	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile Mastic	400	SF	Restrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-106	12"x12" Off-White w/Beige Specks Floor Tile	500	SF	Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-106/107 m	12"x12" Off-White and Brown Floor Tile Mastic	1,000	SF	Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-107	12"X12" Brown with Specks Floor Tile	500	SF	Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-108	Red Carpet Adhesive	3,000	SF	Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-109	Gray Carpet Adhesive	3,000	SF	Rooms 102A, 224A, Attendance Office, 131A, 130, Auditorium, Main Office, Assistant Principals Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-110	4" Black Baseboard	5,000	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-110M	4" Black Baseboard Adhesive	5,000	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-111	Hard Joint Mudded Fittings on Fiberglass Insulated Pipe	4	LF	Utility Sink Room by the Water Heater	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
I	12x12 Light Blue Floor Tile (Duplicate of HA 37)			1st & 2nd Floor Corridors	ASSUMED	MISC								
J	12x12 Dark Blue Floor Tile (Duplicate of HA 35)			1st & 2nd Floor Corridors	ASSUMED	MISC								
K	Brown Linoleum ABATED			Rooms 104 and 104A	ABATED	MISC								
L	Brown Linoleum Mastic ABATED			Rooms 104 and 104A	ABATED	MISC								
M	12x12 Light Blue Floor Tile Mastic (Duplicate of HA 38)			1st & 2nd Floor Corridor	ASSUMED	MISC								
N	12x12 Dark Blue Floor Tile Mastic (Duplicate of HA 36)			1st & 2nd Floor Corridors	ASSUMED	MISC								
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKWN			Yes	ACBM with the potential for damage		
O	1x1 Slotted Acoustical Ceiling Tile	800	SF	Boys' & Girls' Gym	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
P	1x1 Slotted Acoustical Ceiling Tile Adhesive	800	SF	Boys' & Girls' Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date	<u>5/28/2025</u>
Inspector Name	<u>Keith Clough</u>
100-02950	5/15/2026
Inspector's IDPH License Number / Expiration Date	

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04A	
04B	
04C	
04D	
04E	
04F	
04G	
04H	
04I	
04J	
04K	
05A	
05B	
06A	2025- Floor Tile & Mastic removed from Room 230, January 2025. New HA assigned
06B	
07A	Not Observed Multiple Years
07B	Not Observed Multiple Years
07C	
07D	
07E	
07F	

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
07G	
07H	
07I	
07J	
07K	
08	
09	
10	
11A	
11B	
11C	
12A	
12B	
12C	
13	
13A	
13C	
14A	
14C	
15A	
15B	
15P	
16	
17	
17A	
18	
19	
20	
25	

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
25C	
25D	
25M	
26	
26M	
27	
27M	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
48M	

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
49	
49M	
50	
51	
51M	
52	
52M	
53	
54	
54M	
55	
55M	
56	
57	
57M	
58	
59	
60	
60A	
60M	
61	
61M	
62	
62M	
63	
63M	
64	
64M	
65	

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
65M	
66	
66M	
67	
67M	
68	
68M	
69	
69M	
70	
70M	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
81M	
82	
82M	
E	
G	
H	
HA-100	

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
HA-101	
HA-102	
HA-103	
HA-104	
HA-105	
HA-105M	
HA-106	
HA-106/107m	
HA-107	
HA-108	
HA-109	
HA-110	
HA-110M	
HA-111	
I	
J	
K	
L	
M	
N	
NEW	
O	
P	

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive
Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Table II
Management Planner's Review

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Acoustical Ceiling Plaster	9,000	SF	Auditorium	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
02	Hard Plaster	108,000	SF	Throughout Facility	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	1'x1' Ceiling Tile	120,000	SF	Throughout Facility	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
04A	12x12 Various Shades of Beige Floor Tile ABATED			1st Floor West Exit & Corridor, SW Exits, NE Corridor & Men's Washroom (1st Floor), Swimming Pool Corridor	Abated	MISC					
04B	12x12 Various Shades of Tan Floor Tile ABATED			Corridor outside Room 134, Water Fountain, outside Room 124 & 126 patchwork	Abated	MISC					
04C	12x12 Multicolor Dark Beige Floor Tile	1,920	SF	Rooms 220 and 222	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04D	12x12 Light Blue Floor Tile ABATED			Room 134	Abated	MISC					
04E	12x12 Cream w/Brown Specks Floor Tile	7,120	SF	Rooms 115A, 116, 117, 117B, 119, 124, 126, 133, 134, 135, 138A, 139, 210, 211, 213, 217, 218A, Girls Locker Room Office.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04F	12x12 Grey (Dark Tan) w/White Streaks Floor Tile REMOVED			2nd Floor Corridor	Chrysotile	MISC					
04G	12x12 Beige w/Brown & White Streaks Floor Tile	16,000	SF	Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies' Restroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04H	12x12 Crème w/Tan & White Streaks Floor Tile	7,050	SF	Faculty Dining Room & Cafeteria, Ladies' Restroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04I	12x12 Beige w/White Specks Floor Tile ABATED			1st Floor SE Exit	Abated	MISC					
04J	12x12 Taupe w/Brown & White Specks Floor Tile	216	SF	Room 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04K	12x12 Multicolor Cream Floor Tile	2,108	SF	Rooms 220 and 222	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A	9x9 Tan w/White Streaks Vinyl Floor Tile	4,560	SF	Rooms 224, 229, 230, 242, 216, 121, 123, 224, Office Vault	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05B	9x9 Beige w/Brown Streaks Floor Tile	1,500	SF	Rooms 135 and 136	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06A	9x9 Tan w/White Streaks Floor Tile Mastic	3,500	SF	Rooms 230, 229, 230, 242, 216, 121, 123, 224, Office Vault	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06B	9x9 Beige w/Brown Streaks Floor Tile Mastic	1,000	SF	Rooms 135 and 136	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07A	12x12 Various Shades of Beige Floor Tile Mastic NOT OBSERVED	2,081	SF	1st Floor West Exit & Corridor, SW Exits, NE Corridor & 1st Floor Men's	Chrysotile	MISC			SF		

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
07B	12x12 Various Shades of Tan Floor Tile Mastic NOT OBSERVED			Washroom, Swimming Pool Corridor Corridor Outside Room 134, Water Fountain, Outside Room 124 & 126 Patchwork	Chrysotile	MISC					
07C	12x12 Multicolor Dark Beige Floor Tile Mastic	1,920	SF	Rooms 220 and 222	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07D	12x12 Light Blue Floor Tile Mastic ABATED			Room 134	Abated	MISC					
07E	12x12 Cream w/Brown Specks Floor Tile Mastic	7,120	SF	Rooms 115A, 117, 117B, 119, 133, 135, 138A, 139, 210, 211, 213, 218A and Girls' Locker Room Office.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07F	12x12 Grey (Dark Tan) w/White Streaks Floor Tile Mastic ABATED			2nd Floor Corridor	Abated	MISC					
07G	Mastic -12x12 Beige w/Brown & White Streaks Floor Tile	17,020	SF	Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07H	12x12 Crème w/Tan & White Streaks Floor Tile Mastic	7,050	SF	Faculty Dining Room & Cafeteria, Ladies' Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07I	12x12 Beige w/White Specks Floor Tile Mastic ABATED			1st Floor SE Exit	Abated	MISC					
07J	12x12 Taupe w/Brown & White Specks Floor Tile Mastic	216	SF	Room 212	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07K	12x12 Multicolor Cream Mastic Floor Tile	2,108	SF	Rooms 220 and 222	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	1x1 Ceiling Tile Mastic	120,000	SF	1st & 2nd Floor Corridors & Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Drywall (Gypsum Board)	120,000	SF	Above 1x1 Ceiling Tile	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	1x2 Ceiling Tile REMOVED			Boys' Gym	Assumed	MISC					
11A	Gray Baseboard	195	LF	Room 109 & 104	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
11B	Black Baseboard	680	LF	Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
11C	Cream Baseboard	142	LF	Rooms 106 and 108	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12A	Gray Baseboard Mastic	195	LF	Room 109 & 104	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12B	Black Baseboard Mastic	680	LF	Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12C	Cream Baseboard Mastic	142	LF	Rooms 106 and 108	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
13	Yellow Sheet Goods Mastic	208	SF	Counter Tops, Rooms 109, 103, 105	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13A	Light Grey Linoleum	3,300	SF	Room 109 and 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
13C	Black with Gray Linoleum	840	SF	Rooms 106 & 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14A	Light Grey Linoleum Mastic	3,300	SF	Rooms 109 & 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14C	Black with Gray Linoleum Mastic	840	SF	Rooms 106 & 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	Blue Carpet Mastic	4,800	SF	Attendance Office & Surrounding Offices, Assistant Principal's Office, Corridor, Offices D, E, F, H; Main Office, Principal's Office, Girls' Locker Room Office, Room 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15B	Burgundy Carpet Mastic	80	SF	Boys' Locker Room and Coach's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15P	12x12 Black w/Maroon Checkerboard Vinyl Floor Tile	1,390	SF	Room 217 Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Wood Panel Mastic REMOVED			Room 124	Assumed	MISC					
17	Interior Window Glazing ABATED			Throughout 1st & 2nd Floor	Abated	MISC					
17A	Interior Window Glazing ABATED			Throughout 1st & 2nd Floor	Abated	MISC					
18	2x4 Ceiling Tile	840	SF	Room 108	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
19	Drywall	400	SF	Room 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Transite Countertops ABATED			Room 108	Abated	MISC					
25	12x12 Dark Blue Floor Tile	4,960	SF	Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25C	12x12 Tan w/Streaks Vinyl Floor Tile	700	SF	Room 215	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25D	12x12 Tan w/Streaks Vinyl Floor Tile Mastic	700	SF	Room 215	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25M	12x12 Dark Blue Floor Tile Mastic	4,960	SF	Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12x12 White w/Beige Streaks Floor Tile	12,000	SF	Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, Lunchrom and Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26M	12x12 White w/ Beige Streaks Floor Tile Mastic	12,000	SF	Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, and Library, and lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12x12 Brown and White Floor Tile	1,500	SF	Hallway in Modular Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27M	12x12 Brown and White Floor Tile Mastic	1,500	SF	Hallway in Modular Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	2'x4' White Fissured Ceiling Tiles	5,000	SF	Hallway and Classrooms Throughout	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable	Follow O&M Plan

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Modular Building						suspect ACBM	
29	12x12 Red Floor Tile (Duplicate- HA61)			Rooms 112	Assumed	MISC					
30	12x12 Red Floor Tile Mastic (Duplicate- HA61M)			Rooms 112	Assumed	MISC					
31	12x12 Blue Floor Tile (Duplicate- HA60)			Rooms 112	Assumed	MISC					
32	12x12 Blue Floor Tile Mastic (Duplicate- HA60M)			Rooms 112	Assumed	MISC					
33	12x12 White Floor Tile (Duplicate HA62)			Rooms 112	Assumed	MISC					
34	12x12 White Floor Tile Mastic (Duplicate- HA62M)			Rooms 112 and 114	Assumed	MISC					
35	12x12 Dark Blue Floor Tile	12,000	SF	Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12x12 Dark Blue Floor Tile Mastic	12,000	SF	Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12x12 Sky Blue Floor Tile	10,500	SF	Corridors and Room 138A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12x12 Sky Blue Floor Tile Mastic	10,500	SF	Corridors and Room 138A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	22"x22" White Floor Tile	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	22"x22" White Floor Tile Mastic	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	22"x22" Light Blue Floor tile	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	22"x22" Light Blue Floor Tile Mastic	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	22"x22" Dark Blue Floor Tile	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	22"x22" Dark Blue Floor Tile Mastic	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	22"x22" Orange Floor Tile	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	22"x22" Orange Floor Tile Mastic	5,000	SF	Main Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	2'x2' Ceiling Tile	5,000	SF	Main Hall	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
48	12"x12" H Blue Mix Speckled Vinyl Floor Tile	3,300	SF	Annex Building- Throughout Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48M	12"x12" H Blue Mix Speckled Vinyl Floor Tile Mastic	3,300	SF	Annex Building- Throughout Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile	3,300	SF	Annex- Throughout Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49M	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile Mastic	3,300	SF	Annex- Throughout Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	2'x4' Grooved Ceiling Tile	5,000	SF	Throughout Annex	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
51	12x12 Cream w/Beige Specks Vinyl Floor Tile	800	SF	Annex- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51M	12x12 Cream w/Beige Specks Vinyl Floor Tile	800	SF	Annex- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Mastic										
52	12x12 Tan w/Cream Specks Vinyl Floor Tile	800	SF	Annex- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52M	12x12 Tan w/Cream Specks Mastic	800	SF	Annex- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Blue Baseboard Mastic	1,000	SF	Annex- Throughout Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12x12 Brown Mixed Speckled Vinyl Floor Tile	200	SF	Boys & Girls Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54M	12x12 Brown Mixed Speckled Vinyl Floor Tile Mastic	200	SF	Boys' & Girls' Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12x12 Baby Blue Vinyl Floor Tile	500	SF	Room 138	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55M	12x12 Baby Blue Vinyl Floor Tile Mastic	500	SF	Room 138	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	2'x4' Ceiling Tile	560	SF	Rooms 137 and 138	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
57	Tan Linoleum ABATED			Room 104	Abated	MISC					
57M	Tan Linoleum Mastic ABATED			Room 104	Abated	MISC					
58	Lab Counter Tops Vinyl Floor Tile	2,000	SF	Rooms 104, 106, 107, 109, 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Fume Hoods	40	SF	Room 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12x12 Teal Mix Speckled Vinyl Floor Tile	200	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60A	Linoleum Mastic	800	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60M	12x12 Teal Mix Speckled Vinyl Floor Tile Mastic	200	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12x12 Salmon (Pink) Mix Speckled Vinyl Floor Tile	200	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61M	12x12 Salmon (Pink) Vinyl Floor Tile Mastic	200	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12x12 White w/Green Specks Vinyl Floor Tile	200	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62M	12x12 White w/Green Specks Vinyl Floor Tile Mastic	200	SF	Room 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	12x12 H Gray Mixed Speckled Vinyl Floor Tile	600	SF	Rooms 113 & 118	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63M	12x12 H Gray Mixed Speckled Vinyl Floor Tile Mastic	600	SF	Rooms 113 & 118	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	Orange Linoleum	300	SF	Rooms 114, 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64M	Orange Linoleum Mastic	300	SF	Rooms 114, 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	White Linoleum	1,320	SF	Rooms 107, 114 & 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65M	White Linoleum Mastic	1,320	SF	Rooms 107, 114 & 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	Blue Linoleum	300	SF	Rooms 114 & 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66M	Blue Linoleum Mastic	300	SF	Rooms 114 & 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	12x12 Beige Mixed Speckled Vinyl Floor Tile	2,000	SF	Rooms 204, 206, 239, Kitchen & Locker Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
67M	12x12 Beige Mixed Speckled Vinyl Floor Tile Mastic	2,000	SF	Rooms 204, 206, 239, Kitchen & Locker Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	12x12 White w/Black Specks Vinyl Floor Tile	160	SF	Elevator Vestibule & Engineering Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68M	12x12 White w/Black Specks Vinyl Floor Tile Mastic	160	SF	Elevator Vestibule & Engineering Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	9x9 Peach Vinyl Floor Tile	566	SF	Room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69M	9x9 Peach Vinyl Floor Tile Mastic	566	SF	Room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	9x9 Grey Vinyl Floor Tile	284	SF	Room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70M	9x9 Grey Vinyl Floor Tile Mastic	284	SF	Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	12"x12" Blue Mottled Vinyl Floor Tile	600	SF	Rooms 120 & 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	12"x12" Blue Mottled Vinyl Floor Tile Mastic	600	SF	Rooms 120 & 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	12"x12" White w/Brown Specks Vinyl Floor Tile	900	SF	Rooms 120 & 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
74	12"x12" White w/Brown Specks Vinyl Floor Tile Mastic	900	SF	Rooms 120 & 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
75	12"x12" Royal Blue Mottled Vinyl Floor Tile	600	SF	Rooms 120 & 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	12"x12" Royal Blue Mottled Vinyl Floor Tile Mastic	600	SF	Rooms 120 & 131	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	2'x2' Gray w/White Specks Vinyl Floor Tile	700	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
78	2'x2' Gray w/White Specks Vinyl Floor Tile Mastic	700	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	2'x2' Blue w/Tan Specks Vinyl Floor Tile	235	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
80	2'x2' Blue w/Tan Specks Vinyl Floor Tile Mastic	235	SF	Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81	12"x12" Grey & Brown Floor Tile	573	SF	Room 121	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81M	Mastic associated w/12"x12" Grey & Brown Floor Tile	573	SF	Room 121	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82	12"x12" Light Blue Floor Tile	619	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82M	Mastic associated w/12"x12" Light Blue Floor Tile	619	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	Insulation in Fire Rated Doors	240	SF	At Fire Stops Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	MJV on Fiberglass Pipe Insulation	698	LF	Throughout Basement Crawl Space	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
H	Vibration Collars	5	SF	Basement Boiler Room	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-100	2'x4' Plain White Ceiling Tile	150	SF	1st Floor Boys' Restroom	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-101	2'x4' White Ceiling Tile w/Grooves and Pinholes	7,000	SF	Classrooms	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-102	Acoustical "Pop Corn" Plaster	9,000	SF	Auditorium	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
HA-103	2'x4' White Ceiling Tile w/Random Fissures	1,800	SF	Classroom, Corridor, Men's Room	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-104	2'x4' White Ceiling Tile with Regular Holes	200	SF	Ladies Room	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
HA-105	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile	400	SF	Restrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-105M	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile Mastic	400	SF	Restrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-106	12"x12" Off-White w/Beige Specks Floor Tile	500	SF	Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-106/107 m	12"x12" Off-White and Brown Floor Tile Mastic	1,000	SF	Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-107	12"X12" Brown with Specks Floor Tile	500	SF	Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-108	Red Carpet Adhesive	3,000	SF	Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-109	Gray Carpet Adhesive	3,000	SF	Rooms 102A, 224A, Attendance Office, 131A, 130, Auditorium, Main Office, Assistant Principals Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
HA-110	4" Black Baseboard	5,000	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
HA-110M	4" Black Baseboard Adhesive	5,000	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
HA-111	Hard Joint Mudded Fittings on Fiberglass Insulated Pipe	4	LF	Utility Sink Room by the Water Heater	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
I	12x12 Light Blue Floor Tile (Duplicate of HA 37)			1st & 2nd Floor Corridors	Assumed	MISC					
J	12x12 Dark Blue Floor Tile (Duplicate of HA 35)			1st & 2nd Floor Corridors	Assumed	MISC					
K	Brown Linoleum ABATED			Rooms 104 and 104A	Abated	MISC					
L	Brown Linoleum Mastic ABATED			Rooms 104 and 104A	Abated	MISC					
M	12x12 Light Blue Floor Tile Mastic (Duplicate of HA 38)			1st & 2nd Floor Corridor	Assumed	MISC					
N	12x12 Dark Blue Floor Tile Mastic (Duplicate of HA 36)			1st & 2nd Floor Corridors	Assumed	MISC					
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC				6 ACBM with the potential for damage	Follow O&M Plan
O	1x1 Slotted Acoustical Ceiling Tile	800	SF	Boys' & Girls' Gym	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Harlan Academy High School **Unit** 51021 **Building ID** 1350
Address 9652 S. Michigan **City** Chicago, IL, 60628 **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
P	1x1 Slotted Acoustical Ceiling Tile Adhesive	800	SF	Boys' & Girls' Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Review Date	6/12/2025
Manager Planner Name	Steven Geneser

HA Number	Management Comments
01	
02	

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

100-01784	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
03	
04A	
04B	
04C	
04D	
04E	
04F	
04G	
04H	
04I	
04J	
04K	
05A	
05B	
06A	
06B	
07A	
07B	
07C	
07D	
07E	
07F	
07G	
07H	
07I	
07J	

Chicago Public Schools

School Harlan Academy High School

Address 9652 S. Michigan

Unit 51021

Chicago, IL, 60628

Building ID 1350

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
07K	
08	
09	
10	
11A	
11B	
11C	
12A	
12B	
12C	
13	
13A	
13C	
14A	
14C	
15A	
15B	
15P	
16	
17	
17A	
18	
19	
20	
25	
25C	

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
25D	
25M	
26	
26M	
27	
27M	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
48	
48M	
49	
49M	
50	
51	
51M	
52	
52M	
53	
54	
54M	
55	
55M	
56	
57	
57M	
58	
59	
60	
60A	
60M	
61	
61M	
62	
62M	

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
63	
63M	
64	
64M	
65	
65M	
66	
66M	
67	
67M	
68	
68M	
69	
69M	
70	
70M	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
81	
81M	
82	
82M	
E	
G	
H	
HA-100	
HA-101	
HA-102	
HA-103	
HA-104	
HA-105	
HA-105M	
HA-106	
HA-106/107m	
HA-107	
HA-108	
HA-109	
HA-110	
HA-110M	
HA-111	
I	
J	
K	
L	

Chicago Public Schools

School Harlan Academy High School

Unit 51021

Building ID 1350

Address 9652 S. Michigan

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
M	
N	
NEW	
O	
P	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	Acoustical Ceiling Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	9000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **Acoustical Ceiling Plaster**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

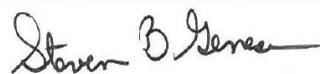

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	Hard Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Facility		
MATERIAL QUANTITY:	108000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **Hard Plaster**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **108000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

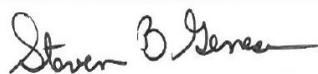

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Facility		
MATERIAL QUANTITY:	120000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

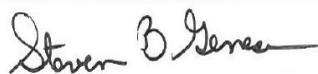

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 04A

MATERIAL DESCRIPTION: 12x12 Various Shades of Beige Floor Tile ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW

MATERIAL LOCATION: 1st Floor West Exit & Corridor, SW Exits, NE Corridor & Men's Washroom (1st Floor), Swimming Pool Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04A**

MATERIAL DESCRIPTION: **12x12 Various Shades of Beige Floor Tile ABATED**

MATERIAL LOCATION: **1st Floor West Exit & Corridor, SW Exits, NE Corridor & Men's Washroom (1st Floor), Swimming Pool Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04B**

MATERIAL DESCRIPTION: **12x12 Various Shades of Tan Floor Tile ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Corridor outside Room 134, Water Fountain, outside Room 124 & 126 patchwork**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04B**

MATERIAL DESCRIPTION: **12x12 Various Shades of Tan Floor Tile ABATED**

MATERIAL LOCATION: **Corridor outside Room 134, Water Fountain, outside Room 124 & 126 patchwork**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04C		
MATERIAL DESCRIPTION:	12x12 Multicolor Dark Beige Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 220 and 222		
MATERIAL QUANTITY:	1920	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04C**

MATERIAL DESCRIPTION: **12x12 Multicolor Dark Beige Floor Tile**

MATERIAL LOCATION: **Rooms 220 and 222**

MATERIAL QUANTITY: **1920** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

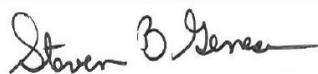

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 04D

MATERIAL DESCRIPTION: 12x12 Light Blue Floor Tile ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 134

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04D**

MATERIAL DESCRIPTION: **12x12 Light Blue Floor Tile ABATED**

MATERIAL LOCATION: **Room 134**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

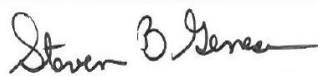

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04E		
MATERIAL DESCRIPTION:	12x12 Cream w/Brown Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 115A, 116, 117, 117B, 119, 124, 126, 133, 134, 135, 138A, 139, 210, 211, 213, 217, 218A, Girls Locker Room Office.**

MATERIAL QUANTITY: **7120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04E**

MATERIAL DESCRIPTION: **12x12 Cream w/Brown Specks Floor Tile**

MATERIAL LOCATION: **Rooms 115A, 116, 117, 117B, 119, 124, 126, 133, 134, 135, 138A, 139, 210, 211, 213, 217, 218A, Girls Locker Room Office.**

MATERIAL QUANTITY: **7120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04F**

MATERIAL DESCRIPTION: **12x12 Grey (Dark Tan) w/White Streaks Floor Tile REMOVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Chrysotile** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Corridor**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04F**

MATERIAL DESCRIPTION: **12x12 Grey (Dark Tan) w/White Streaks Floor Tile REMOVED**

MATERIAL LOCATION: **2nd Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04G		
MATERIAL DESCRIPTION:	12x12 Beige w/Brown & White Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies' Restroom		
MATERIAL QUANTITY:	16000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04G**

MATERIAL DESCRIPTION: **12x12 Beige w/Brown & White Streaks Floor Tile**

MATERIAL LOCATION: **Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies' Restroom**

MATERIAL QUANTITY: **16000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

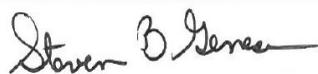

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04H		
MATERIAL DESCRIPTION:	12x12 Crème w/Tan & White Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Faculty Dining Room & Cafeteria, Ladies' Restroom		
MATERIAL QUANTITY:	7050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04H**

MATERIAL DESCRIPTION: **12x12 Crème w/Tan & White Streaks Floor Tile**

MATERIAL LOCATION: **Faculty Dining Room & Cafeteria, Ladies' Restroom**

MATERIAL QUANTITY: **7050** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

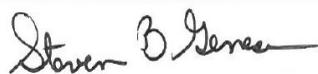

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 04I

MATERIAL DESCRIPTION: 12x12 Beige w/White Specks Floor Tile ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor SE Exit

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **041**

MATERIAL DESCRIPTION: **12x12 Beige w/White Specks Floor Tile ABATED**

MATERIAL LOCATION: **1st Floor SE Exit**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04J		
MATERIAL DESCRIPTION:	12x12 Taupe w/Brown & White Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212		
MATERIAL QUANTITY:	216	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04J**

MATERIAL DESCRIPTION: **12x12 Taupe w/Brown & White Specks Floor Tile**

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY: **216** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

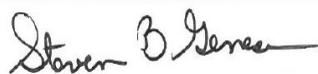

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04K		
MATERIAL DESCRIPTION:	12x12 Multicolor Cream Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 220 and 222		
MATERIAL QUANTITY:	2108	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **04K**

MATERIAL DESCRIPTION: **12x12 Multicolor Cream Floor Tile**

MATERIAL LOCATION: **Rooms 220 and 222**

MATERIAL QUANTITY: **2108** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

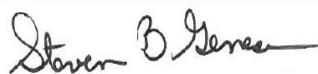

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05A		
MATERIAL DESCRIPTION:	9x9 Tan w/White Streaks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 224, 229, 230, 242, 216, 121, 123 and Office Vault		
MATERIAL QUANTITY:	4560	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **05A**

MATERIAL DESCRIPTION: **9x9 Tan w/White Streaks Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 224, 229, 230, 242, 216, 121, 123 and Office Vault**

MATERIAL QUANTITY: **4560** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

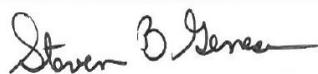

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05B		
MATERIAL DESCRIPTION:	9x9 Beige w/Brown Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 135 and 136		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **05B**

MATERIAL DESCRIPTION: **9x9 Beige w/Brown Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 135 and 136**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

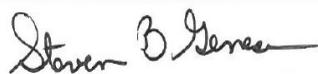

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06A		
MATERIAL DESCRIPTION:	9x9 Tan w/White Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 230, 229, 230, 242, 216, 121, 123, 224, Office Vault		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	2025- Floor Tile & Mastic removed from Room 230, January 2025. New HA assigned		

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **06A**

MATERIAL DESCRIPTION: **9x9 Tan w/White Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 230, 229, 230, 242, 216, 121, 123, 224, Office Vault**

MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

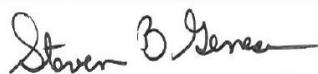

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06B		
MATERIAL DESCRIPTION:	9x9 Beige w/Brown Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 135 and 136		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **06B**

MATERIAL DESCRIPTION: **9x9 Beige w/Brown Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 135 and 136**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

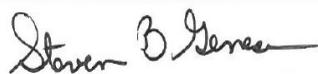

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07A

MATERIAL DESCRIPTION: 12x12 Various Shades of Beige Floor Tile Mastic NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Chrysotile FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor West Exit & Corridor, SW Exits, NE Corridor & 1st Floor Men's Washroom, Swimming Pool Corridor

MATERIAL QUANTITY: 2081 MATERIAL UNITS: SF

DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS: Not Observed Multiple Years

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07A**

MATERIAL DESCRIPTION: **12x12 Various Shades of Beige Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1st Floor West Exit & Corridor, SW Exits, NE Corridor & 1st Floor Men's Washroom, Swimming Pool Corridor**

MATERIAL QUANTITY: **2081** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: MATERIAL UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**

MATERIAL DESCRIPTION: **12x12 Various Shades of Tan Floor Tile Mastic NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Chrysotile** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Corridor Outside Room 134, Water Fountain, Outside Room 124 & 126 Patchwork**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: Keith Clough

Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07B**

MATERIAL DESCRIPTION: **12x12 Various Shades of Tan Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **Corridor Outside Room 134, Water Fountain, Outside Room 124 & 126 Patchwork**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07C		
MATERIAL DESCRIPTION:	12x12 Multicolor Dark Beige Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 220 and 222		
MATERIAL QUANTITY:	1920	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07C**

MATERIAL DESCRIPTION: **12x12 Multicolor Dark Beige Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 220 and 222**

MATERIAL QUANTITY: **1920** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

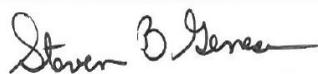

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07D

MATERIAL DESCRIPTION: 12x12 Light Blue Floor Tile Mastic ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 134

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07D**

MATERIAL DESCRIPTION: **12x12 Light Blue Floor Tile Mastic ABATED**

MATERIAL LOCATION: **Room 134**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07E		
MATERIAL DESCRIPTION:	12x12 Cream w/Brown Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 115A, 117, 117B, 119, 133, 135, 138A, 139, 210, 211, 213, 218A and Girls' Locker Room Office.**

MATERIAL QUANTITY: **7120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA:	07E				
MATERIAL DESCRIPTION:	12x12 Cream w/Brown Specks Floor Tile Mastic				
MATERIAL LOCATION:	Rooms 115A, 117, 117B, 119, 133, 135, 138A, 139, 210, 211, 213, 218A and Girls' Locker Room Office.				
MATERIAL QUANTITY:	7120	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07F

MATERIAL DESCRIPTION: 12x12 Grey (Dark Tan) w/White Streaks Floor Tile Mastic ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 2nd Floor Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07F**

MATERIAL DESCRIPTION: **12x12 Grey (Dark Tan) w/White Streaks Floor Tile Mastic ABATED**

MATERIAL LOCATION: **2nd Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07G		
MATERIAL DESCRIPTION:	Mastic -12x12 Beige w/Brown & White Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies Restroom		
MATERIAL QUANTITY:	17020	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07G**

MATERIAL DESCRIPTION: **Mastic -12x12 Beige w/Brown & White Streaks Floor Tile**

MATERIAL LOCATION: **Mens Faculty, 1st Floor: Corridor, SE Stairwell, Main Office Sitting Area, Ladies Restroom**

MATERIAL QUANTITY: **17020** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

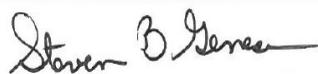

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07H		
MATERIAL DESCRIPTION:	12x12 Crème w/Tan & White Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Faculty Dining Room & Cafeteria, Ladies' Restroom		
MATERIAL QUANTITY:	7050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07H**

MATERIAL DESCRIPTION: **12x12 Crème w/Tan & White Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Faculty Dining Room & Cafeteria, Ladies' Restroom**

MATERIAL QUANTITY: **7050** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

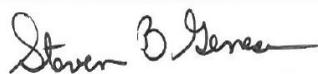

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07I		
MATERIAL DESCRIPTION:	12x12 Beige w/White Specks Floor Tile Mastic ABATED		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor SE Exit

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **071**

MATERIAL DESCRIPTION: **12x12 Beige w/White Specks Floor Tile Mastic ABATED**

MATERIAL LOCATION: **1st Floor SE Exit**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07J		
MATERIAL DESCRIPTION:	12x12 Taupe w/Brown & White Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212		
MATERIAL QUANTITY:	216	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07J**

MATERIAL DESCRIPTION: **12x12 Taupe w/Brown & White Specks Floor Tile Mastic**

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY: **216** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

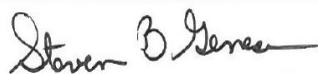

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07K		
MATERIAL DESCRIPTION:	12x12 Multicolor Cream Mastic Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 220 and 222		
MATERIAL QUANTITY:	2108	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **07K**

MATERIAL DESCRIPTION: **12x12 Multicolor Cream Mastic Floor Tile**

MATERIAL LOCATION: **Rooms 220 and 222**

MATERIAL QUANTITY: **2108** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

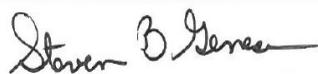

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	1x1 Ceiling Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st & 2nd Floor Corridors & Classrooms		
MATERIAL QUANTITY:	120000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **1x1 Ceiling Tile Mastic**

MATERIAL LOCATION: **1st & 2nd Floor Corridors & Classrooms**

MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

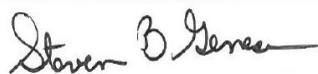

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	Drywall (Gypsum Board)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Above 1x1 Ceiling Tile		
MATERIAL QUANTITY:	120000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **Drywall (Gypsum Board)**

MATERIAL LOCATION: **Above 1x1 Ceiling Tile**

MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

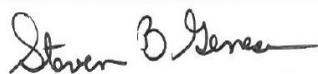

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **1x2 Ceiling Tile REMOVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boys' Gym**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **1x2 Ceiling Tile REMOVED**

MATERIAL LOCATION: **Boys' Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11A		
MATERIAL DESCRIPTION:	Gray Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 109 & 104		
MATERIAL QUANTITY:	195	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **11A**

MATERIAL DESCRIPTION: **Gray Baseboard**

MATERIAL LOCATION: **Room 109 & 104**

MATERIAL QUANTITY: **195** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

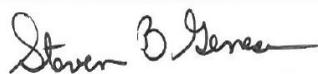

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11B		
MATERIAL DESCRIPTION:	Black Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office		
MATERIAL QUANTITY:	680	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **11B**

MATERIAL DESCRIPTION: **Black Baseboard**

MATERIAL LOCATION: **Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office**

MATERIAL QUANTITY: **680** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

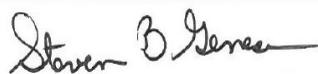

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11C		
MATERIAL DESCRIPTION:	Cream Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106 and 108		
MATERIAL QUANTITY:	142	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **11C**

MATERIAL DESCRIPTION: **Cream Baseboard**

MATERIAL LOCATION: **Rooms 106 and 108**

MATERIAL QUANTITY: **142** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

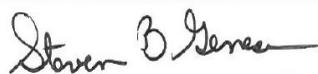

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12A		
MATERIAL DESCRIPTION:	Gray Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 109 & 104		
MATERIAL QUANTITY:	195	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **12A**

MATERIAL DESCRIPTION: **Gray Baseboard Mastic**

MATERIAL LOCATION: **Room 109 & 104**

MATERIAL QUANTITY: **195** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

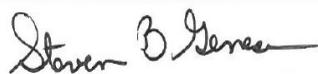

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12B		
MATERIAL DESCRIPTION:	Black Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office		
MATERIAL QUANTITY:	680	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **12B**

MATERIAL DESCRIPTION: **Black Baseboard Mastic**

MATERIAL LOCATION: **Rooms 105, 110 (Gym), 112, 113, 115, 121, 134 & Main Office**

MATERIAL QUANTITY: **680** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

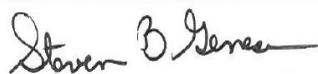

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12C		
MATERIAL DESCRIPTION:	Cream Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106 and 108		
MATERIAL QUANTITY:	142	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **12C**

MATERIAL DESCRIPTION: **Cream Baseboard Mastic**

MATERIAL LOCATION: **Rooms 106 and 108**

MATERIAL QUANTITY: **142** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

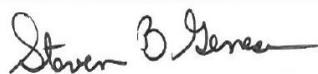

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	Yellow Sheet Goods Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Counter Tops, Rooms 109, 103, 105		
MATERIAL QUANTITY:	208	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Yellow Sheet Goods Mastic**

MATERIAL LOCATION: **Counter Tops, Rooms 109, 103, 105**

MATERIAL QUANTITY: **208** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13A		
MATERIAL DESCRIPTION:	Light Grey Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 109 and 110		
MATERIAL QUANTITY:	3300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **13A**

MATERIAL DESCRIPTION: **Light Grey Linoleum**

MATERIAL LOCATION: **Room 109 and 110**

MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13C		
MATERIAL DESCRIPTION:	Black with Gray Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106 & 108		
MATERIAL QUANTITY:	840	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **13C**

MATERIAL DESCRIPTION: **Black with Gray Linoleum**

MATERIAL LOCATION: **Rooms 106 & 108**

MATERIAL QUANTITY: **840** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

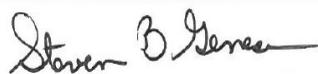

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14A		
MATERIAL DESCRIPTION:	Light Grey Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 109 & 110		
MATERIAL QUANTITY:	3300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **14A**

MATERIAL DESCRIPTION: **Light Grey Linoleum Mastic**

MATERIAL LOCATION: **Rooms 109 & 110**

MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14C		
MATERIAL DESCRIPTION:	Black with Gray Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106 & 108		
MATERIAL QUANTITY:	840	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **14C**

MATERIAL DESCRIPTION: **Black with Gray Linoleum Mastic**

MATERIAL LOCATION: **Rooms 106 & 108**

MATERIAL QUANTITY: **840** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15A		
MATERIAL DESCRIPTION:	Blue Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Attendance Office & Surrounding Offices, Assistant Principal's Office, Corridor, Offices D, E, F, H; Main Office, Principal's Office, Girls' Locker Room Office, Room 131**

MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **15A**

MATERIAL DESCRIPTION: **Blue Carpet Mastic**

MATERIAL LOCATION: **Attendance Office & Surrounding Offices, Assistant Principal's Office, Corridor, Offices D, E, F, H; Main Office, Principal's Office, Girls' Locker Room Office, Room 131**

MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15B		
MATERIAL DESCRIPTION:	Burgundy Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys' Locker Room and Coach's Office		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **15B**

MATERIAL DESCRIPTION: **Burgundy Carpet Mastic**

MATERIAL LOCATION: **Boys' Locker Room and Coach's Office**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15P		
MATERIAL DESCRIPTION:	12x12 Black w/Maroon Checkerboard Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 217 Corridor		
MATERIAL QUANTITY:	1390	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **15P**

MATERIAL DESCRIPTION: **12x12 Black w/Maroon Checkerboard Vinyl Floor Tile**

MATERIAL LOCATION: **Room 217 Corridor**

MATERIAL QUANTITY: **1390** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Wood Panel Mastic REMOVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 124**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Wood Panel Mastic REMOVED**

MATERIAL LOCATION: **Room 124**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 17

MATERIAL DESCRIPTION: Interior Window Glazing ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1st & 2nd Floor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Interior Window Glazing ABATED**

MATERIAL LOCATION: **Throughout 1st & 2nd Floor**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 17A

MATERIAL DESCRIPTION: Interior Window Glazing ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1st & 2nd Floor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **17A**

MATERIAL DESCRIPTION: **Interior Window Glazing ABATED**

MATERIAL LOCATION: **Throughout 1st & 2nd Floor**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	2x4 Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 108		
MATERIAL QUANTITY:	840	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **2x4 Ceiling Tile**

MATERIAL LOCATION: **Room 108**

MATERIAL QUANTITY: **840** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 108		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Room 108**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 20

MATERIAL DESCRIPTION: Transite Countertops ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 108

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Transite Countertops ABATED**

MATERIAL LOCATION: **Room 108**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12x12 Dark Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge		
MATERIAL QUANTITY:	4960	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile**

MATERIAL LOCATION: **Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge**

MATERIAL QUANTITY: **4960** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25C		
MATERIAL DESCRIPTION:	12x12 Tan w/Streaks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 215		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **25C**

MATERIAL DESCRIPTION: **12x12 Tan w/Streaks Vinyl Floor Tile**

MATERIAL LOCATION: **Room 215**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25D		
MATERIAL DESCRIPTION:	12x12 Tan w/Streaks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 215		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **25D**

MATERIAL DESCRIPTION: **12x12 Tan w/Streaks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 215**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25M		
MATERIAL DESCRIPTION:	12x12 Dark Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge		
MATERIAL QUANTITY:	4960	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **25M**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 135, 136, 208, 214, 218, 226, 241 & 2nd Floor Teachers' Lounge**

MATERIAL QUANTITY: **4960** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12x12 White w/Beige Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, Lunchrom and Library**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12x12 White w/Beige Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, Lunchrom and Library**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26M		
MATERIAL DESCRIPTION:	12x12 White w/ Beige Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, and Library, and lunchroom**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: MATERIAL UNITS: **SF**

COMMENTS:



Inspector's Signature:

Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **26M**

MATERIAL DESCRIPTION: **12x12 White w/ Beige Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 112, 115, 122, 124, 125, 126, 130, 133, 134A, 207, 209, 219, 219A, 221, 228, 227A, 231, 232, 234, 236, 238, 240, and Library, and lunchroom**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12x12 Brown and White Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hallway in Modular Building		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12x12 Brown and White Floor Tile**

MATERIAL LOCATION: **Hallway in Modular Building**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27M		
MATERIAL DESCRIPTION:	12x12 Brown and White Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hallway in Modular Building		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **27M**

MATERIAL DESCRIPTION: **12x12 Brown and White Floor Tile Mastic**

MATERIAL LOCATION: **Hallway in Modular Building**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	2'x4' White Fissured Ceiling Tiles		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hallway and Classrooms Throughout Modular Building		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **2'x4' White Fissured Ceiling Tiles**

MATERIAL LOCATION: **Hallway and Classrooms Throughout Modular Building**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 29

MATERIAL DESCRIPTION: 12x12 Red Floor Tile (Duplicate- HA61)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **12x12 Red Floor Tile (Duplicate- HA61)**

MATERIAL LOCATION: **Rooms 112**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 30

MATERIAL DESCRIPTION: 12x12 Red Floor Tile Mastic (Duplicate- HA61M)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **12x12 Red Floor Tile Mastic (Duplicate- HA61M)**

MATERIAL LOCATION: **Rooms 112**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 31

MATERIAL DESCRIPTION: 12x12 Blue Floor Tile (Duplicate- HA60)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12x12 Blue Floor Tile (Duplicate- HA60)**

MATERIAL LOCATION: **Rooms 112**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 32

MATERIAL DESCRIPTION: 12x12 Blue Floor Tile Mastic (Duplicate- HA60M)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12x12 Blue Floor Tile Mastic (Duplicate- HA60M)**

MATERIAL LOCATION: **Rooms 112**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 33

MATERIAL DESCRIPTION: 12x12 White Floor Tile (Duplicate HA62)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **12x12 White Floor Tile (Duplicate HA62)**

MATERIAL LOCATION: **Rooms 112**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 34

MATERIAL DESCRIPTION: 12x12 White Floor Tile Mastic (Duplicate- HA62M)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 112 and 114

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **12x12 White Floor Tile Mastic (Duplicate- HA62M)**

MATERIAL LOCATION: **Rooms 112 and 114**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12x12 Dark Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226		
MATERIAL QUANTITY:	12000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile**

MATERIAL LOCATION: **Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12x12 Dark Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226		
MATERIAL QUANTITY:	12000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile Mastic**

MATERIAL LOCATION: **Corridors Border, Stairwells, Rooms 218, 214, 208, 241 and 226**

MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12x12 Sky Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridors and Room 138A		
MATERIAL QUANTITY:	10500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12x12 Sky Blue Floor Tile**

MATERIAL LOCATION: **Corridors and Room 138A**

MATERIAL QUANTITY: **10500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12x12 Sky Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridors and Room 138A		
MATERIAL QUANTITY:	10500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **12x12 Sky Blue Floor Tile Mastic**

MATERIAL LOCATION: **Corridors and Room 138A**

MATERIAL QUANTITY: **10500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	22"x22" White Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **22"x22" White Floor Tile**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	22"x22" White Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **22"x22" White Floor Tile Mastic**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	22"x22" Light Blue Floor tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **22"x22" Light Blue Floor tile**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	22"x22" Light Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **22"x22" Light Blue Floor Tile Mastic**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	22"x22" Dark Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **22"x22" Dark Blue Floor Tile**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	22"x22" Dark Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **22"x22" Dark Blue Floor Tile Mastic**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	22"x22" Orange Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **22"x22" Orange Floor Tile**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	22"x22" Orange Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **22"x22" Orange Floor Tile Mastic**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	2'x2' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Hall		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **2'x2' Ceiling Tile**

MATERIAL LOCATION: **Main Hall**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	12"x12" H Blue Mix Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex Building- Throughout Classrooms		
MATERIAL QUANTITY:	3300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **12"x12" H Blue Mix Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Annex Building- Throughout Classrooms**

MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48M		
MATERIAL DESCRIPTION:	12"x12" H Blue Mix Speckled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex Building- Throughout Classrooms		
MATERIAL QUANTITY:	3300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **48M**

MATERIAL DESCRIPTION: **12"x12" H Blue Mix Speckled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Annex Building- Throughout Classrooms**

MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- Throughout Classrooms		
MATERIAL QUANTITY:	3300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **12x12 Dark Blue Mixed Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Annex- Throughout Classrooms**

MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49M		
MATERIAL DESCRIPTION:	12x12 Dark Blue Mixed Speckled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- Throughout Classrooms		
MATERIAL QUANTITY:	3300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **49M**

MATERIAL DESCRIPTION: **12x12 Dark Blue Mixed Speckled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Annex- Throughout Classrooms**

MATERIAL QUANTITY: **3300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	2'x4' Grooved Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Annex		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **2'x4' Grooved Ceiling Tile**

MATERIAL LOCATION: **Throughout Annex**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12x12 Cream w/Beige Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- 1st Floor Corridor		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **12x12 Cream w/Beige Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Annex- 1st Floor Corridor**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51M		
MATERIAL DESCRIPTION:	12x12 Cream w/Beige Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- 1st Floor Corridor		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **51M**

MATERIAL DESCRIPTION: **12x12 Cream w/Beige Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Annex- 1st Floor Corridor**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12x12 Tan w/Cream Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- 1st Floor Corridor		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12x12 Tan w/Cream Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Annex- 1st Floor Corridor**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52M		
MATERIAL DESCRIPTION:	12x12 Tan w/Cream Specks Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- 1st Floor Corridor		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **52M**

MATERIAL DESCRIPTION: **12x12 Tan w/Cream Specks Mastic**

MATERIAL LOCATION: **Annex- 1st Floor Corridor**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	Blue Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- Throughout Classrooms		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **Blue Baseboard Mastic**

MATERIAL LOCATION: **Annex- Throughout Classrooms**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	12x12 Brown Mixed Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys & Girls Washroom		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **12x12 Brown Mixed Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Boys & Girls Washroom**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54M		
MATERIAL DESCRIPTION:	12x12 Brown Mixed Speckled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys' & Girls' Washroom		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **54M**

MATERIAL DESCRIPTION: **12x12 Brown Mixed Speckled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Boys' & Girls' Washroom**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	12x12 Baby Blue Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 138		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **12x12 Baby Blue Vinyl Floor Tile**

MATERIAL LOCATION: **Room 138**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55M		
MATERIAL DESCRIPTION:	12x12 Baby Blue Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 138		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **55M**

MATERIAL DESCRIPTION: **12x12 Baby Blue Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 138**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 137 and 138		
MATERIAL QUANTITY:	560	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**

MATERIAL LOCATION: **Rooms 137 and 138**

MATERIAL QUANTITY: **560** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 57

MATERIAL DESCRIPTION: Tan Linoleum ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 104

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **Tan Linoleum ABATED**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57M**

MATERIAL DESCRIPTION: **Tan Linoleum Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/28/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **57M**

MATERIAL DESCRIPTION: **Tan Linoleum Mastic ABATED**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	Lab Counter Tops Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 104, 106, 107, 109, 110		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **Lab Counter Tops Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 104, 106, 107, 109, 110**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	Fume Hoods		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 106		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **Fume Hoods**

MATERIAL LOCATION: **Room 106**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	12x12 Teal Mix Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **12x12 Teal Mix Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60A		
MATERIAL DESCRIPTION:	Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **60A**

MATERIAL DESCRIPTION: **Linoleum Mastic**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60M		
MATERIAL DESCRIPTION:	12x12 Teal Mix Speckled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **60M**

MATERIAL DESCRIPTION: **12x12 Teal Mix Speckled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	12x12 Salmon (Pink) Mix Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **12x12 Salmon (Pink) Mix Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61M		
MATERIAL DESCRIPTION:	12x12 Salmon (Pink) Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **61M**

MATERIAL DESCRIPTION: **12x12 Salmon (Pink) Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	12x12 White w/Green Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **12x12 White w/Green Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62M		
MATERIAL DESCRIPTION:	12x12 White w/Green Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **62M**

MATERIAL DESCRIPTION: **12x12 White w/Green Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 112**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	12x12 H Gray Mixed Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 113 & 118		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **12x12 H Gray Mixed Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 113 & 118**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63M		
MATERIAL DESCRIPTION:	12x12 H Gray Mixed Speckled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 113 & 118		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **63M**

MATERIAL DESCRIPTION: **12x12 H Gray Mixed Speckled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 113 & 118**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	Orange Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 114, 116		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Orange Linoleum**

MATERIAL LOCATION: **Rooms 114, 116**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64M		
MATERIAL DESCRIPTION:	Orange Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 114, 116		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **64M**

MATERIAL DESCRIPTION: **Orange Linoleum Mastic**

MATERIAL LOCATION: **Rooms 114, 116**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	65		
MATERIAL DESCRIPTION:	White Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 107, 114 & 116		
MATERIAL QUANTITY:	1320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **White Linoleum**

MATERIAL LOCATION: **Rooms 107, 114 & 116**

MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	65M		
MATERIAL DESCRIPTION:	White Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 107, 114 & 116		
MATERIAL QUANTITY:	1320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **65M**

MATERIAL DESCRIPTION: **White Linoleum Mastic**

MATERIAL LOCATION: **Rooms 107, 114 & 116**

MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	66		
MATERIAL DESCRIPTION:	Blue Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 114 & 116		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **Blue Linoleum**

MATERIAL LOCATION: **Rooms 114 & 116**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	66M		
MATERIAL DESCRIPTION:	Blue Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 114 & 116		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **66M**

MATERIAL DESCRIPTION: **Blue Linoleum Mastic**

MATERIAL LOCATION: **Rooms 114 & 116**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	12x12 Beige Mixed Speckled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 204, 206, 239, Kitchen & Locker Room		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **12x12 Beige Mixed Speckled Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 204, 206, 239, Kitchen & Locker Room**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	67M		
MATERIAL DESCRIPTION:	12x12 Beige Mixed Speckled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 204, 206, 239, Kitchen & Locker Room		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **67M**

MATERIAL DESCRIPTION: **12x12 Beige Mixed Speckled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 204, 206, 239, Kitchen & Locker Room**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	12x12 White w/Black Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator Vestibule & Engineering Office		
MATERIAL QUANTITY:	160	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **68**

MATERIAL DESCRIPTION: **12x12 White w/Black Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Elevator Vestibule & Engineering Office**

MATERIAL QUANTITY: **160** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68M		
MATERIAL DESCRIPTION:	12x12 White w/Black Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator Vestibule & Engineering Office		
MATERIAL QUANTITY:	160	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **68M**

MATERIAL DESCRIPTION: **12x12 White w/Black Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Elevator Vestibule & Engineering Office**

MATERIAL QUANTITY: **160** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69		
MATERIAL DESCRIPTION:	9x9 Peach Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 120		
MATERIAL QUANTITY:	566	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **69**

MATERIAL DESCRIPTION: **9x9 Peach Vinyl Floor Tile**

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY: **566** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69M		
MATERIAL DESCRIPTION:	9x9 Peach Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 120		
MATERIAL QUANTITY:	566	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **69M**

MATERIAL DESCRIPTION: **9x9 Peach Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY: **566** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70		
MATERIAL DESCRIPTION:	9x9 Grey Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 120		
MATERIAL QUANTITY:	284	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **9x9 Grey Vinyl Floor Tile**

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY: **284** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70M		
MATERIAL DESCRIPTION:	9x9 Grey Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 120		
MATERIAL QUANTITY:	284	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **70M**

MATERIAL DESCRIPTION: **9x9 Grey Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY: **284** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	12"x12" Blue Mottled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 120 & 131		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **12"x12" Blue Mottled Vinyl Floor Tile**

MATERIAL LOCATION: **Room 120 & 131**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	72		
MATERIAL DESCRIPTION:	12"x12" Blue Mottled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 120 & 131		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **72**

MATERIAL DESCRIPTION: **12"x12" Blue Mottled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 120 & 131**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	73		
MATERIAL DESCRIPTION:	12"x12" White w/Brown Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 120 & 131		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **73**

MATERIAL DESCRIPTION: **12"x12" White w/Brown Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 120 & 131**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	12"x12" White w/Brown Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 120 & 131		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **74**

MATERIAL DESCRIPTION: **12"x12" White w/Brown Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 120 & 131**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	12"x12" Royal Blue Mottled Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 120 & 131		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **12"x12" Royal Blue Mottled Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 120 & 131**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	12"x12" Royal Blue Mottled Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 120 & 131		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **76**

MATERIAL DESCRIPTION: **12"x12" Royal Blue Mottled Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 120 & 131**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	2'x2' Gray w/White Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 104		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **77**

MATERIAL DESCRIPTION: **2'x2' Gray w/White Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	78		
MATERIAL DESCRIPTION:	2'x2' Gray w/White Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 104		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **78**

MATERIAL DESCRIPTION: **2'x2' Gray w/White Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	79		
MATERIAL DESCRIPTION:	2'x2' Blue w/Tan Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 104		
MATERIAL QUANTITY:	235	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **79**

MATERIAL DESCRIPTION: **2'x2' Blue w/Tan Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: **235** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	80		
MATERIAL DESCRIPTION:	2'x2' Blue w/Tan Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 104		
MATERIAL QUANTITY:	235	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **80**

MATERIAL DESCRIPTION: **2'x2' Blue w/Tan Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Room 104**

MATERIAL QUANTITY: **235** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	Insulation in Fire Rated Doors		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	At Fire Stops Throughout Facility		
MATERIAL QUANTITY:	240	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Insulation in Fire Rated Doors**

MATERIAL LOCATION: **At Fire Stops Throughout Facility**

MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	MJV on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Basement Crawl Space		
MATERIAL QUANTITY:	698	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **MJV on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout Basement Crawl Space**

MATERIAL QUANTITY: **698** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	H		
MATERIAL DESCRIPTION:	Vibration Collars		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Boiler Room		
MATERIAL QUANTITY:	5	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Vibration Collars**

MATERIAL LOCATION: **Basement Boiler Room**

MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-100		
MATERIAL DESCRIPTION:	2'x4' Plain White Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Boys' Restroom		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-100**

MATERIAL DESCRIPTION: **2'x4' Plain White Ceiling Tile**

MATERIAL LOCATION: **1st Floor Boys' Restroom**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-101		
MATERIAL DESCRIPTION:	2'x4' White Ceiling Tile w/Grooves and Pinholes		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms		
MATERIAL QUANTITY:	7000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-101**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile w/Grooves and Pinholes**

MATERIAL LOCATION: **Classrooms**

MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-102		
MATERIAL DESCRIPTION:	Acoustical "Pop Corn" Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	9000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-102**

MATERIAL DESCRIPTION: **Acoustical "Pop Corn" Plaster**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-103		
MATERIAL DESCRIPTION:	2'x4' White Ceiling Tile w/Random Fissures		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classroom, Corridor, Men's Room		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-103**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile w/Random Fissures**

MATERIAL LOCATION: **Classroom, Corridor, Men's Room**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-104		
MATERIAL DESCRIPTION:	2'x4' White Ceiling Tile with Regular Holes		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Ladies Room		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-104**

MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile with Regular Holes**

MATERIAL LOCATION: **Ladies Room**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-105		
MATERIAL DESCRIPTION:	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Restrooms		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-105**

MATERIAL DESCRIPTION: **12"x12" Beige w/White & Brown Specks Vinyl Floor Tile**

MATERIAL LOCATION: **Restrooms**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

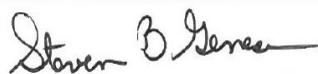

Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-105M		
MATERIAL DESCRIPTION:	12"x12" Beige w/White & Brown Specks Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Restrooms		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-105M**

MATERIAL DESCRIPTION: **12"x12" Beige w/White & Brown Specks Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Restrooms**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-106		
MATERIAL DESCRIPTION:	12"x12" Off-White w/Beige Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridor		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-106**

MATERIAL DESCRIPTION: **12"x12" Off-White w/Beige Specks Floor Tile**

MATERIAL LOCATION: **Corridor**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-106/107m		
MATERIAL DESCRIPTION:	12"x12" Off-White and Brown Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridor		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-106/107m**

MATERIAL DESCRIPTION: **12"x12" Off-White and Brown Floor Tile Mastic**

MATERIAL LOCATION: **Corridor**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-107		
MATERIAL DESCRIPTION:	12"X12" Brown with Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridor		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-107**

MATERIAL DESCRIPTION: **12"X12" Brown with Specks Floor Tile**

MATERIAL LOCATION: **Corridor**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-108		
MATERIAL DESCRIPTION:	Red Carpet Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-108**

MATERIAL DESCRIPTION: **Red Carpet Adhesive**

MATERIAL LOCATION: **Classrooms**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-109		
MATERIAL DESCRIPTION:	Gray Carpet Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 102A, 224A, Attendance Office, 131A, 130, Auditorium, Main Office, Assistant Principals Office		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-109**

MATERIAL DESCRIPTION: **Gray Carpet Adhesive**

MATERIAL LOCATION: **Rooms 102A, 224A, Attendance Office, 131A, 130, Auditorium, Main Office, Assistant Principals Office**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-110		
MATERIAL DESCRIPTION:	4" Black Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-110**

MATERIAL DESCRIPTION: **4" Black Baseboard**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-110M		
MATERIAL DESCRIPTION:	4" Black Baseboard Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-110M**

MATERIAL DESCRIPTION: **4" Black Baseboard Adhesive**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HA-111		
MATERIAL DESCRIPTION:	Hard Joint Muddled Fittings on Fiberglass Insulated Pipe		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Utility Sink Room by the Water Heater		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **HA-111**

MATERIAL DESCRIPTION: **Hard Joint Muddled Fittings on Fiberglass Insulated Pipe**

MATERIAL LOCATION: **Utility Sink Room by the Water Heater**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: I

MATERIAL DESCRIPTION: 12x12 Light Blue Floor Tile (Duplicate of HA 37)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st & 2nd Floor Corridors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **12x12 Light Blue Floor Tile (Duplicate of HA 37)**

MATERIAL LOCATION: **1st & 2nd Floor Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: J

MATERIAL DESCRIPTION: 12x12 Dark Blue Floor Tile (Duplicate of HA 35)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st & 2nd Floor Corridors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile (Duplicate of HA 35)**

MATERIAL LOCATION: **1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **Brown Linoleum ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 104 and 104A**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature: Keith Clough

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **Brown Linoleum ABATED**

MATERIAL LOCATION: **Rooms 104 and 104A**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: L

MATERIAL DESCRIPTION: Brown Linoleum Mastic ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Rooms 104 and 104A

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **Brown Linoleum Mastic ABATED**

MATERIAL LOCATION: **Rooms 104 and 104A**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: M

MATERIAL DESCRIPTION: 12x12 Light Blue Floor Tile Mastic (Duplicate of HA 38)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st & 2nd Floor Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **12x12 Light Blue Floor Tile Mastic (Duplicate of HA 38)**

MATERIAL LOCATION: **1st & 2nd Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: N

MATERIAL DESCRIPTION: 12x12 Dark Blue Floor Tile Mastic (Duplicate of HA 36)

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Assumed FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st & 2nd Floor Corridors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **12x12 Dark Blue Floor Tile Mastic (Duplicate of HA 36)**

MATERIAL LOCATION: **1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:


DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	NEW		
MATERIAL DESCRIPTION:	Newly Installed Suspect ACM		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:



Inspector's Signature:

Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUILDING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	0		
MATERIAL DESCRIPTION:	1x1 Slotted Acoustical Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys' & Girls' Gym		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **1x1 Slotted Acoustical Ceiling Tile**

MATERIAL LOCATION: **Boys' & Girls' Gym**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	1x1 Slotted Acoustical Ceiling Tile Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys' & Girls' Gym		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Steven Geneser		
SCHOOL NAME:	Harlan Academy High School	REVIEW DATE:	6/12/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **1x1 Slotted Acoustical Ceiling Tile Adhesive**

MATERIAL LOCATION: **Boys' & Girls' Gym**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	81		
MATERIAL DESCRIPTION:	12"x12" Grey & Brown Floor Tile		
MATERIAL LOCATION:	Room 121		
MATERIAL QUANTITY:	573	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **51021** BUIDLING ID: **1350**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Harlan Academy High School** REVIEW DATE: **6/12/2025**

ADDRESS: **9652 S. Michigan** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **12"x12" Grey & Brown Floor Tile**

MATERIAL LOCATION: **Room 121**

MATERIAL QUANTITY: **573** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	82M				
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" Light Blue Floor Tile				
MATERIAL LOCATION:	Room 230				
MATERIAL QUANTITY:	619	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **51021** BUIDLING ID: **1350**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Harlan Academy High School** REVIEW DATE: **6/12/2025**

ADDRESS: **9652 S. Michigan** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **82M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Light Blue Floor Tile**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **619** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	81M				
MATERIAL DESCRIPTION:	Mastic associated w/12"x12" Grey & Brown Floor Tile				
MATERIAL LOCATION:	Room 121				
MATERIAL QUANTITY:	573	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE REASON:			
COMMENTS:					

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **51021** BUIDLING ID: **1350**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Harlan Academy High School** REVIEW DATE: **6/12/2025**

ADDRESS: **9652 S. Michigan** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **81M**

MATERIAL DESCRIPTION: **Mastic associated w/12"x12" Grey & Brown Floor Tile**

MATERIAL LOCATION: **Room 121**

MATERIAL QUANTITY: **573** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/12/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	51021	BUIDLING ID:	1350
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Keith Clough		
SCHOOL NAME:	Harlan Academy High School	INSPECTION DATE:	5/28/2025		
ADDRESS:	9652 S. Michigan	IDPH LICENSE NO:	100-02950		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	82		
MATERIAL DESCRIPTION:	12"x12" Light Blue Floor Tile		
MATERIAL LOCATION:	Room 230		
MATERIAL QUANTITY:	619	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/28/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **51021** BUIDLING ID: **1350**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**

SCHOOL NAME: **Harlan Academy High School** REVIEW DATE: **6/12/2025**

ADDRESS: **9652 S. Michigan** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **82**

MATERIAL DESCRIPTION: **12"x12" Light Blue Floor Tile**

MATERIAL LOCATION: **Room 230**

MATERIAL QUANTITY: **619** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **06/12/2025**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443

3/16/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02950

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 02950		ISSUED 3/16/2022	EXPIRES 05/15/2023	INSPECTOR	3/9/2023
KEITH CLOUGH 524 HOMELAND RD MATTESON, IL 60443 Environmental Health				PROJECT MANAGER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	5/20/2022

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443

3/23/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02950

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE			
Front of License		Back of License	
 ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 02950	ISSUED 3/23/2024	EXPIRES 05/15/2025	INSPECTOR 3/9/2025
KEITH CLOUGH 524 HOMELAND RD MATTESON, IL 60443 Environmental Health	 PROJECT MANAGER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that KEITH CLOUGH
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/09/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

03/09/2022

Course Dates:

03/09/2023

Expires:

2203BIR03

Certificate Number:

A handwritten signature in black ink that reads 'Nicholas J. Peneff'.

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443


3/3/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02950


Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE-

Front of License

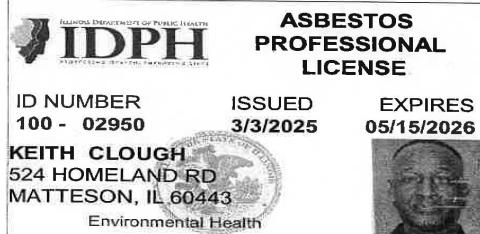

Back of License

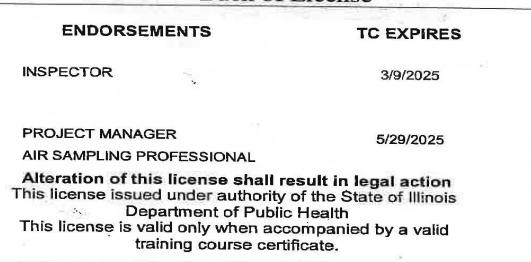

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that KEITH CLOUGH
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/19/2025 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

Course Dates: 03/19/2025
Expires: 03/19/2026
Certificate Number: 2503BIR01


Phone: 312-491-0081

Director of Training
Nicholas J. Penef
Doctor of Public Health

FORM # A-010B



TEM ENVIRONMENTAL, INC.
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS

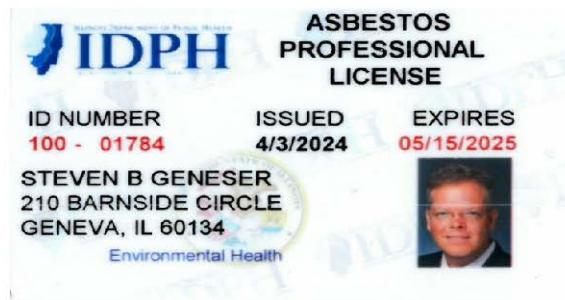

ENDORSEMENTS

TC EXPIRES

INSPECTOR 4/5/2024

MANAGEMENT PLANNER 4/5/2024

PROJECT MANAGER 4/4/2024

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

STEVEN B GENESER
210 BARNSIDE CIRCLE
GENEVA, IL 60134


6/6/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 01784

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

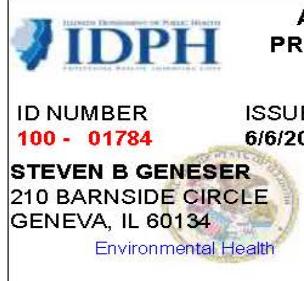

Back of License

ENDORSEMENTS	TC EXPIRES
INSPECTOR	5/7/2026
MANAGEMENT PLANNER	5/7/2026
PROJECT MANAGER	5/6/2026
AIR SAMPLING PROFESSIONAL	
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

**Reliable
Environmental
Solutions, Inc. R E S**

This is to certify that

Steve Geneser

*has on 5/7/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: May 7, 2025

COURSE LENGTH: 4 HOURS

Examination Date: May 7, 2025

Expiration Date: May 7, 2026

Certificate Number: MPR/0561

William S. Williams

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com

**Reliable
Environmental
Solutions, Inc. R E S**

This is to certify that

Steve Geneser

*has on 5/7/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher.*

Course Date: May 7, 2025

COURSE LENGTH: 4 HOURS

Examination Date: May 7, 2025

Expiration Date: May 7, 2026

Certificate Number: BIR/1252



Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com



This is to certify that

Steve Geneser

*has on 5/8/24, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: May 8, 2024

Examination Date: May 8, 2024

Expiration Date: May 8, 2025

Certificate Number: MPR/0531

COURSE LENGTH: 4 HOURS

A handwritten signature in black ink that reads "William S. Williams".

Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed