

ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2415  
SCHOOL NAME: Barbara A. Sizemore Academy of Betty Shabazz  
(Old Johns Academy)  
ADDRESS OF SCHOOL: 6936 S. Hermitage  
CITY: Chicago, IL, 60636

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 1/10/2023

If the address on this form is different than the address of the building, submit a written explanation.

**SECTION II** *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 9/17/2025 ENROLLMENT 375  
IDPH INSPECTOR LICENSE NUMBER: 100-21040  
IDPH LICENSED INSPECTOR NAME (Please Print): Josh Herman  
IDPH MP LICENSE NUMBER: 100-03613  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

9/26/2025

Richard J. Schleyer  
Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: \_\_\_\_\_

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)**

6936 S. Hermitage  
Chicago, IL, 60636

Unit: 66591  
Building ID: 5540

IDPH ID Number: 14-016-2990-2415

**REPORT DATE:**  
Friday, September 26, 2025

**Prepared for:**  
**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**  
**TEM Environmental, Inc.**

174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone 630-790-0880  
Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

09/25/2025

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299      Unit: 25051      Region: 05      IDPH ID: 14-016-2990-2415

School: Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)

Address: 6936 S. Hermitage

Chicago, IL, 60636

Building Contact:      Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 9/17/2025

Review Date: 09/25/2025

Inspector: Josh Herman      Inspector IDPH License: 100-21040  
Management Planner: Daniel Juneau      Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.



Daniel Juneau  
100-03613

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: September 26, 2025

RE: Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy), Unit 66591  
6936 S. Hermitage  
Chicago, IL, 60636

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy) , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy), there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Barbara A. Sizemore      Unit: 25051      Region: 05  
Academy of Betty Shabazz (Old Johns  
Academy)  
Address: 6936 S. Hermitage      Chicago, IL, 60636  
IDPH ID: 14-016-2990-2415      Building ID: 5540  
Contact:      Phone:

### 2. Description of Facility

Original Construction:      Additional Construction:  
Total Square Footage:      No of Floors:  
Current Occupancy: 375

### 3. LEA Designated Person

Contact: Richard J.Schleyer      Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Phone: 630-790-0880      Fax: 630-790-0882

### 5. Inspector

Inspector Name: Josh Herman

Inspector IDPH license # 100-21040  
Reinspection Date: 9/17/2025



Signature:  
Date: 9/17/2025

### 6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613




Signature:  
Date: 09/25/2025

### 7. Review Date: 09/25/2025

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

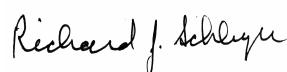

Date: 9/26/2025

Name: Richard J.Schleyer



## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy). This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5540:

25	Rope Boiler Gasket
27	12x12 Brown & Cream Floor Tile
27A	12x12 Brown & Cream Floor Tile Mastic
28	Black Carpet Mastic
29	Carpet Mastic
30	Sink Undercoating
31	Window Glazing
32	Grey Ceramic Tile Grout
33	Chalkboards

34

Gold Stage Curtains

NEW

Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 5540:

- 28                   Black Carpet Mastic
- 29                   Carpet Mastic
- 30                   Sink Undercoating
- 31                   Window Glazing
- 32                   Grey Ceramic Tile Grout
- 33                   Chalkboards
- 34                   Gold Stage Curtains

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

18	12x12 Floor Tile (Original)
19	12x12 Floor Tile Mastic
20	12x12 Floor Tile
21	12x12 Floor Tile Mastic
22	Ceramic Tile Grout
23	Terrazzo
24	Blue Carpet Mastic
25	Rope Boiler Gasket
26	Air Handler Vibration Collar
27	12x12 Brown & Cream Floor Tile
27A	12x12 Brown & Cream Floor Tile Mastic
28	Black Carpet Mastic
29	Carpet Mastic
30	Sink Undercoating
31	Window Glazing
32	Grey Ceramic Tile Grout
33	Chalkboards
34	Gold Stage Curtains
NEW	Newly Installed Suspect ACM

The following areas were deemed to be inaccessible:

15	9x9 Brown Floor Tile Mastic
17	9x9 Cream Floor Tile Mastic
19	12x12 Floor Tile Mastic
21	12x12 Floor Tile Mastic
24	Blue Carpet Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Josh Herman, IDPH License # 100-21040. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy) Building 5540 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

**School** Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy) **Unit** 25051 **Building ID** 5540  
**Address** 6936 S. Hermitage **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
14	9x9 Brown Floor Tile	3,200	SF	1st, 2nd & 3rd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	9x9 Brown Floor Tile Mastic	3,200	SF	1st, 2nd & 3rd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	9x9 Cream Floor Tile	3,200	SF	1st, 2nd & 3rd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
17	9x9 Cream Floor Tile Mastic	3,200	SF	1st, 2nd & 3rd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12x12 Floor Tile (Original)	1,886	SF	Room 202, 312 & 401	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
19	12x12 Floor Tile Mastic	1,886	SF	Room 202, 312 & 401	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12x12 Floor Tile	1,118	SF	1928 Building- Room 106 & Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
21	12x12 Floor Tile Mastic	1,118	SF	1928 Building- Room 106 & Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Ceramic Tile Grout	2,400	SF	Boys' and Girls' Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Terrazzo	2,900	SF	Stairs and Stair Landing	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Blue Carpet Mastic	2,052	SF	2nd Floor Teachers' Washroom, Assistant Principal's Office, Library, Assembly Hall, Main Office, Principal's Office, Room 308, 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Rope Boiler Gasket	6	LF	Boiler Room- Boiler Doors	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
26	Air Handler Vibration Collar	6	LF	Pump Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12x12 Brown & Cream Floor Tile	120	SF	Addition- New Elevator Lobbies on Each Floor	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
27A	12x12 Brown & Cream Floor Tile Mastic	120	SF	Addition- New Elevator Lobbies on Each Floor	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
28	Black Carpet Mastic	600	SF	Room 312	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
29	Carpet Mastic	2,800	SF	Rooms 105, 106, 205 & Basement	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy) **Unit** 25051 **Building ID** 5540  
**Address** 6936 S. Hermitage **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Offices										
30	Sink Undercoating	3	SF	Room 212	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
31	Window Glazing	900	LF	Throughout Building, All Windows	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
32	Grey Ceramic Tile Grout	1,000	SF	1st Floor Washrooms	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
33	Chalkboards	1,200	SF	Throughout, All Classrooms	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
34	Gold Stage Curtains	1,800	SF	Auditorium Stage & Windows	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
B	Cardboard Fittings NOT OBSERVED			Throughout School		TSI								
C	Cardboard Lag NOT OBSERVED			Throughout School		TSI								
D	Aircell Fittings NOT OBSERVED			Pipe Chases, Girls' & Boys' (Original) Basement Restrooms, 1st, 2nd, 3rd Floors		TSI								
E	Aircell Lag NOT OBSERVED			Pipe Chases, Boys' & Girls' Washroom, 1st, 2nd, 3rd Floors		TSI								
I	TSI- ABATED			1928 Building	ABATED	TSI								
J	TSI- ABATED			1928 Building-Abated	ABATED	TSI								
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKNO WN	0		Yes	ACBM with the potential for damage		

# Chicago Public Schools

**School** Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy) **Unit** 25051 **Building ID** 5540  
**Address** 6936 S. Hermitage **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date	<u>9/17/2025</u>
Inspector Name	<u>Josh Herman</u>
<b>100-21040</b>	<b>5/15/2026</b>
Inspector's IDPH License Number / Expiration Date	

#### Inspector's Comments

HA Number:	Inspector Comments:
14	Floor Tile Painted Black
15	Floor Tile Painted Black
16	Floor Tile Painted Black
17	Floor Tile Painted Black
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
27A	
28	
29	
30	
31	
32	
33	
34	
B	Not Observed Multiple Years, including 2025
C	Not Observed Multiple Years, including 2025

# Chicago Public Schools

**School** Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy) **Unit** 25051 **Building ID** 5540  
**Address** 6936 S. Hermitage **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
D	Not Observed Multiple Years, including 2025
E	Not Observed Multiple Years, including 2025
I	
J	
NEW	

**Table II**  
**Management Planner's Review**

---

# Chicago Public Schools

Barbara A. Sizemore  
 Academy of Betty Shabazz  
 (Old Johns Academy)  
**School**  
**Address** 6936 S. Hermitage

Unit 25051

Chicago, IL, 60636

Building ID 5540

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
14	9x9 Brown Floor Tile	3,200	SF	1st, 2nd & 3rd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	9x9 Brown Floor Tile Mastic	3,200	SF	1st, 2nd & 3rd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9x9 Cream Floor Tile	3,200	SF	1st, 2nd & 3rd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	9x9 Cream Floor Tile Mastic	3,200	SF	1st, 2nd & 3rd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12x12 Floor Tile (Original)	1,886	SF	Room 202, 312 & 401	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12x12 Floor Tile Mastic	1,886	SF	Room 202, 312 & 401	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12x12 Floor Tile	1,118	SF	1928 Building- Room 106 & Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12x12 Floor Tile Mastic	1,118	SF	1928 Building- Room 106 & Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Ceramic Tile Grout	2,400	SF	Boys' and Girls' Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Terrazzo	2,900	SF	Stairs and Stair Landing	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Blue Carpet Mastic	2,052	SF	2nd Floor Teachers' Washroom, Assistant Principal's Office, Library, Assembly Hall, Main Office, Principal's Office, Room 308, 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Rope Boiler Gasket	6	LF	Boiler Room- Boiler Doors	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
26	Air Handler Vibration Collar	6	LF	Pump Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
27	12x12 Brown & Cream Floor Tile	120	SF	Addition- New Elevator Lobbies on Each Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27A	12x12 Brown & Cream Floor Tile Mastic	120	SF	Addition- New Elevator Lobbies on Each Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Black Carpet Mastic	600	SF	Room 312	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Carpet Mastic	2,800	SF	Rooms 105, 106, 205 & Basement Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Sink Undercoating	3	SF	Room 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Window Glazing	900	LF	Throughout Building, All Windows	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
32	Grey Ceramic Tile Grout	1,000	SF	1st Floor Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	Chalkboards	1,200	SF	Throughout, All Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	Gold Stage Curtains	1,800	SF	Auditorium Stage & Windows	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	Cardboard Fittings NOT OBSERVED			Throughout School		TSI					
C	Cardboard Lag NOT OBSERVED			Throughout School		TSI					
D	Aircell Fittings NOT OBSERVED			Pipe Chases, Girls' & Boys' (Original) Basement Restrooms, 1st, 2nd, 3rd Floors		TSI					

# Chicago Public Schools

**School** Barbara A. Sizemore  
 Academy of Betty Shabazz  
 (Old Johns Academy) **Unit** 25051 **Building ID** 5540  
**Address** 6936 S. Hermitage **Chicago, IL, 60636** **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
E	Aircell Lag NOT OBSERVED			Pipe Chases, Boys' & Girls' Washroom, 1st, 2nd, 3rd Floors		TSI					
I	TSI- ABATED			1928 Building	Abated	TSI					
J	TSI- ABATED			1928 Building- Abated	Abated	TSI					
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC		0		6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

Barbara A. Sizemore  
Academy of Betty Shabazz  
(Old Johns Academy)  
**School**  
**Address** 6936 S. Hermitage

Unit 25051  
Chicago, IL, 60636

Building ID 5540  
Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

***Management Planner's Comments Summarized at the End of the Report***

Review Date	9/25/2025
Manager Planner Name	Daniel Juneau
100-03613	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
27A	
28	
29	
30	
31	
32	
33	
34	
B	
C	

# Chicago Public Schools

**School** Barbara A. Sizemore  
Academy of Betty Shabazz  
(Old Johns Academy)

**Unit** 25051

**Building ID** 5540

**Address** 6936 S. Hermitage

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
D	
E	
I	
J	
NEW	

## APPENDIX A

---

### Assessment Sheets, Drawings and Photos

**Chicago Public Schools**

**TEM Environmental, Inc.**

***2025 AHERA REINSPECTION***

# Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	9x9 Brown Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	3200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Floor Tile Painted Black		

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **9x9 Brown Floor Tile**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors**

MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	9x9 Brown Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	3200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Floor Tile Painted Black		

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **9x9 Brown Floor Tile Mastic**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors**

MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	9x9 Cream Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	3200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Floor Tile Painted Black		

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **9x9 Cream Floor Tile**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors**

MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	9x9 Cream Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	3200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Floor Tile Painted Black		

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **9x9 Cream Floor Tile Mastic**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors**

MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12x12 Floor Tile (Original)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	Room 202, 312 & 401		
MATERIAL QUANTITY:	1886	MATERIAL UNITS:	<b>SF</b>
DAMAGE QUANTITY:		DAMAGE UNITS:	<b>SF</b>
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **12x12 Floor Tile (Original)**

MATERIAL LOCATION: **Room 202, 312 & 401**

MATERIAL QUANTITY: **1886** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12x12 Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 202, 312 & 401		
MATERIAL QUANTITY:	1886	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **12x12 Floor Tile Mastic**

MATERIAL LOCATION: **Room 202, 312 & 401**

MATERIAL QUANTITY: **1886** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12x12 Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	<b>MODERATE</b>		
MATERIAL LOCATION:	1928 Building- Room 106 & Lunchroom		
MATERIAL QUANTITY:	1118	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **12x12 Floor Tile**

MATERIAL LOCATION: **1928 Building- Room 106 & Lunchroom**

MATERIAL QUANTITY: **1118** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12x12 Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1928 Building- Room 106 & Lunchroom		
MATERIAL QUANTITY:	1118	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **12x12 Floor Tile Mastic**

MATERIAL LOCATION: **1928 Building- Room 106 & Lunchroom**

MATERIAL QUANTITY: **1118** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	Ceramic Tile Grout		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boys' and Girls' Washrooms		
MATERIAL QUANTITY:	2400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Ceramic Tile Grout**

MATERIAL LOCATION: **Boys' and Girls' Washrooms**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairs and Stair Landing		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **Stairs and Stair Landing**

MATERIAL QUANTITY: **2900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUILDING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	Blue Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Teachers' Washroom, Assistant Principal's Office, Library, Assembly Hall, Main Office, Principal's Office, Room 308, 208		
MATERIAL QUANTITY:	2052	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUIDLING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Blue Carpet Mastic**

MATERIAL LOCATION: **2nd Floor Teachers' Washroom, Assistant Principal's Office, Library, Assembly Hall, Main Office, Principal's Office, Room 308, 208**

MATERIAL QUANTITY: **2052** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Management Planner's Signature: 

Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	Rope Boiler Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room- Boiler Doors		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Rope Boiler Gasket**

MATERIAL LOCATION: **Boiler Room- Boiler Doors**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	Air Handler Vibration Collar		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Pump Room		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Air Handler Vibration Collar**

MATERIAL LOCATION: **Pump Room**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12x12 Brown & Cream Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Addition- New Elevator Lobbies on Each Floor		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **12x12 Brown & Cream Floor Tile**

MATERIAL LOCATION: **Addition- New Elevator Lobbies on Each Floor**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27A		
MATERIAL DESCRIPTION:	12x12 Brown & Cream Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Addition- New Elevator Lobbies on Each Floor		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	DAMAGE UNITS: SF		
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **27A**

MATERIAL DESCRIPTION: **12x12 Brown & Cream Floor Tile Mastic**

MATERIAL LOCATION: **Addition- New Elevator Lobbies on Each Floor**

MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **Cardboard Fittings NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **FRIABLE**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:  MATERIAL UNITS:

DAMAGE QUANTITY:  DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years, including 2025**

Inspector's Signature:



Date: **09/17/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUIDLING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **Cardboard Fittings NOT OBSERVED**

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUILDING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: C

MATERIAL DESCRIPTION: Cardboard Lag NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout School

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed Multiple Years, including 2025

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Cardboard Lag NOT OBSERVED**

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUILDING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: D

MATERIAL DESCRIPTION: Aircell Fittings NOT OBSERVED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Pipe Chases, Girls' & Boys' (Original) Basement Restrooms, 1st, 2nd, 3rd Floors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed Multiple Years, including 2025

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Aircell Fittings NOT OBSERVED**

MATERIAL LOCATION: **Pipe Chases, Girls' & Boys' (Original) Basement Restrooms, 1st, 2nd, 3rd Floors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Aircell Lag NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **FRIABLE**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Pipe Chases, Boys' & Girls' Washroom, 1st, 2nd, 3rd Floors**

MATERIAL QUANTITY:  MATERIAL UNITS:

DAMAGE QUANTITY:  DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years, including 2025**

Inspector's Signature:



Date: **09/17/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Aircell Lag NOT OBSERVED**

MATERIAL LOCATION: **Pipe Chases, Boys' & Girls' Washroom, 1st, 2nd, 3rd Floors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUILDING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: I

MATERIAL DESCRIPTION: TSI- ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1928 Building

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **TSI- ABATED**

MATERIAL LOCATION: **1928 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUILDING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: J

MATERIAL DESCRIPTION: TSI- ABATED

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: Abated FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1928 Building- Abated

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUILDING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **TSI- ABATED**

MATERIAL LOCATION: **1928 Building- Abated**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	NEW	
MATERIAL DESCRIPTION:	Newly Installed Suspect ACM	
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Assumed	FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/17/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUIDLING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

---

HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: **0** DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	Black Carpet Mastic		
MATERIAL LOCATION:	Room 312		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25051** BUIDLING ID: **5540**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Barbara A. Sizemore  
Academy of Betty  
Shabazz (Old Johns  
Academy)** REVIEW DATE: **9/25/2025**

ADDRESS: **6936 S. Hermitage** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Black Carpet Mastic**

MATERIAL LOCATION: **Room 312**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Window Glazing		
MATERIAL LOCATION:	Throughout Building, All Windows		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	LF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25051** BUIDLING ID: **5540**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Barbara A. Sizemore  
Academy of Betty  
Shabazz (Old Johns  
Academy)** REVIEW DATE: **9/25/2025**

ADDRESS: **6936 S. Hermitage** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **Window Glazing**

MATERIAL LOCATION: **Throughout Building, All Windows**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Sink Undercoating		
MATERIAL LOCATION:	Room 212		
MATERIAL QUANTITY:	3	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25051** BUIDLING ID: **5540**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Barbara A. Sizemore  
Academy of Betty  
Shabazz (Old Johns  
Academy)** REVIEW DATE: **9/25/2025**

ADDRESS: **6936 S. Hermitage** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Sink Undercoating**

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	Grey Ceramic Tile Grout		
MATERIAL LOCATION:	1st Floor Washrooms		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25051** BUIDLING ID: **5540**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Barbara A. Sizemore  
Academy of Betty  
Shabazz (Old Johns  
Academy)** REVIEW DATE: **9/25/2025**

ADDRESS: **6936 S. Hermitage** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Grey Ceramic Tile Grout**

MATERIAL LOCATION: **1st Floor Washrooms**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Rooms 105, 106, 205 & Basement Offices		
MATERIAL QUANTITY:	2800	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	<b>Chicago Public Schools</b>	UNIT NUMBER:	<b>25051</b>	BUIDLING ID:	<b>5540</b>
CITY/STATE:	<b>Chicago, Illinois</b>	MANAGEMENT PLANNER:	<b>Daniel Juneau</b>		
SCHOOL NAME:	<b>Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)</b>	REVIEW DATE:	<b>9/25/2025</b>		
ADDRESS:	<b>6936 S. Hermitage</b>	IDPH LICENSE NO:	<b>100-21040</b>		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Carpet Mastic**

MATERIAL LOCATION: **Rooms 105, 106, 205 & Basement Offices**

MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	Chalkboards		
MATERIAL LOCATION:	Throughout, All Classrooms		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

## TEM Environmental, Inc. 2025 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25051** BUIDLING ID: **5540**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Barbara A. Sizemore  
Academy of Betty  
Shabazz (Old Johns  
Academy)** REVIEW DATE: **9/25/2025**

ADDRESS: **6936 S. Hermitage** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **Chalkboards**

MATERIAL LOCATION: **Throughout, All Classrooms**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	25051	BUIDLING ID:	5540
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Barbara A. Sizemore Academy of Betty Shabazz (Old Johns Academy)	INSPECTION DATE:	9/17/2025		
ADDRESS:	6936 S. Hermitage	IDPH LICENSE NO:	100-21040		

## INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	Gold Stage Curtains		
MATERIAL LOCATION:	Auditorium Stage & Windows		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 09/17/2025

# Chicago Public Schools

TEM Environmental, Inc.  
2025 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25051** BUIDLING ID: **5540**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**

SCHOOL NAME: **Barbara A. Sizemore  
Academy of Betty  
Shabazz (Old Johns  
Academy)** REVIEW DATE: **9/25/2025**

ADDRESS: **6936 S. Hermitage** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Gold Stage Curtains**

MATERIAL LOCATION: **Auditorium Stage & Windows**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **09/25/2025**

## APPENDIX B

---

### Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

**JOSH R HERMAN**  
5121 N MONITOR AVE  
CHICAGO, IL 60630

5/23/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 21040

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

**Front of License**

**Back of License**



**ASBESTOS  
PROFESSIONAL  
LICENSE**

**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

7/19/2025

ID NUMBER  
100 - 21040

ISSUED  
5/23/2025

EXPIRES  
05/15/2026

**JOSH R HERMAN**  
5121 N MONITOR AVE  
CHICAGO, IL 60630  
Environmental Health



**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**

*Nationally Accredited by PHAB*



**TEM ENVIRONMENTAL, INC.**  
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS



**ASBESTOS  
PROFESSIONAL  
LICENSE**

ID NUMBER  
**100 - 03613**

ISSUED  
**3/1/2022**

EXPIRES  
**05/15/2023**

DANIEL J JUNEAU  
1408 OAKWOOD AVENUE  
DES PLAINES, IL 60016

Environmental Health



**ENDORSEMENTS**

INSPECTOR

**TC EXPIRES**

11/19/2022

MANAGEMENT PLANNER

11/19/2022

PROJECT MANAGER

11/1/2022

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Dan Juneau**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2021

Exam Date: 11/19/2021

Expiration Date: 11/19/2022

Certificate Number: BIR2111192805

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Dan Juneau**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2021

Exam Date: 11/19/2021

Expiration Date: 11/19/2022

Certificate Number: MPR2111192816

A handwritten signature in black ink that reads "Kathy DeSalvo".

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

**DANIEL J JUNEAU**  
1408 OAKWOOD AVENUE  
DES PLAINES, IL 60016

4/3/2024

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 03613

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

Front of License		Back of License	
	<b>ASBESTOS PROFESSIONAL LICENSE</b>	<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
ID NUMBER 100 - 03613	ISSUED 4/3/2024	EXPIRES 05/15/2025	INSPECTOR 11/3/2024
<b>DANIEL J JUNEAU</b> 1408 OAKWOOD AVENUE DES PLAINES, IL 60016 Environmental Health			MANAGEMENT PLANNER 11/3/2024 PROJECT MANAGER 11/7/2024 AIR SAMPLING PROFESSIONAL
<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

DANIEL J JUNEAU  
1408 OAKWOOD AVENUE  
DES PLAINES, IL 60016

5/8/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 03613

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER <b>100 - 03613</b>	ISSUED <b>5/8/2025</b>	EXPIRES <b>05/15/2026</b>	INSPECTOR	11/1/2025
DANIEL J JUNEAU 1408 OAKWOOD AVENUE DES PLAINES, IL 60016 Environmental Health			MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	11/1/2025 11/13/2025
			<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Dan Juneau**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/12/2022

Exam Date: 12/12/2022

Expiration Date: 12/12/2023

Certificate Number: MPR2212123967

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

## Dan Juneau

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113645



Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2024

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2024

Exam Date: 11/1/2024

Expiration Date: 11/1/2025

Certificate Number: BIR2411013089

Course Credit Hours: BIR 4 Hours

A handwritten signature in blue ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street | Willowbrook, IL 60527 (630) 655-3900 | [www.otssafety.com](http://www.otssafety.com)

2024

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Dan Juneau

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2024

Exam Date: 11/1/2024

Expiration Date: 11/1/2025

Certificate Number: MPR2411013107

Course Credit Hours: MPR 4 Hours

A handwritten signature in blue ink that reads "Kristina Miczek".

Kristina Miczek, Training Manager

## APPENDIX C

---

### **Laboratory Accreditations**

## APPENDIX D

---

### Laboratory Results

## APPENDIX E

---

### Chain of Custody Forms

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>	Loc	Localized
	Dist	Distributed