

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2714  
SCHOOL NAME: Leland School  
ADDRESS OF SCHOOL: 5221 W. Congress  
CITY: Chicago, IL, 60644

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **8/17/2010**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 3/20/2013 ENROLLMENT 181  
IDPH INSPECTOR LICENSE NUMBER: 100-8785  
IDPH LICENSED INSPECTOR NAME (Please Print): Kathy Yurks  
IDPH MP LICENSE NUMBER: 100-03613  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



3/20/2013

*Signature of Designated Person*

*Date*

---

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Leland School**

5221 W. Congress  
Chicago, IL, 60644

Unit: 26391  
Building ID: 7320

IDPH ID Number: 14-016-2990-2714

**REPORT DATE:**

Wednesday, March 20, 2013

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

February 28, 2013

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 26391                      Region: 03                      IDPH ID: 14-016-2990-2714

School: Leland School                      Building ID: 7320

Address: 5221 W. Congress  
Chicago, IL, 60644

Building Contact:                      Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 3/20/2013

Inspector: Kathy Yurks                      Inspector IDPH License: 100-8785  
Management Planner: Daniel Juneau                      Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Daniel Juneau  
100-03613

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: February 28, 2013

RE: Leland School, Unit 26391  
5221 W. Congress  
Chicago, IL, 60644

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Leland School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Leland School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113.

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Leland School Unit: 26391 Region: 03  
Address: 5221 W. Congress Chicago, IL, 60644  
IDPH ID: 14-016-2990-2714 Building ID: 7320  
Contact: Phone:

### 2. Description of Facility

Original Construction: 1970 Additional Construction:  
Total Square Footage: 15400 No of Floors: 1  
Current Occupancy: 181

### 3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Dan Juneau  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Kathy Yurks


Inspector IDPH license # 100-8785

  
Signature:  
Date: 2/28/2013

### 6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

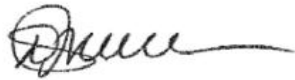  
Signature:  
Date: 3/20/2013

### 7. Review Date: 3/20/2013

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 3/20/2013

Name: Ms. Lynn Crivello

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Leland School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 7320:

3A	12" x 12" Dark Blue Floor Tile
7A	12" x 12" Dark Blue Floor Tile Mastic

B. The following new homogenous areas have been identified for Building 7320:

- |    |                                  |
|----|----------------------------------|
| 30 | 12" X 12" Grey Tile              |
| 31 | 12" x 12" Gray Floor Tile Mastic |



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

18	Wiring Insulation in Univents
19 A	12" x 12" White Floor Tile with Gray Streaks
19 B	12" x 12" White Floor Tile w/Gray Streaks Mastic
19 C	Ceiling Panels
19 D	4" Blond Vinyl Baseboard
19 E	4" Blond Vinyl Baseboard Mastic
19 F	White Plaster-like Material in Wall Panels
19 G	Possible Insulation Inside of Wall Panels
20	Roofing Material - Not AHERA
21	12" x 12" White Floor Tile w/Blue Streaks
22	12" x 12" White Floor Tile w/Blue Streaks Mastic
23	4" Black Vinyl Baseboard
24	4" Black Vinyl Baseboard Mastic
25	12x12 white with blue streaks
26	12x12 white with blue streaks mastic
27	2' x 4' Smooth Ceiling Tile
28	12" x 12" Beige w/Brown Specks Floor Tile
29	Mastic associated with 12" x 12" Beige w/Brown Specks FT
30	12" X 12" Grey Tile
31	12" x 12" Gray Floor Tile Mastic
3A	12" x 12" Dark Blue Floor Tile
7A	12" x 12" Dark Blue Floor Tile Mastic

The following areas were deemed to be inaccessible:

19 B	12" x 12" White Floor Tile w/Gray Streaks Mastic
19 E	4" Blond Vinyl Baseboard Mastic
19 F	White Plaster-like Material in Wall Panels
19 G	Possible Insulation Inside of Wall Panels
22	12" x 12" White Floor Tile w/Blue Streaks Mastic
24	4" Black Vinyl Baseboard Mastic
26	12x12 white with blue streaks mastic
29	Mastic associated with 12" x 12" Beige w/Brown Specks FT
31	12" x 12" Gray Floor Tile Mastic
7A	12" x 12" Dark Blue Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Kathy Yurks, IDPH License # 100-8785. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Leland School Building 7320 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Leland School Unit 26391 Building ID 7320

Address 5221 W. Congress Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
10	Blue Carpet Adhesive			Throughout Building	NO_ACBM	MISC								
11	Sheet Rock Material			Throughout Building	NO_ACBM	MISC								
12	Joint Compound Off Sheet Rock Material			Throughout Building	NO_ACBM	MISC								
13	Dark Blue Stair Cap Material			Stairway to Multipurpose Room	NO_ACBM	MISC								
14	Dark Blue Stair Cap Material Adhesive			Stairway to Multipurpose Room	NO_ACBM	MISC								
15	Plaster Material			Multi-purpose Room	NO_ACBM	MISC					No			
16	Burlap-Like Material			Multi-purpose Room and Kitchen Storage	NO_ACBM	MISC								
17	Metal Window Glazing Material - Not AHERA	2,400	LF	Exterior of Building	CHR	MISC	N							
18	Wiring Insulation in Univents	30	LF	Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19 A	12" x 12" White Floor Tile with Gray Streaks	1,540	SF	Throughout Modular Building	ASSUMED	MISC	N	NONE	100		No	ACBM with potential for significant damage		HIGH
19 B	12" x 12" White Floor Tile w/Gray Streaks Mastic	1,540	SF	Throughout Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19 C	Ceiling Panels	1,875	SF	Throughout Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
19 D	4" Blond Vinyl Baseboard	200	LF	Throughout Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19 E	4" Blond Vinyl Baseboard Mastic	200	LF	Throughout Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19 F	White Plaster-like Material in Wall Panels	1,875	SF	Throughout Modular Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19 G	Possible Insulation Inside of Wall Panels	1,000	SF	Throughout Modular Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
1A	12" x 12" Sandy Beige Floor Tile w/Mixed Streaks			Kitchen - ABATED	ABATED	MISC								
1B	12" x 12" Off White Floor Tile w/White Streaks			Dishwasher Room - ABATED	ABATED	MISC								
2	9"x9" Sandy Beige Floor Tile w/ Brown & Wht Strks			Multi-purpose Room, Kitchen Storage - ABATED	ABATED	MISC								
20	Roofing Material - Not AHERA			Exterior Roof	ASSUMED	MISC	N							
21	12" x 12" White Floor Tile w/Blue Streaks	1,984	SF	Multi-Purpose Room, Kitchen and Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
22	12" x 12" White Floor Tile w/Blue Streaks Mastic	1,984	SF	Multi-Purpose Room, Kitchen and	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW



# Chicago Public Schools

School Leland School Unit 26391 Building ID 7320

Address 5221 W. Congress Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Specks Mastic			ABATED										
7A	12" x 12" Dark Blue Floor Tile Mastic	98	SF	Stairway Area to Multipurpose Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
8	Black Vinyl Baseboard			Rooms 201-210, Kitchen Storage	NO_ACBM	MISC								
8A	Brown Vinyl Baseboard			Bathrooms and Kitchen Storage	NO_ACBM	MISC								
9	Black Vinyl Baseboard Adhesive			Rooms 201-210 and Kitchen Storage	NO_ACBM	MISC								
9A	Brown Vinyl Baseboard Adhesive			Bathrooms and Kitchen Storage	NO_ACBM	MISC								
A	Joint Compound off Fiberglass Pipe Insulation	100	LF	Throughout School	CHR	TSI	Y	LOC	1		No	Damaged or significantly damaged friable thermal system insulating ACBM		MODERATE

# Chicago Public Schools

School Leland School Unit 26391 Building ID 7320

Address 5221 W. Congress Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>2/28/2013</b>
Inspector Name <b>Kathy Yurks</b>
<b>100-8785</b> <b>5/15/2013</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
10	
11	
12	
13	
14	
15	
16	
17	
18	
19 A	
19 B	
19 C	
19 D	
19 E	
19 F	
19 G	
1A	Material gone
1B	Material not observed
2	Material not observed
20	
21	
22	
23	
24	



# Chicago Public Schools

School Leland School Unit 26391 Building ID 7320

Address 5221 W. Congress Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
25	
26	
27	
28	
29	
2A	Material not observed
2B	Material gone
30	
31	
3A	
4	
4A	
4B	
5A	
5B	
6	
6A	
6B	
7A	
8	
8A	
9	
9A	
A	

# Chicago Public Schools

**School** Leland School **Unit** 26391 **Building ID** 7320

**Address** 5221 W. Congress **Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Leland School  
**Address** 5221 W. Congress

**Unit** 26391  
 Chicago, IL, 60644

**Building ID** 7320  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
10	Blue Carpet Adhesive			Throughout Building	No ACBM	MISC					
11	Sheet Rock Material			Throughout Building	No ACBM	MISC					
12	Joint Compound Off Sheet Rock Material			Throughout Building	No ACBM	MISC					
13	Dark Blue Stair Cap Material			Stairway to Multipurpose Room	No ACBM	MISC					
14	Dark Blue Stair Cap Material Adhesive			Stairway to Multipurpose Room	No ACBM	MISC					
15	Plaster Material			Multi-purpose Room	No ACBM	MISC					
16	Burlap-Like Material			Multi-purpose Room and Kitchen Storage	No ACBM	MISC					
17	Metal Window Glazing Material - Not AHERA	2,400	LF	Exterior of Building	Chrysotile	MISC	No		LF		
18	Wiring Insulation in Univents	30	LF	Washrooms	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
19 A	12" x 12" White Floor Tile with Gray Streaks	1,540	SF	Throughout Modular Building	Assumed	MISC	No	100	SF	5 ACBM with potential for significant damage	Operations and Maintenance
19 B	12" x 12" White Floor Tile w/Gray Streaks Mastic	1,540	SF	Throughout Modular Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
19 C	Ceiling Panels	1,875	SF	Throughout Modular Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
19 D	4" Blond Vinyl Baseboard	200	LF	Throughout Modular Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
19 E	4" Blond Vinyl Baseboard Mastic	200	LF	Throughout Modular Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
19 F	White Plaster-like Material in Wall Panels	1,875	SF	Throughout Modular Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
19 G	Possible Insulation Inside of Wall Panels	1,000	SF	Throughout Modular Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
1A	12" x 12" Sandy Beige Floor Tile w/Mixed Streaks			Kitchen - ABATED	Abated	MISC					
1B	12" x 12" Off White Floor Tile w/White Streaks			Dishwasher Room - ABATED	Abated	MISC					
2	9"x9" Sandy Beige Floor Tile w/ Brown & Wht Strks			Multi-purpose Room, Kitchen Storage - ABATED	Abated	MISC					
20	Roofing Material - Not AHERA			Exterior Roof	Assumed	MISC	No				
21	12" x 12" White Floor Tile w/Blue Streaks	1,984	SF	Multi-Purpose Room, Kitchen and Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
22	12" x 12" White Floor Tile w/Blue Streaks Mastic	1,984	SF	Multi-Purpose Room, Kitchen and Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
23	4" Black Vinyl Baseboard	188	LF	Multi-Purpose Room, Kitchen and Storage	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
24	4" Black Vinyl Baseboard Mastic	188	LF	Multi-Purpose Room, Kitchen and Storage	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
25	12x12 white with blue streaks	12,000	SF	Throughout school	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
26	12x12 white with blue streaks mastic	12,000	SF	Throughout school	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27	2' x 4' Smooth Ceiling Tile	550	SF	Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
28	12" x 12" Beige w/Brown Specks Floor Tile	75	SF	Modular Building Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

# Chicago Public Schools

**School** Leland School  
**Address** 5221 W. Congress

**Unit** 26391  
 Chicago, IL, 60644

**Building ID** 7320  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
29	Mastic associated with 12" x 12" Beige w/Brown Specks FT	75	SF	Modular Building Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
2A	9" x 9" Off-White Floor Tile - ABATED			Multi-Purpose Room	Abated	MISC					
2B	9" x 9" Sandy Off White w/ Gray Specs Floor Tile			Kitchen Storage - ABATED	Abated	MISC					
30	12" X 12" Grey Tile	27	SF	Kitchen under fridge	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31	12" x 12" Gray Floor Tile Mastic	27	SF	Kitchen under fridge unit	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	
3A	12" x 12" Dark Blue Floor Tile	98	SF	Stairway Area to Multi-Purpose Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
4	2' x 4' Deep Pressed Wormy Pinhole Ceiling Panels			Throughout	No ACBM	MISC					
4A	2'x4' Small Speckled Wormy Pinhole Ceiling Panels			Throughout	No ACBM	MISC					
4B	2' x 4' Deep Pressed Wormy Pinhole Ceiling Panels			Throughout	No ACBM	MISC					
5A	12" x 12" Sandy Beige Floor Tile w/Streaks Mastic			Dishwasher Room/Kitchen	No ACBM	MISC					
5B	12"x12" Off-White Floor Tile w/Wh Streaks Mastic			Dishwasher Room - ABATED	Abated	MISC					
6	9"x9" Sandy Beige Floor Tile w/Brown & Wh Mastic			Multi-purpose Room, Kitchen Storage - ABATED	Abated	MISC					
6A	9" x 9" Off-White Floor Tile Mastic			Multipurpose Room - ABATED	Abated	MISC					
6B	9"x9" Off-White Floor Tile w/ Gray Specks Mastic			Kitchen Storage - ABATED	Abated	MISC					
7A	12" x 12" Dark Blue Floor Tile Mastic	98	SF	Stairway Area to Multipurpose Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
8	Black Vinyl Baseboard			Rooms 201-210, Kitchen Storage	No ACBM	MISC					
8A	Brown Vinyl Baseboard			Bathrooms and Kitchen Storage	No ACBM	MISC					
9	Black Vinyl Baseboard Adhesive			Rooms 201-210 and Kitchen Storage	No ACBM	MISC					
9A	Brown Vinyl Baseboard Adhesive			Bathrooms and Kitchen Storage	No ACBM	MISC					
A	Joint Compound off Fiberglass Pipe Insulation	100	LF	Throughout School	Chrysotile	TSI	Yes	1	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Operations and Maintenance

# Chicago Public Schools

**School** Leland School  
**Address** 5221 W. Congress

**Unit** 26391  
 Chicago, IL, 60644

**Building ID** 7320  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

*Management Planner's Comments Summarized at the End of the Report*

Review Date	3/20/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
10	
11	
12	
13	
14	
15	
16	
17	
18	
19 A	
19 B	
19 C	
19 D	

# Chicago Public Schools

**School** Leland School  
**Address** 5221 W. Congress

**Unit** 26391  
 Chicago, IL, 60644

**Building ID** 7320  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates  
 600 West Van Buren St., Ste 500  
 Phone: (312) 762-2900 Fax: (312) 782-5145

*Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
19 E	
19 F	
19 G	
1A	
1B	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
2A	
2B	
30	
31	
3A	
4	
4A	
4B	
5A	
5B	
6	

# Chicago Public Schools

**School** Leland School  
**Address** 5221 W. Congress

**Unit** 26391  
Chicago, IL, 60644

**Building ID** 7320  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates  
600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
6A	
6B	
7A	
8	
8A	
9	
9A	
A	



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Blue Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Blue Carpet Adhesive**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Sheet Rock Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **Sheet Rock Material**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Joint Compound Off Sheet Rock Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Joint Compound Off Sheet Rock Material**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Dark Blue Stair Cap Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Stairway to Multipurpose Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Dark Blue Stair Cap Material**

MATERIAL LOCATION: **Stairway to Multipurpose Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Dark Blue Stair Cap Material Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Stairway to Multipurpose Room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

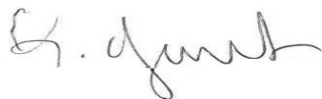

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Dark Blue Stair Cap Material Adhesive**

MATERIAL LOCATION: **Stairway to Multipurpose Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Plaster Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Multi-purpose Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

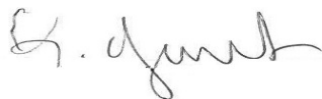

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Plaster Material**

MATERIAL LOCATION: **Multi-purpose Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Burlap-Like Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Multi-purpose Room and Kitchen Storage**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

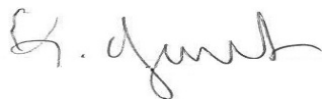

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Burlap-Like Material**

MATERIAL LOCATION: **Multi-purpose Room and Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Metal Window Glazing Material - Not AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of Building**

MATERIAL QUANTITY: **2400**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

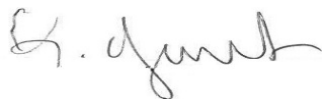

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Metal Window Glazing Material - Not AHERA**  
MATERIAL LOCATION: **Exterior of Building**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **LF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

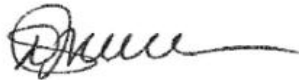

Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Wiring Insulation in Univents**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Washrooms**

MATERIAL QUANTITY: **30**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

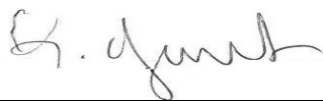

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Wiring Insulation in Univents**

MATERIAL LOCATION: **Washrooms**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

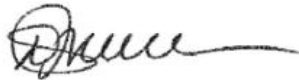

Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUILDING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 A**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile with Gray Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance Repair**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **1540**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 A**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile with Gray Streaks**  
MATERIAL LOCATION: **Throughout Modular Building**  
MATERIAL QUANTITY: **1540** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Operations and Maintenance  
Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUILDING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 B**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **1540**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

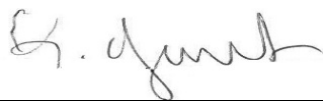

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 B**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Streaks Mastic**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **1540**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 C**  
MATERIAL DESCRIPTION: **Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Throughout Modular Building**  
MATERIAL QUANTITY: **1875** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 C**  
MATERIAL DESCRIPTION: **Ceiling Panels**  
MATERIAL LOCATION: **Throughout Modular Building**  
MATERIAL QUANTITY: **1875** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 D**  
MATERIAL DESCRIPTION: **4" Blond Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **200**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

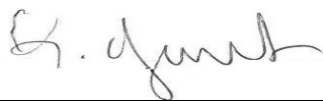

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 D**  
MATERIAL DESCRIPTION: **4" Blond Vinyl Baseboard**  
MATERIAL LOCATION: **Throughout Modular Building**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

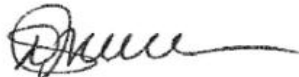

Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 E**  
MATERIAL DESCRIPTION: **4" Blond Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **200**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

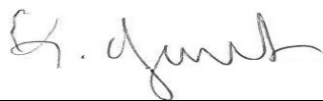

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 E**  
MATERIAL DESCRIPTION: **4" Blond Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **Throughout Modular Building**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 F**  
MATERIAL DESCRIPTION: **White Plaster-like Material in Wall Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **1875**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

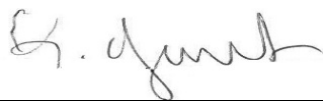

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 F**

MATERIAL DESCRIPTION: **White Plaster-like Material in Wall Panels**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **1875**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19 G**  
MATERIAL DESCRIPTION: **Possible Insulation Inside of Wall Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Modular Building**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **19 G**

MATERIAL DESCRIPTION: **Possible Insulation Inside of Wall Panels**

MATERIAL LOCATION: **Throughout Modular Building**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

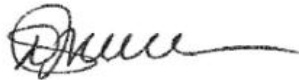

Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1A**  
MATERIAL DESCRIPTION: **12" x 12" Sandy Beige Floor Tile w/Mixed Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material gone**

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **1A**

MATERIAL DESCRIPTION: **12" x 12" Sandy Beige Floor Tile w/Mixed Streaks**

MATERIAL LOCATION: **Kitchen - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1B**  
MATERIAL DESCRIPTION: **12" x 12" Off White Floor Tile w/White Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Dishwasher Room - ABATED**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:

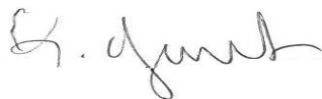

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **1B**

MATERIAL DESCRIPTION: **12" x 12" Off White Floor Tile w/White Streaks**

MATERIAL LOCATION: **Dishwasher Room - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **9"x9" Sandy Beige Floor Tile w/ Brown & Wht Strks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Multi-purpose Room, Kitchen Storage - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:

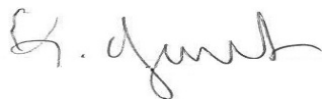

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **9"x9" Sandy Beige Floor Tile w/ Brown & Wht Strks**

MATERIAL LOCATION: **Multi-purpose Room, Kitchen Storage - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Roofing Material - Not AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior Roof**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

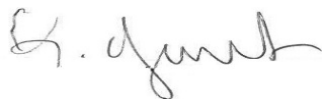

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Roofing Material - Not AHERA**

MATERIAL LOCATION: **Exterior Roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**  
MATERIAL QUANTITY: **1984** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

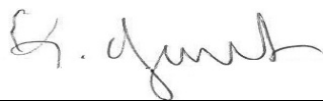

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks**  
MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**  
MATERIAL QUANTITY: **1984** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**

MATERIAL QUANTITY: **1984**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks Mastic**  
MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**  
MATERIAL QUANTITY: **1984** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**

MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

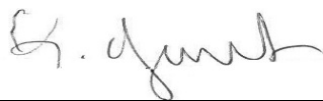

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard**  
MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**  
MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_

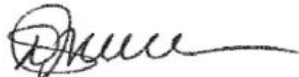

Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**

MATERIAL QUANTITY: **188**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

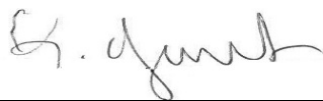

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **4" Black Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **Multi-Purpose Room, Kitchen and Storage**  
MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **12x12 white with blue streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Throughout school**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **12x12 white with blue streaks**  
MATERIAL LOCATION: **Throughout school**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **12x12 white with blue streaks mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout school**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

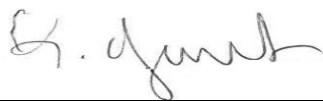

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **12x12 white with blue streaks mastic**  
MATERIAL LOCATION: **Throughout school**  
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **2' x 4' Smooth Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Bathrooms**

MATERIAL QUANTITY: **550**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

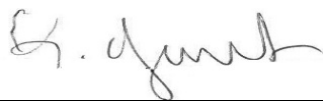

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **2' x 4' Smooth Ceiling Tile**

MATERIAL LOCATION: **Bathrooms**

MATERIAL QUANTITY: **550**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**

MATERIAL LOCATION: **Modular Building Bathrooms**

MATERIAL QUANTITY: **75**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Specks Floor Tile**  
MATERIAL LOCATION: **Modular Building Bathrooms**  
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Beige w/Brown Specks FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Modular Building Bathrooms**

MATERIAL QUANTITY: **75**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

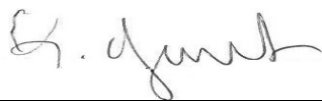

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Beige w/Brown Specks FT**  
MATERIAL LOCATION: **Modular Building Bathrooms**  
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2A**  
MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile - ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Multi-Purpose Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **2A**

MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile - ABATED**

MATERIAL LOCATION: **Multi-Purpose Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2B**  
MATERIAL DESCRIPTION: **9" x 9" Sandy Off White w/ Gray Specs Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen Storage - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material gone**

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **2B**

MATERIAL DESCRIPTION: **9" x 9" Sandy Off White w/ Gray Specs Floor Tile**

MATERIAL LOCATION: **Kitchen Storage - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3A**  
MATERIAL DESCRIPTION: **12" x 12" Dark Blue Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stairway Area to Multi-Purpose Room**

MATERIAL QUANTITY: **98**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

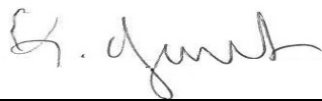

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **3A**  
MATERIAL DESCRIPTION: **12" x 12" Dark Blue Floor Tile**  
MATERIAL LOCATION: **Stairway Area to Multi-Purpose Room**  
MATERIAL QUANTITY: **98** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

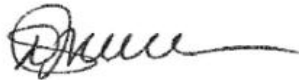

Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**  
MATERIAL DESCRIPTION: **2' x 4' Deep Pressed Wormy Pinhole Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

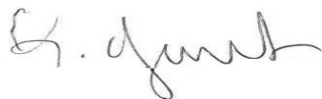

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **4**

MATERIAL DESCRIPTION: **2' x 4' Deep Pressed Wormy Pinhole Ceiling Panels**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4A**  
MATERIAL DESCRIPTION: **2'x4' Small Speckled Wormy Pinhole Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

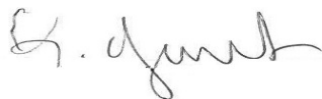

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **4A**

MATERIAL DESCRIPTION: **2'x4' Small Speckled Wormy Pinhole Ceiling Panels**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4B**  
MATERIAL DESCRIPTION: **2' x 4' Deep Pressed Wormy Pinhole Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **4B**

MATERIAL DESCRIPTION: **2' x 4' Deep Pressed Wormy Pinhole Ceiling Panels**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5A**  
MATERIAL DESCRIPTION: **12" x 12" Sandy Beige Floor Tile w/Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Dishwasher Room/Kitchen**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

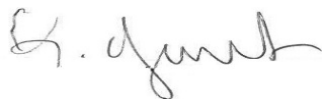

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **5A**  
MATERIAL DESCRIPTION: **12" x 12" Sandy Beige Floor Tile w/Streaks Mastic**  
MATERIAL LOCATION: **Dishwasher Room/Kitchen**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5B**  
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Wh Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Dishwasher Room - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **5B**

MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Wh Streaks Mastic**

MATERIAL LOCATION: **Dishwasher Room - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**  
MATERIAL DESCRIPTION: **9"x9" Sandy Beige Floor Tile w/Brown & Wh Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Multi-purpose Room, Kitchen Storage - ABATED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

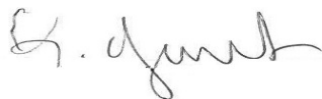

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **6**  
MATERIAL DESCRIPTION: **9"x9" Sandy Beige Floor Tile w/Brown & Wh Mastic**  
MATERIAL LOCATION: **Multi-purpose Room, Kitchen Storage - ABATED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6A**  
MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Multipurpose Room - ABATED**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

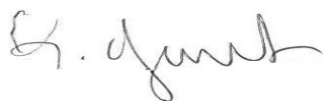

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **6A**

MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile Mastic**

MATERIAL LOCATION: **Multipurpose Room - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6B**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile w/ Gray Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen Storage - ABATED**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

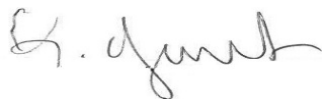

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **6B**

MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile w/ Gray Specks Mastic**

MATERIAL LOCATION: **Kitchen Storage - ABATED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7A**  
MATERIAL DESCRIPTION: **12" x 12" Dark Blue Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Stairway Area to Multipurpose Room**  
MATERIAL QUANTITY: **98** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

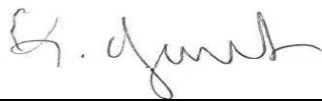

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **7A**  
MATERIAL DESCRIPTION: **12" x 12" Dark Blue Floor Tile Mastic**  
MATERIAL LOCATION: **Stairway Area to Multipurpose Room**  
MATERIAL QUANTITY: **98** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 201-210, Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **8**

MATERIAL DESCRIPTION: **Black Vinyl Baseboard**

MATERIAL LOCATION: **Rooms 201-210, Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8A**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Bathrooms and Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **8A**

MATERIAL DESCRIPTION: **Brown Vinyl Baseboard**

MATERIAL LOCATION: **Bathrooms and Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**  
MATERIAL DESCRIPTION: **Black Vinyl Baseboard Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 201-210 and Kitchen Storage**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **Black Vinyl Baseboard Adhesive**

MATERIAL LOCATION: **Rooms 201-210 and Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9A**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Bathrooms and Kitchen Storage**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

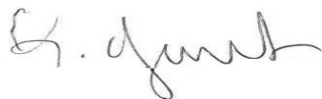

Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **9A**

MATERIAL DESCRIPTION: **Brown Vinyl Baseboard Adhesive**

MATERIAL LOCATION: **Bathrooms and Kitchen Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School** INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Joint Compound off Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Repair Operations and Maintenance**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **02/28/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

---

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Joint Compound off Fiberglass Pipe Insulation**  
MATERIAL LOCATION: **Throughout School**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **1** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair  
Operations and Maintenance**

Comments:

Management Planner's Signature: \_\_\_\_\_

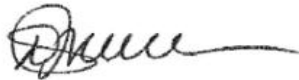

Date: **03/20/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)


LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **26391**      BUILDING ID: **7320**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School**      INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress**      IDPH LICENSE NO: **100-8785**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12" X 12" Grey Tile**  
MATERIAL LOCATION: **Kitchen under fridge**  
MATERIAL QUANTITY: **27**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **Yes**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **HIGH**      CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

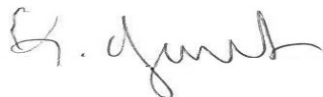

Date: 02/28/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUILDING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12" X 12" Grey Tile**  
MATERIAL LOCATION: **Kitchen under fridge**  
MATERIAL QUANTITY: **27** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_




Date: **03/20/2013**


K:\CPS 2011\2013 Three Year\A\Gad In\wings\Region 3\U\George Leland Elementary School\Leland First Floor.dwg



Parking Lot

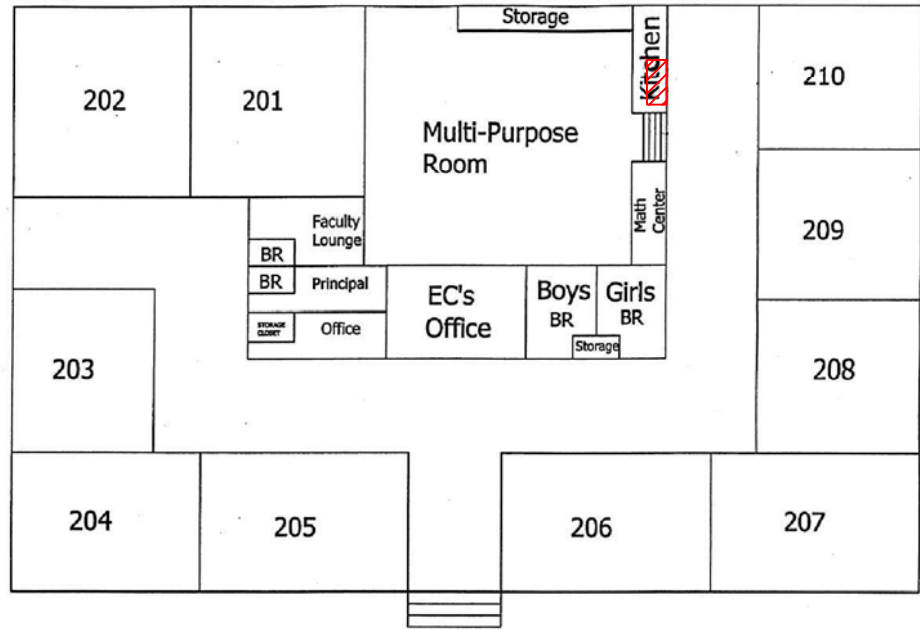

**ASBESTOS REINSPECTION KEY NOTES:**

 HA-30 12"x 12" Grey Floor Tile

Leland First Floor  
2013 Asbestos Reinspection



CLIENT:  
Chicago Public Schools  
125 South Clark Street,  
Chicago, Illinois 60603

PROJECT NAME:  
2013 AHERA Reinspection  
George Leland Elementary School  
5221 W Congress Pkwy  
Chicago, IL 60644

SHEET NAME:  
Leland First Floor - HA-30

INSPECTED BY:  
Kathy Yurks

DRAWN BY: MJW	DATE: 3/27/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #: 100- 08785

Carnow, Conibear & Assoc., Ltd.  
Environmental Consulting Services  
600 W. Van Buren St., Suite 500, Chicago, IL 60607  
t: 312.782.4486 f: 312.782.5145  
www.ccaatltd.com

**CARNOW  
CONIBEAR**

CCA PROJECT NUMBER  
A320130001-66

DATE  
02/28/2013

SHEET NUMBER  
**HA-30**

# Chicago Public Schools

Carnow, Conibear and Associates

## 2013 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)


LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **26391**      BUIDLING ID: **7320**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Kathy Yurks**  
SCHOOL NAME: **Leland School**      INSPECTION DATE: **2/28/2013**  
ADDRESS: **5221 W. Congress**      IDPH LICENSE NO: **100-8785**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile Mastic**  
MATERIAL LOCATION: **Kitchen under fridge unit**  
MATERIAL QUANTITY: **27**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION:  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Not Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:

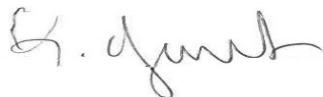

Date: **02/28/2013**



# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26391** BUILDING ID: **7320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Leland School** REVIEW DATE: **3/20/2013**  
ADDRESS: **5221 W. Congress** IDPH LICENSE NO: **100-8785**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile Mastic**

MATERIAL LOCATION: **Kitchen under fridge unit**

MATERIAL QUANTITY: **27**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_




Date: **03/20/2013**

K:\CPS 2011\2013 Three Year\A\Gad In\wings\Region 3\U\George Leland Elementary School\Leland First Floor.dwg



Parking Lot

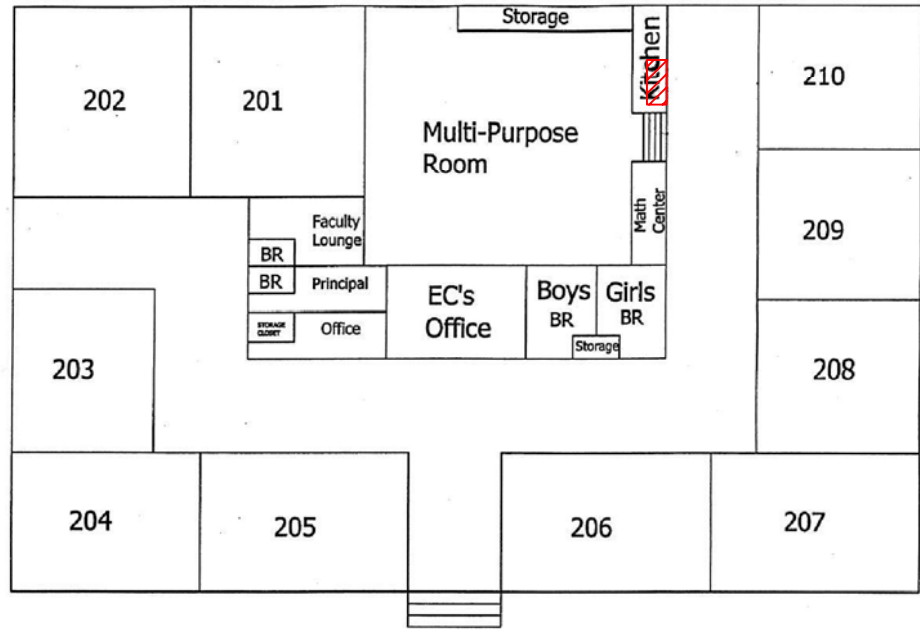

**ASBESTOS REINSPECTION KEY NOTES:**



HA-31 Mastic Associated with 12"x 12" Grey Floor Tile

Leland First Floor

2013 Asbestos Reinspection

NOT TO SCALE



CLIENT:  
Chicago Public Schools  
125 South Clark Street,  
Chicago, Illinois 60603

PROJECT NAME:  
2013 AHERA Reinspection  
George Leland Elementary School  
5221 W Congress Pkwy  
Chicago, IL 60644

SHEET NAME:  
Leland First Floor - HA-31

INSPECTED BY:  
Kathy Yurks

DRAWN BY: MJW	DATE: 3/27/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 08785

Carnow, Conibear & Assoc., Ltd.  
Environmental Consulting Services  
600 W. Van Buren St., Suite 500, Chicago, IL 60607  
t: 312.782.4486 f: 312.782.5145  
www.ccaatd.com

**CARNOW CONIBEAR**

CCA PROJECT NUMBER  
A320130001-66


DATE  
02/28/2013

SHEET NUMBER  
**HA-31**

# APPENDIX B

## Inspector and Management Planner Licenses

---

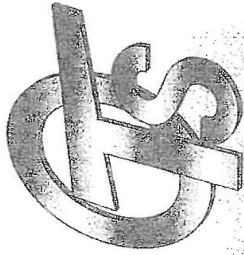

# Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

## Asbestos Building Inspector

Occupational Training and Supply, Inc. certifies that

# Kathy Yurks

has successfully completed the 24 hour Asbestos Building Inspector Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: ABIL206201045

Exam Date: 6/20/2012

Course Date: 6/18/2012-6/20/2012

Expiration Date: 6/20/2013

Kathy DeSalvo, Director

2012



**ASBESTOS  
PROFESSIONAL  
LICENSE**

**ID NUMBER**  
100 - 08785

**ISSUED**  
1/24/2013

**EXPIRES**  
05/15/2014

**KATHY YURKS**  
101 ROHRER PO BOX 32  
MUNCU, IL 61857

Environmental Health



**ENDORSEMENTS**


**TC EXPIRES**

INSPECTOR

6/20/2013

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

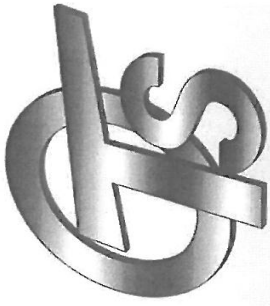

# Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

## Asbestos Building Inspector Refresher

*Occupational Training and Supply, Inc. certifies that*

# Daniel Juneau

**has successfully completed the 4 hour Asbestos Building Inspector Refresher Course**  
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department  
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance  
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

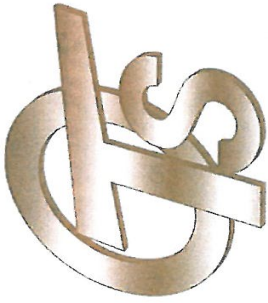

# Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Management Planner Refresher

*Occupational Training and Supply, Inc. certifies that*

# Daniel Juneau

**has successfully completed the 4 hour Asbestos Management Planner Refresher Course** and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

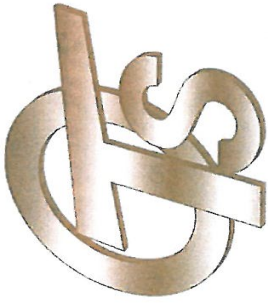

# Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Management Planner Refresher

*Occupational Training and Supply, Inc. certifies that*

# Daniel Juneau

**has successfully completed the 4 hour Asbestos Management Planner Refresher Course** and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013



# Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,  
Project Manager, and Air Sampling Professional



## ASBESTOS PROFESSIONAL LICENSE

ID NUMBER  
**100 - 03613**

ISSUED  
**4/11/2013**

EXPIRES  
**05/15/2014**

DANIEL J JUNEAU  
1408 OAKWOOD AVENUE  
DES PLAINES, IL 60016

Environmental Health



### ENDORSEMENTS

### TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

**CARNOW  
CONIBEAR**

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed