

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0009
SCHOOL NAME: DuSable Campus
ADDRESS OF SCHOOL: 4934 S. Wabash
CITY: Chicago, IL, 60615

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/22/2010

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/18/2013 ENROLLMENT 0


IDPH INSPECTOR LICENSE NUMBER: 100-02175

IDPH LICENSED INSPECTOR NAME (Please Print): Ethan Payne

IDPH MP LICENSE NUMBER: 100-03613

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113

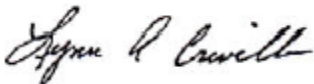

4/18/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

DuSable Campus

4934 S. Wabash
Chicago, IL, 60615

Unit: 46091
Building ID: 1280

IDPH ID Number: 14-016-2990-0009

REPORT DATE:

Thursday, April 18, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 1, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46091 Region: 04 IDPH ID: 14-016-2990-0009

School: DuSable Campus Building ID: 1280

Address: 4934 S. Wabash
Chicago, IL, 60615

Building Contact: Contact Phone:


Current Building Owners: Chicago Public Schools

Review Date: 4/18/2013

Inspector: Ethan Payne Inspector IDPH License: 100-02175
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 01, 2013

RE: DuSable Campus, Unit 46091
4934 S. Wabash
Chicago, IL, 60615

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at DuSable Campus , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at DuSable Campus, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: DuSable Campus
Address: 4934 S. Wabash
IDPH ID: 14-016-2990-0009
Contact:

Unit: 46091
Chicago, IL, 60615
Building ID: 1280
Phone:

Region: 04

2. Description of Facility

Original Construction:
Total Square Footage:
Current Occupancy: 0

Additional Construction:
No of Floors:

3. LEA Designated Person

Contact: Ms. Lynn Crivello
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

Phone: (773) 553-3113

4. Managing Environmental Consultant


MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900

Fax: (312) 782-5145

5. Inspector

Inspector Name: Ethan Payne


Inspector IDPH license # 100-02175

Signature: 
Date: 3/1/2013

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

Signature: 
Date: 4/18/2013

7. Review Date: 4/18/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/18/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the DuSable Campus. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1280:

100	Multi-Brown Ceramic Tile Grout
101	Spray-On Ceiling Material
102	Cream Colored Ceramic Tile Mastic
103	Light Blue Ceramic Tile Mastic
104	Swimming Pool Edge Mortar
105	Blue and Yellow Ceramic Tile Grout
106	Yellow Linoleum on Counter Top and Wall
108	Brown Baseboard
109	Brown Baseboard Mastic

110	12" x 12" Brown Floor Tile w/White Specks
112	Green Marble
113	Light Brown Terrazzo
114	Light Gray Terrazzo Flooring
12	Insulation on Boiler #1
128	Lab Counter Tops
13	Boiler #1 Gasket
135	Free Standing Lab Tables
136	12" x 12" Tan Floor Tile w/Brown Streaks
140	Brown Linoleum
148	Black and White Dots Linoleum
15	Red Tank Insulation
150	Aircell Pipe Insul.&Possibly in Inaccessible Areas
151	Joint Insul. assoc. w/ HA 151 & Inaccessible Areas
16	Insulation on Tank #2
17	Cementitious Incinerator Insulation
18	Gasket on Boiler #2
19	Insulation on Boiler #2
20	Pipe Insulation on Boiler #2
21	Insulation on Tank #1
22	Pipe Insulation
23	Air Duct Insulation
25	Terrazzo Wall & Stall
26	Black Board

27	White Marble
28	Black Marble
29	Cinderblock
30	Cinderblock Mortar
31	Pipe Insulation
32	Plaster Walls
33	Cementitious Pipe Joints
35	Fiberglass Pipe Insulation
38	Fiberglass Pipe Insulation
39	Interior Brick
40	Interior Brick Mortar
41	12" x 12" White Floor Tile w/ Blue Specks
42	12" x 12" White Floor Tile w/Blue Specks Mastic
45	12"x12" Brown Floor Tile w/White Streaks
47	Cinderblock
48	Cinderblock Mortar
49	Sound Proofing
50	Finished Block Mortar
53	Dark Brown & White Ceramic Tile Grout
56	2' x 4' Ceiling Panels
57	Drywall
58	1' x 1' Acoustical Ceiling Tile
59	Plaster
60	Corkboard

61	Pipe Chase Brick
62	Pipe Chase Brick Mortar
63	Terrazzo Stall Panels
64	Terrazzo Sinks
65	Light Brown & Tan Ceramic Tile Grout
67	Blue Carpet Mastic
68	Cement Flooring
69	12" x 12" White Floor Tile w/ Black Specks
70	12" x 12" White Floor Tile w/Black Specks Mastic
71	12" x 12" Off White Floor Tile w/Beige Specks
73	12" x 12" Tan Floor Tile w/ Light Brown Streaks
76	Terrazzo Flooring
77	Finished Brick Mortar
79	12" x 12" Off-White Floor Tile w/Gray Streaks
81	12" x 12" Cream Floor Tile w/White Streaks
83	Gray Carpet Mastic
96	12" x 12" Red Floor Tile
99	Brown Linoleum

B. The following new homogenous areas have been identified for Building 1280:

166	1'x1' White Ceiling Tile
167	1'x1' White Ceiling Tile Adhesive

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

100	Multi-Brown Ceramic Tile Grout
101	Spray-On Ceiling Material
102	Cream Colored Ceramic Tile Mastic
103	Light Blue Ceramic Tile Mastic
105	Blue and Yellow Ceramic Tile Grout
106	Yellow Linoleum on Counter Top and Wall
108	Brown Baseboard
109	Brown Baseboard Mastic
110	12" x 12" Brown Floor Tile w/White Specks
112	Green Marble
113	Light Brown Terrazzo
114	Light Gray Terrazzo Flooring
116	Exterior Brick Mortar - Not AHERA
117	Exterior Brick - Not AHERA
118	Exterior Brick Mortar - Not AHERA
119	Exterior Window Caulk - Not AHERA
12	Insulation on Boiler #1
122	Exterior Door Caulk - Not AHERA
123	Roofing Material - Not AHERA
124	Roof Flashing - Not AHERA
126	Greenish Brown Carpet Mastic
127	1' x 1' Ceiling Tile Adhesive
128	Lab Counter Tops
129	Liner in Vault Door
13	Boiler #1 Gasket
130	Green Carpet Mastic
131	Purple Carpet Mastic
132	Brown Carpet Mastic
133	Blue Carpet Mastic
134	Reddish Purple Carpet Mastic
135	Free Standing Lab Tables
136	12" x 12" Tan Floor Tile w/Brown Streaks
140	Brown Linoleum
142	12" x 12" Tan w/White Streaks Vinyl Floor Tile
143	12" x 12" Tan w/White Streaks Vinyl FT Mastic
144	12" x 12" Blue w/White Streaks Vinyl Floor Tile
145	12" x 12" Blue w/White Streaks Vinyl FT Mastic
146	12" x 12" Gray w/Beige & White Spots Floor Tile
147	12" x 12" Gray w/Beige & White Spots FT Mastic
148	Black and White Dots Linoleum
149	Black and White Dots Linoleum Mastic
15	Red Tank Insulation
150	Aircell Pipe Insul.&Possibly in Inaccessible Areas
151	Joint Insul. assoc. w/ HA 151 & Inaccessible Areas

152	Chalk Board/ Poster Board Adhesive
153	12" X 12" Off White w/Blue Swirls Floor Tile
154	12" X 12" Off White w/Blue Swirls Floor Tile Mastic
155	Brown Linoleum
156	Brown Linoleum Mastic
157	12" X 12" Off White Tan Mottle Floor Tile
158	12"X12" Off White Tan Mottle Floor Tile Mastic
159	12"X12" Tan Mottle Floor Tile
16	Insulation on Tank #2
160	12"X12" Tan Mottle Floor Tile Mastic
161	Linoleum
162	Linoleum Mastic
163	12"X12" Off White Grey Mottle Floor Tile
164	12"X12" Off White Grey Mottle Floor tile mastic
165	Sink Insulation
166	1'x1' White Ceiling Tile
167	1'x1' White Ceiling Tile Adhesive
17	Cementitious Incinerator Insulation
18	Gasket on Boiler #2
19	Insulation on Boiler #2
20	Pipe Insulation on Boiler #2
21	Insulation on Tank #1
22	Pipe Insulation
23	Air Duct Insulation
25	Terrazzo Wall & Stall
26	Black Board
27	White Marble
28	Black Marble
29	Cinderblock
30	Cinderblock Mortar
31	Pipe Insulation
32	Plaster Walls
33	Cementitious Pipe Joints
34	Spray-on Cementitious Material
35	Fiberglass Pipe Insulation
38	Fiberglass Pipe Insulation
39	Interior Brick
40	Interior Brick Mortar
41	12" x 12" White Floor Tile w/ Blue Specks
42	12" x 12" White Floor Tile w/Blue Specks Mastic
45	12"x12" Brown Floor Tile w/White Streaks
47	Cinderblock
48	Cinderblock Mortar
49	Sound Proofing
50	Finished Block Mortar
53	Dark Brown & White Ceramic Tile Grout
56	2' x 4' Ceiling Panels
57	Drywall
58	1' x 1' Acoustical Ceiling Tile
59	Plaster

60	Corkboard
61	Pipe Chase Brick
62	Pipe Chase Brick Mortar
63	Terrazzo Stall Panels
64	Terrazzo Sinks
65	Light Brown & Tan Ceramic Tile Grout
67	Blue Carpet Mastic
68	Cement Flooring
69	12" x 12" White Floor Tile w/ Black Specks
70	12" x 12" White Floor Tile w/Black Specks Mastic
71	12" x 12" Off White Floor Tile w/Beige Specks
73	12" x 12" Tan Floor Tile w/ Light Brown Streaks
75	Carpet Mastic on Planter
76	Terrazzo Flooring
77	Finished Brick Mortar
78	Locker Caulk
79	12" x 12" Off-White Floor Tile w/Gray Streaks
81	12" x 12" Cream Floor Tile w/White Streaks
83	Gray Carpet Mastic
96	12" x 12" Red Floor Tile
99	Brown Linoleum
FT-001	9x9 Carmel Colored Floor Tile

The following areas were deemed to be inaccessible:

102	Cream Colored Ceramic Tile Mastic
103	Light Blue Ceramic Tile Mastic
107	Yellow Linoleum Mastic on Counter Top and Wall
111	12" x 12" Brown Floor Tile w/White Specks Mastic
127	1' x 1' Ceiling Tile Adhesive
129	Liner in Vault Door
13	Boiler #1 Gasket
130	Green Carpet Mastic
131	Purple Carpet Mastic
132	Brown Carpet Mastic
133	Blue Carpet Mastic
134	Reddish Purple Carpet Mastic
137	12" x 12" Tan Floor Tile w/Brown Streaks Mastic
138	Cementitious Joint Insulation on Fiberglass Piping
143	12" x 12" Tan w/White Streaks Vinyl FT Mastic
145	12" x 12" Blue w/White Streaks Vinyl FT Mastic
147	12" x 12" Gray w/Beige & White Spots FT Mastic
149	Black and White Dots Linoleum Mastic
152	Chalk Board/ Poster Board Adhesive
160	12"X12" Tan Mottle Floor Tile Mastic
162	Linoleum Mastic
167	1'x1' White Ceiling Tile Adhesive
22	Pipe Insulation

37	Cementitious Pipe Joint Insulation
39	Interior Brick
42	12" x 12" White Floor Tile w/Blue Specks Mastic
44	9" x 9" Tan Floor Tile w/White Streaks Mastic
46	12" x 12" Brown Floor Tile w/White Streaks Mastic
52	9" x 9" Brown Floor Tile w/White Streaks Mastic
55	9"x9" Dark Brown Floor Tile w/White Streaks Mastic
70	12" x 12" White Floor Tile w/Black Specks Mastic
72	12"x12" Off White Floor Tile w/Beige Specks Mastic
74	12" x 12" Tan Floor Tile w/Lt Brn Streaks Mastic
80	12"x12" Off-White Floor Tile w/Gray Streaks Mastic
83	Gray Carpet Mastic
85	9" x 9" Red Floor Tile Mastic
87	9" x 9" Black Floor Tile Mastic
89	9" x 9" Burnt Orange Floor Tile Mastic
91	9" x 9" Chocolate Brown Floor Tile Mastic
93	Black Border Floor Tile Mastic
95	9" x 9" Black Floor Tile Mastic
97	12" x 12" Red Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ethan Payne, IDPH License # 100-02175. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The DuSable Campus Building 1280 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
100	Multi-Brown Ceramic Tile Grout			Gym Office Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
101	Spray-On Ceiling Material	900	SF	1st and 2nd Floor Corridors (1962 Addition)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
102	Cream Colored Ceramic Tile Mastic	400	SF	1st Floor Girl's Locker Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
103	Light Blue Ceramic Tile Mastic	200	SF	Swimming Pool Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
104	Swimming Pool Edge Mortar	120	LF	Swimming Pool	ANT	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
105	Blue and Yellow Ceramic Tile Grout	200	SF	Swimming Pool, Girl's Locker Room, Boy's Locker Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
106	Yellow Linoleum on Counter Top and Wall	50	SF	Room 113	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
107	Yellow Linoleum Mastic on Counter Top and Wall	300	SF	Room 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
108	Brown Baseboard	75	SF	Room 113	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
109	Brown Baseboard Mastic	75	SF	Room 113	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
110	12" x 12" Brown Floor Tile w/White Specks	2,400	SF	1st Floor Lunchroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
111	12" x 12" Brown Floor Tile w/White Specks Mastic	2,400	SF	First Floor Lunchroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
112	Green Marble	120	SF	Auditorium	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
113	Light Brown Terrazzo	140	SF	Outside Auditorium	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
114	Light Gray Terrazzo Flooring	120	SF	Outside Auditorium	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
115	Exterior Brick - Not AHERA	580,000	SF	Exterior of 1934 Building	CHR	MISC					No			
116	Exterior Brick Mortar - Not AHERA	580,000	SF	Exterior of 1934 Building	ASSUMED						No			
117	Exterior Brick - Not AHERA	580,000	SF	Exterior of 1962 Addition	ASSUMED	MISC					No			
118	Exterior Brick Mortar - Not AHERA	580,000	SF	Exterior of 1962 Addition	ASSUMED	MISC					No			
119	Exterior Window Caulk - Not AHERA	4,800	SF	1934 Building	ASSUMED	MISC					No			
12	Insulation on Boiler #1	360	SF	Boiler Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
120	Exterior Window Caulk - Not AHERA	4,800		1962 Addition	CHR						No			
121	Exterior Door Caulk - Not AHERA	280		1934 Building	CHR						No			
122	Exterior Door Caulk - Not AHERA	280	LF	1962 Addition	ASSUMED	MISC					No			
123	Roofing Material - Not AHERA	105,600	SF	Roof	ASSUMED						No			
124	Roof Flashing - Not AHERA	700	LF	Roof	ASSUMED						No			
126	Greenish Brown Carpet Mastic	0	SF	Room 324	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
127	1' x 1' Ceiling Tile Adhesive	10,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
128	Lab Counter Tops	1,008	SF	Rooms 129, 135, 233, 235, 266, 327, and 329	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
129	Liner in Vault Door	32	SF	Room 327	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Boiler #1 Gasket	16	LF	Boiler Room Boiler #1	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
130	Green Carpet Mastic	1,450	SF	Room 220, 117, 103	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
131	Purple Carpet Mastic	750	SF	Room 217	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
132	Brown Carpet Mastic	750	SF	Room 165	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
133	Blue Carpet Mastic	750	SF	Room 115	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
134	Reddish Purple Carpet Mastic	2,250	SF	Rooms 121, 123, and 125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
135	Free Standing Lab Tables	769	SF	Rooms 129, 135, 233, 235, 327, and 329	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
136	12" x 12" Tan Floor Tile w/Brown Streaks			Room 348	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
137	12" x 12" Tan Floor Tile w/Brown Streaks Mastic	750	SF	Room 348	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
138	Cementitious Joint Insulation on Fiberglass Piping	400	LF	Basement/Tunnel	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
139	Transite Table Top	0	SF	Room 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Pipe Insulation			Boiler Room Behind Red Tank	ABATED	TSI								
140	Brown Linoleum	400	SF	Room 109	ASSUMED	MISC		NONE	0		Yes	ACBM with the potential for damage		LOW
141	Brown Linoleum Mastic	400	SF	Room 109	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
142	12" x 12" Tan w/White Streaks Vinyl Floor Tile	900	SF	Room 235	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
143	12" x 12" Tan w/White Streaks Vinyl FT Mastic	900	SF	Room 235	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
144	12" x 12" Blue w/White Streaks Vinyl Floor Tile	100	SF	Room 165 Health Center	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
145	12" x 12" Blue w/White Streaks Vinyl FT Mastic	100	SF	Room 165 Health Center	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
146	12" x 12" Gray w/Beige & White Spots Floor Tile	4,200	SF	Room 230 (Lunchroom)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
147	12" x 12" Gray w/Beige & White Spots FT Mastic	4,200	SF	Room 230	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
148	Black and White Dots Linoleum	120	SF	Gym Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
149	Black and White Dots Linoleum Mastic	120	SF	Gym Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Red Tank Insulation	96	SF	Boiler Room	ASSUMED	TSI	N	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
150	Aircell Pipe Insul.&Possibly in Inaccessible Areas	0	SF	2nd flr Girl's Washrm's by Library&227, 2nd flr Boy's Washrm by 235, 1st flr Women's Faculty Washrm	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
151	Joint Insul. assoc. w/ HA 151 & Inaccessible Areas	0	SF	2nd floor Girl's Washrooms by Library & 227, Boy's Bathroom by 235	ASSUMED	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
152	Chalk Board/ Poster Board Adhesive	15,200	SF	Throughout All Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
153	12" X 12" Off White w/Blue Swirls Floor Tile	1,850	SF	Rm. 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
154	12" X 12" Off White w/Blue Swirls Floor Tile Mastic	100	SF	Rm. 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
155	Brown Linoleum	100	SF	Rm 121	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
156	Brown Linoleum Mastic	100	SF	Rm 121	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
157	12" X 12" Off White Tan Mottle Floor Tile	800	SF	Rm 302	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
158	12"X12" Off White Tan Mottle Floor Tile Mastic	800	SF	Rm 302	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
159	12"X12" Tan Mottle Floor Tile	1,200	SF	Rm 109	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
16	Insulation on Tank #2	96	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
160	12"X12" Tan Mottle Floor Tile Mastic	1,200	SF	Rm 109	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
161	Linoleum	3,700	SF	Science Rooms. Rm.329, 335, 346	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
162	Linoleum Mastic	3,700	SF	Science Room. Rm. 329, 335, 346	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
163	12"X12" Off White Grey Mottle Floor Tile	1,100	SF	Rm 113	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
164	12"X12" Off White Grey Mottle Floor tile mastic	1,100	SF	Rm 113	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
165	Sink Insulation	4	SF	Rm 121	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
166	1'x1' White Ceiling Tile	17,500	SF	Gymnasiums 256, 257, and 258	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
167	1'x1' White Ceiling Tile Adhesive	17,500	SF	Gymnasiums 256, 257 and 258	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Cementitious Incinerator Insulation		SF	Boiler Room	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		LOW
18	Gasket on Boiler #2	18	LF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
19	Insulation on Boiler #2	268	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
20	Pipe Insulation on Boiler #2	20	LF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
21	Insulation on Tank #1	288	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
22	Pipe Insulation	20	LF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
23	Air Duct Insulation		SF	In Circuit Breaker Room	ASSUMED	TSI	N	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
24	Mag Block Pipe Insulation	150	LF	2nd Level of Boiler Room by Outer Wall	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
25	Terrazzo Wall & Stall	216	SF	Washrooms Throughout Facility	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
26	Black Board	24	SF	Boiler Room Wall by Stairs	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
27	White Marble	200	SF	Washrooms Throughout Facility	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
28	Black Marble	200	SF	Washrooms Throughout Facility	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
29	Cinderblock	580,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
30	Cinderblock Mortar	580,000	SF	Throughout Original Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
31	Pipe Insulation	18	LF	Next to Plenum #2	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
32	Plaster Walls	475,200	SF	Basement	ASSUMED	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
33	Cementitious Pipe Joints	475,200	SF	Wind Tunnel #6	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
34	Spray-on Cementitious Material			Wall by Fan Room 7	ASSUMED	MISC								
35	Fiberglass Pipe Insulation	80	SF	Next to Fan Room # 8	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
36	Fittings on Fiberglass Pipe Insulation	570	LF	Under New Addition, Air Tunnel # 8	AMO	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
37	Cementitious Pipe Joint Insulation	0	LF	Engine Room West Side Next to Fan Room # 7	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
38	Fiberglass Pipe Insulation	120	LF	Fan Room #2	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
39	Interior Brick	1,632	SF	Boiler Room	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		LOW
40	Interior Brick Mortar	1,632	SF	Boiler Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
41	12" x 12" White Floor Tile w/ Blue Specks	2,646	SF	1962 Addition 3rd Floor Corridor	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
42	12" x 12" White Floor Tile w/Blue Specks Mastic	2,640	SF	1962 Addition 3rd Floor Corridor	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
43	9" x 9" Tan Floor Tile w/White Streaks	34,400	SF	1st,2nd & 3rd Fl Halls,101,104,105,1	CHR	MISC	N	NONE	0		No	ACBM with potential for significant damage	5	HIGH

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				06,107,108,154,201, 203-207,261,263-270,301-305,307,308, 350,364-370										
44	9" x 9" Tan Floor Tile w/White Streaks Mastic	34,400	SF	1st,2nd & 3rd Fl Halls,101,104,105,1 06,107,108,154,201, 203-207,261,263-270,301-305,307,308,350,36 4-370	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12"x12" Brown Floor Tile w/White Streaks	8,012	SF	Rooms 126, 365, 364, 367, 366, 369, 370	ASSUMED	MISC		NONE	0		Yes	ACBM with the potential for damage		MODERATE
46	12" x 12" Brown Floor Tile w/White Streaks Mastic	4,200	SF	Rooms 365, 364, and 367	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	Cinderblock			Throughout 1962 Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
48	Cinderblock Mortar	580,000	SF	Throughout 1962 Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
49	Sound Proofing	80	SF	Rm 206 Storage	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
50	Finished Block Mortar	26,000	SF	Throughout 1934 Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
51	9" x 9" Brown Floor Tile w/White Streaks	12,000	SF	1st,2nd & 3rd Fl Halls,101,104,105,1 06,107,108,154,201, 203-207,261,263-270,301-305,307,308,334,35 0,364-370	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
52	9" x 9" Brown Floor Tile w/White Streaks Mastic	12,000	SF	1st,2nd & 3rd Fl Halls,101,104,105,1 06,107,108,154,201, 203-207,261,263-270,301-305,307,308,334,35 0,364-370	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	Dark Brown & White Ceramic Tile Grout	544	SF	2nd Floor Men's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
54	9" x 9" Dark Brown Floor Tile w/White Streaks	50	SF	Room 208	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
55	9"x9" Dark Brown Floor Tile w/White	50	SF	Rm 208	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Streaks Mastic											potential for damage		
56	2' x 4' Ceiling Panels	3,468	SF	Rooms 301, 302, and 303	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
57	Drywall	12,000	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
58	1' x 1' Acoustical Ceiling Tile	1,600	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
59	Plaster	130,000	SF	Throughout 1934 Building	ASSUMED	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
60	Corkboard	40	SF	Rooms 311 and 313	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
61	Pipe Chase Brick	96	SF	3rd Floor Next to Men's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
62	Pipe Chase Brick Mortar	96	SF	3rd Floor Next to Men's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
63	Terrazzo Stall Panels	8	SF	3rd Floor Men's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
64	Terrazzo Sinks	4	SF	3rd Floor Men's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
65	Light Brown & Tan Ceramic Tile Grout	40	SF	Women's 3rd Floor Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
66	Red Carpet Mastic			Auditorium	ABATED	MISC					No			
67	Blue Carpet Mastic			Music Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
68	Cement Flooring	596	SF	Rm 335	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
69	12" x 12" White Floor Tile w/ Black Specks	1,200	SF	Rooms 113, 109, 231, and 329	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
70	12" x 12" White Floor Tile w/Black Specks Mastic	1,200	SF	Rooms 113, 109, 231, and 329	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
71	12" x 12" Off White Floor Tile w/Beige Specks	3,080	SF	1st, 2nd & 3rd Floor Corridors, Rooms 327 and 329	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
72	12"x12" Off White Floor Tile w/Beige Specks Mastic	18,800	SF	1st, 2nd & 3rd Floor Corridors, Rooms 327 and 329	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	12" x 12" Tan Floor Tile w/ Light Brown Streaks	42	SF	3rd Floor Safe Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
74	12" x 12" Tan Floor Tile w/Lt Brn Streaks	540	SF	3rd Floor Safe	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Mastic			Room, Rm. 318, 332								potential for damage		
75	Carpet Mastic on Planter			Greenhouse	ASSUMED	MISC	N							
76	Terrazzo Flooring	580	SF	1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
77	Finished Brick Mortar	580,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
78	Locker Caulk			Throughout Facility	ASSUMED	MISC					No			
79	12" x 12" Off-White Floor Tile w/Gray Streaks	2,108	SF	2nd Floor Lunchroom and Room 230	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
80	12"x12" Off-White Floor Tile w/Gray Streaks Mastic	2,400	SF	2nd Floor Lunchroom, Room 230	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
81	12" x 12" Cream Floor Tile w/White Streaks	360	SF	Room 233 and 235	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
82	12" x 12" Cream Floor Tile w/White Streaks Mastic	750	SF	Room 233 and 235	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
83	Gray Carpet Mastic	450	SF	Room 251 and 253	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
84	9" x 9" Red Floor Tile	380	SF	Rooms 360, 260, 109 and 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
85	9" x 9" Red Floor Tile Mastic	380	SF	Rooms 360, 260, 109 and 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
86	9" x 9" Black Floor Tile	380	SF	Rooms 360, 260, 109 and 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
87	9" x 9" Black Floor Tile Mastic	380	SF	Rooms 360, 260, 109 and 113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
88	9" x 9" Burnt Orange Floor Tile	300	SF	Gym Office, Rms 110 and 112	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
89	9" x 9" Burnt Orange Floor Tile Mastic	300	SF	Gym Office, Rms 110 and 112	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
90	9" x 9" Chocolate Brown Floor Tile	350	SF	Gym Office, Rms 110 and 112, Vault	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
91	9" x 9" Chocolate Brown Floor Tile Mastic	350	SF	Gym Office, Rms 110 and 112, Vault	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
92	Black Border Floor Tile	40	LF	Door by North Gym	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
93	Black Border Floor Tile Mastic	40	LF	Door by North Gym	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
94	9" x 9" Black Floor Tile	12	SF	Gym Closet	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
95	9" x 9" Black Floor Tile Mastic	12	SF	Gym Closet	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
96	12" x 12" Red Floor Tile	6	SF	Under Desk in Gym	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the		LOW

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Office								potential for damage		
97	12" x 12" Red Floor Tile Mastic	6	SF	Under Desk in Gym Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
98	12x12 Carmel Colored Floor Tile	1,850	SF	Gym Washroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
99	Brown Linoleum	100	SF	Rm 109	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		HIGH
FT-001	9x9 Carmel Colored Floor Tile	30	SF	Gymnasium Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/1/2013
Inspector Name Ethan Payne
100-02175 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
100	
101	
102	
103	
104	
105	
106	
107	
108	
109	
110	
111	
112	
113	
114	
115	Not AHERA
116	Not AHERA
117	Not AHERA
118	Not AHERA
119	Not AHERA
12	
120	Not AHERA
121	Not AHERA
122	Not AHERA

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
123	Not AHEAR
124	Not AHERA
126	
127	
128	
129	
13	
130	
131	
132	
133	
134	
135	
136	
137	
138	
139	
14	Material was not observed - 2013 3 years re-inspection
140	
141	
142	
143	
144	
145	
146	
147	
148	
149	
15	

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
150	
151	
152	
153	
154	
155	
156	
157	
158	
159	
16	
160	
161	
162	
163	
164	
165	
166	
167	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
27	
28	
29	
30	
31	
32	
33	
34	Material was not observed - 2013 3 years re-inspection
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	Material was not observed - 2013 3 years re-inspection
67	
68	
69	
70	
71	
72	
73	
74	
75	Material was not observed - 2013 3 years re-inspection
76	
77	
78	Material was not observed - 2013 3 years re-inspection
79	
80	
81	
82	
83	
84	

Chicago Public Schools

School DuSable Campus Unit 46091 Building ID 1280

Address 4934 S. Wabash Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
85	
86	
87	
88	
89	
90	
91	
92	
93	
94	
95	
96	
97	
98	
99	
FT-001	

Table II

Management Planner's Review

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
100	Multi-Brown Ceramic Tile Grout			Gym Office Washroom	Assumed	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
101	Spray-On Ceiling Material	900	SF	1st and 2nd Floor Corridors (1962 Addition)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
102	Cream Colored Ceramic Tile Mastic	400	SF	1st Floor Girl's Locker Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
103	Light Blue Ceramic Tile Mastic	200	SF	Swimming Pool Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
104	Swimming Pool Edge Mortar	120	LF	Swimming Pool	Anthophyllite	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
105	Blue and Yellow Ceramic Tile Grout	200	SF	Swimming Pool, Girl's Locker Room, Boy's Locker Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
106	Yellow Linoleum on Counter Top and Wall	50	SF	Room 113	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
107	Yellow Linoleum Mastic on Counter Top and Wall	300	SF	Room 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
108	Brown Baseboard	75	SF	Room 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
109	Brown Baseboard Mastic	75	SF	Room 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
110	12" x 12" Brown Floor Tile w/White Specks	2,400	SF	1st Floor Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
111	12" x 12" Brown Floor Tile w/White Specks Mastic	2,400	SF	First Floor Lunchroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
112	Green Marble	120	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
113	Light Brown Terrazzo	140	SF	Outside Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
114	Light Gray Terrazzo Flooring	120	SF	Outside Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
115	Exterior Brick - Not AHERA	580,000	SF	Exterior of 1934 Building	Chrysotile	MISC			SF		
116	Exterior Brick Mortar - Not AHERA	580,000	SF	Exterior of 1934 Building	Assumed				SF		
117	Exterior Brick - Not AHERA	580,000	SF	Exterior of 1962 Addition	Assumed	MISC			SF		
118	Exterior Brick Mortar - Not AHERA	580,000	SF	Exterior of 1962 Addition	Assumed	MISC			SF		
119	Exterior Window Caulk - Not AHERA	4,800	SF	1934 Building	Assumed	MISC			SF		
120	Insulation on Boiler #1	360	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
121	Exterior Window Caulk - Not AHERA	4,800		1962 Addition	Chrysotile						
122	Exterior Door Caulk - Not AHERA	280		1934 Building	Chrysotile						
123	Exterior Door Caulk - Not AHERA	280	LF	1962 Addition	Assumed	MISC			LF		
124	Roofing Material - Not AHERA	105,600	SF	Roof	Assumed				SF		
126	Roof Flashing - Not AHERA	700	LF	Roof	Assumed				LF		
127	Greenish Brown Carpet Mastic	0	SF	Room 324	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
128	1' x 1' Ceiling Tile Adhesive	10,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
129	Lab Counter Tops	1,008	SF	Rooms 129, 135, 233, 235, 266, 327, and 329	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
129	Liner in Vault Door	32	SF	Room 327	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
13	Boiler #1 Gasket	16	LF	Boiler Room Boiler #1	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
130	Green Carpet Mastic	1,450	SF	Room 220, 117, 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
131	Purple Carpet Mastic	750	SF	Room 217	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
132	Brown Carpet Mastic	750	SF	Room 165	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
133	Blue Carpet Mastic	750	SF	Room 115	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
134	Reddish Purple Carpet Mastic	2,250	SF	Rooms 121, 123, and 125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
135	Free Standing Lab Tables	769	SF	Rooms 129, 135, 233, 235, 327, and 329	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
136	12" x 12" Tan Floor Tile w/Brown Streaks			Room 348	Assumed	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
137	12" x 12" Tan Floor Tile w/Brown Streaks Mastic	750	SF	Room 348	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
138	Cementitious Joint Insulation on Fiberglass Piping	400	LF	Basement/Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
139	Transite Table Top	0	SF	Room 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
14	Pipe Insulation			Boiler Room Behind Red Tank	Abated	TSI					
140	Brown Linoleum	400	SF	Room 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
141	Brown Linoleum Mastic	400	SF	Room 109	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
142	12" x 12" Tan w/White Streaks Vinyl Floor Tile	900	SF	Room 235	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
143	12" x 12" Tan w/White Streaks Vinyl FT Mastic	900	SF	Room 235	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
144	12" x 12" Blue w/White Streaks Vinyl Floor Tile	100	SF	Room 165 Health Center	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
145	12" x 12" Blue w/White Streaks Vinyl FT Mastic	100	SF	Room 165 Health Center	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
146	12" x 12" Gray w/Beige & White Spots Floor Tile	4,200	SF	Room 230 (Lunchroom)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
147	12" x 12" Gray w/Beige & White Spots FT Mastic	4,200	SF	Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
148	Black and White Dots Linoleum	120	SF	Gym Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
149	Black and White Dots Linoleum Mastic	120	SF	Gym Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
15	Red Tank Insulation	96	SF	Boiler Room	Assumed	TSI	No	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
150	Aircell Pipe Insul.&Possibly in Inaccessible Areas	0	SF	2nd flr Girl's Washrm's by Library&227, 2nd flr Boy's Washrm by 235, 1st flr Women's Faculty Washrm	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
151	Joint Insul. assoc. w/ HA 151 & Inaccessible Areas	0	SF	2nd floor Girl's Washrooms by Library & 227, Boy's Bathroom by 235	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
152	Chalk Board/ Poster Board Adhesive	15,200	SF	Throughout All Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
153	12" X 12" Off White w/Blue Swirls Floor Tile	1,850	SF	Rm. 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
154	12" X 12" Off White w/Blue Swirls Floor Tile Mastic	100	SF	Rm. 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
155	Brown Linoleum	100	SF	Rm 121	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
156	Brown Linoleum Mastic	100	SF	Rm 121	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
157	12" X 12" Off White Tan Mottle Floor Tile	800	SF	Rm 302	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
158	12"X12" Off White Tan Mottle Floor Tile Mastic	800	SF	Rm 302	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
159	12"X12" Tan Mottle Floor Tile	1,200	SF	Rm 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	Insulation on Tank #2	96	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
160	12"X12" Tan Mottle Floor Tile Mastic	1,200	SF	Rm 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
161	Linoleum	3,700	SF	Science Rooms. Rm.329, 335, 346	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
162	Linoleum Mastic	3,700	SF	Science Room. Rm. 329, 335, 346	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
163	12"X12" Off White Grey Mottle Floor Tile	1,100	SF	Rm 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
164	12"X12" Off White Grey Mottle Floor tile mastic	1,100	SF	Rm 113	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
165	Sink Insulation	4	SF	Rm 121	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
166	1'x1' White Ceiling Tile	17,500	SF	Gymnasiums 256, 257, and 258	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
167	1'x1' White Ceiling Tile Adhesive	17,500	SF	Gymnasiums 256, 257 and 258	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
17	Cementitious Incinerator Insulation		SF	Boiler Room	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
18	Gasket on Boiler #2	18	LF	Boiler Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
19	Insulation on Boiler #2	268	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
20	Pipe Insulation on Boiler #2	20	LF	Boiler Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
21	Insulation on Tank #1	288	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
22	Pipe Insulation	20	LF	Boiler Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
23	Air Duct Insulation		SF	In Circuit Breaker Room	Assumed	TSI	No	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
24	Mag Block Pipe Insulation	150	LF	2nd Level of Boiler Room by Outer Wall	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
25	Terrazzo Wall & Stall	216	SF	Washrooms Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
26	Black Board	24	SF	Boiler Room Wall by Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27	White Marble	200	SF	Washrooms Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
28	Black Marble	200	SF	Washrooms Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
29	Cinderblock	580,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
30	Cinderblock Mortar	580,000	SF	Throughout Original Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School DuSable Campus
Address 4934 S. Wabash

Unit 46091
Chicago, IL, 60615

Building ID 1280
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
31	Pipe Insulation	18	LF	Next to Plenum #2	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
32	Plaster Walls	475,200	SF	Basement	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
33	Cementitious Pipe Joints	475,200	SF	Wind Tunnel #6	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
34	Spray-on Cementitious Material			Wall by Fan Room 7	Assumed	MISC					
35	Fiberglass Pipe Insulation	80	SF	Next to Fan Room # 8	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
36	Fittings on Fiberglass Pipe Insulation	570	LF	Under New Addition, Air Tunnel # 8	Amosite	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
37	Cementitious Pipe Joint Insulation	0	LF	Engine Room West Side Next to Fan Room # 7	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
38	Fiberglass Pipe Insulation	120	LF	Fan Room #2	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
39	Interior Brick	1,632	SF	Boiler Room	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
40	Interior Brick Mortar	1,632	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
41	12" x 12" White Floor Tile w/ Blue Specks	2,646	SF	1962 Addition 3rd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
42	12" x 12" White Floor Tile w/Blue Specks Mastic	2,640	SF	1962 Addition 3rd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
43	9" x 9" Tan Floor Tile w/White Streaks	34,400	SF	1st,2nd & 3rd Fl Halls,101,104,105,106,107,108,154,20 1,203-207,261,263-270,301- 305,307,308, 350,364-370	Chrysotile	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
44	9" x 9" Tan Floor Tile w/White Streaks Mastic	34,400	SF	1st,2nd & 3rd Fl Halls,101,104,105,106,107,108,154,20 1,203-207,261,263-270,301- 305,307,308,350,364-370	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
45	12"x12" Brown Floor Tile w/White Streaks	8,012	SF	Rooms 126, 365, 364, 367, 366, 369, 370	Assumed	MISC		0	SF	6 ACBM with the potential for damage	Operations and Maintenance
46	12" x 12" Brown Floor Tile w/White Streaks Mastic	4,200	SF	Rooms 365, 364, and 367	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
47	Cinderblock			Throughout 1962 Building	Assumed	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
48	Cinderblock Mortar	580,000	SF	Throughout 1962 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
49	Sound Proofing	80	SF	Rm 206 Storage	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
50	Finished Block Mortar	26,000	SF	Throughout 1934 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51	9" x 9" Brown Floor Tile w/White Streaks	12,000	SF	1st,2nd & 3rd Fl	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School DuSable Campus
Address 4934 S. Wabash

Unit 46091
Chicago, IL, 60615

Building ID 1280
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Halls,101,104,105,106,107,108,154,20 1,203-207,261,263-270,301- 305,307,308,334,350,364-370							
52	9" x 9" Brown Floor Tile w/White Streaks Mastic	12,000	SF	1st,2nd & 3rd Fl Halls,101,104,105,106,107,108,154,20 1,203-207,261,263-270,301- 305,307,308,334,350,364-370	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53	Dark Brown & White Ceramic Tile Grout	544	SF	2nd Floor Men's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
54	9" x 9" Dark Brown Floor Tile w/White Streaks	50	SF	Room 208	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
55	9"x9" Dark Brown Floor Tile w/White Streaks Mastic	50	SF	Rm 208	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
56	2' x 4' Ceiling Panels	3,468	SF	Rooms 301, 302, and 303	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
57	Drywall	12,000	SF	Throughout Facility	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
58	1' x 1' Acoustical Ceiling Tile	1,600	SF	Throughout Facility	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
59	Plaster	130,000	SF	Throughout 1934 Building	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
60	Corkboard	40	SF	Rooms 311 and 313	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
61	Pipe Chase Brick	96	SF	3rd Floor Next to Men's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
62	Pipe Chase Brick Mortar	96	SF	3rd Floor Next to Men's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
63	Terrazzo Stall Panels	8	SF	3rd Floor Men's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
64	Terrazzo Sinks	4	SF	3rd Floor Men's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
65	Light Brown & Tan Ceramic Tile Grout	40	SF	Women's 3rd Floor Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
66	Red Carpet Mastic			Auditorium	Abated	MISC					
67	Blue Carpet Mastic			Music Room	Assumed	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
68	Cement Flooring	596	SF	Rm 335	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
69	12" x 12" White Floor Tile w/ Black Specks	1,200	SF	Rooms 113, 109, 231, and 329	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
70	12" x 12" White Floor Tile w/Black Specks Mastic	1,200	SF	Rooms 113, 109, 231, and 329	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
71	12" x 12" Off White Floor Tile w/Beige Specks	3,080	SF	1st, 2nd & 3rd Floor Corridors, Rooms 327 and 329	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
72	12"x12" Off White Floor Tile w/Beige Specks Mastic	18,800	SF	1st, 2nd & 3rd Floor Corridors, Rooms327 and 329	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
73	12" x 12" Tan Floor Tile w/ Light Brown Streaks	42	SF	3rd Floor Safe Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
74	12" x 12" Tan Floor Tile w/Lt Brn Streaks Mastic	540	SF	3rd Floor Safe Room, Rm. 318, 332	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
75	Carpet Mastic on Planter			Greenhouse	Assumed	MISC	No				
76	Terrazzo Flooring	580	SF	1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
77	Finished Brick Mortar	580,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
78	Locker Caulk			Throughout Facility	Assumed	MISC					
79	12" x 12" Off-White Floor Tile w/Gray Streaks	2,108	SF	2nd Floor Lunchroom and Room 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
80	12"x12" Off-White Floor Tile w/Gray Streaks Mastic	2,400	SF	2nd Floor Lunchroom, Room 230	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
81	12" x 12" Cream Floor Tile w/White Streaks	360	SF	Room 233 and 235	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
82	12" x 12" Cream Floor Tile w/White Streaks Mastic	750	SF	Room 233 and 235	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
83	Gray Carpet Mastic	450	SF	Room 251 and 253	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
84	9" x 9" Red Floor Tile	380	SF	Rooms 360, 260, 109 and 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
85	9" x 9" Red Floor Tile Mastic	380	SF	Rooms 360, 260, 109 and 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
86	9" x 9" Black Floor Tile	380	SF	Rooms 360, 260, 109 and 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
87	9" x 9" Black Floor Tile Mastic	380	SF	Rooms 360, 260, 109 and 113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
88	9" x 9" Burnt Orange Floor Tile	300	SF	Gym Office, Rms 110 and 112	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
89	9" x 9" Burnt Orange Floor Tile Mastic	300	SF	Gym Office, Rms 110 and 112	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
90	9" x 9" Chocolate Brown Floor Tile	350	SF	Gym Office, Rms 110 and 112, Vault	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
91	9" x 9" Chocolate Brown Floor Tile Mastic	350	SF	Gym Office, Rms 110 and 112, Vault	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
92	Black Border Floor Tile	40	LF	Door by North Gym	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
93	Black Border Floor Tile Mastic	40	LF	Door by North Gym	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
94	9" x 9" Black Floor Tile	12	SF	Gym Closet	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
95	9" x 9" Black Floor Tile Mastic	12	SF	Gym Closet	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
96	12" x 12" Red Floor Tile	6	SF	Under Desk in Gym Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
97	12" x 12" Red Floor Tile Mastic	6	SF	Under Desk in Gym Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
98	12x12 Carmel Colored Floor Tile	1,850	SF	Gym Washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
99	Brown Linoleum	100	SF	Rm 109	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
FT-001	9x9 Carmel Colored Floor Tile	30	SF	Gymnasium Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School DuSable Campus
Address 4934 S. Wabash

Unit 46091
 Chicago, IL, 60615

Building ID 1280
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/18/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
100	
101	
102	
103	
104	
105	
106	
107	
108	
109	
110	
111	
112	

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
113	
114	
115	
116	
117	
118	
119	
12	
120	
121	
122	
123	
124	
126	
127	
128	
129	
13	
130	
131	
132	
133	
134	
135	
136	
137	
138	

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
139	
14	
140	
141	
142	
143	
144	
145	
146	
147	
148	
149	
15	
150	
151	
152	
153	
154	
155	
156	
157	
158	
159	
16	
160	
161	
162	

Chicago Public Schools

School DuSable Campus
Address 4934 S. Wabash

Unit 46091
Chicago, IL, 60615

Building ID 1280
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
163	
164	
165	
166	
167	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	

Chicago Public Schools

School DuSable Campus
Address 4934 S. Wabash

Unit 46091
Chicago, IL, 60615

Building ID 1280
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
90	
91	
92	

Chicago Public Schools

School DuSable Campus

Unit 46091

Building ID 1280

Address 4934 S. Wabash

Chicago, IL, 60615

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
93	
94	
95	
96	
97	
98	
99	
FT-001	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **100**
MATERIAL DESCRIPTION: **Multi-Brown Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym Office Washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **100**
MATERIAL DESCRIPTION: **Multi-Brown Ceramic Tile Grout**
MATERIAL LOCATION: **Gym Office Washroom**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **101**
MATERIAL DESCRIPTION: **Spray-On Ceiling Material**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st and 2nd Floor Corridors (1962 Addition)**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **101**
MATERIAL DESCRIPTION: **Spray-On Ceiling Material**
MATERIAL LOCATION: **1st and 2nd Floor Corridors (1962 Addition)**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

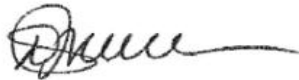

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **Cream Colored Ceramic Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Girl's Locker Room**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **Cream Colored Ceramic Tile Mastic**
MATERIAL LOCATION: **1st Floor Girl's Locker Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **Light Blue Ceramic Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Swimming Pool Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **Light Blue Ceramic Tile Mastic**
MATERIAL LOCATION: **Swimming Pool Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **Swimming Pool Edge Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Anthophyllite** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Swimming Pool**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **Swimming Pool Edge Mortar**
MATERIAL LOCATION: **Swimming Pool**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Blue and Yellow Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Swimming Pool, Girl's Locker Room, Boy's Locker Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Blue and Yellow Ceramic Tile Grout**
MATERIAL LOCATION: **Swimming Pool, Girl's Locker Room, Boy's Locker Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Yellow Linoleum on Counter Top and Wall**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Yellow Linoleum on Counter Top and Wall**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Yellow Linoleum Mastic on Counter Top and Wall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Yellow Linoleum Mastic on Counter Top and Wall**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **Brown Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **Brown Baseboard**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor Lunchroom**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White Specks**
MATERIAL LOCATION: **1st Floor Lunchroom**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **First Floor Lunchroom**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White Specks Mastic**
MATERIAL LOCATION: **First Floor Lunchroom**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **Green Marble**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **Green Marble**
MATERIAL LOCATION: **Auditorium**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

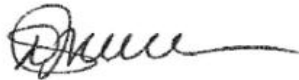

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **Light Brown Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Outside Auditorium**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **Light Brown Terrazzo**
MATERIAL LOCATION: **Outside Auditorium**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **Light Gray Terrazzo Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Outside Auditorium**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **Light Gray Terrazzo Flooring**
MATERIAL LOCATION: **Outside Auditorium**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1934 Building**

MATERIAL QUANTITY: **580000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
MATERIAL LOCATION: **Exterior of 1934 Building**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **116**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1934 Building**

MATERIAL QUANTITY: **580000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **116**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
MATERIAL LOCATION: **Exterior of 1934 Building**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

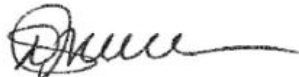

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **117**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1962 Addition**

MATERIAL QUANTITY: **580000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **117**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
MATERIAL LOCATION: **Exterior of 1962 Addition**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

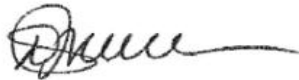

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **118**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1962 Addition**

MATERIAL QUANTITY: **580000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **118**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
MATERIAL LOCATION: **Exterior of 1962 Addition**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **119**
MATERIAL DESCRIPTION: **Exterior Window Caulk - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1934 Building**

MATERIAL QUANTITY: **4800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **119**
MATERIAL DESCRIPTION: **Exterior Window Caulk - Not AHERA**
MATERIAL LOCATION: **1934 Building**
MATERIAL QUANTITY: **4800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Insulation on Boiler #1**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Insulation on Boiler #1**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

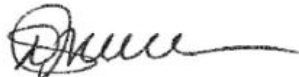

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **120**
MATERIAL DESCRIPTION: **Exterior Window Caulk - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1962 Addition**

MATERIAL QUANTITY: **4800**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **120**
MATERIAL DESCRIPTION: **Exterior Window Caulk - Not AHERA**
MATERIAL LOCATION: **1962 Addition**
MATERIAL QUANTITY: **4800** MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **121**
MATERIAL DESCRIPTION: **Exterior Door Caulk - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1934 Building**

MATERIAL QUANTITY: **280**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **121**
MATERIAL DESCRIPTION: **Exterior Door Caulk - Not AHERA**
MATERIAL LOCATION: **1934 Building**
MATERIAL QUANTITY: **280** MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

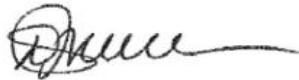

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **122**
MATERIAL DESCRIPTION: **Exterior Door Caulk - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1962 Addition**

MATERIAL QUANTITY: **280**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **122**
MATERIAL DESCRIPTION: **Exterior Door Caulk - Not AHERA**
MATERIAL LOCATION: **1962 Addition**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **123**
MATERIAL DESCRIPTION: **Roofing Material - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **105600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not AHEAR**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **123**
MATERIAL DESCRIPTION: **Roofing Material - Not AHERA**
MATERIAL LOCATION: **Roof**
MATERIAL QUANTITY: **105600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **124**
MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS: **Not AHERA**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **124**
MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**
MATERIAL LOCATION: **Roof**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

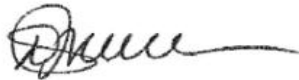

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **126**
MATERIAL DESCRIPTION: **Greenish Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 324**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **126**
MATERIAL DESCRIPTION: **Greenish Brown Carpet Mastic**
MATERIAL LOCATION: **Room 324**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

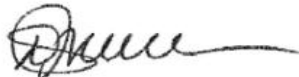

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **127**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **127**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile Adhesive**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **128**
MATERIAL DESCRIPTION: **Lab Counter Tops**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 129, 135, 233, 235, 266, 327, and 329**
MATERIAL QUANTITY: **1008** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **128**
MATERIAL DESCRIPTION: **Lab Counter Tops**
MATERIAL LOCATION: **Rooms 129, 135, 233, 235, 266, 327, and 329**
MATERIAL QUANTITY: **1008** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

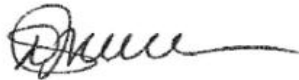

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **129**
MATERIAL DESCRIPTION: **Liner in Vault Door**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 327**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **129**
MATERIAL DESCRIPTION: **Liner in Vault Door**
MATERIAL LOCATION: **Room 327**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Boiler #1 Gasket**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room Boiler #1**
MATERIAL QUANTITY: **16** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Boiler #1 Gasket**
MATERIAL LOCATION: **Boiler Room Boiler #1**
MATERIAL QUANTITY: **16** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **130**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 220, 117, 103**
MATERIAL QUANTITY: **1450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **130**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
MATERIAL LOCATION: **Room 220, 117, 103**
MATERIAL QUANTITY: **1450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **131**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 217**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **131**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
MATERIAL LOCATION: **Room 217**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **132**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 165**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **132**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
MATERIAL LOCATION: **Room 165**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **133**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 115**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **133**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Room 115**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **134**
MATERIAL DESCRIPTION: **Reddish Purple Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 121, 123, and 125**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **134**
MATERIAL DESCRIPTION: **Reddish Purple Carpet Mastic**
MATERIAL LOCATION: **Rooms 121, 123, and 125**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **135**
MATERIAL DESCRIPTION: **Free Standing Lab Tables**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 129, 135, 233, 235, 327, and 329**
MATERIAL QUANTITY: **769** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **135**
MATERIAL DESCRIPTION: **Free Standing Lab Tables**
MATERIAL LOCATION: **Rooms 129, 135, 233, 235, 327, and 329**
MATERIAL QUANTITY: **769** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

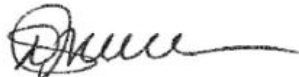

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **136**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 348**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **136**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown Streaks**
MATERIAL LOCATION: **Room 348**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

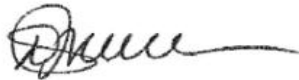

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **137**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 348**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **137**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Brown Streaks Mastic**
MATERIAL LOCATION: **Room 348**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **138**
MATERIAL DESCRIPTION: **Cementitious Joint Insulation on Fiberglass Piping**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Basement/Tunnel**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **138**
MATERIAL DESCRIPTION: **Cementitious Joint Insulation on Fiberglass Piping**
MATERIAL LOCATION: **Basement/Tunnel**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **139**
MATERIAL DESCRIPTION: **Transite Table Top**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **139**
MATERIAL DESCRIPTION: **Transite Table Top**
MATERIAL LOCATION: **Room 113**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

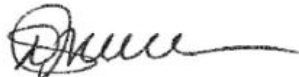

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room Behind Red Tank**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material was not observed - 2013 3 years re-inspection**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Pipe Insulation**

MATERIAL LOCATION: **Boiler Room Behind Red Tank**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **140**
MATERIAL DESCRIPTION: **Brown Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 109**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **140**
MATERIAL DESCRIPTION: **Brown Linoleum**
MATERIAL LOCATION: **Room 109**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

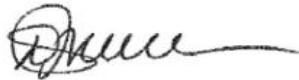

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **141**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 109**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **141**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
MATERIAL LOCATION: **Room 109**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **142**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Streaks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 235**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **142**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Streaks Vinyl Floor Tile**
MATERIAL LOCATION: **Room 235**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **143**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Streaks Vinyl FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 235**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **143**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Streaks Vinyl FT Mastic**
MATERIAL LOCATION: **Room 235**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **144**
MATERIAL DESCRIPTION: **12" x 12" Blue w/White Streaks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 165 Health Center**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **144**
MATERIAL DESCRIPTION: **12" x 12" Blue w/White Streaks Vinyl Floor Tile**
MATERIAL LOCATION: **Room 165 Health Center**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **145**
MATERIAL DESCRIPTION: **12" x 12" Blue w/White Streaks Vinyl FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 165 Health Center**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **145**
MATERIAL DESCRIPTION: **12" x 12" Blue w/White Streaks Vinyl FT Mastic**
MATERIAL LOCATION: **Room 165 Health Center**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **146**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Beige & White Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 230 (Lunchroom)**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **146**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Beige & White Spots Floor Tile**
MATERIAL LOCATION: **Room 230 (Lunchroom)**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **147**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Beige & White Spots FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 230**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **147**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Beige & White Spots FT Mastic**
MATERIAL LOCATION: **Room 230**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **148**
MATERIAL DESCRIPTION: **Black and White Dots Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym Washroom**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **148**
MATERIAL DESCRIPTION: **Black and White Dots Linoleum**
MATERIAL LOCATION: **Gym Washroom**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

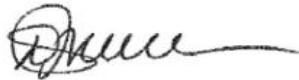

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **149**
MATERIAL DESCRIPTION: **Black and White Dots Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym Washroom**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **149**
MATERIAL DESCRIPTION: **Black and White Dots Linoleum Mastic**
MATERIAL LOCATION: **Gym Washroom**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Red Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Red Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

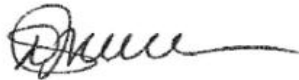

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **150**
MATERIAL DESCRIPTION: **Aircell Pipe Insul.&Possibly in Inaccessible Areas**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd flr Girl's Washrm's by Library&227, 2nd flr Boy's Washrm by 235, 1st flr Women's Faculty Washrm**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **150**
MATERIAL DESCRIPTION: **Aircell Pipe Insul.&Possibly in Inaccessible Areas**
MATERIAL LOCATION: **2nd flr Girl's Washrm's by Library&227, 2nd flr Boy's Washrm by 235, 1st flr Women's Faculty Washrm**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **151**
MATERIAL DESCRIPTION: **Joint Insul. assoc. w/ HA 151 & Inaccessible Areas**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd floor Girl's Washrooms by Library & 227, Boy's Bathroom by 235**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **151**
MATERIAL DESCRIPTION: **Joint Insul. assoc. w/ HA 151 & Inaccessible Areas**
MATERIAL LOCATION: **2nd floor Girl's Washrooms by Library & 227, Boy's Bathroom by 235**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **152**
MATERIAL DESCRIPTION: **Chalk Board/ Poster Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout All Classrooms**

MATERIAL QUANTITY: **15200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **152**
MATERIAL DESCRIPTION: **Chalk Board/ Poster Board Adhesive**
MATERIAL LOCATION: **Throughout All Classrooms**
MATERIAL QUANTITY: **15200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **153**
MATERIAL DESCRIPTION: **12" X 12" Off White w/Blue Swirls Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rm. 107**
MATERIAL QUANTITY: **1850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **153**
MATERIAL DESCRIPTION: **12" X 12" Off White w/Blue Swirls Floor Tile**
MATERIAL LOCATION: **Rm. 107**
MATERIAL QUANTITY: **1850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **154**
MATERIAL DESCRIPTION: **12" X 12" Off White w/Blue Swirls Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm. 107**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **154**
MATERIAL DESCRIPTION: **12" X 12" Off White w/Blue Swirls Floor Tile Mastic**
MATERIAL LOCATION: **Rm. 107**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **155**
MATERIAL DESCRIPTION: **Brown Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rm 121**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **155**
MATERIAL DESCRIPTION: **Brown Linoleum**
MATERIAL LOCATION: **Rm 121**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **156**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 121**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **156**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
MATERIAL LOCATION: **Rm 121**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **157**
MATERIAL DESCRIPTION: **12" X 12" Off White Tan Mottle Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rm 302**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **157**
MATERIAL DESCRIPTION: **12" X 12" Off White Tan Mottle Floor Tile**
MATERIAL LOCATION: **Rm 302**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **158**
MATERIAL DESCRIPTION: **12"X12" Off White Tan Mottle Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 302**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **158**
MATERIAL DESCRIPTION: **12"X12" Off White Tan Mottle Floor Tile Mastic**
MATERIAL LOCATION: **Rm 302**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **159**
MATERIAL DESCRIPTION: **12"X12" Tan Mottle Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rm 109**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **159**
MATERIAL DESCRIPTION: **12"X12" Tan Mottle Floor Tile**
MATERIAL LOCATION: **Rm 109**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Insulation on Tank #2**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Insulation on Tank #2**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **96**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **160**
MATERIAL DESCRIPTION: **12"X12" Tan Mottle Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 109**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **160**
MATERIAL DESCRIPTION: **12"X12" Tan Mottle Floor Tile Mastic**
MATERIAL LOCATION: **Rm 109**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **161**
MATERIAL DESCRIPTION: **Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Science Rooms. Rm.329, 335, 346**
MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **161**
MATERIAL DESCRIPTION: **Linoleum**
MATERIAL LOCATION: **Science Rooms. Rm.329, 335, 346**
MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **162**
MATERIAL DESCRIPTION: **Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Science Room. Rm. 329, 335, 346**
MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **162**
MATERIAL DESCRIPTION: **Linoleum Mastic**
MATERIAL LOCATION: **Science Room. Rm. 329, 335, 346**
MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **163**
MATERIAL DESCRIPTION: **12"X12" Off White Grey Mottle Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rm 113**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **163**
MATERIAL DESCRIPTION: **12"X12" Off White Grey Mottle Floor Tile**
MATERIAL LOCATION: **Rm 113**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **164**
MATERIAL DESCRIPTION: **12"X12" Off White Grey Mottle Floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 113**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **164**
MATERIAL DESCRIPTION: **12"X12" Off White Grey Mottle Floor tile mastic**
MATERIAL LOCATION: **Rm 113**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **165**
MATERIAL DESCRIPTION: **Sink Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 121**
MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **165**
MATERIAL DESCRIPTION: **Sink Insulation**
MATERIAL LOCATION: **Rm 121**
MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Cementitious Incinerator Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Cementitious Incinerator Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Gasket on Boiler #2**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **18** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Gasket on Boiler #2**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **18** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

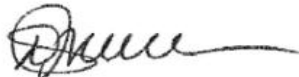

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Insulation on Boiler #2**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **268** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Insulation on Boiler #2**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **268**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Pipe Insulation on Boiler #2**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Pipe Insulation on Boiler #2**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

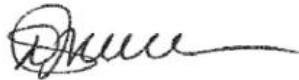

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Insulation on Tank #1**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **288** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Insulation on Tank #1**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **288**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Pipe Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

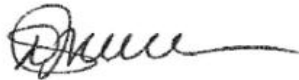

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Air Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **In Circuit Breaker Room**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Air Duct Insulation**
MATERIAL LOCATION: **In Circuit Breaker Room**
MATERIAL QUANTITY: MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

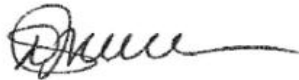

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **2nd Level of Boiler Room by Outer Wall**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
MATERIAL LOCATION: **2nd Level of Boiler Room by Outer Wall**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Terrazzo Wall & Stall**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Washrooms Throughout Facility**
MATERIAL QUANTITY: **216** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Terrazzo Wall & Stall**
MATERIAL LOCATION: **Washrooms Throughout Facility**
MATERIAL QUANTITY: **216** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Black Board**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room Wall by Stairs**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Black Board**
MATERIAL LOCATION: **Boiler Room Wall by Stairs**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

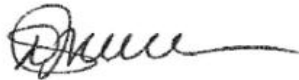

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **White Marble**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Washrooms Throughout Facility**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **White Marble**
MATERIAL LOCATION: **Washrooms Throughout Facility**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

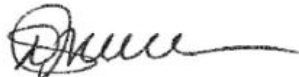

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Black Marble**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Washrooms Throughout Facility**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Black Marble**
MATERIAL LOCATION: **Washrooms Throughout Facility**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

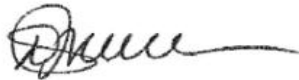

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Cinderblock**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Cinderblock**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Cinderblock Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Original Building**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Cinderblock Mortar**

MATERIAL LOCATION: **Throughout Original Building**

MATERIAL QUANTITY: **580000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Next to Plenum #2**
MATERIAL QUANTITY: **18** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **Pipe Insulation**

MATERIAL LOCATION: **Next to Plenum #2**

MATERIAL QUANTITY: **18**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Plaster Walls**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: **475200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Plaster Walls**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: **475200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Cementitious Pipe Joints**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Wind Tunnel #6**
MATERIAL QUANTITY: **475200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Cementitious Pipe Joints**
MATERIAL LOCATION: **Wind Tunnel #6**
MATERIAL QUANTITY: **475200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Spray-on Cementitious Material**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Wall by Fan Room 7**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material was not observed - 2013 3 years re-inspection**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Spray-on Cementitious Material**

MATERIAL LOCATION: **Wall by Fan Room 7**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Next to Fan Room # 8**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Next to Fan Room # 8**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Fittings on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Under New Addition, Air Tunnel # 8**
MATERIAL QUANTITY: **570** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Fittings on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Under New Addition, Air Tunnel # 8**
MATERIAL QUANTITY: **570** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Cementitious Pipe Joint Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engine Room West Side Next to Fan Room # 7**
MATERIAL QUANTITY: **0** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Cementitious Pipe Joint Insulation**

MATERIAL LOCATION: **Engine Room West Side Next to Fan Room # 7**

MATERIAL QUANTITY: **0**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Fan Room #2**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Fan Room #2**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

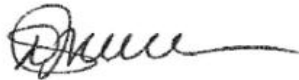

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Interior Brick**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Interior Brick**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Interior Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Interior Brick Mortar**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **1632**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Blue Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1962 Addition 3rd Floor Corridor**
MATERIAL QUANTITY: **2646** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Blue Specks**
MATERIAL LOCATION: **1962 Addition 3rd Floor Corridor**
MATERIAL QUANTITY: **2646** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

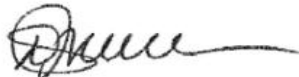

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1962 Addition 3rd Floor Corridor**
MATERIAL QUANTITY: **2640** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Specks Mastic**
MATERIAL LOCATION: **1962 Addition 3rd Floor Corridor**
MATERIAL QUANTITY: **2640** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **1st,2nd & 3rd Fl Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308, 350,364-370**
MATERIAL QUANTITY: **34400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/White Streaks**
MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,350,364-370**
MATERIAL QUANTITY: **34400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,350,364-370**

MATERIAL QUANTITY: **34400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/White Streaks Mastic**
MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,350,364-370**
MATERIAL QUANTITY: **34400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

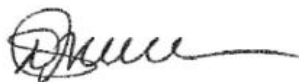

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 126, 365, 364, 367, 366, 369, 370**
MATERIAL QUANTITY: **8012** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile w/White Streaks**
MATERIAL LOCATION: **Rooms 126, 365, 364, 367, 366, 369, 370**
MATERIAL QUANTITY: **8012** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 365, 364, and 367**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White Streaks Mastic**
MATERIAL LOCATION: **Rooms 365, 364, and 367**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Cinderblock**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 1962 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Cinderblock**
MATERIAL LOCATION: **Throughout 1962 Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

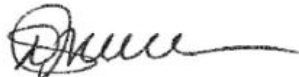

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Cinderblock Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Building**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Cinderblock Mortar**
MATERIAL LOCATION: **Throughout 1962 Building**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Sound Proofing**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 206 Storage**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Sound Proofing**
MATERIAL LOCATION: **Rm 206 Storage**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

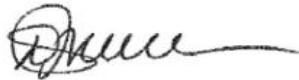

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Finished Block Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1934 Building**
MATERIAL QUANTITY: **26000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Finished Block Mortar**
MATERIAL LOCATION: **Throughout 1934 Building**
MATERIAL QUANTITY: **26000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

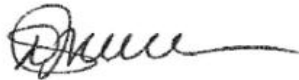

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**

MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,334,350,364-370**

MATERIAL QUANTITY: **12000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White Streaks**
MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,334,350,364-370**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,334,350,364-370**

MATERIAL QUANTITY: **12000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile w/White Streaks Mastic**
MATERIAL LOCATION: **1st,2nd & 3rd FI Halls,101,104,105,106,107,108,154,201,203-207,261,263-270,301-305,307,308,334,350,364-370**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

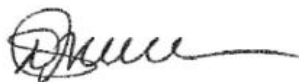

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **Dark Brown & White Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Men's Washroom**

MATERIAL QUANTITY: **544**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **Dark Brown & White Ceramic Tile Grout**

MATERIAL LOCATION: **2nd Floor Men's Washroom**

MATERIAL QUANTITY: **544**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile w/White Streaks**
MATERIAL LOCATION: **Room 208**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **9"x9" Dark Brown Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 208**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **9"x9" Dark Brown Floor Tile w/White Streaks Mastic**
MATERIAL LOCATION: **Rm 208**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 301, 302, and 303**
MATERIAL QUANTITY: **3468** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Panels**
MATERIAL LOCATION: **Rooms 301, 302, and 303**
MATERIAL QUANTITY: **3468** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

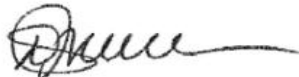

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **1' x 1' Acoustical Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **1' x 1' Acoustical Ceiling Tile**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **1600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1934 Building**
MATERIAL QUANTITY: **130000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **Throughout 1934 Building**
MATERIAL QUANTITY: **130000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Corkboard**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 311 and 313**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Corkboard**
MATERIAL LOCATION: **Rooms 311 and 313**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Pipe Chase Brick**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Next to Men's Washroom**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Pipe Chase Brick**
MATERIAL LOCATION: **3rd Floor Next to Men's Washroom**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

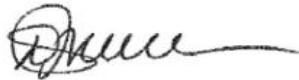

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Pipe Chase Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Next to Men's Washroom**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Pipe Chase Brick Mortar**
MATERIAL LOCATION: **3rd Floor Next to Men's Washroom**
MATERIAL QUANTITY: **96** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Terrazzo Stall Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Men's Washroom**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **Terrazzo Stall Panels**

MATERIAL LOCATION: **3rd Floor Men's Washroom**

MATERIAL QUANTITY: **8**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

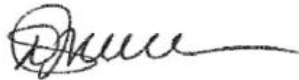

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Terrazzo Sinks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Floor Men's Washroom**

MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Terrazzo Sinks**

MATERIAL LOCATION: **3rd Floor Men's Washroom**

MATERIAL QUANTITY: **4**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **Light Brown & Tan Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Women's 3rd Floor Washroom**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **65**

MATERIAL DESCRIPTION: **Light Brown & Tan Ceramic Tile Grout**

MATERIAL LOCATION: **Women's 3rd Floor Washroom**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Red Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material was not observed - 2013 3 years re-inspection**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **66**

MATERIAL DESCRIPTION: **Red Carpet Mastic**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Music Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **Blue Carpet Mastic**

MATERIAL LOCATION: **Music Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY: **0**

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **Cement Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 335**
MATERIAL QUANTITY: **596** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **Cement Flooring**
MATERIAL LOCATION: **Rm 335**
MATERIAL QUANTITY: **596** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

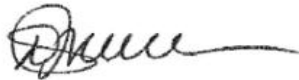

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Black Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 113, 109, 231, and 329**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Black Specks**
MATERIAL LOCATION: **Rooms 113, 109, 231, and 329**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

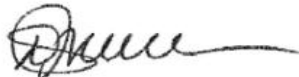

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Black Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 113, 109, 231, and 329**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Black Specks Mastic**
MATERIAL LOCATION: **Rooms 113, 109, 231, and 329**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

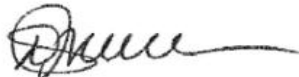

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12" x 12" Off White Floor Tile w/Beige Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors, Rooms 327 and 329**
MATERIAL QUANTITY: **3080** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12" x 12" Off White Floor Tile w/Beige Specks**
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors, Rooms 327 and 329**
MATERIAL QUANTITY: **3080** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile w/Beige Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors, Rooms 327 and 329**
MATERIAL QUANTITY: **18800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile w/Beige Specks Mastic**
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors, Rooms327 and 329**
MATERIAL QUANTITY: **18800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/ Light Brown Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Safe Room**
MATERIAL QUANTITY: **42** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/ Light Brown Streaks**
MATERIAL LOCATION: **3rd Floor Safe Room**
MATERIAL QUANTITY: **42** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

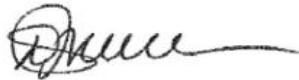

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Lt Brn Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Floor Safe Room, Rm. 318, 332**

MATERIAL QUANTITY: **540**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile w/Lt Brn Streaks Mastic**
MATERIAL LOCATION: **3rd Floor Safe Room, Rm. 318, 332**
MATERIAL QUANTITY: **540** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Carpet Mastic on Planter**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Greenhouse**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material was not observed - 2013 3 years re-inspection**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **75**

MATERIAL DESCRIPTION: **Carpet Mastic on Planter**

MATERIAL LOCATION: **Greenhouse**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **Terrazzo Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **580** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **Terrazzo Flooring**
MATERIAL LOCATION: **1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **580** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

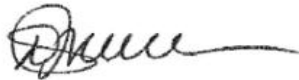

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Finished Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **580000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **77**

MATERIAL DESCRIPTION: **Finished Brick Mortar**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **580000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **Locker Caulk**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material was not observed - 2013 3 years re-inspection**

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **78**

MATERIAL DESCRIPTION: **Locker Caulk**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Gray Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Lunchroom and Room 230**

MATERIAL QUANTITY: **2108**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Gray Streaks**
MATERIAL LOCATION: **2nd Floor Lunchroom and Room 230**
MATERIAL QUANTITY: **2108** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

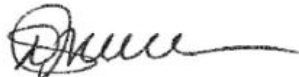

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Gray Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Lunchroom, Room 230**

MATERIAL QUANTITY: **2400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Gray Streaks Mastic**
MATERIAL LOCATION: **2nd Floor Lunchroom, Room 230**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **12" x 12" Cream Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 233 and 235**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **12" x 12" Cream Floor Tile w/White Streaks**

MATERIAL LOCATION: **Room 233 and 235**

MATERIAL QUANTITY: **360**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **12" x 12" Cream Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 233 and 235**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **12" x 12" Cream Floor Tile w/White Streaks Mastic**
MATERIAL LOCATION: **Room 233 and 235**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **Gray Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 251 and 253**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **Gray Carpet Mastic**
MATERIAL LOCATION: **Room 251 and 253**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

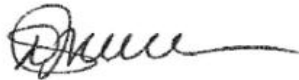

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 360, 260,109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile**
MATERIAL LOCATION: **Rooms 360, 260,109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 360, 260, 109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 360, 260, 109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 360, 260, 109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile**
MATERIAL LOCATION: **Rooms 360, 260, 109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 360, 260, 109 and 113**

MATERIAL QUANTITY: **380**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 360, 260, 109 and 113**
MATERIAL QUANTITY: **380** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

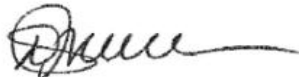

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **9" x 9" Burnt Orange Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Gym Office, Rms 110 and 112**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **9" x 9" Burnt Orange Floor Tile**
MATERIAL LOCATION: **Gym Office, Rms 110 and 112**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **9" x 9" Burnt Orange Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym Office, Rms 110 and 112**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **9" x 9" Burnt Orange Floor Tile Mastic**
MATERIAL LOCATION: **Gym Office, Rms 110 and 112**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **9" x 9" Chocolate Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Gym Office, Rms 110 and 112, Vault**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/01/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **9" x 9" Chocolate Brown Floor Tile**
MATERIAL LOCATION: **Gym Office, Rms 110 and 112, Vault**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **91**
MATERIAL DESCRIPTION: **9" x 9" Chocolate Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym Office, Rms 110 and 112, Vault**

MATERIAL QUANTITY: **350**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **91**
MATERIAL DESCRIPTION: **9" x 9" Chocolate Brown Floor Tile Mastic**
MATERIAL LOCATION: **Gym Office, Rms 110 and 112, Vault**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **92**
MATERIAL DESCRIPTION: **Black Border Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Door by North Gym**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **92**

MATERIAL DESCRIPTION: **Black Border Floor Tile**

MATERIAL LOCATION: **Door by North Gym**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **93**
MATERIAL DESCRIPTION: **Black Border Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Door by North Gym**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **93**

MATERIAL DESCRIPTION: **Black Border Floor Tile Mastic**

MATERIAL LOCATION: **Door by North Gym**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **94**
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Gym Closet**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **94**

MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile**

MATERIAL LOCATION: **Gym Closet**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **95**
MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym Closet**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **95**

MATERIAL DESCRIPTION: **9" x 9" Black Floor Tile Mastic**

MATERIAL LOCATION: **Gym Closet**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **96**
MATERIAL DESCRIPTION: **12" x 12" Red Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Under Desk in Gym Office**

MATERIAL QUANTITY: **6**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **96**

MATERIAL DESCRIPTION: **12" x 12" Red Floor Tile**

MATERIAL LOCATION: **Under Desk in Gym Office**

MATERIAL QUANTITY: **6**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **97**
MATERIAL DESCRIPTION: **12" x 12" Red Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Under Desk in Gym Office**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **97**

MATERIAL DESCRIPTION: **12" x 12" Red Floor Tile Mastic**

MATERIAL LOCATION: **Under Desk in Gym Office**

MATERIAL QUANTITY: **6**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **12x12 Carmel Colored Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Gym Washroom**
MATERIAL QUANTITY: **1850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **12x12 Carmel Colored Floor Tile**
MATERIAL LOCATION: **Gym Washroom**
MATERIAL QUANTITY: **1850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **99**
MATERIAL DESCRIPTION: **Brown Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rm 109**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **99**
MATERIAL DESCRIPTION: **Brown Linoleum**
MATERIAL LOCATION: **Rm 109**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

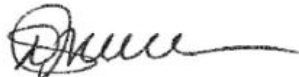

Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-001**
MATERIAL DESCRIPTION: **9x9 Carmel Colored Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Gymnasium Washroom**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUIDLING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **FT-001**

MATERIAL DESCRIPTION: **9x9 Carmel Colored Floor Tile**

MATERIAL LOCATION: **Gymnasium Washroom**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/18/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **166**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**
MATERIAL LOCATION: **Gymnasiums 256, 257, and 258**
MATERIAL QUANTITY: **17500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**


HOMOGENEOUS AREA: **166**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**
MATERIAL LOCATION: **Gymnasiums 256, 257, and 258**
MATERIAL QUANTITY: **17500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **04/18/2013**

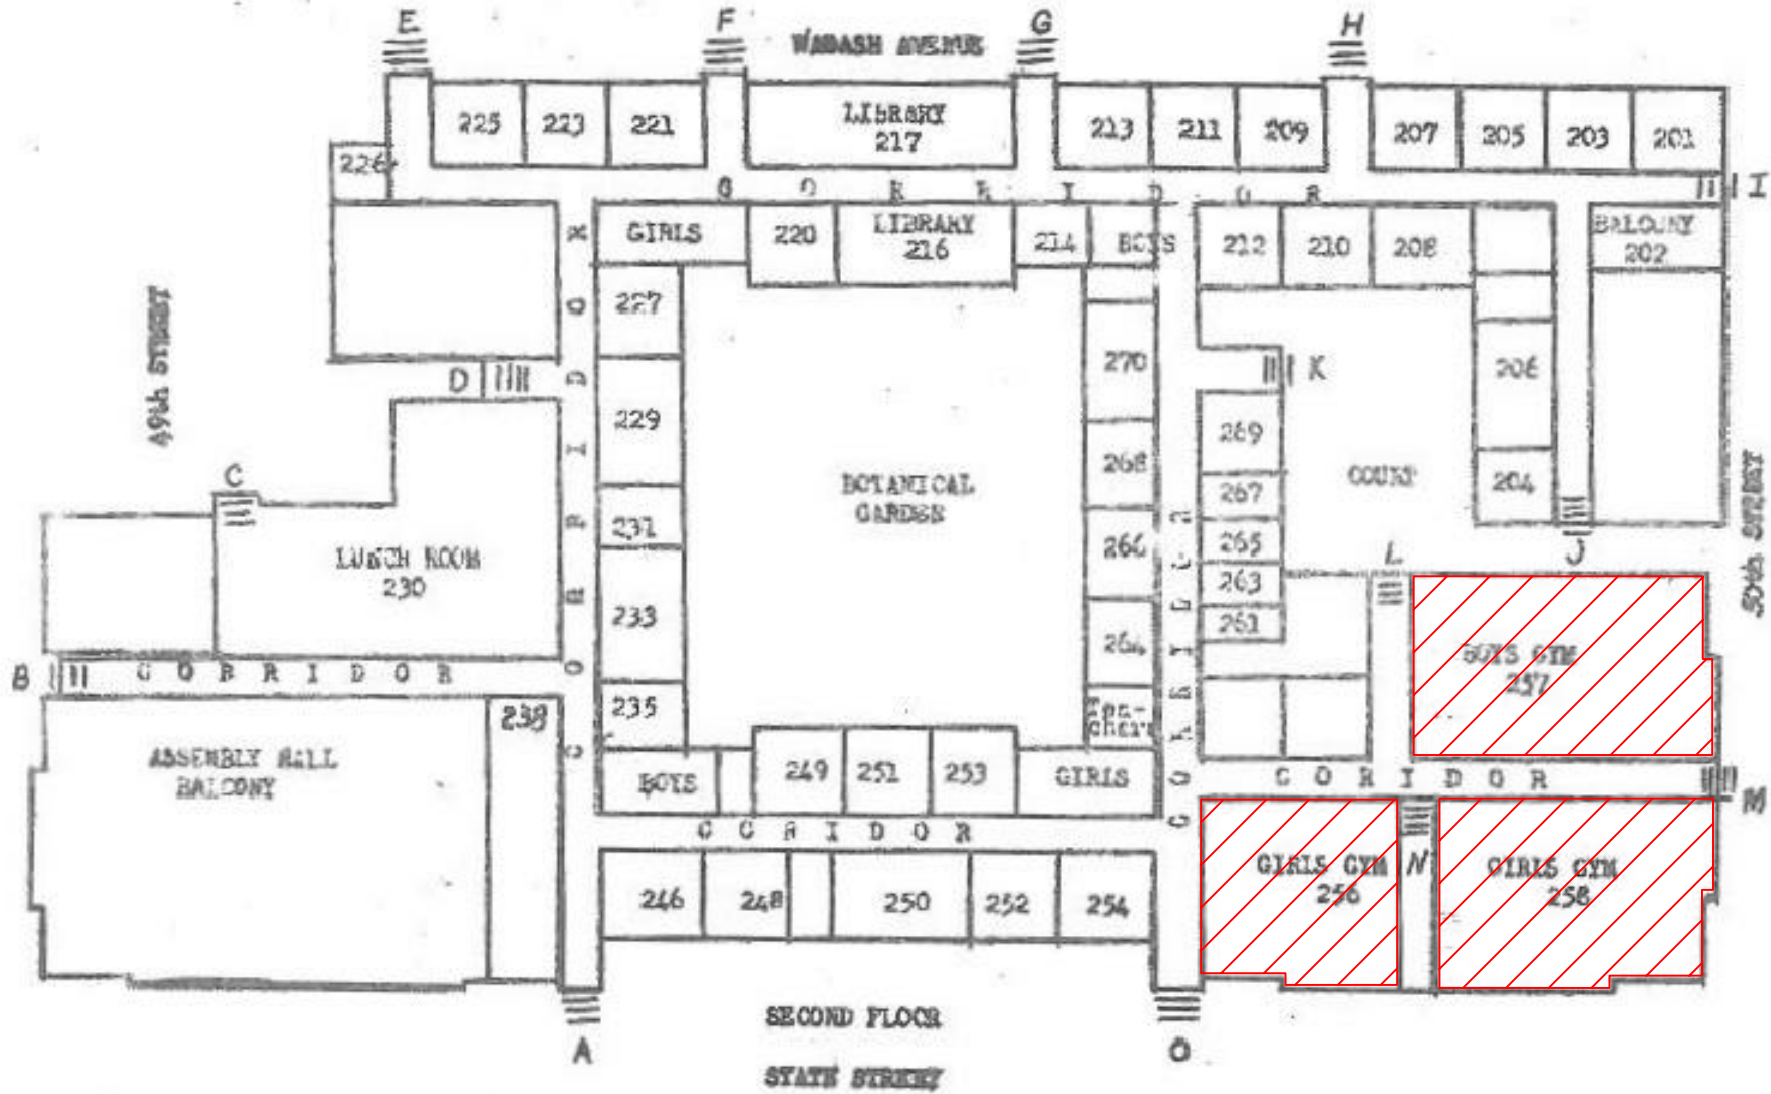

ASBESTOS REINSPECTION KEY NOTES:

 HA-166 1'x1' White Ceiling Tile

SECOND FLOOR
ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
DuSable High School
4934 S. Wabash Street
Chicago, Illinois 60615

SHEET NAME:
Asbestos CPS Reinspection 2013

DRAWN BY: DM	DATE: 3-1-13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

INSPECTED BY:
Ethan Payne

IDPH License #:100-2175

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaltd.com

CCA PROJECT NUMBER
A320130001-174

DATE
March 18, 2013
SHEET NUMBER

**CARNOW
CONIBEAR** HA-166

C:\PS\2013\2013_Thru_Year\Cal Draw\gpr\gpr\4\DU\State Campus\DuSable\CPS_2yrs_DuSable.dwg

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**
SCHOOL NAME: **DuSable Campus** INSPECTION DATE: **3/1/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **167**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile Adhesive**
MATERIAL LOCATION: **Gymnasiums 256, 257 and 258**
MATERIAL QUANTITY: **17500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/01/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46091** BUILDING ID: **1280**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **DuSable Campus** REVIEW DATE: **4/18/2013**
ADDRESS: **4934 S. Wabash** IDPH LICENSE NO: **100-02175**

HOMOGENEOUS AREA: **167**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile Adhesive**
MATERIAL LOCATION: **Gymnasiums 256, 257 and 258**
MATERIAL QUANTITY: **17500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **04/18/2013**

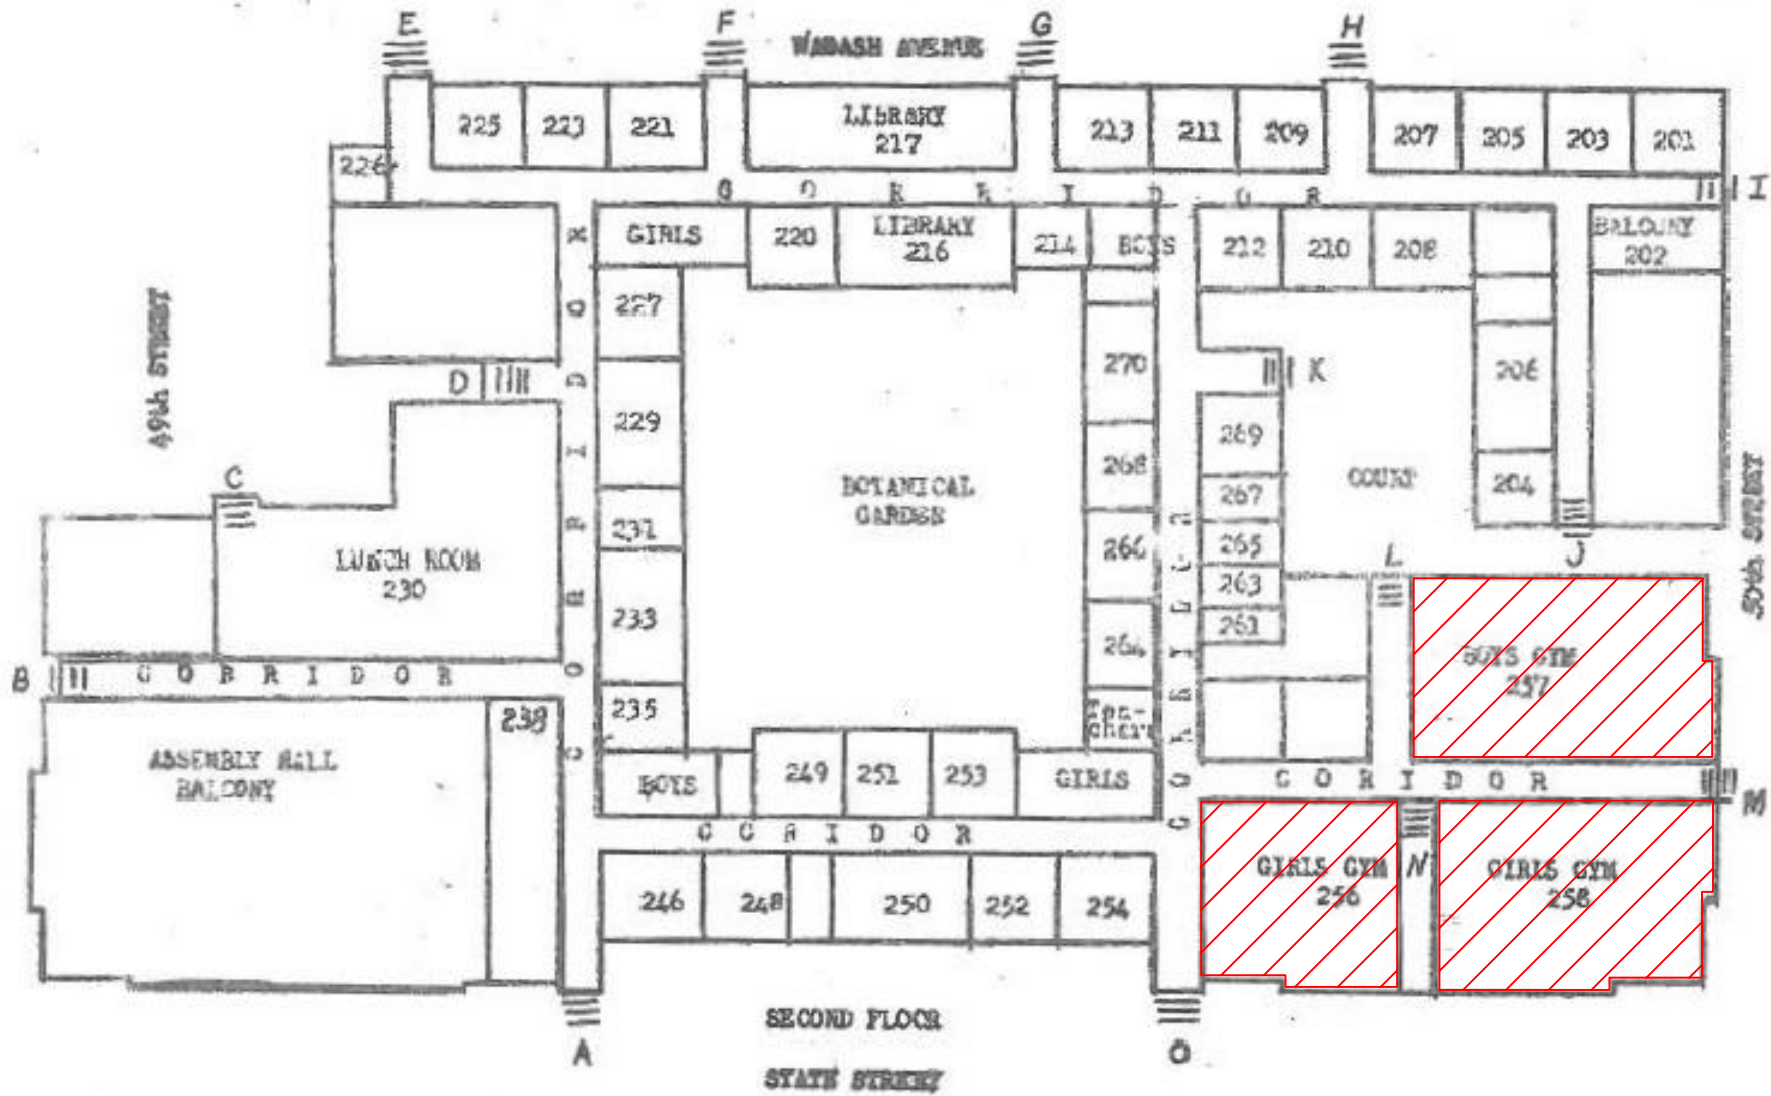

ASBESTOS REINSPECTION KEY NOTES:

 HA-167 1'x1' White Ceiling Tile Adhesive

SECOND FLOOR
ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
DuSable High School
4934 S. Wabash Street
Chicago, Illinois 60615

SHEET NAME:
Asbestos CPS Reinspection 2013

DRAWN BY: DM	DATE: 3-1-13	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

INSPECTED BY:
Ethan Payne

IDPH License #:100-2175

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccailld.com

CCA PROJECT NUMBER
A320130001-174

DATE
March 18, 2013

SHEET NUMBER

**CARNOW
CONIBEAR** HA-167

C:\PS 2011\2013\Thru Year\Cal Draw\gpr\gpr\4\DD\State Campus\DuSable\CPS_2yrr_DuSable.dwg

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

ETHAN PAYNE

This is to certify that _____
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/21/2012 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



Nicholas J. Peneff

03/21/2012

Course Dates:

03/21/2013

Expires:

1203BIR13

Certificate Number:

Phone Number: (312) 491-0081

Director of Training

Nicholas J. Peneff

Doctor of Public Health

FORM # A-010



Pat Quinn, Governor

525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.state.il.us

5/22/2012

ETHAN M PAYNE
11529 S. PEORIA
CHICAGO, IL 60643

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02175

Enclosed is your Asbestos Professional License that expires 05/15/2013

CERTIFICATE EXPIRATION DATE


INSPECTOR

3/21/2013

PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

~~7/29/2012~~

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.
Our WEB address is <http://www.idph.state.il.us/envhealth/chhome.htm>

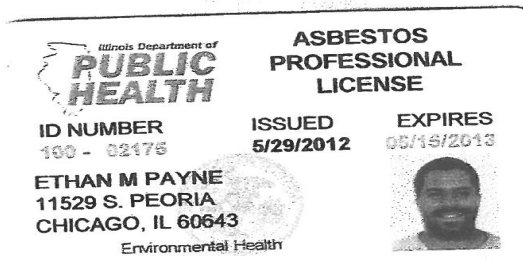



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

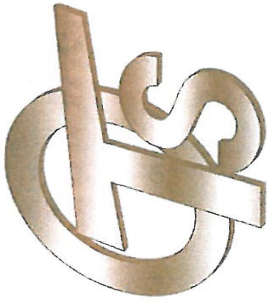

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013


Course Date: 2/25/2013

Expiration Date: 2/25/2014

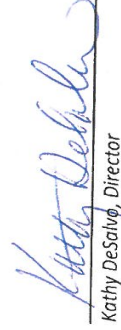

Kathy DeSalvo, Director

2013

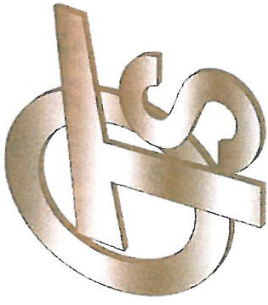

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed