

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0005
SCHOOL NAME: Perspectives Charter- Calumet Campus (Middle, HS
of Tech, High School)
ADDRESS OF SCHOOL: 8131 S. May
CITY: Chicago, IL, 60620

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/12/2010**


If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/30/2013 ENROLLMENT 0
IDPH INSPECTOR LICENSE NUMBER: 100-10882
IDPH LICENSED INSPECTOR NAME (Please Print): Beinville Brooks
IDPH MP LICENSE NUMBER: 100-09870
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Todd Huffer

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



4/30/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School)

8131 S. May
Chicago, IL, 60620

Unit: 53081
Building ID: 1250

IDPH ID Number: 14-016-2990-0005

REPORT DATE:

Tuesday, April 30, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 30, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 53081 Region: 05 IDPH ID: 14-016-2990-0005

School: Perspectives Charter- Calumet Campus (Middle, HS of Tech, Building ID: 1250
High School)
Address: 8131 S. May

Chicago, IL, 60620

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 4/30/2013

Inspector: Beinville Brooks

Inspector IDPH License: 100-10882

Management Planner: Todd Huffer

Management Planner IDPH License: 100-09870

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Todd Huffer
100-09870

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 30, 2013

RE: Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School), Unit 53081
8131 S. May
Chicago, IL, 60620

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School), there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Unit: 53081 Region: 05
Address: 8131 S. May Chicago, IL, 60620
IDPH ID: 14-016-2990-0005 Building ID: 1250
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 0

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Beinville Brooks


Inspector IDPH license # 100-10882


Signature:
Date: 3/30/2013

6. Management Planner

Management Planner Name: Todd Huffer

Management Planner IDPH license # 100-09870



Signature:
Date: 4/30/2013

7. Review Date: 4/30/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

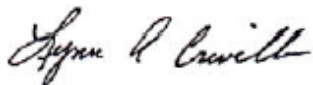

Date: 4/30/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School). This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1250:

11C	12x12 blue/green floor tile
11D	12x12 mottled brown floor tile
11F	12x12 beige specked floor tile
11G	12x12 off white floor tile
11H	12x12 mottled gray floor tile
13	brown linoleum
16C	12x12 mastic blue/green floor tile
16D	12x12 mastic mottled brown floor tile
16H	12x12 mastic mottled gray floor tile

- M boiler interior insulation
- O boiler door insulation

B. The following new homogenous areas have been identified for Building 1250:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

11C	12x12 blue/green floor tile
11D	12x12 mottled brown floor tile
11F	12x12 beige specked floor tile
11G	12x12 off white floor tile
11H	12x12 mottled gray floor tile
13	brown linoleum
16C	12x12 mastic blue/green floor tile
16D	12x12 mastic mottled brown floor tile
16H	12x12 mastic mottled gray floor tile
31	electrical wire
36	kiln insulation - removed
37	kiln refractory-removed
38	fire door in hallway
39	drywall
41	incinerator brick
42	Carpet mastic
43	12" x 12" Brown floor tile
44	Mastic for 12" x 12" brown mottle floor tile
45	12" x 12" off-white floor tile with gray
46	Mastic for 12" x 12" off-white with gray floor tile
47	Red Terrazzo
48	Brown Carpet Adhesive
49	Grey w/White Linoleum
HA-1000	1'x1' white ceiling tile with regular holes
HA-1002	2'x4' white ceiling tile fissured with holes
HA-1003	9"x9" tanwith dark streaks VFT
HA-1003m	black mastic for 9"x9" tan with dark streaks VFT
M	boiler interior insulation
O	boiler door insulation
P	new white 1x1 vft
Q	green/red mottled carpet
R	Green/gray Carpet
S	1x1 yellow VFT
T	Tan linoleum tile
U	new white w/dark specs tiles 1x1
V	12x12 lite brown VFT
W	White and Tan tile
X	Mastic for white and tan tile
Y	FLOOR TILE /MASTIC

The following areas were deemed to be inaccessible:

16B	12x12 mastic white with dark specs
16D	12x12 mastic mottled brown floor tile
31	electrical wire
38	fire door in hallway
39	drywall
41	incinerator brick
42	Carpet mastic
44	Mastic for 12" x 12" brown mottle floor tile
46	Mastic for 12" x 12" off-white with gray floor tile
48	Brown Carpet Adhesive
HA-1003m	black mastic for 9"x9" tan with dark streaks VFT
M	boiler interior insulation
O	boiler door insulation
Y	FLOOR TILE /MASTIC

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Beinville Brooks, IDPH License # 100-10882. The Management Plan was updated by Todd Huffer, IDPH License # 100-09870. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Building 1250 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Unit 53081 Building ID 1250
 Address 8131 S. May Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
042	Aircell Pipe Insulation	100	SF	Tunnels	CHR	TSI	Y		100			ACBM with the potential for damage		
11	12x12 white floor tile	190,000	SF	throughout the rooms. Kitchen	CHR	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
11A	12x12 red mottled floor tile	1,000	SF	room 114-114A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11B	12x12 white with dark specs	8,000	SF	rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11C	12x12 blue/green floor tile	1,800	SF	room 244, 2nd floor teachers room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11D	12x12 mottled brown floor tile	150	SF	room 237	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11E	12x12 brown with green and white floor tile	1,600	SF	engineering offices	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11F	12x12 beige specked floor tile	1,000	SF	room 146, pattern in storage room between rooms 113 & 117	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11G	12x12 off white floor tile	150	SF	pattern in storage room between room 113 & 117	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11H	12x12 mottled gray floor tile	4,500	SF	rooms 206, 313, 327, 328, 331, 332, 333, 334, 344	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11I	12x12 mottled green and orange floor tile	6,000	SF	dining room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	9x9 pale green floor tile	100	SF	kitchen office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12A	9x9 lite brown floor tile			mdf room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12B	9x9 black floor tile	100	SF	assembly hall foyer	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12C	9x9 brown floor tile	100	SF	assembly hall foyer	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12D	9x9 red floor tile	100	SF	assembly hall foyer	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	brown linoleum	400	SF	southwest storage and room 137	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
16	12x12 mastic white floor tile	190,000	SF	kitchen serving area, dining area, 1st 2nd 3rd flr corridors, office, throughout	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Unit 53081 Building ID 1250
 Address 8131 S. May Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				the rooms										
16A	12x12 mastic red mottled floor tile	1,000	SF	room 114-114A	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16B	12x12 mastic white with dark specs	8,000	SF	rooms 103,101,111, 116,133,135,168,21 0,331, replacement in cafeteria	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16C	12x12 mastic blue/green floor tile	1,800	SF	room 244, 2nd floor teachers room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
16D	12x12 mastic mottled brown floor tile	150	SF	room 237	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
16E	12x12 mastic brown with green and white floor tile	1,600	SF	engineer offices	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16F	12x12 mastic beige specked floor tile	1,000	SF	room 146, pattern in storage room between rooms 113 & 117	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16G	12x12 mastic off white floor tile	150	SF	pattern in storage room between room 113 & 117-NOW Kitchen	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16H	12x12 mastic mottled gray floor tile	4,500	SF	rooms 206, 313, 327, 328, 331, 332, 333, 334, 344	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
16I	12x12 mastic mottled green and orange floor tile	6,000	SF	dining room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	9x9 mastic pale green floor tile	100	SF	kitchen office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
27A	9x9 mastic lite brown floor tile			mdf room	NO_ACBM	MISC								
27B	9x9 mastic black floor tile			assembly hall foyer	NO_ACBM	MISC								
27C	9x9 mastic brown floor tile			assembly hall foyer	NO_ACBM	MISC								
27D	9x9 mastic red floor tile	100	SF	assembly hall foyer	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
28	black baseboard			café, office, engineers offices, room 308	NO_ACBM	MISC								
29	mastic for black baseboard		LF	café, office, engineer office, room 308	NO_ACBM	MISC								
30	mastic for brown linoleum			southwest storage	NO_ACBM	MISC								
31	electrical wire	150	LF	assembly hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
32	vibration damper			attic	NO_ACBM	MISC								
33	canvas jacket			3rd floor corridors & class rooms - not	MISC		N					ACBM with the potential for damage		

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Unit 53081 Building ID 1250
 Address 8131 S. May Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				observed										
34	lab desk tops			room 348	NO_ACBM	MISC								
35	lab tables tops			rooms 334,344	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36	kiln insulation - removed				ASSUMED	MISC								Moderate
37	kiln refractory-removed				ASSUMED	MISC								Moderate
38	fire door in hallway	20	SF	rotc	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		MODERATE
39	drywall	300	SF	office (130)	ASSUMED	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
41	incinerator brick	250	SF	boiler room - inaccessible	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
42	Carpet mastic	2,250	SF	Rooms 121, 121A, 121B, 123, 123A, 123B, 123C	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12" x 12" Brown floor tile	1,600	SF	Rooms 117 and 217	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
44	Mastic for 12" x 12" brown mottle floor tile	1,600	SF	Rooms 117, and 217	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12" x 12" off-white floor tile with gray	1,200	SF	Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
46	Mastic for 12" x 12" off-white with gray floor tile	1,200	SF	Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	Red Terrazzo	2,500	SF	Hallway Border and Stairways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	Brown Carpet Adhesive	800	SF	Rooms 223, 223F and 323	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	Grey w/White Linoleum	800	SF	Room 334	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
HA-1000	1'x1' white ceiling tile with regular holes	1,000	SF	rm. 249	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
HA-1001	1'x1' white ceiling tile with grooves	1,000	SF	rm. 204 on walls	CHR	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
HA-1002	2'x4' white ceiling tile fissured with holes	10,000	SF	throughout	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
HA-1003	9"x9" tanwith dark streaks VFT	150	SF	Rm. 209	ASSUMED	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
HA-1003m	black mastic for 9"x9" tan with dark streaks VFT	150	SF	Rm. 209	ASSUMED	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
M	boiler interior insulation	30	CF	boilers - inaccessible	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
N	boiler gasket			boilers - inaccessible	NO_ACBM	MISC								
O	boiler door insulation	20	SF	boilers - inaccessible	ASSUMED	TSI	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Unit 53081 Building ID 1250
 Address 8131 S. May Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
P	new white 1x1 vft			rooms 144 and 150	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
Q	green/red mottled carpet	1,000	SF	room 132	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
R	Green/gray Carpet	1,000	SF	room 166	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
S	1x1 yellow VFT	4,000	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
T	Tan linoleum tile	1,800	SF	Room 168	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
U	new white w/dark specs tiles 1x1	1,000	SF	Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
V	12x12 lite brown VFT	130	SF	mdf room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
W	White and Tan tile			Between rooms 113 & 117	ASSUMED	MISC								
X	Mastic for white and tan tile	150	SF	Kitchen-was a storage room b/t 113 and 117	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
Y	FLOOR TILE /MASTIC	200,000	SF	THROUGHOUT BLD.SEE NOTES FOR LOCATION	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) Unit 53081 Building ID 1250
Address 8131 S. May Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/30/2013
Inspector Name Beinville Brooks
100-10882 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
042	Not Observed.
11	
11A	
11B	
11C	
11D	
11E	
11F	
11G	
11H	
11I	
12	
12A	
12B	
12C	
12D	
13	
16	
16A	
16B	
16C	
16D	
16E	
16F	

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) **Unit** 53081 **Building ID** 1250
Address 8131 S. May **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
16G	
16H	
16I	
27	
27A	
27B	
27C	
27D	
28	
29	
30	
31	
32	
33	Not Observed.
34	
35	
36	Removed.
37	Removed.
38	
39	
41	
42	
43	
44	
45	
46	
47	
48	
49	

Chicago Public Schools

School Perspectives Charter- Calumet Campus (Middle, HS of Tech, High School) **Unit** 53081 **Building ID** 1250
Address 8131 S. May **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
HA-1000	
HA-1001	
HA-1002	
HA-1003	
HA-1003m	
M	
N	
O	
P	
Q	
R	
S	
T	
U	
V	
W	Not Observed.
X	
Y	

Table II

Management Planner's Review

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)

Unit 53081

Building ID 1250

Address 8131 S. May

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
042	Aircell Pipe Insulation	100	SF	Tunnels	Chrysotile	TSI	Yes	100	SF	6 ACBM with the potential for damage	Remove
11	12x12 white floor tile	190,000	SF	throughout the rooms, Kitchen	Chrysotile	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
11A	12x12 red mottled floor tile	1,000	SF	room 114-114A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11B	12x12 white with dark specs	8,000	SF	rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11C	12x12 blue/green floor tile	1,800	SF	room 244, 2nd floor teachers room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11D	12x12 mottled brown floor tile	150	SF	room 237	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11E	12x12 brown with green and white floor tile	1,600	SF	engineering offices	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11F	12x12 beige specked floor tile	1,000	SF	room 146, pattern in storage room between rooms 113 & 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11G	12x12 off white floor tile	150	SF	pattern in storage room between room 113 & 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11H	12x12 mottled gray floor tile	4,500	SF	rooms 206, 313, 327, 328, 331, 332, 333, 334, 344	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11I	12x12 mottled green and orange floor tile	6,000	SF	dining room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12	9x9 pale green floor tile	100	SF	kitchen office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12A	9x9 lite brown floor tile			mdf room	Chrysotile	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
12B	9x9 black floor tile	100	SF	assembly hall foyer	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12C	9x9 brown floor tile	100	SF	assembly hall foyer	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12D	9x9 red floor tile	100	SF	assembly hall foyer	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
13	brown linoleum	400	SF	southwest storage and room 137	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16	12x12 mastic white floor tile	190,000	SF	kitchen serving area, dining area, 1st 2nd 3rd flr corridors, office, throughout the rooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16A	12x12 mastic red mottled floor tile	1,000	SF	room 114-114A	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16B	12x12 mastic white with dark specs	8,000	SF	rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16C	12x12 mastic blue/green floor tile	1,800	SF	room 244, 2nd floor teachers room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16D	12x12 mastic mottled brown floor tile	150	SF	room 237	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16E	12x12 mastic brown with green and white floor tile	1,600	SF	engineer offices	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)

Unit 53081

Building ID 1250

Address 8131 S. May

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
16F	12x12 mastic beige specked floor tile	1,000	SF	room 146, pattern in storage room between rooms 113 & 117	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16G	12x12 mastic off white floor tile	150	SF	pattern in storage room between room 113 & 117-NOW Kitchen	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16H	12x12 mastic mottled gray floor tile	4,500	SF	rooms 206, 313, 327, 328, 331, 332, 333, 334, 344	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
16I	12x12 mastic mottled green and orange floor tile	6,000	SF	dining room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27	9x9 mastic pale green floor tile	100	SF	kitchen office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27A	9x9 mastic lite brown floor tile			mdf room	No ACBM	MISC					
27B	9x9 mastic black floor tile			assembly hall foyer	No ACBM	MISC					
27C	9x9 mastic brown floor tile			assembly hall foyer	No ACBM	MISC					
27D	9x9 mastic red floor tile	100	SF	assembly hall foyer	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
28	black baseboard			café, office, engineers offices, room 308	No ACBM	MISC					
29	mastic for black baseboard		LF	café, office, engineer office, room 308	No ACBM	MISC			LF		
30	mastic for brown linoleum			southwest storage	No ACBM	MISC					
31	electrical wire	150	LF	assembly hall	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
32	vibration damper			attic	No ACBM	MISC					
33	canvas jacket			3rd floor corridors & class rooms - not observed		MISC	No			6 ACBM with the potential for damage	
34	lab desk tops			room 348	No ACBM	MISC					
35	lab tables tops			rooms 334,344	Chrysotile	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
36	kiln insulation - removed				Assumed	MISC					
37	kiln refractory-removed				Assumed	MISC					
38	fire door in hallway	20	SF	rotc	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
39	drywall	300	SF	office (130)	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
41	incinerator brick	250	SF	boiler room - inaccessible	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
42	Carpet mastic	2,250	SF	Rooms 121, 121A, 121B, 123, 123A, 123B, 123C	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
43	12" x 12" Brown floor tile	1,600	SF	Rooms 117 and 217	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
44	Mastic for 12" x 12" brown mottle floor tile	1,600	SF	Rooms 117, and 217	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
45	12" x 12" off-white floor tile with gray	1,200	SF	Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)

Unit 53081

Building ID 1250

Address 8131 S. May

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
46	Mastic for 12" x 12" off-white with gray floor tile	1,200	SF	Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
47	Red Terrazzo	2,500	SF	Hallway Border and Stairways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
48	Brown Carpet Adhesive	800	SF	Rooms 223, 223F and 323	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
49	Grey w/White Linoleum	800	SF	Room 334	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1000	1'x1' white ceiling tile with regular holes	1,000	SF	rm. 249	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1001	1'x1' white ceiling tile with grooves	1,000	SF	rm. 204 on walls	Chrysotile	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1002	2'x4' white ceiling tile fissured with holes	10,000	SF	throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-1003	9"x9" tanwith dark streaks VFT	150	SF	Rm. 209	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
HA-1003m	black mastic for 9"x9" tan with dark streaks VFT	150	SF	Rm. 209	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
M	boiler interior insulation	30	CF	boilers - inaccessible	Assumed	TSI	No	0	CF	6 ACBM with the potential for damage	Operations and Maintenance
N	boiler gasket			boilers - inaccessible	No ACBM	MISC					
O	boiler door insulation	20	SF	boilers - inaccessible	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
P	new white 1x1 vft			rooms 144 and 150	Assumed	MISC	No	0		6 ACBM with the potential for damage	Operations and Maintenance
Q	green/red mottled carpet	1,000	SF	room 132	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
R	Green/gray Carpet	1,000	SF	room 166	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
S	1x1 yellow VFT	4,000	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
T	Tan linoleum tile	1,800	SF	Room 168	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
U	new white w/dark specs tiles 1x1	1,000	SF	Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
V	12x12 lite brown VFT	130	SF	mdf room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
W	White and Tan tile			Between rooms 113 & 117	Assumed	MISC					
X	Mastic for white and tan tile	150	SF	Kitchen-was a storage room b/t 113 and 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
Y	FLOOR TILE /MASTIC	200,000	SF	THOUGHTOUT BLD.SEE NOTES FOR LOCATION	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)

Unit 53081

Building ID 1250

Address 8131 S. May

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/30/2013
Manager Planner Name	Todd Huffer
100-09870	5/15/2013
Manager IDPH License No/Expiration	

HA Number	Management Comments
042	Material in sealed off tunnels. No access until HA has been removed/repared
11	
11A	
11B	
11C	
11D	
11E	
11F	

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)
Address 8131 S. May

Unit 53081
Chicago, IL, 60620

Building ID 1250
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
11G	
11H	
11I	
12	
12A	
12B	
12C	
12D	
13	
16	
16A	
16B	
16C	
16D	
16E	
16F	
16G	
16H	
16I	
27	
27A	
27B	
27C	
27D	
28	

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)

Unit 53081

Building ID 1250

Address 8131 S. May

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
41	
42	
43	
44	
45	
46	
47	
48	
49	
HA-1000	
HA-1001	
HA-1002	
HA-1003	
HA-1003m	

Chicago Public Schools

School Perspectives Charter-
Calumet Campus (Middle,
HS of Tech, High School)

Unit 53081

Building ID 1250

Address 8131 S. May

Chicago, IL, 60620

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
M	
N	
O	
P	
Q	
R	
S	
T	
U	
V	
W	Not Observed.
X	
Y	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **042**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Tunnels**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Not Observed.**

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **042**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Tunnels**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material in sealed off tunnels. No access until HA has been removed/repaired

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12x12 white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **throughout the rooms, Kitchen**

MATERIAL QUANTITY: **190000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12x12 white floor tile**
MATERIAL LOCATION: **throughout the rooms, Kitchen**
MATERIAL QUANTITY: **190000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **12x12 red mottled floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 114-114A**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **12x12 red mottled floor tile**
MATERIAL LOCATION: **room 114-114A**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11B**
MATERIAL DESCRIPTION: **12x12 white with dark specs**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11B**
MATERIAL DESCRIPTION: **12x12 white with dark specs**
MATERIAL LOCATION: **rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11C**
MATERIAL DESCRIPTION: **12x12 blue/green floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 244, 2nd floor teachers room**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11C**
MATERIAL DESCRIPTION: **12x12 blue/green floor tile**
MATERIAL LOCATION: **room 244, 2nd floor teachers room**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11D**
MATERIAL DESCRIPTION: **12x12 mottled brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 237**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11D**
MATERIAL DESCRIPTION: **12x12 mottled brown floor tile**
MATERIAL LOCATION: **room 237**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11E**
MATERIAL DESCRIPTION: **12x12 brown with green and white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **engineering offices**

MATERIAL QUANTITY: **1600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11E**
MATERIAL DESCRIPTION: **12x12 brown with green and white floor tile**
MATERIAL LOCATION: **engineering offices**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11F**
MATERIAL DESCRIPTION: **12x12 beige specked floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 146, pattern in storage room between rooms 113 & 117**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

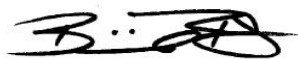

Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11F**
MATERIAL DESCRIPTION: **12x12 beige specked floor tile**
MATERIAL LOCATION: **room 146, pattern in storage room between rooms 113 & 117**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11G**
MATERIAL DESCRIPTION: **12x12 off white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **pattern in storage room between room 113 & 117**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11G**
MATERIAL DESCRIPTION: **12x12 off white floor tile**
MATERIAL LOCATION: **pattern in storage room between room 113 & 117**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11H**
MATERIAL DESCRIPTION: **12x12 mottled gray floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rooms 206, 313, 327, 328, 331, 332, 333, 334, 344**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

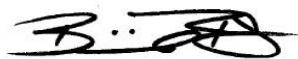

Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **11H**
MATERIAL DESCRIPTION: **12x12 mottled gray floor tile**
MATERIAL LOCATION: **rooms 206, 313, 327, 328, 331, 332, 333, 334, 344**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11I**
MATERIAL DESCRIPTION: **12x12 mottled green and orange floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **dining room**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12x12 mottled green and orange floor tile**
MATERIAL LOCATION: **dining room**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **9x9 pale green floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **kitchen office**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **9x9 pale green floor tile**
MATERIAL LOCATION: **kitchen office**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **9x9 lite brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **mdf room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **9x9 lite brown floor tile**
MATERIAL LOCATION: **mdf room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12B**
MATERIAL DESCRIPTION: **9x9 black floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **assembly hall foyer**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **12B**
MATERIAL DESCRIPTION: **9x9 black floor tile**
MATERIAL LOCATION: **assembly hall foyer**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12C**
MATERIAL DESCRIPTION: **9x9 brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **assembly hall foyer**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **12C**
MATERIAL DESCRIPTION: **9x9 brown floor tile**
MATERIAL LOCATION: **assembly hall foyer**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12D**
MATERIAL DESCRIPTION: **9x9 red floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **assembly hall foyer**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **12D**
MATERIAL DESCRIPTION: **9x9 red floor tile**
MATERIAL LOCATION: **assembly hall foyer**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **brown linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **southwest storage and room 137**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **brown linoleum**
MATERIAL LOCATION: **southwest storage and room 137**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12x12 mastic white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **kitchen serving area, dining area, 1st 2nd 3rd flr corridors, office, throughout the rooms**

MATERIAL QUANTITY: **190000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-Calumet Campus (Middle, HS of Tech, High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12x12 mastic white floor tile**
MATERIAL LOCATION: **kitchen serving area, dining area, 1st 2nd 3rd flr corridors, office, throughout the rooms**
MATERIAL QUANTITY: **190000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12x12 mastic red mottled floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 114-114A**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12x12 mastic red mottled floor tile**
MATERIAL LOCATION: **room 114-114A**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16B**
MATERIAL DESCRIPTION: **12x12 mastic white with dark specs**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16B**
MATERIAL DESCRIPTION: **12x12 mastic white with dark specs**
MATERIAL LOCATION: **rooms 103,101,111, 116,133,135,168,210,331, replacement in cafeteria**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16C**
MATERIAL DESCRIPTION: **12x12 mastic blue/green floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **room 244, 2nd floor teachers room**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16C**
MATERIAL DESCRIPTION: **12x12 mastic blue/green floor tile**
MATERIAL LOCATION: **room 244, 2nd floor teachers room**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16D**
MATERIAL DESCRIPTION: **12x12 mastic mottled brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 237**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16D**
MATERIAL DESCRIPTION: **12x12 mastic mottled brown floor tile**
MATERIAL LOCATION: **room 237**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16E**
MATERIAL DESCRIPTION: **12x12 mastic brown with green and white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **engineer offices**

MATERIAL QUANTITY: **1600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16E**
MATERIAL DESCRIPTION: **12x12 mastic brown with green and white floor tile**
MATERIAL LOCATION: **engineer offices**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16F**
MATERIAL DESCRIPTION: **12x12 mastic beige specked floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 146, pattern in storage room between rooms 113 & 117**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16F**
MATERIAL DESCRIPTION: **12x12 mastic beige specked floor tile**
MATERIAL LOCATION: **room 146, pattern in storage room between rooms 113 & 117**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16G**
MATERIAL DESCRIPTION: **12x12 mastic off white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **pattern in storage room between room 113 & 117-NOW Kitchen**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-Calumet Campus (Middle, HS of Tech, High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16G**
MATERIAL DESCRIPTION: **12x12 mastic off white floor tile**
MATERIAL LOCATION: **pattern in storage room between room 113 & 117-NOW Kitchen**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16H**
MATERIAL DESCRIPTION: **12x12 mastic mottled gray floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rooms 206, 313, 327, 328, 331, 332, 333, 334, 344**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

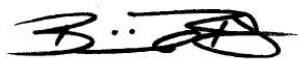

Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16H**
MATERIAL DESCRIPTION: **12x12 mastic mottled gray floor tile**
MATERIAL LOCATION: **rooms 206, 313, 327, 328, 331, 332, 333, 334, 344**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16I**
MATERIAL DESCRIPTION: **12x12 mastic mottled green and orange floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **dining room**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **16I**
MATERIAL DESCRIPTION: **12x12 mastic mottled green and orange floor tile**
MATERIAL LOCATION: **dining room**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **9x9 mastic pale green floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **kitchen office**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **9x9 mastic pale green floor tile**
MATERIAL LOCATION: **kitchen office**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **9x9 mastic lite brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **mdf room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **9x9 mastic lite brown floor tile**
MATERIAL LOCATION: **mdf room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27B**
MATERIAL DESCRIPTION: **9x9 mastic black floor tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **assembly hall foyer**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **27B**
MATERIAL DESCRIPTION: **9x9 mastic black floor tile**
MATERIAL LOCATION: **assembly hall foyer**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27C**
MATERIAL DESCRIPTION: **9x9 mastic brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **assembly hall foyer**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **27C**
MATERIAL DESCRIPTION: **9x9 mastic brown floor tile**
MATERIAL LOCATION: **assembly hall foyer**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27D**
MATERIAL DESCRIPTION: **9x9 mastic red floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **assembly hall foyer**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **27D**
MATERIAL DESCRIPTION: **9x9 mastic red floor tile**
MATERIAL LOCATION: **assembly hall foyer**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **black baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **café, office, engineers offices, room 308**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **black baseboard**
MATERIAL LOCATION: **café, office, engineers offices, room 308**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **mastic for black baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **café, office, engineer office, room 308**

MATERIAL QUANTITY: MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

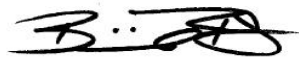

Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **mastic for black baseboard**
MATERIAL LOCATION: **café, office, engineer office, room 308**
MATERIAL QUANTITY: MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **mastic for brown linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **southwest storage**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

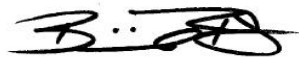

Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **mastic for brown linoleum**
MATERIAL LOCATION: **southwest storage**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **electrical wire**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **assembly hall**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **electrical wire**
MATERIAL LOCATION: **assembly hall**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **vibration damper**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **attic**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **vibration damper**

MATERIAL LOCATION: **attic**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **canvas jacket**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd floor corridors & class rooms - not observed**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature: _____



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **canvas jacket**
MATERIAL LOCATION: **3rd floor corridors & class rooms - not observed**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **lab desk tops**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 348**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

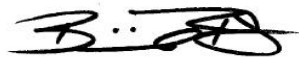

Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **lab desk tops**
MATERIAL LOCATION: **room 348**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **lab tables tops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **rooms 334,344**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

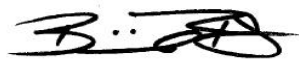

Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **lab tables tops**
MATERIAL LOCATION: **rooms 334,344**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **kiln insulation - removed**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Moderate**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Removed.**

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **kiln insulation - removed**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **kiln refractory-removed**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Moderate**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Removed.**

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **kiln refractory-removed**

MATERIAL LOCATION:

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **fire door in hallway**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **rotc**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **fire door in hallway**
MATERIAL LOCATION: **rotc**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **drywall**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **office (130)**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **drywall**
MATERIAL LOCATION: **office (130)**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **incinerator brick**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **boiler room - inaccessible**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **incinerator brick**
MATERIAL LOCATION: **boiler room - inaccessible**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 121, 121A, 121B, 123, 123A, 123B, 123C**

MATERIAL QUANTITY: **2250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Carpet mastic**
MATERIAL LOCATION: **Rooms 121, 121A, 121B, 123, 123A, 123B, 123C**
MATERIAL QUANTITY: **2250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Brown floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rooms 117 and 217**

MATERIAL QUANTITY: **1600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Brown floor tile**
MATERIAL LOCATION: **Rooms 117 and 217**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Mastic for 12" x 12" brown mottle floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 117, and 217**

MATERIAL QUANTITY: **1600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Mastic for 12" x 12" brown mottle floor tile**
MATERIAL LOCATION: **Rooms 117, and 217**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" off-white floor tile with gray**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" off-white floor tile with gray**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Mastic for 12" x 12" off-white with gray floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 110**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Mastic for 12" x 12" off-white with gray floor tile**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Red Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallway Border and Stairways**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Red Terrazzo**
MATERIAL LOCATION: **Hallway Border and Stairways**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Brown Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 223, 223F and 323**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Brown Carpet Adhesive**
MATERIAL LOCATION: **Rooms 223, 223F and 323**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Grey w/White Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 334**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Grey w/White Linoleum**
MATERIAL LOCATION: **Room 334**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1000**
MATERIAL DESCRIPTION: **1'x1' white ceiling tile with regular holes**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **rm. 249**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **HA-1000**
MATERIAL DESCRIPTION: **1'x1' white ceiling tile with regular holes**
MATERIAL LOCATION: **rm. 249**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1001**
MATERIAL DESCRIPTION: **1'x1' white ceiling tile with grooves**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **rm. 204 on walls**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **HA-1001**
MATERIAL DESCRIPTION: **1'x1' white ceiling tile with grooves**
MATERIAL LOCATION: **rm. 204 on walls**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1002**
MATERIAL DESCRIPTION: **2'x4' white ceiling tile fissured with holes**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **throughout**

MATERIAL QUANTITY: **10000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **HA-1002**
MATERIAL DESCRIPTION: **2'x4' white ceiling tile fissured with holes**
MATERIAL LOCATION: **throughout**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1003**
MATERIAL DESCRIPTION: **9"x9" tanwith dark streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rm. 209**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **HA-1003**
MATERIAL DESCRIPTION: **9"x9" tanwith dark streaks VFT**
MATERIAL LOCATION: **Rm. 209**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-1003m**
MATERIAL DESCRIPTION: **black mastic for 9"x9" tan with dark streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rm. 209**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **HA-1003m**
MATERIAL DESCRIPTION: **black mastic for 9"x9" tan with dark streaks VFT**
MATERIAL LOCATION: **Rm. 209**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **boiler interior insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **boilers - inaccessible**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **CF**
DAMAGE QUANTITY: DAMAGE UNITS: **CF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **boiler interior insulation**
MATERIAL LOCATION: **boilers - inaccessible**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **CF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **CF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **boiler gasket**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **boilers - inaccessible**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

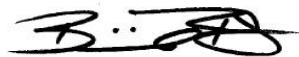

Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **boiler gasket**
MATERIAL LOCATION: **boilers - inaccessible**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **boiler door insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **boilers - inaccessible**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **boiler door insulation**
MATERIAL LOCATION: **boilers - inaccessible**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **new white 1x1 vft**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **rooms 144 and 150**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **new white 1x1 vft**
MATERIAL LOCATION: **rooms 144 and 150**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **green/red mottled carpet**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **room 132**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **green/red mottled carpet**
MATERIAL LOCATION: **room 132**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**
MATERIAL DESCRIPTION: **Green/gray Carpet**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **room 166**

MATERIAL QUANTITY: **1000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **R**
MATERIAL DESCRIPTION: **Green/gray Carpet**
MATERIAL LOCATION: **room 166**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUILDING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **S**
MATERIAL DESCRIPTION: **1x1 yellow VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **S**
MATERIAL DESCRIPTION: **1x1 yellow VFT**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T**
MATERIAL DESCRIPTION: **Tan linoleum tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 168**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **T**
MATERIAL DESCRIPTION: **Tan linoleum tile**
MATERIAL LOCATION: **Room 168**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **U**
MATERIAL DESCRIPTION: **new white w/dark specs tiles 1x1**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 110**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **U**
MATERIAL DESCRIPTION: **new white w/dark specs tiles 1x1**
MATERIAL LOCATION: **Room 110**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **V**
MATERIAL DESCRIPTION: **12x12 lite brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **mdf room**

MATERIAL QUANTITY: **130**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **V**
MATERIAL DESCRIPTION: **12x12 lite brown VFT**
MATERIAL LOCATION: **mdf room**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **W**
MATERIAL DESCRIPTION: **White and Tan tile**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Between rooms 113 & 117**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **W**
MATERIAL DESCRIPTION: **White and Tan tile**
MATERIAL LOCATION: **Between rooms 113 & 117**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Not Observed.

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **X**
MATERIAL DESCRIPTION: **Mastic for white and tan tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen-was a storage room b/t 113 and 117**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **X**
MATERIAL DESCRIPTION: **Mastic for white and tan tile**
MATERIAL LOCATION: **Kitchen-was a storage room b/t 113 and 117**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Perspectives Charter- Calumet
Campus (Middle, HS of Tech, High
School)** INSPECTION DATE: **3/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Y**
MATERIAL DESCRIPTION: **FLOOR TILE /MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **THOUGHOUT BLD.SEE NOTES FOR LOCATION**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/30/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **53081** BUIDLING ID: **1250**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **Perspectives Charter-
Calumet Campus
(Middle, HS of Tech,
High School)** REVIEW DATE: **4/30/2013**
ADDRESS: **8131 S. May** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **Y**
MATERIAL DESCRIPTION: **FLOOR TILE /MASTIC**
MATERIAL LOCATION: **THOUGHOUT BLD.SEE NOTES FOR LOCATION**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/30/2013**


Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

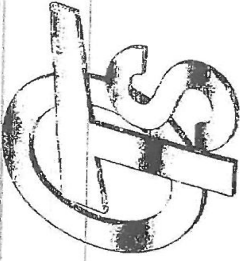

Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Abatement Contractor/Supervisor Refresher/Project Supervisor Refresher

Occupational Training and Supply, Inc. certifies that

Beinville Brooks


has successfully completed the 8 hour Asbestos Contractor/Supervisor Refresher course and has passed the competency exam with a minimum score of 70%. This course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: ASR1205070842


Exam Date: 5/7/2012

Course Date: 5/7/2012

Expiration Date: 5/7/2013

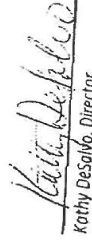
Kathy Desaino, Director

2012



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER **ISSUED** **EXPIRES**
100 - 10682 2/15/2012 05/15/2012

BEINVILLE S BROOKS
PO BOX 1373
CALUMET, IL 60409

Environmental Health



ENDORSEMENTS
SUPERVISOR/WORKER
INSPECTOR

TC EXPIRES
5/9/2012
12/1/2012

PROJECT MANAGER 5/9/2012
AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Todd Huffer

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042317

Exam Date: 12/4/2012

Course Date: 12/4/2012


Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012



Todd Huffer

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional

 **ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER 100 - 09870	ISSUED 4/4/2012	EXPIRES 05/15/2013
--	----------------------------------	-------------------------------------

TODD T HUFFER
918 N WOLCOTT UNIT 6
CHICAGO, IL 60622

Environmental Health

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/8/2012
MANAGEMENT PLANNER	1/19/2013
PROJECT MANAGER	9/8/2012
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Todd Huffer

has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPRI302250735

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed